

MOTORHERZ






















START. POWER. RESULT.

*ALTERNATORS
STARTER MOTORS*

*CATALOGUE
2016*












Alternators

Bosch

<p>ALB0002</p>  <p>ARB0225 PAL0400</p>  <p>12v 70amp a:39 b:14 c:61</p> <p>VW, SKODA Polo Fox Lupo Fabia</p> <p>BNM, AMF BMS, BNV BAY, BWB VW 045903023B BO 0124315013 HC CA1682IR</p>	<p>ALB0003</p>  <p>ALB0003WA ARB0225 PAL0400</p>  <p>12v 140amp a:39 b:14 c:62</p> <p>VW, AUDI A2 Polo</p> <p>ANY, AMF, ATL BHC, BAY VW 045903023G BO 0124525027 HC CA1841IR</p>	<p>ALB0004 <i>New</i></p>  <p>ALB0004WA ARB0587 PAL0210</p>  <p>12v 160amp a:45.5 b:60 c:82.5</p> <p>VOLVO S60, S80 V70 XC70, XC90</p> <p>B5204T5, B5254T2 B5244S, B5244T5 B5244SG2, D5244T VO 8603265 BO 0124625024 HC CA2028IR</p>	<p>ALB0005</p>  <p>ALB0005WA ARB0313</p> <p>12v 90amp b:56</p> <p>JOHN DEERE Tractors Farm Tractors Utility</p> <p>6414 94HP 105HP, 115HP JD AL166645 BO 0124325166 CG 114681</p>
<p>ALB0013</p>  <p>ALB0013WA ARB0225 PAL0400</p>  <p>12v 150amp a:91 b:56</p> <p>MERCEDES-BENZ C Class M Class SLK Class</p> <p>MB 0131548302 BO 0124615014 WAI 11042N</p>	<p>ALB0015</p>  <p>ALB0015WA ARB0241 PAL0280</p>  <p>12v 105amp a:53 b:75</p> <p>BUICK Regal 3.8L CHEVROLET Impala 3.8L Monte Carlo 3.8L</p> <p>V6 GM 10339422 BO 0124415035 WAI 11045N</p>	<p>ALB0017</p>  <p>ALB0017RB ALB0017WA ARB0241 PAL0280</p>  <p>12v 125amp a:52 b:57</p> <p>CHEVROLET Impala 3.8L PONTIAC Montana 3.4L OLDSMOBILE</p> <p>V6 GM 10418889 BO 6004ML0017 WA 13771N</p>	<p>ALB0018</p>  <p>ALB0018WA ARB0615 PAL0450</p>  <p>12v 136amp a:46 b:14 c:67</p> <p>DODGE Ram Pickup 5.9L CHRYSLER</p> <p>L6 Diesel CH 56028732AA BO 0124525041 WAI 13987N</p>
<p>ALB0020</p>  <p>ALB0020WA ARB0260</p> <p>12v 200amp b:80 c:112</p> <p>US Trucks FORD MACK PETERBILT School Bus</p> <p>Cummins ISM, ISX Caterpillar MBE900, MBE4000, VED12 BO AL9962SB BO 0124625043 WAI 12716N</p>	<p>ALB0021</p>  <p>ALB0021WA ARB0236 PAL0112</p>  <p>12v 80amp a:30 b:25 c:35</p> <p>TOYOTA Vitz</p> <p>1KRFE TO 2706040020 BO 0124225052 HC CA2102IR</p>	<p>ALB0022</p>  <p>ALB0022WA ARB0260</p> <p>12v 160amp b:80 c:110</p> <p>US Trucks FORD MACK PETERBILT Medium&Heavy-Duty Trucks</p> <p>Cummins Caterpillar MBE900 CH 3972732 BO 0124525109 WAI 12491N</p>	<p>ALB0023</p>  <p>ALB0023WA ARB0915 PAL0450</p>  <p>12v 120amp a:40 b:70 c:56</p> <p>JEEP Grand Cherokee 2.7L CHRYSLER PT Cruiser 2.2L</p> <p>ENF Diesel CH 05073920AA BO 0124515084 CG 114210</p>




Alternators

Bosch

<p>ALB0026</p>  <p>ALB0026WA</p> <p>12v 55amp a:43 b:18 c:67.5</p> <p>JOHN DEERE VM Tractors 3.852.2313G 76F 2.7L Diesel 85F 2.7L Diesel JD FGV38522313 100F 3.0L Diesel BO 0124120001 CG 114466</p>	<p>ALB0031</p>  <p>ALB0031WA</p> <p>ARB0385</p> <p>12v 90amp a:45 b:14 c:82</p> <p>IVECO FORD Scorpio VW IV 500358338 Passat BO 0123320066 MH ALB0031</p>	<p>ALB0038</p>  <p>ALB0038WA</p> <p>ARB0353</p> <p>12v 65amp a:110 b:56</p> <p>VW, AUDI RP, SK, RL, RF, RH Caravelle, Caddy RD, PP, GZ, EW, DX Golf, Jetta, LT 3A, 4B, AAD, ABT, DS Passat VW 069903023F 100, 80, Coupe BO 0120489370 HC CA520IR</p>	<p>ALB0044</p> <p>12v 120amp</p> <p>FIAT Bravo</p> <p>FI 51839616 BO F000BL0700 MH ALB0044</p>
<p>ALB0046</p>  <p>12v 150amp b:14 c:85</p> <p>FIAT Ducato 3.0L IVECO Daily 3.0L</p> <p>IVE 504385138 BO F000BL0704 MH ALB0046</p>	<p>ALB0047</p>  <p>ALB0047WA</p> <p>ARB0701</p> <p>12v 150amp a:40 b:13 c:82</p> <p>FIAT Ducato 2.3L IVECO Daily 2.3L</p> <p>FI 504385134 BO F000BL0705 MH ALB0047</p>	<p>ALB0048</p>  <p>ALB0048WA</p> <p>ARB0701</p> <p>12v 110amp b:14 c:83</p> <p>FIAT Ducato Bus Ducato Box Ducato Flatbed Ducato Chassis</p> <p>BO F000BL0706 MH ALB0048</p>	<p>ALB0049</p>  <p>ALB0049WA</p> <p>ARB0701</p> <p>12v 110amp a:41 b:14 c:80</p> <p>FIAT Ducato 2.3L IVECO Daily 2.3L</p> <p>FI 504385133 BO F000BL0707 MH ALB0049</p>
<p>ALB0054</p>  <p>ALB0054WA</p> <p>ARB0385</p> <p>12v 90amp a:29.5 b:14 c:61</p> <p>VW Golf 2.8L Jetta 2.8L Passat 2.8L Corrado 2.8L</p> <p>VW 050903017A BO 0123340005 HC CA912IR</p>	<p>ALB0064 <i>New</i></p>  <p>ALB0064WA</p> <p>ARB0283 PAL0474 DFM L</p> <p>12v 140amp a:50.5 b:33.5 c:56</p> <p>OPEL Y22DTR Astra 2.2l Zafira 2.2l</p> <p>OP 13108597 BO 0124525031 HC CA2067IR</p>	<p>ALB0066</p>  <p>ALB0066WA</p> <p>ARB0385</p> <p>12v 115amp a:30.5 b:14.5 c:61</p> <p>CHRYSLER 425CLIRSX Voyager</p> <p>CH 38522303 BO 0123510109 HC CA1590IR</p>	<p>ALB0069</p>  <p>12v 35amp a:76 b:56</p> <p>MERCEDES-BENZ 200 207 220 230</p> <p>M115923, M115926 OM616937, OM615912 M115951 BO 0120400856 BO 0120400857 HC CA69IR</p>

Alternators

Bosch

<p>ALB0077 <i>Old</i> ALB0077WA</p>  <p>ARB0350 PAL0295</p>  <p>12v 33amp a:49 b:25 c:74</p> <p>FIAT 127 128 Fiorino</p> <p>128A048 128AC000 127A000 FI 4753104 BO 0120339515 HC CA77IR</p>	<p>ALB0087 ALB0087WA</p>  <p>ARB0350 PAL0294</p>  <p>12v 55amp a:77 b:56</p> <p>MERCEDES 123, SEAT 4t, 5t, 6t, 16t 19t, 22t, 25t 190, 240, 280 Ibiza, Malaga, Ronda</p> <p>M102921, M102924 M115955, OM616939 021A1000, 124B6000 MB 0041541802 BO 0120489556 HC CA87IR</p>	<p>ALB0088 ALB0088WA</p>  <p>ARB0350</p> <p>12v 55amp a:91.95 b:71</p> <p>VOLVO 240 340 360</p> <p>B21A, B19ET B200K, B19A B23E BO 0120489066 BO 0120489065 HC CA88IR</p>	<p>ALB0096 ALB0096WA</p>  <p>ARB0350 PAL0294</p>  <p>12v 55amp a:36.5 b:11 c:81</p> <p>FORD RENAULT Transit Sierra R16</p> <p>4AB, 4AA YTT, PRE, 4RB 821 VW 83AB10300AA BO 0120489617 HC CA96IR</p>
<p>ALB0128</p>  <p>12v 45amp a:77 b:56</p> <p>OPEL Ascona Manta Rekord Corsa</p> <p>13S, 13N, 20D 13N, 13S, 10S 20D, 21D, 23D OP 1204154 BO 0120489117 HC CA128IR</p>	<p>ALB0132 ALB0132WA</p>  <p>ARB0363</p> <p>24v 45amp b:51</p> <p>VOLVO Penta Trucks F Series Marine 5.5l Diesel</p> <p>TD100B, TD121G TD101G, TD120G TD60C, TD70F VO 1505107 BO 0120489643 HC CA132IR</p>	<p>ALB0139 <i>Old</i></p>  <p>ARB0350 PAL0294</p>  <p>12v 70amp b:56</p> <p>AUDI 80</p> <p>FY, FZ</p> <p>BO 0120489016 BO 0120489872 HC CA139IR</p>	<p>ALB0140</p>  <p>12v 45amp a:108 b:56 c:82</p> <p>AUDI 80 100</p> <p>EP, WV, YN YP, CY YV</p> <p>BO 0120489860 BO 0120489015 HC CA140IR</p>
<p>ALB0141 <i>Old</i></p>  <p>ARB0353 PAL0294</p>  <p>12v 65amp a:108.5 b:56</p> <p>VW LT Santana Transporter</p> <p>CP, DW, CH, DL WV, YP, DS, WN DF, DG, DH BO 0120489758 BO 0120489003 HC CA141IR</p>	<p>ALB0155</p>  <p>ARB0363</p> <p>24v 35amp b:80</p> <p>RENAULT SCANIA PEGASO S 170</p> <p>DS905, MIDR060212D DS805 DS1115 RE 5001014139 BO 0120469569 HC CA155IR</p>	<p>ALB0158</p>  <p>ARB0353 PAL0294</p>  <p>12v 45amp a:86 b:56</p> <p>OPEL Astra Belmont Carlton Ascona</p> <p>18E, C16NZ 16SH, 18SE, 17D 20SE, C20NEJ, C16LZ OP 1204003 BO 0120489122 HC CA158IR</p>	<p>ALB0163</p>  <p>ARB0350</p> <p>12v 75amp a:82.5 b:56</p> <p>VW Passat Santana Scirocco</p> <p>WN YS, DX DS, EG VW 035903015N BO 0120469525 HC CA163IR</p>









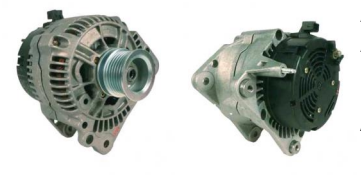






Alternators

Bosch

<p>ALB0186</p>  <p>ALB0186WA ARB0361</p>	<p>ALB0187</p>  <p>ALB0187WA ARB0362</p>	<p>ALB0190</p>  <p>ALB0190WA ARB0350 PAL0294</p> 	<p>ALB0192</p>  <p>ALB0192WA ARB0350 PAL0294</p> 
<p>12v 55amp b:80</p> <p>MAN, MERCEDES-BENZ Trucks EU 5t, 6t, 1400, 1500 700, 800, 900 1000, 1100, 1300</p> <p>OM353976, OM366954 D0826LF05, D0826F02 OM353952, OM353946 MB 0051543302 BO 0120489726 HC CA1861R</p>	<p>24v 27amp b:80</p> <p>MERCEDES-BENZ Various Trucks</p> <p>OM314946, OM314948 OM356904</p> <p>MB 0031544802 BO 0120489728 HC CA1871R</p>	<p>12v 35amp a:36 b:10.5 c:79</p> <p>FORD Capri Escort Granada Transit</p> <p>J1E, TV13L, EV13H G1, J1F, G2, J2, J3, TV13H YYH, MWB, 4AA, 4AB FO 71BB10300FA BO 0120489511 HC CA1901R</p>	<p>12v 55amp a:21 b:80.5</p> <p>BMW 320 320I 520</p> <p>BM 12311361374 BO 0120489685 HC CA1921R</p>
<p>ALB0196 <i>Old</i></p>  <p>ALB0196WA ARB0353 PAL0294</p> 	<p>ALB0219</p> 	<p>ALB0220</p>  <p>ALB0220WA ARB0386</p>	<p>ALB0225 <i>Old</i></p>  <p>ALB0225WA ARB0350</p>
<p>12v 65amp a:77 b:56</p> <p>BMW 3 5</p> <p>M10B16, M10B18 M20B20, M20B23 VA 2950390 BO 0120489030 HC CA1961R</p>	<p>24v 55amp a:50 b:20</p> <p>UNIVERSAL</p> <p>BO 9120060033 CG 114355</p>	<p>24v 140amp b:15 c:180</p> <p>MAN, KHD Various Models</p> <p>IS IA1067 BO 0120689553 CG 114365</p>	<p>12v 70amp a:22 b:13.5 c:79</p> <p>FORD Sierra 2.8L</p> <p>XR4</p> <p>FO 78GB10300FD BO 0120469512 HC CA2251R</p>
<p>ALB0227</p>  <p>ALB0227WA ARB0363</p>	<p>ALB0228 <i>Old</i></p>  <p>ALB0228WA ARB0355 PAL0291</p> 	<p>ALB0235</p>  <p>ALB0235WA ARB0350</p>	<p>ALB0238</p>  <p>ALB0238WA ARB0355</p>
<p>24v 55amp b:80</p> <p>SCANIA Trucks 82, 92, 112, 113, 114 SCANIA Buses CATERPILLAR Engines marine</p> <p>DS805, DSC901 DS1115, DSC1404 SC 1117252 BO 0120469569 HC CA2271R</p>	<p>12v 40amp a:23 b:27</p> <p>PEUGEOT 204 304 305</p> <p>PG 570255 BO 0120489277 HC CA2281R</p>	<p>12v 45amp a:77 b:56</p> <p>ALFA ROMEO Alfa 33</p> <p>AR30585, AR30504 AR30502 AR30143 BO 0120489719 BO 0120489912 HC CA2351R</p>	<p>12v 55amp a:88 b:56</p> <p>VOLVO 240 740 760</p> <p>D24 D24T, D24TIC VO 1308719</p> <p>DEUTZ, FENDT Agricultural BO 0120489069 HC CA2381R</p>














Alternators

Bosch

<p>ALB0240</p>  <p>ALB0240WA ARB0374</p>	<p>ALB0242</p>  <p>ALB0242WA ARB0350 PAL0294</p> 	<p>ALB0244</p>  <p>ALB0244WA ARB0350</p>	<p>ALB0251 <i>Old</i></p>  <p>ALB0251RB ALB0251WA ARB0350</p>
<p>24v 55amp b:80</p> <p>DAF, FORD, MAN Diesel Trucks Escort 1.4L, 1.8L Fiesta 1.0L, 1.1L, 1.3L Mondeo, Scorpio</p> <p>WS225, WS259 D0826F01, D0826LF01 RTF, RTE, F6F, F6G MN 51261017156 BO 0120469527 HC CA240IR</p>	<p>12v 65amp a:110 b:56</p> <p>AUDI, VW 80, 100, Coupe Golf, Jetta, Passat Santana, Cabriolet Quantum</p> <p>PH, WH, DS, JW, EP EW, EZ, ABN, HM DS, JH, JN, HT, MZ VW 049903023TX BO 0120469501 HC CA242IR</p>	<p>12v 75amp b:56.2</p> <p>AUDI VW PORSHE 924 2.0L 928 4.5L</p> <p>VW 035903015M BO 0120469500 HC CA244IR</p>	<p>12v 80amp a:78 b:56</p> <p>BMW 3 5 6 7, M</p> <p>M10B18, M40B16 M20B20, M30B32 S14B23, S38B35 BW 12311271663 BO 0120469538 HC CA251IR</p>
<p>ALB0254 <i>Old</i></p>  <p>ALB0254WA ARB0353</p>	<p>ALB0259 <i>Old</i></p>  <p>ARB0301</p>	<p>ALB0263 <i>Old</i></p>  <p>ALB0263RB ALB0263WA ARB0355</p>	<p>ALB0265</p>  <p>ALB0265RB ALB0265WA ARB0385</p>
<p>12v 65amp a:52.5 b:23 c:73</p> <p>FIAT, LANCIA Prisma Delta Y Regata</p> <p>831A1000, 149C1000 138C2048, 831B1000 146A5046, 156B000 FI 46231682 BO 0120488207 HC CA254IR</p>	<p>12v 35amp a:26 b:10 c:88.5</p> <p>FORD DAF Escort Transit Granada</p> <p>4RC FO 1553526 BO 0120400758 HC CA259IR</p>	<p>12v 80amp a:76 b:56</p> <p>MERCEDES-BENZ 100 500, 560 420 210</p> <p>OM616, OM616963 M117965, M117961, M117962 M116965, M102945 BO 0120469588 BO 0120469642 HC CA263IR</p>	<p>12v 70amp a:26 b:14.5 c:60</p> <p>VW, SKODA</p> <p>VW 038903023G BO 0123310019 HC CA1249IR</p>
<p>ALB0266</p>  <p>ARB0368</p>	<p>ALB0270 <i>New</i></p>  <p>ALB0270WA ARB0714 PAL0407</p> 	<p>ALB0271</p>  <p>ALB0271WA ARB0321 PAL0453</p> 	<p>ALB0272 <i>New</i></p>  <p>ARB0677</p>
<p>12v 55amp b:56</p> <p>CASE MERCEDES-BENZ</p> <p>HA 50366500 BO 0120488138 HC CA1450IR</p>	<p>12v 120amp a:68.5 b:28 c:76.5</p> <p>BMW Z4</p> <p>2.5L 3.0L</p> <p>BM 12317519618 BO 0124515105 HC CA1826IR</p>	<p>12v 120amp a:32.5 b:14 c:61</p> <p>RENAULT Grand Megane Scenic</p> <p>RE 8200356669 BO 0124425018 HC CA1945IR</p>	<p>12v 140amp a:118 b:56</p> <p>SAAB 9-5</p> <p>SAAB 12770124 BO 0124525143 HC CA1961IR</p>

























Alternators

Bosch

<p>ALB0275 <i>New</i></p>  <p>ALB0275WA ARB0024 PAL0407 </p> <p>12v 180amp a:30 b:63 c:41</p> <p>BMW 116, 118, 120 316, 318, 320 520</p> <p>BM 12317542351 BO 0121715017 HC CA2035IR</p>	<p>ALB0278 <i>New</i></p>  <p>ALB0278WA ARB0160 PAL0474 </p> <p>12v 120amp a:111.5 b:61</p> <p>OPEL, VAUXHALL 1.9L Signum Vectra Zafira</p> <p>OP 13229991 BO 0124425058 HC CA2045IR</p>	<p>ALB0284 <i>Old</i></p>  <p>ALB0284WA ARB0353</p> <p>12v 80amp a:20 b:56</p> <p>OPEL Monza Omega Senator</p> <p>H20E H25E C30LE OP 90337051 BO 0120469575 HC CA284IR</p>	<p>ALB0296</p>  <p>ALD0296WA</p> <p>12v 55amp a:109 b:56</p> <p>AUDI, SEAT, VW 80, 100, Coupe Toledo</p> <p>4B, SH, CN, NP, RS AAE, AAD, ABM GU, GX, PF, GZ VW 026903015 BO 0120489185 HC CA296IR</p>
<p>ALB0298</p>  <p>ALB0298RB ALB0298WA ALV0298RB ARB0353</p> <p>12v 65amp a:109 b:56</p> <p>AUDI, SEAT, VW 80, 100, Coupe Golf, Jetta, LT, Passat Toledo</p> <p>4B, SH, CN, NP, RS AAE, AAD, ABM GU, GX, PF, GZ VW 026903015 BO 0120489364 HC CA298IR</p>	<p>ALB0299</p>  <p>ALB0299WA ARB0353</p> <p>12v 70amp a:36.5 b:14 c:82.5</p> <p>FORD Escort Sierra Scorpio</p> <p>N5F, REC, NRC, NEL, NR NRA, STR, SFA, SFB, L REF, RED, NES, YTR, L FO 86EF10300BA BO 0120469655 HC CA299IR</p>	<p>ALB0301</p>  <p>ALB0301WA ARB0355</p> <p>12v 70amp a:22 b:71</p> <p>VOLVO 760 Series</p> <p>VOLV 5003002 BO 0120469568 HC CA590IR</p>	<p>ALB0302</p>  <p>ALB0302WA ARB0353</p> <p>12v 65amp a:98 b:56</p> <p>VW, AUDI Golf Jetta Passat, Polo 80</p> <p>JP, ME, JR EZ, 1Y, MN, 1V RA, SB, MF, ABK VW 068903017T BO 0120489449 HC CA302IR</p>
<p>ALB0318</p>  <p>ALB0318RB ALB0318WA ARB0353</p> <p>12v 90amp a:84 b:56</p> <p>AUDI, VW 90, 100, 200 Golf, Jetta, LT Passat, Transporter</p> <p>JK, RA, SB, 1Y, CY JP, JR, DW, 1G, DV ACT, ACL, DT VW 035903017AX BO 0120469581 HC CA318IR</p>	<p>ALB0319</p>  <p>ALB0319WA ARB0353</p> <p>12v 65amp a:110 b:56</p> <p>VW Caddy 1.6 Diesel Transporter 1.6 Diesel Transporter 1.7 Diesel</p> <p>JK, JX CS, KY VW 036903017GX BO 0120489427 HC CA319IR</p>	<p>ALB0320</p>  <p>ALB0320RB ALB0320WA ARB0353</p> <p>12v 90amp a:82 b:56</p> <p>AUDI, OPEL, SEAT, VW 80, 100, Coupe, Caddy Golf, Jetta, LT, Passat</p> <p>KF, KU, KG AAD, 3A, 1Z WE, WR, WC VW 026903015B BO 0120469581 HC CA320IR</p>	<p>ALB0321</p>  <p>ALB0321RB ALB0321WA ALV0321RB ARB0355 PAL0294 </p> <p>12v 55amp a:92 b:56</p> <p>MERCEDES-BENZ 12t, 14t, 17t, 19t 20t, 26t, 30t, 33t 4t, 5t, T1</p> <p>OM441905, OM441914 M102921, M102962 OM601912, OM601940 MB 0061545402 BO 0120489061 HC CA321IR</p>







Alternators

Bosch

<p>ALB0322 <i>Old</i></p>   <p>ALB0322WA ARB0353</p> <p>12v 90amp a:36 b:14 c:81</p> <p>FORD Sierra Transit</p> <p>RED, LSE, REF, NES NAT, NAV, LAT, N6T</p> <p>BO 0120469659 BO 0120469754 HC CA322IR</p>	<p>ALB0324</p>   <p>ALB0324RB ALB0324WA ARB0353</p> <p>12v 90amp b:13 c:82</p> <p>FORD Scorpio, Sierra Transit JAGUAR XJ</p> <p>ARD, ARC BRC, BRE, BRF AJ6, AJ64 FO 85GB10300LA BO 0120469661 HC CA324IR</p>	<p>ALB0326</p>   <p>ALB0326WA ARB0363</p> <p>24v 55amp a:50 b:17.5 c:63</p> <p>IVECO Marine Aifo</p> <p>8281M3210 546041970</p> <p>FI 4844266 BO 0120469549 HC CA326IR</p>	<p>ALB0333</p>   <p>ALB0333RB ALB0333WA ARB0362</p> <p>24v 55amp b:80</p> <p>DAF, KASSBOHRER, MAN NS133L, NS133M MERCEDES, SSANGYONG RS180L, OM442 65, 75, 85, 95, CF, LF, XF D27DT, M104992 Setra, 10t, 12t, 14t MB 0101542002 Cargo, Musso, Kyron BO 0120469001 HC CA333IR</p>
<p>ALB0334</p>   <p>ARB0374</p> <p>24v 35amp b:80</p> <p>RENAULT, MAN FORD R21 Escort Mondeo</p> <p>J8S714, RFN J8S786, RKC J8S788 MN 51261017155 BO 0120489230 HC CA334IR</p>	<p>ALB0335</p>   <p>ALB0335RB ALB0335WA ARB0355</p> <p>12v 80amp a:92 b:56</p> <p>MERCEDES-BENZ 190, 208, 210, 260 300, 308, 310 Axor, O 100 4t, 5t, 18t, 19t, 22t, 25t</p> <p>M103942, M102942 OM601940, M115955 OM442997, M103983 MB 0071546702 BO 0120469744 HC CA335IR</p>	<p>ALB0337</p>   <p>ARB0353</p> <p>12v 45amp a:109.5 b:56.3</p> <p>VW LT Passat</p> <p>DV, 1G, DW 1S, JK, CY ACT, ACL BO 0120489368 BO 0120489367 HC CA337IR</p>	<p>ALB0339</p>   <p>ALB0339WA ARB0361</p> <p>12v 55amp a:77 b:56</p> <p>CASE, CLAAS, MERCEDES M115921, OM621 Agricultural machine F4L913, BF6L913T IVECO, MERCEDES, STEYRWD61000, WD61001 Trucks MB 0061541602 LAMBORGHINI Jalpa 3.5 BO 0120489710 HC CA339IR</p>
<p>ALB0340</p>   <p>ALB0340WA ARB0361</p> <p>12v 65amp a:77 b:56</p> <p>DEUTZ, FAHR, KHD Agricultural DX, Intrac, M Series IVECO trucks</p> <p>BF6L913, F6L912 F4L913, BF6L913T F6L913 KH 1172857 BO 0120489756 HC CA340IR</p>	<p>ALB0341</p>   <p>ALB0341WA ARB0362</p> <p>24v 27amp b:56</p> <p>DEUTZ Agricultural CASE, LIEBHERR Industrials IVECO, MERCEDES, STEYRMB Trucks</p> <p>F6L413, BF6L913 BF4L913T, BF8L513 F8L413F, BF8L513 0061541702 BO 0120489707 HC CA341IR</p>	<p>ALB0343</p>   <p>ALB0343WA ARB0353</p> <p>12v 90amp a:65 b:14 c:82</p> <p>AUDI VW Coupe 100, 200 5000</p> <p>NM NF MC VW 027903017 BO 0120469831 HC CA343IR</p>	<p>ALB0345</p>   <p>ALB0345WA ARB0355 PAL0294</p> <p>12v 70amp a:92 b:56</p> <p>MERCEDES-BENZ 12t, 14t, 17t, 18t, 19t 190, 200, 208, 210 230, 250, 260, 300 30t, 32t, 33t, 35t</p> <p>OM441905, OM441914 M102961, M102962 OM605911, OM457960 MB 0061548702 BO 0120489325 HC CA345IR</p>

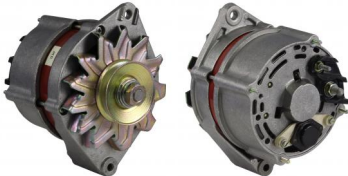











Alternators

Bosch

<p>ALB0347</p>  <p>ALB0347WA ARB0353</p> <p>12v 55amp a:77.5 b:56</p> <p>VW Polo NZ, HZ GL, GK VW 036903017J BO 0120489428 HC CA347IR</p>	<p>ALB0352</p>  <p>ALB0352WA ARB0353</p> <p>12v 70amp a:88 b:56</p> <p>OPEL Omega Ascona Rekord Kadet 18NV, 18SV, 20SE 16N, 18E, 20NE C18NV, E18NV, 20SEH BO 0120489343 BO 0120489341 HC CA352IR</p>	<p>ALB0353</p>  <p>ALB0353WA ARB0353</p> <p>12v 65amp a:77 b:56</p> <p>ALBIN - Marine BEDFORD, LANCIA, OPEL Ascona, Astra, Corsa Kadett, Vectra 20DTR 13N, 13S E16NZ, C16NZ OP 90337044 BO 0120489339 HC CA353IR</p>	<p>ALB0358</p>  <p>ALB0358WA ARB0353 PAL0454</p>  <p>12v 55amp a:39.5 b:13.5 c:80</p> <p>NISSAN Cabstar 2.7L Cabstar 3.0L TD27T BD30TI NI 2310069T05 BO 6033GB4008 HC JA1614IR</p>
<p>ALB0362 <i>Old</i></p>  <p>ALB0362WA ARB0353</p> <p>12v 80amp a:81.5 b:56</p> <p>BMW 5 6 3 7 M10B18, M20B20 M30B28, M30B35 M20B25, M30B32 BO 0120469758 BO 0120469759 HC CA362IR</p>	<p>ALB0364</p>  <p>ALB0364WA ARB0353</p> <p>12v 55amp b:56</p> <p>VW Polo Polo Classic 1W MN AAU VW 031903023C BO 0120488241 HC CA364IR</p>	<p>ALB0366</p>  <p>ALB0366WA ARB0350</p> <p>12v 90amp b:51</p> <p>VOLVO, VALTRA Agriculture VOLVO Trucks F 80 Series F Series B39B, TD60B TD100A, TD120A TD100G, TD40A VO 1509425 BO 0120469507 HC CA366IR</p>	<p>ALB0367</p>  <p>ALB0367WA ARB0353 PAL0294</p>  <p>12v 45amp a:109 b:56</p> <p>AUDI 80 1.6 Diesel AUDI 90 1.6 Diesel VW Passat 1.6 Diesel Santana 1.6 Diesel CR, CY, JK VW 068903017 BO 0120489966 HC CA367IR</p>
<p>ALB0368</p>  <p>ALB0368WA ARB0362</p> <p>24v 35amp b:56</p> <p>IVECO, DEUTZ, STEYR P/PA Series KHD AH AHB AHW KH 01162135 BO 0120489731 HC CA368IR</p>	<p>ALB0376</p>  <p>ALB0376WA ARB0353</p> <p>12v 65amp a:75 b:56</p> <p>VW Golf Jetta Polo JR, MH, JP, ME, SB GX, MF, 1V, RP, NZ 3F, PY, NZ, GK, AAK VW 039903027C BO 0120489240 HC CA376IR</p>	<p>ALB0381</p>  <p>ALB0381WA ARB0355</p> <p>12v 80amp a:93 b:71</p> <p>VOLVO 240, 340, 360, 740, 940 244, 245 B230F, B230FT B230F, B230K B23E, D24, D24T VO 1363496 BO 0120469785 HC CA381IR</p>	<p>ALB0383</p>  <p>ALB0383WA ARB0353</p> <p>12v 55amp a:26 b:13.5 c:80</p> <p>OPEL BEDFORD VAUXHALL OP 1204330 BO 0120488002 HC CA383IR</p>














Alternators

Bosch

<p>ALB0384</p>  <p>ALB0384WA ARB0353</p> <p>12v 70amp a:39.5 b:13.5 c:80</p> <p>OPEL Omega Senator Rekord</p> <p>23YDT, 23DTR, 23YD 23TD, 23D</p> <p>OP 1204056 BO 0120488000 HC CA384IR</p>	<p>ALB0408</p>  <p>ALB0408WA ARB0408</p> <p>12v 90amp a:37 b:14 c:60</p> <p>RENAULT NISSAN LOGAN 1.6MPI 10-> SANDERO 1.6 09-></p> <p>NI 231007633R BO F000BL0408 MH ALB0408</p>	<p>ALB0415 <i>New</i></p>  <p>ALB0415 ARB0044 PAL0415</p> <p>12v 180amp a:42 b:14.5 c:61</p> <p>AUDI A6 VOLKSWAGEN Crafter</p> <p>VW 03G903016L BO 0121715077 VA 439783</p>	<p>ALB0429 <i>New</i></p>  <p>ALB0429 ARB0353</p> <p>12v 80amp a:30 b:16 c:78.5</p> <p>BMW</p> <p>BM 12311722207 BO 0120469876 HC CA539IR</p>
<p>ALB0431 <i>Old</i></p>  <p>ALB0431WA ARB0353</p> <p>12v 55amp a:76.5 b:56</p> <p>BEDFORD OPEL OPEL VAUXHALL</p> <p>13S, 13N 16SV, E16NZ E12GV, 10S OP 1204133 BO 0120489769 HC CA99IR</p>	<p>ALB0443 <i>New</i></p>  <p>ALB0443 ARB0139 PAL0200</p> <p>12v 90amp a:42 b:13 c:81</p> <p>NISSAN Serena Vanette</p> <p>LD20 LD23</p> <p>NI 231009C600 BO 9120335000 HC JA1162IR</p>	<p>ALB0455 <i>New</i></p>  <p>ALB0455WA ARB0231</p> <p>12v 200amp b:55</p> <p>JOHN DEERE Combines Cotton Stripper Cotton Picker</p> <p>414 Diesel 548 Diesel 824 Diesel JD AH212040 BO 0124625030 WA 12796N</p>	<p>ALB0460 <i>New</i></p>  <p>ALB0460WA</p> <p>12v 110amp a:32 b:14 c:61</p> <p>BO F000RL0677 MH ALB0460</p>
<p>ALB0461 <i>New</i></p>  <p>ALB0461 F00M346 PAL0407</p> <p>12v 140amp a:25 b:70 c:57</p> <p>AUDI A4 A5 Q5</p> <p>CADA, CDNC CAEB, CDZA CNCD, CPMB VW 06H903017J BO 0125711044 DR DRA1029</p>	<p>ALB0462 <i>New</i></p>  <p>ALB0462 ARB0805 PAL0415</p> <p>12v 180amp a:38 b:13 c:62</p> <p>SEAT Alhambra SKODA Superb VOLKSWAGEN Passat</p> <p>CFGC, CFFE CFFA, CFFB CLLA VW 03L903024F BO 0125811028 LU LRA03402</p>	<p>ALB0464 <i>New</i></p>  <p>ALB0464</p> <p>12v 140amp a:35 b:13 c:56</p> <p>SSANGYONG Korando 2.0L</p> <p>MB A6711540302</p>	<p>ALB0465 <i>New</i></p>  <p>ALB0465 PAL0416</p> <p>12v 150amp b:76 c:54</p> <p>VOLVO S80 II V70 III XC70 II XC90</p> <p>B6324S B6304T2 VO 36000210 BO 0121615111 WA 11345R</p>











Alternators

Bosch

<p>ALB0466 <i>New</i></p>  <p>ARB0074 PAL0416</p>  <p>12v 150amp a:64 b:33 c:59</p> <p>FORD, VOLVO Galaxy Mondeo, S-Max S60, S80, V60 V70, XC60</p> <p>TNWA, TNWB B4204T6, B4204T7 TNBA, TPBA VO 30659675 BO 0125711045 DR DRA1031</p>	<p>ALB0468 <i>New</i></p>  <p>ARB0408</p> <p>12v 90amp a:78 b:14 c:62</p> <p>DACIA Dokker DACIA Lodgy RENAULT Duster</p> <p>K7MA8 K4M616 NI 231004527R BO F000BL0407</p>	<p>ALB0500</p>  <p>ALB0500WA ARB0363</p> <p>24v 55amp b:51</p> <p>VOLVO F10 Series F12 Series 610, 611, 612 Various Models</p> <p>TD121GD TD101PA TD60C VO 11063163 BO 0120469523 HC CA500IR</p>	<p>ALB0501</p>  <p>ALB0501WA ALB501WA ARB0362</p> <p>24v 55amp b:56</p> <p>Iveco 100 Deutz AX KHD 9.6 Ford Cargo 6.0 9.6</p> <p>BF8L513 150/6CA-Dover F6L413 IV 42522722 BO 0120469008 HC CA501IR</p>
<p>ALB0502</p>  <p>ALB0502WA ARB0361</p> <p>12v 90amp b:80</p> <p>CLAAS MERCEDES-BENZ Various Models</p> <p>Various Models MB 0051543202 BO 0120469013 HC CA502IR</p>	<p>ALB0503</p>  <p>ALB0503WA ARB0353</p> <p>12v 90amp a:82 b:56</p> <p>BMW, PIAGGIO 320 323 525</p> <p>M20B20 M20B23 M30B25 BM 12311711203 BO 0120469757 HC CA503IR</p>	<p>ALB0505</p>  <p>ALB0505WA ARB0353</p> <p>12v 45amp a:99 b:56</p> <p>VW 1, 6 Golf Jetta Passat</p> <p>1V, JR RA, 1Y ME, SB, MF VW 068903017RX BO 0120489372 HC CA505IR</p>	<p>ALB0513 <i>Old</i></p>  <p>ALB0513WA ARB0353</p> <p>12v 70amp a:77 b:56</p> <p>OPEL Ascona Corsa Astra Kadett</p> <p>16SV, 13N, 13S, E16NZ 12ST, 12NC, 13NB, 14NV C14NZ, X16SZR, E16NZ, 13S BO 0120489634 BO 0120489339 HC CA513IR</p>
<p>ALB0514</p>  <p>ALB0514WA ARB0353</p> <p>12v 70amp a:77 b:56</p> <p>LANCIA OPEL Gamma Ascona</p> <p>830A000 830A4000 13N, 13S, 16SV, C16LZ OP 1204041 BO 0120489138 HC CA514IR</p>	<p>ALB0516</p>  <p>ALB0516RB ALB0516WA ARB0353</p> <p>12v 70amp a:87 b:56</p> <p>OPEL, VAUXHALL Ascona, Calibra Astra Kadett Vectra</p> <p>16D, 16DA, 17D C20LET, 20XEJ X17DTL, 17DR OP 1204033 BO 0120488187 HC CA516IR</p>	<p>ALB0517</p>  <p>ALB0517WA ARB0353</p> <p>12v 70amp a:85 b:56</p> <p>OPEL Astra Omega Vectra</p> <p>C18NZ, C20NE, C20XE C20NEF, C20NEJ, E18NVR 20XEJ, 18SV OP 1204121 BO 0120488172 HC CA517IR</p>	<p>ALB0518</p>  <p>ALB0518WA ARB0363</p> <p>24v 55amp b:51</p> <p>VOLVO Rucks B Series F Series FL Series</p> <p>TD122FL, TD123ES TD102FF, TD103ES D6B, 20NE, D7A285 VO 1089861 BO 0120469014 HC CA518IR</p>


Alternators

Bosch

<p>ALB0519</p>  <p>ARB0353</p> <p>12v 65amp a:35 b:11 c:81</p> <p>OPEL E18NVR, 18SEH, E18NVR/W Omega C16SE, C14SE, C14NZ Astra E16NZ, C16LZ, 18NV Vectra OP 1204344 Kadett BO 0120488123 HC CA519IR</p>	<p>ALB0521 <i>Old</i></p> <p>ALB0521WA</p> <p>ARB0353</p> <p>12v 90amp a:31.5 b:14 c:82</p> <p>AUDI 9A, KR 7A, KV, NM, AAR Corrado, Passat AAT, NF, MC, NG 100, 200, 80, 90 BO 0120469888 A6 BO 0120469822 HC CA521IR</p>	<p>ALB0528 <i>Old</i></p> <p>ALB0528WA</p> <p>ARB0355</p> <p>12v 55amp a:93.8 b:71</p> <p>VOLVO B230A, B230K, B230F 240 B23A, D24, D24T 740 B200F, B200K 360 BO 0120489297 BO 0120489295 HC CA528IR</p>	<p>ALB0530</p>  <p>ARB0353</p> <p>12v 65amp a:35 b:11 c:81</p> <p>OPEL C14NZ, X16SZ, C14SE Astra E16NZ, 16SV, 14NV Vectra E18NVR, 18SEH, 18NV Omega OP 1204058 BO 0120488200 HC CA530IR</p>
<p>ALB0540 <i>Old</i></p>  <p>ALB0540RB ALB0540WA</p> <p>ARB0353</p> <p>12v 115amp a:45 b:16 c:80</p> <p>BMW M20B25 5 M20B20 525 520 BM 12311720591 BO 0120468043 HC CA540IR</p>	<p>ALB0541</p>  <p>ARB0352</p> <p>12v 90amp a:46 b:16 c:80</p> <p>BMW M30 730 M30B30 530 M30B35 535 BO 0120469990 BM 12311713363 HC CA541IR</p>	<p>ALB0547</p>  <p>ARB0353</p> <p>12v 90amp a:45 b:16 c:80</p> <p>BMW E34 520 M20B25 525 BM 12311726248 BO 0120469902 HC CA547IR</p>	<p>ALB0548 <i>Old</i></p>  <p>ARB0353</p> <p>12v 55amp a:84.5 b:56</p> <p>OPEL C2ONEJ, 18SE Carlton C2ONEF, 20XE Astra C2ONE, 18E, C2ONEJ Omega OP 1204076 Belmont BO 0120488162 HC CA548IR</p>
<p>ALB0550</p>  <p>ALB0550WA</p> <p>ARB0363</p> <p>24v 55amp b:27 c:68</p> <p>SCANIA, VOLVO TD63E, DS1115 93, 112, 113, 143 DSC1123, DSC1404 Series B4184S, D6A250 650, FL Series SC 1105367 S40 BO 0120469920 HC CA550IR</p>	<p>ALB0563</p>  <p>ALB0563WA</p> <p>ARB0353 PAL0265 W D+ B+</p> <p>12v 90amp a:33.5 b:14 c:82</p> <p>FORD BOA, N9F, N8D Sierra NRI, N9F, NRA FP 89BX10300NC BO 0120469870 HC CA563IR</p>	<p>ALB0566 <i>Old</i></p>  <p>12v 80amp a:85 b:56</p> <p>MERCEDES-BENZ B234R, B308I, B234L SAAB B201S, B201X, B202 9000 900 BO 0120469881 450 BO 0120469683 HC CA566IR</p>	<p>ALB0568</p>  <p>ARB0362</p> <p>24v 30amp b:80</p> <p>MERCEDES-BENZ OM314946 5t, 6t, 7t, 8t, 9t OM366907 11t-20t, 22t, 24t, 26t OM357921 30t, 32t, 33t, 35t MB 0051541102 and Various Trucks BO 0120489316 HC CA568IR</p>

Alternators

Bosch

<p>ALB0569</p>  <p>ALB0569WA ARB0353</p> <p>12v 85amp b:17 c:64</p> <p>ALFA ROMEO, FIAT IVECO, LANCIA Alfa 164, Croma Daily I, Zeta Thema</p> <p>834C1000, 814497S AR06476, 154C3046 814497S, 8140272720 FI 46231742 BO 0120469710 HC CA569IR</p>	<p>ALB0593 <i>Old</i></p>  <p>ALB0593WA ARB0353 PAL0294</p> <p>12v 65amp a:77.5 b:56</p> <p>ALFA ROMEO Alfasud Alfa 33</p> <p>AR30558, AR30736 AR30737, AR30737A AR30743 FI 60537889 BO 0120488119 HC CA593IR</p>	<p>ALB0595</p>  <p>ALB0595WA ALI0595 ARB0362</p> <p>24v 55amp b:56</p> <p>MERCEDES, STEYR Unimog 6.0l 13S 6.6l 14S 6.6l 15S 6.6l</p> <p>OM356980 OM357945 EM780992 MB 0051548102 BO 0120469579 HC CA595IR</p>	<p>ALB0608</p>  <p>ALB0608WA ARB0352</p> <p>12v 90amp a:60.8 b:15.8 c:80.5</p> <p>BMW 3 5</p> <p>M40B16 M40B18 BO 0120469878 BO 0120469879 HC CA608IR</p>
<p>ALB0610</p>  <p>ALB0610RB ALB0610WA ALB610WA ARB0353</p> <p>12v 90amp a:99 b:56</p> <p>VW Transporter 1.6L Transporter 1.9L Transporter 2.4L Transporter 2.5L</p> <p>RA, AAB, JX, KY VW 068903031R BO 0120469722 HC CA610IR</p>	<p>ALB0615</p>  <p>ALB0615WA ARB0353</p> <p>12v 70amp a:84.5 b:56</p> <p>OPEL Astra Vectra</p> <p>C20XE, C20XE, X17DTL 17D, 17DR BO 0120488100 BO 0120488169 HC CA615IR</p>	<p>ALB0619</p>  <p>ALB0619WA ARB0353</p> <p>12v 65amp a:52 b:56</p> <p>VW Caddy 1.6L</p> <p>Diesel VW 036903017G BO 0120489432 HC CA619IR</p>	<p>ALB0620 <i>New</i></p>  <p>ALB0620 ARB0352 PAL0265</p> <p>12v 55amp a:23 b:11 c:81</p> <p>FORD</p> <p>FO 87BB10300AA BO 0120489477 HC CA620IR</p>
<p>ALB0622</p>  <p>ALB0622 ARB0355</p> <p>12v 100amp a:21 b:71.5</p> <p>VOLVO 740 Series 2.3L 760 Series 2.3L 780 Series 2.3L 940 Series 2.3L</p> <p>VO 1363497 BO 0120468009 HC CA622IR</p>	<p>ALB0645</p>  <p>ALB0645RB ALB0645WA</p> <p>12v 100amp a:91 b:56</p> <p>MERCEDES-BENZ BMW 500 300 3, 5</p> <p>OM603971, M103984 M119972, M119960 M119982 BO 0120468057 BO 0120468060 HC CA645IR</p>	<p>ALB0646</p>  <p>ALB0646WA ARB0387</p> <p>12v 120amp a:91.5 b:56</p> <p>MERCEDES-BENZ 600 S600 S500 S420</p> <p>M120980, M119981 M120982 M119980 MB 0081549202 BO 0120465013 HC CA646IR</p>	<p>ALB0647</p>  <p>ALB0647 ARB0353</p> <p>12v 70amp a:90 b:56</p> <p>MERCEDES-BENZ 300 OPEL, VAUXHALL Astra 1.4l Astra 1.6l</p> <p>OM401975, M104994 M104990, OM542921 OM541922 OP 1204128 BO 0120488255 HC CA647IR</p>













Alternators

Bosch

<p>ALB0665</p>  <p>ALB0665WA ARB0385</p> <p>12v 80amp a:38 b:25 c:81</p> <p>NISSAN SR20DE Primera SR20DI</p> <p>NI 2310072J00 BO 0120485015 HC JA665IR</p>	<p>ALB0700</p>  <p>ALB0700RB ALB0700WA ARB0353</p> <p>12v 115amp a:32 b:14.5 c:82</p> <p>ALFA ROMEO, AUDI 1T, AAR LANCIA NF, ABP 90, 100, 200, S4, S6 834E000, 834F2000 Coupe, Cabriolet, V8 VW 034903015F Kappa, Thema, Alfa164 BO 0120468017 HC CA700IR</p>	<p>ALB0702</p>  <p>ALB0702WA ARB0362</p> <p>24v 35amp a:77 b:56</p> <p>IVECO F6L912, F6L913 Various Trucks F5L413FR, F8L513 KHD, LIEBHERR BF6L913T, BF8L513 Industrial Engines KH 01182153 BO 0120488153 HC CA702IR</p>	<p>ALB0708</p>  <p>ALB0708WA ARB0353</p> <p>12v 90amp a:88 b:56</p> <p>AUDI, VW HP, HY 90, Coupe, 4000 KV, KX Passat, Transporer JS, JT Quantum VW 034903017A BO 0120469931 HC CA708IR</p>
<p>ALB0712</p>  <p>ALB0712RB ALB0712WA ARB0353</p> <p>12v 90amp a:49 b:13 c:82</p> <p>BMW M30B32 7 160A1046 FIAT 836A4000 Punto FI 7774480 Tipo BO 0120469847 HC CA712IR</p>	<p>ALB0714</p>  <p>ALB0714RB ALB0714WA ARB0355</p> <p>12v 80amp a:91.5 b:56</p> <p>MERCEDES-BENZ OM603963 300 OM457960 Axor OM602940 O 100 MB 0081543002 BO 0120469928 HC CA714IR</p>	<p>ALB0722</p>  <p>ALB0722WA ARB0363</p> <p>24v 45amp b:50</p> <p>VOLVO TD122FL, TD102F B Series, F Series TD102FBQ, D6A210 FL Series D6A230, D6B FS Series VO 85000710 N Series BO 0120489303 HC CA722IR</p>	<p>ALB0724</p>  <p>ALB0724WA ARB0387</p> <p>12v 70amp a:92 b:56</p> <p>MERCEDES-BENZ OM401973, OM401985 Sprinter OM604915, M111960 300 M111920, M102910 12t, 14t, 17t MB 0081545102 180, 220, 300 BO 0120485011 HC CA724IR</p>
<p>ALB0727</p>  <p>ALB0727WA ARB0355</p> <p>12v 90amp a:56 b:17 c:63.5</p> <p>FIAT, LANCIA 835A7000, 154E100 Dedra 835A2046, 154C30466 Thema 836A3000, 175A1000 Coupe FI 99448466 Croma BO 0120469861 HC CA727IR</p>	<p>ALB0731</p>  <p>ALB0731WA ARB0385</p> <p>12v 90amp a:34.5 b:13.5 c:81</p> <p>FORD L1F, RKB, NGD Mondeo NGA, L1J, NGC RKA, NGA FO 93BB10300CE BO 0123212001 HC CA731IR</p>	<p>ALB0732</p>  <p>ALB0732WA ARB0387 PAL0271</p> <p>12v 70amp a:39.5 b:14.5 c:60</p> <p>VW AFT, ADZ Golf ABS, 2E Passat ANP, PG VW 030903023DX BO 0123500001 HC CA732IR</p>	<p>ALB0733</p>  <p>ALB0733RB ALB0733WA ALV0733RB ARB0385 PAL0271</p> <p>12v 70amp a:39.5 b:14 c:61</p> <p>SEAT, SKODA, VW AEE, 1F, 1Y Golf, Jetta, Passat AKV, APQ, AEX Polo, Transporter 2E, AGG, AWG Felicia, Toledo VW 028903025G Cordoba, Ibiza BO 0123310020 HC CA733IR</p>

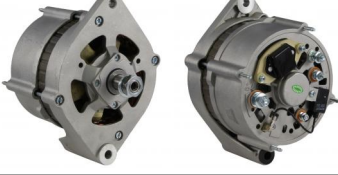Alternators

Bosch

<p>ALB0734</p>  <p>ALB0734WA ARB0305</p> <p>12v 33amp a:76 b:56</p> <p>CLAAS, EICHER JOHN DEERE, SAME LAMBORGHINI Agricultural machine</p> <p>EDL22, EDL372 EDL44, EDL45 EDL38, EDL39 JD AR62401 BO 0120300517 HC CA734IR</p>	<p>ALB0736</p>  <p>ALB0736RB ALB0736WA ARB0385 PAL0271</p> <p>12v 90amp a:40 b:14 c:61</p> <p>FORD, SEAT, SKODA, VW Galaxy, Alhambra Arosa, Cordoba, Ibiza Felicia, Golf, Passat Polo, ransporter, Vento</p> <p>1Z, AHU, AVG AEE, 1Y, 1F, AKV AAZ, 2E, ABV VW 021903017A BO 0123320001 HC CA736IR</p>	<p>ALB0737</p>  <p>ARB0385</p> <p>12v 80amp a:81 b:56</p> <p>ALFA ROMEO Alfa 155 Alfa 164</p> <p>AR64103, AR67103 AR06420, AR67105 AR06416 FI 60567586 BO 0123310026 HC CA737IR</p>	<p>ALB0738</p>  <p>ALB0738WA ARB0385</p> <p>12v 70amp a:33 b:14.5 c:81.5</p> <p>FORD Escort Fiesta MAN NL Series</p> <p>RDA, L1H, RKC, F6F D0836LF03, LJF F6G, D2066LUH41 FO 92FB10300FB BO 0120485029 HC CA738IR</p>
<p>ALB0740</p>  <p>ALB0740RB ALB0740WA ALB740WA ARB0387 PAL0271</p> <p>12v 90amp a:40 b:14 c:61</p> <p>VW Golf Passat Polo Transporter</p> <p>AAM, AGG VW 030903023C BO 0123340002 HC CA740IR</p>	<p>ALB0747</p>  <p>ALB0747WA ARB0353</p> <p>12v 90amp a:31.5 b:17.5 c:64</p> <p>ALFA ROMEO Alfa 164 FIAT Thema Tipo</p> <p>1602ACT 146A4000 160A5000 FI 5999520 BO 0120469646 HC CA747IR</p>	<p>ALB0749</p>  <p>ARB0363</p> <p>24v 55amp b:80</p> <p>SCANIA 112 Series 113 Series</p> <p>DSC1130 DSC1113 DSC1118 SC 371972 BO 0120469960 HC CA749IR</p>	<p>ALB0757</p>  <p>ARB0355</p> <p>12v 55amp a:44.5 b:13.5 c:80.5</p> <p>NISSAN Vanette 2.0L Trade 2.0L</p> <p>LD20II NI 23100D9704 BO 9120144605 HC JA757IR</p>
<p>ALB0823</p>  <p>ARB0381</p> <p>24v 120amp b:16 c:180</p> <p>MERCEDES-BENZ O 530 2550</p> <p>OM457942 OM44299 MB 0061542102 BO 0120689513 HC CA823IR</p>	<p>ALB0824</p>  <p>ALB0824WA ARB0381</p> <p>24v 120amp b:15 c:180</p> <p>MERCEDES-BENZ O 305 O 307 Viano</p> <p>OM407955, OM407919 OM407915, OM407918 OM651940 MB 0071542802 BO 0120689513 HC CA824IR</p>	<p>ALB0826</p>  <p>ALB0826WA ARB0353</p> <p>12v 65amp a:72 b:16 c:80</p> <p>BMW 316, 318</p> <p>E36, E30 BM 12311721912 BO 0120488219 HC CA826IR</p>	<p>ALB0827</p>  <p>ALB0827RB ALB0827WA ARB0385 PAL0271</p> <p>12v 70amp a:39 b:14 c:61.5</p> <p>AUDI, FORD SEAT, SKODA, VW Cordoba, Ibiza, Inca Toledo, Felicia Golf, Passat, Polo</p> <p>AEE, APQ, AER AKV, AFT, AJV AAF, ACU, 1Y, 1Z VW 021903017 BO 0123320019 HC CA827IR</p>












Alternators

Bosch

<p>ALB0828</p>  <p>ALB0828WA ARB0385 PAL0271</p> 	<p>ALB0829</p>  <p>ALB0829RB ALB0829WA ARB0385</p>	<p>ALB0833</p>  <p>ALB0833RB ALB0833WA ARB0385</p>	<p>ALB0842</p>  <p>ALB0842WA ARB0353</p>
<p>12v 120amp a:39 b:14 c:61</p> <p>FORD, SEAT, SKODA, VW 1Z, AHV, AER Galaxy, Arosa Ibiza, Inca, Toledo Felicia, Passat, Polo Golf III-IV, Transporter</p> <p>ALL, AEX, AKV APQ, ABD, ANX VW 028903018C BO 0123510001 HC CA828IR</p>	<p>12v 90amp a:39 b:14 c:61</p> <p>AUDI 80, Cabriolet SKODA, VW Felicia Transporter 2.0L</p> <p>1Z, AAZ AEF AAC BO 0120485023 VW 028903018F HC CA829IR</p>	<p>12v 70amp a:92 b:56</p> <p>MERCEDES-BENZ Sprinter 180, 190, 200, 220 230, 250, 260, 300</p> <p>OM441915, OM401973 OM601943, OM602980 M103983, M102982 MB 0081545102 BO 0120485011 HC CA833IR</p>	<p>12v 90amp a:107 b:56</p> <p>AUDI 80, 100, Coupe A6, Cabriolet BMC Trucks EU Professional 8.3 Diesel</p> <p>AAE, AAD, ACE ABK, 6A ISC260 VW 050903015J BO 0120469003 HC CA842IR</p>
<p>ALB0843</p>  <p>ALB0843WA ARB0385</p>	<p>ALB0852</p>  <p>ALB0852WA ARB0385</p>	<p>ALB0853</p>  <p>ALB0853WA ARB0363</p>	<p>ALB0854</p>  <p>ALB0854WA ARB0362</p>
<p>12v 90amp a:107 b:56</p> <p>AUDI 80, 100, Coupe A6, Cabriolet BMC Trucks EU Professional 8.3 Diesel</p> <p>AAE, AAD, ACE ABK, 6A ISC260 VW 050903015J BO 0123335001 HC CA843IR</p>	<p>12v 70amp a:39 b:14 c:61</p> <p>AUDI 80 A6</p> <p>AHU 1Z AAZ VW 028903025AX BO 0123320003 HC CA852IR</p>	<p>24v 80amp b:51</p> <p>VOLVO B series F Series FL Series FS Series</p> <p>D6B, D6A250 TD61G, TD61F D6A180, TD63E VO 1089862 BO 0120468114 HC CA853IR</p>	<p>24v 35amp b:80</p> <p>PADANE MAN Trucks EU 5t, 6t, 7t, 8t MERCEDES Trucks EU Z-Serie</p> <p>OM356904 OM422907 D0824LF01 MB 0071542402 BO 0120488277 HC CA854IR</p>
<p>ALB0855</p>  <p>ALB0855WA ARB0385</p>	<p>ALB0859 <i>Old</i></p>  <p>ARB0353</p>	<p>ALB0868</p>  <p>ALB0868RB ALB0868WA ARB0668 PAL0284</p> 	<p>ALB0897 <i>Old</i></p>  <p>ARB0353</p>
<p>12v 120amp a:30 b:14 c:82</p> <p>AUDI A8 A6 A4 80</p> <p>AAH AJG, ALW ALF, ABC VW 078903015A BO 0120465007 HC CA855IR</p>	<p>12v 90amp a:69 b:28 c:76</p> <p>BMW 5 520i 525i</p> <p>M50 M52B25 M50B20 BM 12311735234 BO 0120469912 HC CA859IR</p>	<p>12v 65amp a:38.5 b:25 c:67</p> <p>NISSAN Micra</p> <p>CG10DE CG13DE NI 2310054B61 BO 0120335008 HC JA868IR</p>	<p>12v 90amp a:70 b:28 c:76.5</p> <p>BMW 328 325 320</p> <p>M52B28 M52B25 M50B20 BM 12311730752 BO 0120469969 HC CA897IR</p>













Alternators

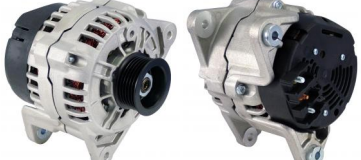Bosch

<p>ALB0899</p>  <p>ALB0899WA ARB0355</p> <p>12v 65amp a:91 b:71</p> <p>VOLVO 240 940</p> <p>B230F B230FB</p> <p>VO 3544624 BO 0120488230 HC CA8991R</p>	<p>ALB0901 <i>Old</i></p>  <p>ALB0901WA ARB0353</p> <p>12v 80amp a:69 b:28 c:76.5</p> <p>BMW 525 520</p> <p>M50B25 M50B20</p> <p>BM 12311726372 BO 0120469906 HC CA9011R</p>	<p>ALB0907</p>  <p>ALB0907WA ARB0363</p> <p>24v 80amp b:14.5 c:100</p> <p>VOLVO 9700 Series FL Series, FH Series FM Series, MH Series</p> <p>DH12D340 D16A520 D7C250</p> <p>VO 1096758 BO 0120468135 HC CA9071R</p>	<p>ALB0908</p>  <p>ALB0908WA ARB0384</p> <p>12v 70amp a:106.5 b:56</p> <p>AUDI Cabriolet A6 80 100</p> <p>ABK ACE ABM, AAD VW 050903015BX BO 0120485047 HC CA9081R</p>
<p>ALB0910</p>  <p>ALB0910WA ARB0353 PAL0294</p> <p>12v 65amp a:26 b:56</p> <p>AUDI 80, 100, Coupe VW Golf, Jetta, Passat Caddy, Scirocco</p> <p>EZ, HM ABN, JW DR, WH</p> <p>VW 034903015C BO 0120489197 HC CA9101R</p> <p>D+ B+ B-</p>	<p>ALB0911</p>  <p>ALB0911WA ARB0353</p> <p>12v 65amp a:78 b:56</p> <p>AUDI 80, 90, 100, Coupe VW LT, Passat Fox, Golf, Jetta</p> <p>AAD, SE KV, DW KX, HP</p> <p>VW 025903023B BO 0120489364 HC CA9111R</p>	<p>ALB0949 <i>New</i></p>  <p>ALB0949WA ARB0026 PAL0400</p> <p>12v 150amp a:54 b:92 c:74</p> <p>FORD Transit 2.4L Transit 2.4L 4x4 Transit 3.2L</p> <p>JXFA, JXFC SAFA, SAFB H9FB</p> <p>FO 1730987 BO 0125711049</p> <p>L DFM</p>	<p>ALB0987</p>  <p>ALB0987RB ALB0987WA ARB0872 PAL0223</p> <p>12v 80amp a:52 b:28 c:42</p> <p>TOYOTA Carina Corolla Avensis</p> <p>7AFE 4AFE</p> <p>TO 2706016460 BO 0123325002 HC JA9871R</p> <p>L IG S</p>
<p>ALB0991</p> <p>ALB0991WA ARB0668 PAL0284</p> <p>12v 65amp a:42 b:25.5 c:82.5</p> <p>FORD NISSAN Terrano</p> <p>KA24E</p> <p>NI 231000F600 BO 0123115011 HC JA9911R</p> <p>S L</p>	<p>ALB0992</p>  <p>ALB0992WA ARB0406 PAL0306</p> <p>12v 60amp a:34 b:58</p> <p>HONDA, ROVER Accord III Civic II Prelude</p> <p>B20A2 B20A8</p> <p>HO 31100PP4E03 BO 0120485050 HC JA9921R</p> <p>IG T L FR</p>	<p>ALB1020 <i>New</i></p>  <p>ALB1020WA ARB0131 PAL0416</p> <p>12v 180amp a:78 b:34 c:56</p> <p>VOLVO S40 S60 C70 S80</p> <p>D5244T4 D5204T5 D5244T11</p> <p>VO 30659131 BO 0125811020</p> <p>L IN NC</p>	<p>ALB1027</p>  <p>ALB1027WA ARB0305 PAL0293</p> <p>12v 55amp a:83 b:56</p> <p>JOHN DEERE Agricultural</p> <p>4.0I Diesel 5.9I Diesel</p> <p>JD AZ26910 BO 0120300516 HC CA10271R</p> <p>D- DF D+</p>


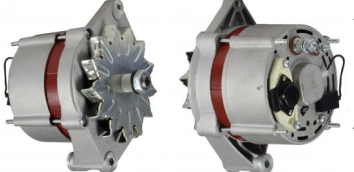














Alternators

Bosch

<p>ALB1032</p>  <p>ALB1032WA ARB0385 PAL0265 W D+ B+</p> <p>12v 70amp a:33.0 b:14 c:81.5</p> <p>FORD Escort MAN 18t Series</p> <p>RDA L1E D0836LF03 FO R94AB10300BA BO 0123310015 HC CA1032IR</p>	<p>ALB1035</p>  <p>ALB035WA ALB1035WA ARB0362</p> <p>24v 80amp b:80</p> <p>DAF, MAN, MB, RENAULT EU Trucks 7t, 8t, 10t</p> <p>OM364921 NS133L MIDR063540M3 DA 1298995 BO 0120468053 HC CA1035IR</p>	<p>ALB1037</p>  <p>ALB037WA ALB1037WA ARB0385</p> <p>12v 70amp a:33 b:14 c:79</p> <p>FORD Escort 1.4L - 1.8L</p> <p>FUH L1E RDA FO 95AB10300DB BO 0123310029 HC CA1037IR</p>	<p>ALB1041</p>  <p>ALB1041WA ARB0353</p> <p>12v 90amp b:16 c:80</p> <p>BMW 316i 1.6L 318i 1.8L 518i 1.8L</p> <p>M42B18 M40B16 BM 12311721921 BO 0120469913 HC CA1041IR</p>
<p>ALB1043</p>  <p>ALB1043WA ARB0385</p> <p>12v 80amp a:91.5 b:56</p> <p>CITROEN Berlingo PEUGEOT 306</p> <p>A9A, DHX DJY, DHY, DHW PE 9631318380 BO 0123310010 HC CA1043IR</p>	<p>ALB1044</p>  <p>ALB1044RB ALB1044WA ALV1044RB ARB0385</p> <p>12v 90amp a:92 b:56</p> <p>MERCEDES-BENZ 12t 17t 180</p> <p>OM401973 111975 MB A0101549902 BO 0123335002 HC CA1044IR</p>	<p>ALB1045</p>  <p>ALB1045WA ARB0385</p> <p>12v 90amp a:50.5 b:33.5 c:59</p> <p>OPEL, VAUXHALL Astra 1.6L Astra 1.8L Astra 2.0L</p> <p>C16NZ C18NZ C20NE OP 90356897 BO 0123350001 HC CA1045IR</p>	<p>ALB1054 <i>Old</i></p>  <p>12v 140amp a:69 b:28 c:78.5</p> <p>BMW 520i 525i Z3</p> <p>S52 BM 12311730261 BO 0120468103 HC CA1054IR</p>
<p>ALB1056</p>  <p>ALB1056WA ARB0384</p> <p>12v 120amp a:48 b:21 c:55.5</p> <p>VOLVO 850, 960, S90, V90 RENAULT Laguna Safrane</p> <p>B5254T, N7Q704 B5254S, B5252S, N7Q710 B5204FT, B5252S, B5234F7 RE 7701042288 BO 0120465006 HC CA1056IR</p>	<p>ALB1057</p>  <p>ALB1057RB ALB1057WA ARB0387</p> <p>12v 120amp a:92 b:56</p> <p>MERCEDES-BENZ 12t 180 DAEWOO</p> <p>OM440909 M111920 MB 0091544302 BO 0123510012 HC CA1057IR</p>	<p>ALB1061 <i>Old</i></p>  <p>12v 80amp a:82 b:56</p> <p>ALFA ROMEO</p> <p>FI 60611990 BO 0123320023 HC CA1061IR</p>	<p>ALB1062</p>  <p>ALB1062WA ARB0385</p> <p>12v 90amp a:92 b:56</p> <p>MERCEDES-BENZ 12t 17t 18t DAEWOO</p> <p>OM441915 M111944 MB 0091543002 BO 0123320045 HC CA1062IR</p>














Alternators

Bosch

<p>ALB1066</p>  <p>ALB1066WA ARB0385</p> <p>12v 55amp a:53 b:34 c:59</p> <p>OPEL Astra Corsa Combo</p> <p>C14NZ, C12NZ X12SZ, X14NZ C14SE OP 6204088 BO 0123100002 HC CA1066IR</p>	<p>ALB1068</p>  <p>ALB1068WA ARB1758</p> <p>12v 120amp b:56</p> <p>JOHN DEERE 1065 5.9L 1068 5.9L 1072 5.9L, 1075 5.9L 1085 7.6L</p> <p>JD AL81438 BO 0120484017 HC CA1068IR</p>	<p>ALB1069</p>  <p>ALB1069WA ARB0387</p> <p>12v 90amp a:92.5 b:71</p> <p>VOLVO 940 960 BMW 3 Series, 5 Series</p> <p>B230G, B234G B204FT, M42B18 M40B16 VO 3544119 BO 0120465018 HC CA1069IR</p>	<p>ALB1070</p>  <p>ALB1070WA ARB0385</p> <p>12v 120amp a:51 b:33.5 c:59</p> <p>OPEL, SAAB, VAUXHALL Omega, Vectra 900, 9000</p> <p>C25XE, X25XE, X30XE B258I, B204E OP 6204004 BO 0123505004 HC CA1070IR</p>
<p>ALB1071</p>  <p>ALB1071WA ARB0385 PAL0265</p>  <p>12v 90amp a:33 b:14 c:83</p> <p>FORD Transit Scorpio</p> <p>Y5A N3A NSD FO 95GB10300KA BO 0123320014 HC CA1071IR</p>	<p>ALB1072</p>  <p>ARB0355</p> <p>12v 55amp a:92 b:56.5</p> <p>MERCEDES-BENZ 208 210 308, 310 5t</p> <p>OM601940 OM602940 OM601941 MB 0071546002 BO 0120489331 HC CA1072IR</p>	<p>ALB1075</p>  <p>ALB1075WA ARB0347 PAL0200</p>  <p>12v 90amp a:46 b:13 c:65</p> <p>MITSUBISHI Carisma</p> <p>4G93 4G92</p> <p>MI MD353869 BO 01233150008 HC CA1075IR</p>	<p>ALB1076</p>  <p>ALB1076RB</p> <p>12v 115amp a:29 b:14.5 c:61.5</p> <p>FORD Galaxy 2.0 i</p> <p>Y5B NSE</p> <p>FO 95VW10300EC BO 0123510031 HC CA1076IR</p>
<p>ALB1081</p>  <p>ALB1081WA ARB0387</p> <p>12v 110amp a:84 b:56</p> <p>MERCEDES-BENZ 14t 500 600 300</p> <p>OM401973 M119974, M104980 M120981 MB 0081548302 BO 0120465014 HC CA1081IR</p>	<p>ALB1082</p>  <p>ALB1082RB ALB1082WA ALB9082WA ARB0392 PAL0275</p>  <p>12v 90amp b:51</p> <p>THERMO KING SB Super II</p> <p>TK 1E32215G01 BO 0120484049 HC CA1082IR</p>	<p>ALB1087</p>  <p>ALB1087WA ARB0388 PAL0264</p>  <p>12v 70amp a:33 b:14 c:78.5</p> <p>FORD Fiesta 1.3L MAZDA 121 1.3L</p> <p>JJA, JJC, JJE, J4J JJK, JHC, DHF MZ 1E0318300 BO 0123310023 HC CA1087IR</p>	<p>ALB1088</p>  <p>ALB1088WA ARB0384</p> <p>12v 120amp a:48 b:21 c:55.5</p> <p>RENAULT Laguna Safrane</p> <p>N7Q700 N7Q710 N7Q704 VO 9130274 BO 0123310030 HC CA1088IR</p>
















Alternators

Bosch

<p>ALB1089</p>  <p>ALB1089RB ALB1089WA</p> <p>ARB0388 PAL0272</p>  <p>DF D+</p> <p>12v 120amp a:40 b:14 c:61</p> <p>FORD Galaxy</p> <p>VOLVO S70 VW</p> <p>ALE 1Z, AHU B5234T2 VW 028903018BX BO 0123505011 HC CA1089IR</p>	<p>ALB1090</p>  <p>ALB1090WA</p> <p>ARB0385</p> <p>12v 90amp a:82 b:56</p> <p>MERCEDES-BENZ 230 Vito V-Class</p> <p>OM601970 OM601942 MB A0111540502 BO 0123320047 HC CA1090IR</p>	<p>ALB1091</p>  <p>ARB0353</p> <p>12v 140amp a:41 b:28.5 c:77</p> <p>BMW 525i</p> <p>BM 12311735395 BO 0120468078 HC CA1091IR</p>	<p>ALB1092</p>  <p>ALB1092WA</p> <p>ARB0385</p> <p>12v 140amp a:69 b:28 c:76</p> <p>BMW 320, 323 325, 328 520, 525</p> <p>E34 E36 E46 BM 12311738351 BO 0120465031 HC CA1092IR</p>
<p>ALB1093</p>  <p>ALB1093WA</p> <p>ARB0384</p> <p>12v 70amp a:35 b:14 c:82</p> <p>AUDI A4 SKODA Felicia VW Passat</p> <p>ADP, ADR, AMG, AMH AHL, AER VW 058903016 BO 0123310022 HC CA1093IR</p>	<p>ALB1096</p>  <p>ALB1096WA</p> <p>ARB0387</p> <p>12v 80amp a:48.5 b:21 c:56</p> <p>VOLVO 850 S40 V70</p> <p>RENAULT</p> <p>B5254T, B5204T2 B5234T5, B5254FS B5234T2, B5254FS VO 9442188 BO 0120465012 HC CA1096IR</p>	<p>ALB1097</p>  <p>ARB0385</p> <p>12v 80amp a:23.5 b:56.5</p> <p>ALFA ROMEO Alfa 155 2.5L</p> <p>FI 60580106 BO 0120485026 HC CA1097IR</p>	<p>ALB1102</p>  <p>ARB0385</p> <p>12v 80amp a:25.5 b:56.5</p> <p>ALFA ROMEO Alfa 145 Alfa 146</p> <p>1.4L 1.6L 1.7L 16V FI 60588395 BO 0123310028 HC CA1102IR</p>
<p>ALB1106</p> <p>ALB1106RB ALB1106WA</p> <p>ARB0385</p> <p>12v 70amp a:47 b:24 c:73.5</p> <p>BMW 3</p> <p>M43B16, M43164E3 M42B18 M44B19 BM 12311427287 BO 0123310006 HC CA1106IR</p>	<p>ALB1107</p>  <p>ARB0385</p> <p>12v 120amp a:13.5 b:14 c:58</p> <p>ALFA ROMEO LANCIA SAAB VW Golf IV</p> <p>FI 60562020 BO 0123510099 HC CA1107IR</p>	<p>ALB1117</p>  <p>ALB1117WA</p> <p>ARB0139 PAL0200</p>  <p>L S</p> <p>12v 60amp a:42 b:13 c:60.5</p> <p>AUDI A4 FORD Maverick NISSAN Terrano</p> <p>TD27 TD27T AFM NI 231000F000 BO 9120334631 HC JA1117IR</p>	<p>ALB1136</p>  <p>ALB1136WA</p> <p>12v 90amp a:46 c:65</p> <p>MITSUBISHI Carisma 1.6L Carisma 1.8L</p> <p>4G93 4G92 MI MD318458 BO 0123315015 HC CA1136IR</p>














Alternators

Bosch

<p>ALB1138</p>  <p>ALB1138WA ARB0387</p> <p>12v 90amp a:118.5 b:56</p> <p>SAAB 9-3 9-5 900</p> <p>B205L, B204L, B202L B235R, B204R B205R, B234R SB 8548943 BO 0123335005 HC CA1138IR</p>	<p>ALB1140</p>  <p>ALB1140WA ARB0385</p> <p>12v 120amp a:20.5 b:14.5 c:80</p> <p>AUDI 80 Coupe VW</p> <p>RS2 VW 058903018C BO 0123505008 HC CA1140IR</p>	<p>ALB1141</p>  <p>ALB1141WA ARB0353</p> <p>12v 120amp a:30 b:14 c:82</p> <p>AUDI A4 A6 A8 100</p> <p>AAT AEL, AFB AAR, AKN VW 046903015F BO 0120468109 HC CA1141IR</p>	<p>ALB1142</p>  <p>ALB1142RB ALB1142WA ARB0385</p> <p>12v 120amp a:43 b:14 c:61</p> <p>VW Golf Passat Vento Transporter</p> <p>AAA ABV AMY, AES VW 021903025G BO 0123510007 HC CA1142IR</p>
<p>ALB1143</p>  <p>ALB1143WA ARB0387 PAL0271</p>  <p>12v 150amp a:43 b:14 c:61</p> <p>FORD Galaxy MERCEDES-BENZ 280</p> <p>AAA, M104900 AMY FO 95VW10300SA BO 0123520002 HC CA1143IR</p>	<p>ALB1144</p>  <p>ALB1144RB ALB1144WA ARB0388 PAL0272</p>  <p>12v 120amp a:40 b:14 c:61</p> <p>AUDI SKODA VW Golf Sharan</p> <p>AJH, BAE AHF, BAF AGR, AWB VW 038903023J BO 0123510046 HC CA1144IR</p>	<p>ALB1145</p>  <p>ALB1145WA ARB0388 PAL0264</p>  <p>12v 90amp a:33 b:14 c:78.5</p> <p>FORD Fiesta 1.3L Ka 1.3L</p> <p>JJA, JJJ, J4C, J4Q, JJB JJE, JJK, J4J, J4R, J4D JJC, JJM, J4L, J4T, J4S FO R97KB10300AA BO 0123320050 HC CA1145IR</p>	<p>ALB1146</p>  <p>ALB1146WA ARB0385</p> <p>12v 70amp a:53 b:33.5 c:56</p> <p>MERCEDES-BENZ 500 OPEL Astra Corsa</p> <p>14NV, C16NZ, OM541948 C14NZ, E16NZ, X16SZR C14SE, C16SE, X12SZ OP 90289247 BO 0123110005 HC CA1146IR</p>
<p>ALB1147</p>  <p>ALB1147RB ALB1147WA ARB0511</p> <p>12v 120amp a:40 b:14 c:61</p> <p>AUDI A4, A6 Cabriolet VW Polo</p> <p>1z AHU ASY VW 028903018BX BO 0123510008 HC CA1147IR</p>	<p>ALB1148</p>  <p>ALB1148WA ARB0363</p> <p>24v 65amp b:23 c:68</p> <p>SCANIA 113 Series 3 series 93 H/220-T 143 H500 96-> 4 series 94 C/260-T 144 L/530 97-></p> <p>DSC1116 SC 1394969 BO 0120468131 HC CA1148IR</p>	<p>ALB1149</p>  <p>ALB1149WA ARB0384</p> <p>12v 90amp a:29.5 b:14 c:61</p> <p>FORD Galaxy 2.0L Galaxy 2.3L</p> <p>E5SB NSE FO R95VW10300CC BO 0123310027 HC CA1149IR</p>	<p>ALB1151</p>  <p>ALB1151WA ARB0512</p> <p>12v 70amp a:92 b:56</p> <p>BMW 3 CITROEN Berlingo PEUGEOT 306, 406 FIAT LANCIA</p> <p>M41D18 RFT, LFY RFX, RFY PE 9617861380 BO 0123310013 HC CA1151IR</p>

Alternators

Bosch

<p>ALB1155</p>  <p>ALB1155WA ARB0512</p> <p>12v 70amp a:91.5 b:56</p> <p>CITROEN Expert, Xsara PEUGEOT 106, 306, 806</p> <p>NFY, D8B DHY, DJY DHX, 161A PE 9617842880 BO 0123310012 HC CA1155IR</p>	<p>ALB1176</p>  <p>ALB1176WA ARB0512</p> <p>12v 70amp a:38 b:25 c:65</p> <p>NISSAN Micra 1.0L</p> <p>CG13DE CG10DE NI 231005F600 BO 0123110007 HC JA1176IR</p>	<p>ALB1197</p>  <p>ALB1197WA ARB0368</p> <p>12v 65amp b:51</p> <p>CASE CATERPILLAR INTERNATIONAL HARV JOHN DEERE</p> <p>Cummins 6BT CS A187873 BO 0120488205 HC CA1197IR</p>	<p>ALB1198</p>  <p>ALB1198WA ALE1198RB ARB0368</p> <p>12v 95amp b:50.5</p> <p>CASE 100 Series 400 Series 1000 Series</p> <p>Cummins 6BT CS A187623 BO 0120484011 HC CA1198IR</p>
<p>ALB1204</p>  <p>ALB1204WA ARB0529 PAL0272</p>  <p>12v 115amp a:40 b:14 c:61</p> <p>VOLVO 850 C70 S70</p> <p>D5252T, B5252S B5204T3, B5244T7 VO 8111048 BO 0123515013 HC CA1204IR</p>	<p>ALB1206</p>  <p>ALB1206WA ARB0387</p> <p>12v 143amp a:82.5 b:56</p> <p>MERCEDES-BENZ 280 400 Axor 2 24t Series</p> <p>OM442951 M112921, M119971 OM457937 MB 0101546802 BO 0123510004 HC CA1206IR</p>	<p>ALB1207</p>  <p>ALB1207WA ARB0545</p> <p>12v 140amp a:66 b:28</p> <p>BMW 5 Series 7 Series 8 Series Z Series</p> <p>M62B44, M52B20 M60B30, M62B35 M73B54, M60B40 BM 12311742910 BO 0123515001 HC CA1207IR</p>	<p>ALB1209</p>  <p>ALB1209RB ALB1209WA ARB0387</p> <p>12v 90amp a:92 b:56</p> <p>MERCEDES-BENZ 180, 220, 290, 300 Unimog</p> <p>OM604910, OM606962 OM602981, OM602989 MB 0091543302 BO 0123320041 HC CA1209IR</p>
<p>ALB1212</p>  <p>ALB1212WA</p> <p>12v 90amp a:34 b:12 c:54</p> <p>CHRYSLER Lebaron DODGE Caravan DODGE Spirit PLYMOUTH Acclaim PLYMOUTH Voyager</p> <p>EDG, EDT EDR, 6G72 EDM, EFA CH 4557432 BO 0120450011 HC UA1212</p>	<p>ALB1213</p>  <p>ALB1213WA</p> <p>12v 120amp a:34 b:12 c:54</p> <p>CHRYSLER Voyager 2.5L Voyager 3.3L Voyager 3.8L</p> <p>R00 EGA K CH 4686021 BO 0120450029 HC UA1213</p>	<p>ALB1214</p>  <p>12v 120amp a:32 b:12.5 c:54</p> <p>CHRYSLER Voyager 2.5L</p> <p>L00 M00 EGH CH 4686019 BO 0120450027 HC UA1214</p>	<p>ALB1224</p>  <p>ALB1224WA ARB0381</p> <p>24v 120amp b:16 c:184</p> <p>MERCEDES-BENZ SCANIA</p> <p>DSC1124, DSC908 DSC1108, DSC1181 DS1134, DSC1122 SC 571520 BO 0120689543 HC CA1224IR</p>













Alternators

Bosch

<p>ALB1226</p>  <p>ALB1226RB ALB1226WA</p> <p>ARB0385</p> <p>12v 90amp a:42.5 b:14.0 c:61.0</p> <p>SKODA, VW Felicia 1.9 Diesel AEF Polo 1.9 Diesel</p> <p>VW 028903018F BO 0123320033 HC CA1226IR</p>	<p>ALB1227</p>  <p>ALB1227WA</p> <p>ARB0353 D+ PAL0294 B+ B+</p> <p>12v 70amp a:35 b:12.5 c:80</p> <p>FORD GLB, J4B, J6A Escort GMA, JLA, TLB Fiesta 1.0 GSE, GSG, TKB Sierra FO 86AX10300DB Scorpio BO 0120489304 HC CA1227IR</p>	<p>ALB1228</p>  <p>ALB1228WA</p> <p>ARB0385 PAL0271</p> <p>12v 90amp a:39 b:14.5 c:60.5</p> <p>VW LT AGX, AHD, AGK, AAB Multivan AAF, AEU, APL, AET Transporter VW 028903027N BO 0123320018 HC CA1228IR</p>	<p>ALB1229</p>  <p>ALB1229WA</p> <p>ARB0520 PAL0271</p> <p>12v 120amp a:39 b:14 c:61</p> <p>VW LT AGX, AHD, AGK, AAB Multivan AEN, ACV, AAB, ACU Transporter VW 028903027P BO 0123515016 HC CA1229IR</p>
<p>ALB1231</p>  <p>ARB0385</p> <p>12v 55amp a:51.5 b:33.5 c:53.5</p> <p>OPEL X14XE, C14SE Tigra 1.4L C14NZ, X12SZ Corsavan X16XE, X14SZ Corsa 1.4L OP 6204016 Combo BO 0123100001 HC CA1231IR</p>	<p>ALB1232</p>  <p>ALB1232WA</p> <p>ARB0385</p> <p>12v 120amp a:32.5 b:14 c:81.5</p> <p>AUDI AGH, ABZ, AKJ A8 ABZ, AKG, AEW S8 AHC, AKH VW 077903015E BO 0123510013 HC CA1232IR</p>	<p>ALB1234</p>  <p>ALB1234WA</p> <p>ARB0353</p> <p>12v 90amp a:56 b:17 c:63.5</p> <p>FIAT, LANCIA 836A3000, 835A8000 Tempra 2.0L 154C3000, 175A1000 Tipo 2.0L 159A4046, 814497Y Croma 2.0L FI 7697867 Coupe 2.0L BO 0120469034 HC CA1234IR</p>	<p>ALB1235</p>  <p>ALB1235WA</p> <p>ARB0381</p> <p>24v 120amp b:15.5 c:180</p> <p>KASSBOHRER SETRA OM421A, OM441A Trucks D2866LOH, D2866KOH KS 7421345000 BO 0120689526 HC CA1235IR</p>
<p>ALB1236</p>  <p>ALB1236WA</p> <p>ARB0381</p> <p>24v 140amp b:16 c:180</p> <p>DROGMOLLER Trucks SETRA Trucks M476933, M476934 MERCEDES-BENZ Trucks OM441950, OM442919 O303, O404, O405 MB 0081547802 O407, O408, 300 Series BO 0120689535 HC CA1236IR</p>	<p>ALB1237</p>  <p>ALB1237WA</p> <p>ARB0381</p> <p>24v 140amp b:16 c:182</p> <p>IKARUS, MAN MAND2866 MERCEDES, NEOPLAN D0826OH02, D0826LOH02 EL, EM, NG, NL, NM, SD D2866LOH34 SG Series MB 0111549602 St, Viano, Tourliner BO 0120689527 HC CA1237IR</p>	<p>ALB1239</p>  <p>ALB1239WA ALV1239RB</p> <p>ARB0385 PAL0271</p> <p>12v 90amp a:42 b:14 c:61</p> <p>SEAT AKU Arosa AEF, AGD VW AKU, AHG Polo 1.7L VW 028903026A Polo 1.9L BO 0123320036 HC CA1239IR</p>	<p>ALB1240</p>  <p>ALB1240WA</p> <p>ARB0385 PAL0271</p> <p>12v 90amp a:40.5 b:14 c:60.5</p> <p>AUDI, SKODA, VW AEH, AKL, AGN, ARX A3 AEE, AFK, AGU, ALL Felicia, Octavia AGR, AKQ, ANW, AQM Golf, Polo VW 028903018AX Beetle BO 0123320034 HC CA1240IR</p>






















Alternators

Bosch

<p>ALB1241</p>  <p>ALB1241RB ARB0385</p> <p>12v 120amp a:40.5 b:14 c:60.5</p> <p>AUDI A3 SKODA Octavia VW GOLF</p> <p>ANP, AEE AGU, AEH AKL, AGU VW 037903025D BO 0123510065 HC CA1241IR</p>	<p>ALB1244</p>  <p>ALB1244WA ARB0385</p> <p>12v 90amp a:106.5 b:56</p> <p>AUDI 80 100 Cabriolet A6</p> <p>AAE, ACE, ABT AAD, ABM ABK, ADA VW 050903015B BO 0120485041 HC CA1244IR</p>	<p>ALB1245</p>  <p>ALB1245WA ARB0385</p> <p>12v 140amp a:65.5 b:28</p> <p>BMW 530, 540 Series 730, 740 Series 840 Series</p> <p>M60, E32 M60B40 M60B30 BM 12311704082 BO 0123214002 HC CA1245IR</p>	<p>ALB1246</p>  <p>ALB1246RB ALB1246WA ARB0387</p> <p>12v 90amp a:84 b:56</p> <p>SAAB 9000 2.0I 9000 2.3I 9000 3.0I</p> <p>B204E, B234E B234I, B234L, B234R B308I, B204I SA 93184956 BO 0123320039 HC CA1246IR</p>
<p>ALB1248</p>  <p>ALB1248RB ALB1248WA ARB0511</p> <p>12v 120amp a:29 b:14 c:60.6</p> <p>AUDI, VW A4 Passat 1.9 TDI</p> <p>8D2 AFN, AHU, AJM B5 VW 028903028 BO 0123515003 HC CA1248IR</p>	<p>ALB1254</p>  <p>ALB1254WA ARB0385</p> <p>12v 115amp a:81 b:56</p> <p>MERCEDES-BENZ Vito V230</p> <p>OM601970 OM601942 OM601970 MB 0101540302 BO 0123510058 HC CA1254IR</p>	<p>ALB1255</p>  <p>ALB1255WA ARB0385</p> <p>12v 70amp a:44 b:14.5 c:61</p> <p>SKODA Felicia VW Polo</p> <p>AEF AGD AKU, AHG VW 028903026B BO 0123310038 HC CA1255IR</p>	<p>ALB1256</p>  <p>ALB1256WA ALV1256RB ARB0545 PAL0232 15 61E</p> <p>12v 90amp a:68.5 b:28 c:76</p> <p>BMW 320, 323, 325, 328 X5, Z3</p> <p>E36, E38 E39, E53 M52 BM 12311432977 BO 0123315013 HC CA1256IR</p>
<p>ALB1257</p>  <p>ALB1257WA</p> <p>12v 70amp a:53 b:33.5</p> <p>OPEL Agila Corsa Astra Combo</p> <p>Z10XE, Z12XE Z14XEP, Z12XE X10XE OP 90589721 BO 0123110008 HC CA1257IR</p>	<p>ALB1259</p>  <p>ALB1259WA ARB0353</p> <p>12v 140amp a:65 b:28</p> <p>BMW 850 750</p> <p>M70B56 M70B50 BM 12311733772 BO 0120468033 HC CA1259IR</p>	<p>ALB1260</p>  <p>ALB1260RB ALB1260WA ARB0388</p> <p>12v 120amp a:53 b:14 c:59</p> <p>FORD Galaxy VOLVO V70 VW Golf</p> <p>AVG D10A360, D5252T AHU, ALE VW 97VW10300EA BO 0123515017 HC CA1260IR</p>	<p>ALB1261</p>  <p>ALB1261WA ARB0385</p> <p>12v 90amp a:47 b:20 c:73</p> <p>BMW 318 Z3</p> <p>M44 E36 BM 12311247288 BO 0123320012 HC CA1261IR</p>
















Alternators

Bosch

<p>ALB1262</p>  <p>ALB1262WA</p> <p>ARB0388 PAL0272</p>  <p>DF D+</p> <p>12v 90amp a:25.5 b:14.5 c:61</p> <p>VW Golf Jetta Passat</p> <p>VW 028903028R BO 0123325005 HC CA1262IR</p>	<p>ALB1263</p>  <p>ALB1263WA</p> <p>ARB0385 PAL0271</p>  <p>W D+</p> <p>12v 70amp a:16.5 b:14.5 c:61</p> <p>FORD VW Golf Passat Vento 1.9L</p> <p>VW 028903028H BO 0123310025 HC CA1263IR</p>	<p>ALB1264</p>  <p>ALB1264WA</p> <p>ARB0388 PAL0272</p>  <p>DF D+</p> <p>12v 120amp a:16 b:14.5 c:61</p> <p>FORD Galaxy VW Golf Polo</p> <p>VW 028903018B BO 0123505012 HC CA1264IR</p>	<p>ALB1265</p>  <p>ALB1265WA</p> <p>ARB0385 PAL0271</p>  <p>W D+</p> <p>12v 90amp a:16.5 b:14.5 c:61</p> <p>SKODA Felicia Octavia VW Golf</p> <p>VW 028903028G BO 0123320008 HC CA1265IR</p>
<p>ALB1267</p>  <p>ALB1267RB ALB1267WA</p> <p>ARB0385 PAL0271</p>  <p>W D+</p> <p>12v 70amp a:39 b:14 c:59</p> <p>AUDI A3 SKODA Felicia, Octavia VW Golf</p> <p>AEH, AGU, AEE AKL, ARX, AKL AGN, AKQ, AHW VW 037903025B BO 0123310037 HC CA1267IR</p>	<p>ALB1268</p>  <p>ALB1268WA</p> <p>ARB0385 PAL0271</p>  <p>W D+</p> <p>12v 70amp a:29 b:14 c:61</p> <p>VW Corrado Golf Passat Vento</p> <p>AAA ABV VW 021903025E BO 0123310018 HC CA1268IR</p>	<p>ALB1269</p>  <p>ALB1269WA</p> <p>ARB0385 PAL0271</p>  <p>W D+</p> <p>12v 90amp a:29 b:14 c:61</p> <p>FORD Galaxy SEAT Cordoba SKODA Felicia VW Golf VW Passat</p> <p>AEX, AKV, APQ AEE, ABU, AES AGG, 1F, 2E VW 074903023Q BO 0123320008 HC CA1269IR</p>	<p>ALB1297</p>  <p>ALB1297WA</p> <p>ARB0385 PAL0271</p>  <p>W D+</p> <p>12v 90amp a:39.5 b:14 c:61.5</p> <p>VW, SEAT Golf Polo Caddy</p> <p>AAZ, AHU, ALE AEY, AKW, AFN BJX, AEY VW 028903028J BO 0123310049 HC CA1297IR</p>
<p>ALB1299</p>  <p>ALB1299RB ALB1299WA</p> <p>ARB0387</p> <p>12v 115amp a:92.5 b:56</p> <p>MERCEDES-BENZ 200, 208, 220 250, 290, 300 Sprinter Vario</p> <p>OM602980 OM601943 OM604912 MB 0101540102 BO 0123510101 HC CA1299IR</p>	<p>ALB1300</p>  <p>ALB1300WA</p> <p>ARB0387</p> <p>12v 115amp a:82.5 b:56</p> <p>MERCEDES-BENZ Sprinter, Vito 240, 280, 320, 500 VW LT</p> <p>M112910, M112911 M111979, OM442942 AGL MB 0091546002 BO 0123510068 HC CA1300IR</p>	<p>ALB1301</p>  <p>ALB1301WA</p> <p>ARB0387</p> <p>12v 90amp a:82.5 b:56</p> <p>MERCEDES-BENZ Atego, Sprinter 200, 230, Vito VW LT</p> <p>M111979, M111984 OM904910, OM904916 AGL MB A0111540302 BO 0123335008 HC CA1301IR</p>	<p>ALB1315 New</p>  <p>ALB1315WA</p> <p>ARB4151 PAL0400</p>  <p>L DFM</p> <p>12v 150amp a:26 b:70 c:56</p> <p>MERCEDES-BENZ C Class</p> <p>MB A0131546302 BO 0124525171 MH ALB1315</p>













Alternators

Bosch

<p>ALB1327</p>  <p>ALB1327RB ALB1327WA</p> <p>ARB0385</p> <p>12v 100amp a:51.5 b:33.5 c:59</p> <p>OPEL, VAUXHALL Frontera B Omega B Vectra B</p> <p>X22DTH, Y22DTH X20DTH X20DTL, Y20DTH OP 90506202 BO 0123500008 HC CA1327IR</p>	<p>ALB1328</p>  <p>ALB1328WA</p> <p>ARB0385</p> <p>12v 120amp a:18.5 b:33.5 c:59</p> <p>OPEL, VAUXHALL Astra G Vectra B Zafira</p> <p>X20DTL, Y20DTL OP 6204025 BO 0123510043 HC CA1328IR</p>	<p>ALB1329</p>  <p>ALB1329WA</p> <p>12v 55amp a:54.5 b:33.5 c:54</p> <p>OPEL Corsa</p> <p>X12XE X10XE</p> <p>OP 6204069 BO 0123100003 HC CA1329IR</p>	<p>ALB1335</p>  <p>ALB1335WA</p> <p>ARB1758</p> <p>12v 120amp b:56</p> <p>CLAAS, FENDT Combines Agricultural Various Models</p> <p>Various Models FD G198902011010 BO 0120484015 HC CA1335IR</p>
<p>ALB1336</p>  <p>ALB1336WA</p> <p>ARB0363</p> <p>24v 55amp a:45 b:17 c:63.5</p> <p>IVECO EuroCargo, EuroStar EuroTech, EuroTrakker TurboStar, TurboTech Zeta, P/PA Series</p> <p>804025B4200LTC 8060454100TCA 806025VTC IV 99454112 IV 0120469978 HC CA1336IR</p>	<p>ALB1341</p>  <p>ALB1341WA</p> <p>ARB0385 PAL0271</p>  <p>12v 120amp a:16 b:14.2 c:61.5</p> <p>AUDI, FORD, SEAT, VW 80, A4, A6 Galaxy Ibiza, Cordoba, Toledo Golf III, Passat, Polo</p> <p>1Z, AHV ALE, AFF AFN, AVG VW 028903025S BO 0123510027 HC CA1341IR</p>	<p>ALB1364</p>  <p>ALB1364WA</p> <p>ARB0385</p> <p>12v 70amp a:42 b:13 c:80.9</p> <p>NISSAN Terrano King Cab FORD Maverick</p> <p>TD27TI Z24i TD27E NI 231007F000 BO 0123310033 HC JA1364IR</p>	<p>ALB1378</p>  <p>ALB1378RB ALB1378WA</p> <p>ARB0225 PAL0400</p>  <p>12v 90amp a:39 b:14 c:61</p> <p>AUDI, SEAT, SKODA, VW A2, A3, S3, TT Cordoba, Ibiza Fabia, Octavia Beetle, Golf, Polo, Bora</p> <p>AKL, AEH, AGN, AGU AQA, ARZ, APF, BBY AXJ, AWH, BCA, BGU VW 028903028D BO 0124325003 HC CA1378IR</p>
<p>ALB1381</p>  <p>ALB1381WA</p> <p>ARB0360</p> <p>12v 110amp b:14 c:101</p> <p>CASE, CUMMINS JOHN DEERE 7000 Series 8000 Series Various</p> <p>Various CA 125849A1R BO 0120468028 HC CA1381IR</p>	<p>ALB1391</p>  <p>ALB1391WA</p> <p>ARB0231</p> <p>12v 70amp a:55 b:33.5 c:56</p> <p>OPEL Astra Corsa</p> <p>X20XE, X14XE X16SZR, X16XEL Z18XE, Z14XE OP 13156051 BO 0124225002 HC CA1391IR</p>	<p>ALB1393</p>  <p>ALB1393WA</p> <p>ARB0381</p> <p>24v 120amp b:16 c:182</p> <p>MAN, DAF NL Series NM Series SG Series SL Series</p> <p>MB 0091547202 BO 0120689522 HC CA1393IR</p>	<p>ALB1394</p>  <p>ALB1394WA</p> <p>ARB0225 PAL0400</p>  <p>12v 120amp a:39 b:14 c:61.5</p> <p>AUDI, FORD, SKODA, VW A3, A4, S3, TT Galaxy Fabia, Octavia Bora, Caddy, Golf</p> <p>AEH, AKL, APF, APG ALH, AHF, ASV AQY, AWH, AXJ VW 021903025K BO 0124515010 HC CA1394IR</p>













Alternators

Bosch

<p>ALB1395</p>  <p>ALB1395WA ARB0387</p> <p>12v 90amp a:92.5 b:56</p> <p>MERCEDES-BENZ C200, C220, C250 CLK200 E200, E220, E250 E290, E300</p> <p>M111944 OM604915 OM605960 MB A0111540002 BO 0123320046 HC CA1395IR</p>	<p>ALB1399</p>  <p>ALB1399WA ARB0385 PAL0271</p> <p>12v 120amp a:26 b:14 c:61</p> <p>VW Corrado Golf III Passat Vento</p> <p>AAA ABV VW 021903025B BO 0123510005 HC CA1399IR</p>	<p>ALB1401</p>  <p>ALB1401RB ARB0388 PAL0272</p> <p>12v 90amp a:42.5 b:14 c:61</p> <p>VW Polo 1.7L Diesel Polo 1.9L Diesel</p> <p>AGD AKU AHG VW 028903028P BO 0123325006 HC CA1401IR</p>	<p>ALB1402</p>  <p>ALB1402RB ALB1402WA ARB0225 PAL0400</p> <p>12v 90amp a:39 b:14 c:61.5</p> <p>VW LT Multivan Transporter</p> <p>AGX, AHD, APA BBE, BBF, ANJ ACV, AEU, AET VW 074903025K BO 0124325004 HC CA1402IR</p>
<p>ALB1403</p>  <p>ALB1403WA ARB0511</p> <p>12v 120amp a:30 b:14.5 c:61</p> <p>AUDI A4 A6 VW Passat</p> <p>1Z AFF, AFN, AHU AJM, ATJ, AVG VW 028903028F BO 0123515008 HC CA1403IR</p>	<p>ALB1405</p>  <p>ALB1405RB ALB1405WA ARB0925 PAL0306</p> <p>12v 75amp a:90 b:58</p> <p>HONDA, NISSAN Civic 1.4L Civic 1.5L Civic 1.6L Terrano 2.4L</p> <p>D14A2, D14A3, D14A4 D16Y2, D16Y3, D16Y5 KA24E, D15Z6, B16A2 HO 31100P1KE03 BO 0123315007 HC JA1405IR</p>	<p>ALB1415</p>  <p>ALB1415WA ARB0206 PAL0400</p> <p>12v 80amp a:91 b:56</p> <p>HONDA Accord 1.6L Accord 1.8L Accord 2.0L Accord 2.2L, 2.3L</p> <p>F20B6, F23Z5 F18B2, 20T2N D16B6, H22A7 HO 31100PDAE01 BO 0124325006 HC JA1415IR</p>	<p>ALB1426</p>  <p>ALB1426WA ARB0287 PAL0309</p> <p>12v 70amp a:90 b:56</p> <p>HONDA Accord</p> <p>F20Z1 F20Z2 F22Z2 HO 31100P45G040 BO 0123115009 HC JA1426IR</p>
<p>ALB1433</p>  <p>ALB1433WA ARB1758</p> <p>12v 95amp b:56</p> <p>IVECO MK Series</p> <p>BF4L913T, BF6L913 F4L913, F6L913 IV 1178607 BO 0120484001 HC CA1433IR</p>	<p>ALB1436</p>  <p>ALB1436WA ARB0225 PAL0400</p> <p>12v 70amp a:40 b:14 c:60</p> <p>AUDI, SKODA, VW A3 Fabia Octavia Beetle</p> <p>AZL, AQY, AGU AEE, AEH, AKL, AGU ARZ, ARX, AUM, AVC VW 028903028C BO 0124315003 HC CA1436IR</p>	<p>ALB1438</p>  <p>ALB1438WA ARB0363</p> <p>24v 80amp b:27 c:71</p> <p>CITROEN, IVECO RENAULT VI, SCANIA Xantia, Kerax Various Models</p> <p>RFY, MIDR062356A41 806025VTC DSC1116, DSC1117 SC 1105368 BO 0120468065 HC CA1438IR</p>	<p>ALB1439</p>  <p>ALB1439WA ALN1439RB ARB0229 PAL0211</p> <p>12v 120amp a:44.5 b:20 c:82</p> <p>VOLVO C70, XC S60, S70, S80 V40, V70</p> <p>B5254T, B5234T2 B5234T3, B5244T GB5252S, B4204T VO 8251655 BO 0124515019 HC CA1439IR</p>















Alternators

Bosch

<p>ALB1440</p>  <p>ALB1440WA ARB0231</p> <p>12v 70amp a:52 b:33.5 c:59</p> <p>OPEL Astravan Astra</p> <p>X17DT X17DTL</p> <p>OP 9117933 BO 0124225025 HC CA1440IR</p>	<p>ALB1441</p>  <p>ALB1441WA ARB0225 PAL0400</p> <p>12v 90amp a:39.5 b:14.5 c:61</p> <p>AUDI, SEAT, SKODA, VW A2, Arosa, Ibiza Cordoba, Fabia Polo, Lupo Roomster</p> <p>AMF, ANY, BNM BNV, BMS, BAH AYZ, BAY, BWB VW 045903023E BO 0124325012 HC CA1441IR</p>	<p>ALB1443</p>  <p>ALB1443WA ARB0963 PAL0211</p> <p>12v 120amp a:45 b:108.5 c:81.5</p> <p>CITROEN, VOLVO Jumpy S60, S80 V70, XC</p> <p>D8B B5244T4, B6304S3 B6294T, B6304S3 VO 8111001 BO 0124515017 HC CA1443IR</p>	<p>ALB1445</p>  <p>ALB1445WA ARB0225 PAL0400</p> <p>12v 120amp a:39 b:14.5 c:61.5</p> <p>VOLVO, VW S60, S70, S80 N Series LT, Multivan Transporter</p> <p>TD101F, D5244T D5252T, AGX, AHD AVT, AAF, AXG, AYY VW 074903025J BO 0124515013 HC CA1445IR</p>
<p>ALB1446</p>  <p>ALB1446RB ALB1446WA ARB0225 PAL0400</p> <p>12v 90amp a:39 b:14 c:61.5</p> <p>AUDI, FORD, SEAT SKODA, VW A3, Allroad, Galaxy Cordoba, Ibiza, Fabia Octavia, Golf, Polo</p> <p>AGR, ALH, AHF, ASZ BAU, ASZ, BTB, NSE ATD, BNM, BMS VW 038903018P BO 0124325001 HC CA1446IR</p>	<p>ALB1448</p>  <p>ALB1448WA ARB0362</p> <p>24v 30amp a:45 b:17 c:63</p> <p>IVECO Marine Aifo</p> <p>8210M2210 IV 98417133 BO 0120489612 HC CA1448IR</p>	<p>ALB1452</p>  <p>ALB1452RB ALB1452WA ARB0512</p> <p>12v 120amp a:44.5 b:22 c:54.5</p> <p>ALFA ROMEO FIAT LANCIA</p> <p>838A2000, 839A5000 175A3000, AR32501 838A1000 FI 7782187 BO 0123510010 HC CA1452IR</p>	<p>ALB1456</p>  <p>ALB1456WA ARB0365</p> <p>24v 80amp b:27 c:76.5</p> <p>RENAULT Magnum Agora Kerax</p> <p>MIDR063540P41 MIDR062045I41 MIDR062045D41 RE 5010306007 BO 0120468140 HC CA1456IR</p>
<p>ALB1470</p>  <p>ALB1470RB ALB1470WA ARB0239 PAL0214</p> <p>12v 98amp a:20 b:80 c:41</p> <p>DACIA, NISSAN, RENAULT Logan, Sandero Kubistar, Scenic Clio, Espace, Kangoo Megane</p> <p>F4R740, K4M700 N7Q700, E7J635 K4M752, K7J710 RE 7700101274 BO 0124415014 HC CA1470IR</p>	<p>ALB1471</p>  <p>ALB1471RB ALB1471WA ARB0220</p> <p>12v 90amp a:58.5 b:25 c:70</p> <p>FIAT, LANCIA Brava, Doblo, Marea Multipla, Palio, Siena Stilo, Lybra</p> <p>182A4000 185A3000 182B6000 FI 46532668 BO 0124325058 HC CA1471IR</p>	<p>ALB1477</p>  <p>ALB1477RB ALB1477WA ARB0385</p> <p>12v 120amp a:91.5 b:56</p> <p>DODGE, MERCEDES-BENZ SSANGYONG 280, 320 420, 500, 600 Musso, Spirit</p> <p>M104943, M104944 M104991, M104992 MB 0081547402 BO 0123510002 HC CA1477IR</p>	<p>ALB1478</p>  <p>ALB1478WA ARB0385</p> <p>12v 115amp a:27 b:14 c:60.5</p> <p>CHRYSLER Voyager 2.5L DODGE Caravan 2.5L</p> <p>M00 425CLIRSX CH 4727206 BO 0123510037 HC CA1478IR</p>






















Alternators

Bosch

<p>ALB1480 <i>New</i></p> <p>ALB1480WA</p>  <p>ARB0313 ARB0677</p> <p>12v 143amp b:56</p> <p>FENDIT D2566ME MERCEDES-BENZ D227-6 OM601970 MB A0101541602 BO 0124615053 IS 11203119</p>	<p>ALB1481</p> <p>ALB1481RB ALB1481WA</p>  <p>ARB0387</p> <p>12v 115amp a:31 b:70 c:56</p> <p>MERCEDES-BENZ OM611LA 200, 208, 211, 220 OM612981 308, 311, 313, 316 OM611961 Actros, Sprinter, Vito MB 0101545902 BO 0123510082 HC CA1481IR</p>	<p>ALB1482</p> <p>ALB1482WA</p>  <p>ARB0214 PAL0231</p>  <p>12v 105amp a:33.5 b:14 c:59</p> <p>FORD EDBB, EDBC, EDBA Cougar RKF, RKB, L1J, RKH Mondeo YF, NGA Maverick FO 98BB10300BC BO 0124415006 HC CA1482IR</p>	<p>ALB1485</p> <p>ALB1485RB ALB1485WA</p>  <p>ARB0220</p> <p>12v 80amp a:59 b:25 c:70.5</p> <p>FIAT, LANCIA 182B6000 Lybra 182A4000 Palio 178D2011 Marea FI 46532667 BO 0124325009 HC CA1485IR</p>
<p>ALB1486</p> <p>ALB1486WA</p>  <p>ARB0385</p> <p>12v 90amp a:30 b:14 c:61</p> <p>AUDI AFH A4 1.9L AHH VW AFF Passat 1.9L VW 028903027 BO 0123320025 HC CA1486IR</p>	<p>ALB1489</p> <p>ALB1489RB ALB1489WA ALB489WA</p>  <p>ARB0387</p> <p>12v 90amp a:32 b:70</p> <p>MERCEDES-BENZ OM611960 Actros OM611981 Sprinter OM611LA Vito MB 0111540602 200, 220 Series BO 0123320051 HC CA1489IR</p>	<p>ALB1490</p> <p>ALB1490RB ALB1490WA</p>  <p>ARB0231</p> <p>12v 100amp a:50.5 b:33.5 c:57</p> <p>OPEL, VAUXHALL Y20DTL Astra Y20DTH Zafira OP 1204134 BO 0124225023 HC CA1490IR</p>	<p>ALB1491</p> <p>ALB1491WA ALB491WA</p>  <p>ARB0387</p> <p>12v 150amp a:83 b:56</p> <p>MERCEDES-BENZ M112922, M112944 55, 280 M113941, M113960 320, 430, 500 M113964, M113986 MB 0101542902 BO 0123520017 HC CA1491IR</p>
<p>ALB1492</p> <p>ALB1492RB ALB1492WA</p>  <p>ARB0512</p> <p>12v 120amp a:30 b:14 c:60</p> <p>ALFA ROMEO, LANCIA 838B000, AR16102 Alfa 166 AR16105, AR32401 GTV AR34201, AR34301 Spider FI 60652354 Kappa BO 0123510095 HC CA1492IR</p>	<p>ALB1500</p> <p>ALB1500WA</p>  <p>ARB0387</p> <p>12v 90amp a:92 b:56</p> <p>MERCEDES-BENZ M111943, M111947 200 M111958, OM442989 230 M111973, M111983 26t MB 0091547602 BO 0123320035 HC CA1500IR</p>	<p>ALB1501</p> <p>ALB1501RB ALB1501WA</p>  <p>ARB0385</p> <p>12v 100amp a:52 b:34 c:56</p> <p>OPEL B258I Astra B204E, B202S SAAB C20NE, C18NZ, C18XEL 900 OP 9117934 9000 BO 0123505003 HC CA1501IR</p>	<p>ALB1502</p> <p>ALB1502WA</p>  <p>ARB0261 PAL0400</p>  <p>12v 70amp a:39 b:14 c:62</p> <p>AUDI, SKODA, VW AHF, AGR, ALH A3 ASZ, ASV, AXR Fabia, Octavia ATD, AGZ, AHF Beetle, Bora VW 038903023K BO 0124315032 HC CA1502IR</p>





















Alternators

Bosch

<p>ALB1504</p>  <p>ALB1504RB ALB1504WA</p> <p>ARB0225 PAL0400</p>  <p>12v 70amp a:41 b:14 c:61</p> <p>SKODA, VW Octavia Golf Bora, Caddy</p> <p>AMD, AZD AUD, AUA BCB, AUS VW 037903025L BO 0124315005 HC CA1504IR</p>	<p>ALB1505</p>  <p>ALB1505WA ALB1505WA</p> <p>ARB0362</p> <p>24v 100amp a:112 b:80</p> <p>MERCEDES-BENZ 8t, Vario Actros, Atego, Atego 2 Axor, Axor 2, Citaro Econic, Unimog</p> <p>OM904908, OM904923 M102987, M115954 OM542920, OM541944 MB 0091549902 BO 0120468143 HC CA1505IR</p>	<p>ALB1507</p>  <p>ALB1507WA</p> <p>ARB0385</p> <p>12v 120amp a:51.5 b:33.5 c:53.0</p> <p>CADILLAC, OPEL, VAUXHAC25XE Catera Omega B Vectra A Vectra B</p> <p>X25XE X30XE OP 90460576 BO 0123510020 HC CA1507IR</p>	<p>ALB1510</p>  <p>ALB1510RB</p> <p>ARB0385 PAL0271</p>  <p>12v 90amp a:39.5 b:14 c:61.5</p> <p>VW Golf Polo SEAT Ibiza</p> <p>AHU, AAZ, ALE, 1Y AEY, AKW, AFN, BJX VW 6K0903028 BO 0123320038 HC CA1510IR</p>
<p>ALB1511</p>  <p>ALB1511WA ALV0233</p> <p>ARB0225 PAL0400</p>  <p>12v 70amp a:40 b:14 c:61</p> <p>AUDI, SEAT, SKODA, VW A3, S3, Toledo Ibiza, Cordoba, Leon Fabia, Octavia Golf, Polo, Beetle</p> <p>AEH, AUR, BCA AVY, AKL, APF 412TCE VW 028903028C BO 0124315004 HC CA1511IR</p>	<p>ALB1512</p>  <p>ALB1512WA ALV1512RB</p> <p>ARB0225 PAL0400</p>  <p>12v 90amp a:39.5 b:14 c:61.5</p> <p>AUDI A2</p> <p>AUA BBY VW 030903023M BO 0124325011 HC CA1512IR</p>	<p>ALB1525</p>  <p>ALB1525WA</p> <p>ARB0353</p> <p>12v 90amp a:41.5 b:13.5 c:80.5</p> <p>NISSAN Serena 2.3L Vanette</p> <p>LD23 NI 231007C001 BO 6033GB5009 HC JA1525IR</p>	<p>ALB1527</p>  <p>ALB1527WA</p> <p>ARB0353 PAL0455</p>  <p>12v 55amp a:43 b:13.5 c:80.5</p> <p>NISSAN Cabstar Eco-T100 Trade</p> <p>BD30Ti TD27T NI 2310069T04 BO 6033GB4020 HC JA1527IR</p>
<p>ALB1540</p>  <p>ALB1540RB ALB1540WA</p> <p>ARB0225 PAL0400</p>  <p>12v 90amp a:30 b:14 c:61</p> <p>AUDI A4 A6 VW Passat</p> <p>AHU, 1Z, AFN, AVG ATJ, AFF, AJM AFN, AVG, AHH VW 028903029D BO 0124325049 HC CA1540IR</p>	<p>ALB1541</p>  <p>ALB1541WA</p> <p>ARB0225 PAL0400</p>  <p>12v 120amp a:30 b:14.5 c:61.5</p> <p>AUDI, SKODA, VW A4, A6 Superb Passat</p> <p>AVB, AVF, AWX BGW, AHH, AHU, 1Z AJM, ATJ, AFF VW 028903029B BO 0124515026 HC CA1541IR</p>	<p>ALB1542</p>  <p>ALB1542WA</p> <p>ARB0225 PAL0400</p>  <p>12v 90amp a:39.5 b:14 c:61</p> <p>SEAT, SKODA, VW Arosa, Cordoba, Ibiza Fabia, Roomster Polo, Caddy, Lupo Bora, Transporter</p> <p>AUS, AUD, AUA BCB, BKR, AKQ AKK, AQQ, BBY VW 037903025M BO 0124325013 HC CA1542IR</p>	<p>ALB1544</p>  <p>ALB1544WA</p> <p>ARB0239 PAL0214</p>  <p>12v 85amp a:20 b:80 c:40</p> <p>DACIA, NISSAN, RENAULT F4R740, K4J714 Logan, Sandero Kubistar Clio, Espace, Kangoo Laguna, Megane, Scenic</p> <p>F4P720, K4M700 K4M752, K4M708 RE 7700101274 BO 0124325031 HC CA1544IR</p>













Alternators

Bosch

<p>ALB1545</p>  <p>ALB1545WA ARB0225 PAL0400</p>  <p>12v 70amp a:35 b:14 c:82</p> <p>AUDI, SKODA, VW A4, A6 Superb Passat</p> <p>AWT, AZM APT, ARG ANA, AHL VW 06B903016 BO 0124315010 HC CA1545IR</p>	<p>ALB1546</p>  <p>ALB1546WA ARB0225 PAL0400</p>  <p>12v 90amp a:35 b:14 c:82</p> <p>AUDI, SKODA, VW A3, A4, A6 Superb Passat</p> <p>AWM, ALT, ATX AGN, AHL, ANA AWT, AZM, AMX VW 038903018EX BO 0124325017 HC CA1546IR</p>	<p>ALB1547</p>  <p>ALB1547WA ARB0225 PAL0400</p>  <p>12v 70amp a:43 b:14 c:61</p> <p>VW Polo Lupo</p> <p>ASX AKU AHG VW 038903025 BO 0124315006 HC CA1547IR</p>	<p>ALB1548</p>  <p>ALB1548WA ARB0225 PAL0400</p>  <p>12v 90amp a:43.5 b:14 c:61</p> <p>SEAT, VW Arosa Lupo Polo</p> <p>AKU ASX AHG VW 038903025A BO 0124325014 HC CA1548IR</p>
<p>ALB1549</p>  <p>ALB1549WA ARB0225 PAL0400</p>  <p>12v 120amp a:39 b:14 c:61</p> <p>AUDI, SKODA, VW TT Octavia LT, Beetle, Golf Jetta, Multivan</p> <p>AAB, AEN, APL ATC, AWP, BEA AVU, AGK, ATA VW 038903018B BO 0124515035 HC CA1549IR</p>	<p>ALB1551</p>  <p>ALB1551WA ARB0355</p> <p>12v 90amp a:69 b:21 c:78</p> <p>VOLVO 740 940 960</p> <p>VO 3523044 BO 0120469915 HC CA1551IR</p>	<p>ALB1552</p>  <p>ALB1552RB ALB1552WA ARB0388 PAL0263</p>  <p>12v 70amp a:35 b:14 c:78</p> <p>FORD Fiesta</p> <p>JJL, JJJ, J4R JJF, JJC, J 4C J4K, JJA FO 96FB10300AA BO 0123310055 HC CA1552IR</p>	<p>ALB1554</p>  <p>ALB1554WA ARB0353</p> <p>12v 70amp a:36 b:11 c:83</p> <p>FORD Escort</p> <p>GSG, JLA, JLB, JBB F6B, F6D, FUC, L4B J6A, F6F, N7A FO 86AB10300NB BO 0120489408 HC CA1554IR</p>
<p>ALB1555</p>  <p>ALB1555WA ARB0385</p> <p>12v 130amp a:118.5 b:56</p> <p>SAAB 9-3 9-5</p> <p>B204i, B204E B205E, B235E B235R SA 4941761 BO 0123510096 HC CA1555IR</p>	<p>ALB1556</p>  <p>ALB1556WA ARB0385</p> <p>12v 90amp a:48.5 b:14 c:82</p> <p>IVECO Daily I</p> <p>814063 814023 814043 IV 99473468 BO 0123315500 HC CA1556IR</p>	<p>ALB1557</p>  <p>ALB1557WA ARB0225 PAL0402</p>  <p>12v 90amp a:47 b:14 c:80.5</p> <p>IVECO Daily II</p> <p>814043N, 814043S 814043B, 814043 814063 IV 500317453 BO 0124320001 HC CA1557IR</p>	<p>ALB1560</p>  <p>ALB1560WA ARB0225 PAL0400</p>  <p>12v 90amp a:39 b:14 c:61</p> <p>SKODA, SEAT Alhambra, Arosa, Ibiza Roomster</p> <p>MPV ADY, AER, ALD ALL, AUC, ANV, CGGB VW 037903025H BO 0124325015 HC CA1560IR</p>
























Alternators

Bosch

<p>ALB1562</p>  <p>ALB1562WA ARB0385</p> <p>12v 70amp a:30 b:14 c:61</p> <p>AUDI A3 1.9L A4 1.9L VW Passat 1.9L</p> <p>VW 028903027Q BO 0123310031 HC CA1562IR</p>	<p>ALB1563</p>  <p>ALB1563WA ARB0385</p> <p>12v 90amp a:82 b:56</p> <p>MERCEDES-BENZ V-class Vito</p> <p>OM601970 OM601942 MB 0091543102 BO 0123320062 HC CA1563IR</p>	<p>ALB1566</p>  <p>ALB1566WA ARB0261 PAL0400</p> <p>12v 70amp a:39.5 b:14 c:61</p> <p>SEAT Ibiza 1.4 SKODA Fabia 1.4</p> <p>AUA, AUB BBY, BBZ VW 037903025Q BO 0124315008 HC CA1566IR</p>	<p>ALB1567</p>  <p>ALB1567WA ARB0261 PAL0400</p> <p>12v 80amp a:78 b:56 c:61</p> <p>AUDI, SEAT, SKODA A2 1.4L Ibiza 1.4L Fabia 1.4L</p> <p>AUA, AUB, BKY BBY, BBZ VW 037903025K BO 0124325016 HC CA1567IR</p>
<p>ALB1568</p>  <p>ALB1568WA ARB0225 PAL0400</p> <p>12v 70amp a:39.5 b:14 c:61</p> <p>SEAT, SKODA, VW Arosa, Cordoba, Ibiza Fabia, Roomster Fox, Lupo, Polo</p> <p>AER, AEX, ALD ALL, AUC, BBY, BBZ CGGB, BXW, AFK VW 037903025G BO 0124315007 HC CA1568IR</p>	<p>ALB1569</p>  <p>ALB1569RB ALB1569WA ARB0547 PAL0232</p> <p>12v 90amp a:47 b:20 c:73.5</p> <p>BMW 3 Z</p> <p>M43B16, M43B19 M43164E3, M43194E1 BM 12311435423 BO 0123325011 HC CA1569IR</p>	<p>ALB1570</p>  <p>ALB1570RB ALB1570WA ARB0385 PAL0271</p> <p>12v 90amp a:40 b:14 c:61</p> <p>AUDI, SEAT, SKODA, VW A3, Alhambra Octavia Golf IV Sharan, Beetle</p> <p>ARX, AGR, AHF AJH, AGP, AQM ALH, AJH, AEG VW 038903023H BO 0123320031 HC CA1570IR</p>	<p>ALB1575</p>  <p>ALB1575RB ALB1575WA ARB0206 PAL0400</p> <p>12v 85amp a:89.5 b:58</p> <p>ROVER 45 25</p> <p>14K4F, 16K4F, 18K4F 14K4M, 18K4K (VVC) RO YLE102420 BO 0124225010 HC CA1575IR</p>
<p>ALB1576</p>  <p>ALB1576WA ARB0206 PAL0400</p> <p>12v 85amp a:90.5 b:58</p> <p>MG, ROVER MGF, TF, ZR, ZS 25, 45</p> <p>14K4M, 14K4F, 16K4F 18K4F, 11K4F, 18K4K RO YLE102420 BO 0124225011 HC CA1576IR</p>	<p>ALB1577</p>  <p>ALB1577RB ALB1577WA ARB0231</p> <p>12v 120amp a:51 b:33.5 c:54.5</p> <p>OPEL, VAUXHALL Astra Omega Signum Vectra</p> <p>Y20DTL, Y20DTH Y22DTR, Y22DTH X20DTL, X20DTH OP 6204105 BO 0124515005 HC CA1577IR</p>	<p>ALB1580 <i>New</i></p>  <p>ALB1580 ARB0547 PAL0232</p> <p>12v 70amp a:47 b:20 c:73</p> <p>BMW</p> <p>M43B19 M43164E3 M43B16 BM 12311435425 BO 0123325015 HC CA1580IR</p>	<p>ALB1582</p>  <p>ALB1582WA ARB0283 PAL0474</p> <p>12v 120amp a:50.5 b:33.5 c:57</p> <p>OPEL, VAUXHALL Astra F, Astra G Astra MK Atravan MK Zafira A</p> <p>X20DTH, Y20DTH X20DTL, Y20DTL Y22DTR OP 6204084 BO 0124515032 HC CA1582IR</p>













Alternators

Bosch

<p>ALB1585</p>  <p>ALB1585WA ARB0347 PAL0200</p>  <p>12v 90amp a:38 b:13 c:66.5</p> <p>MITSUBISHI 4G13 Space Star 4G18 1.3L/1.6L 16V 1998-></p> <p>MI MD257744 BO 0124325008 HC CA1585IR</p>	<p>ALB1586</p>  <p>ALB1586WA ARB0261 PAL0400</p>  <p>12v 70amp a:34.5 b:14 c:82</p> <p>SEAT AQV, AQW Arosa AZE, AZF SKODA AME, ATZ, AHT Fabia VW 047903015Q BO 0124325014 HC CA1586IR</p>	<p>ALB1587</p>  <p>ALB1587WA ARB0225 PAL0400</p>  <p>12v 90amp a:39 b:14 c:61</p> <p>VW AGK, ATA LT AEF, ACV Polo AGD Transporter VW 038903018 BO 0124325022 HC CA1587IR</p>	<p>ALB1588</p>  <p>ALB1588WA ARB0238 PAL0400</p>  <p>12v 120amp a:30.5 b:14 c:82.5</p> <p>AUDI, VW APR, BNG, ARN A4, A6, A8 ASN, AVK, BDV Passat 2.8 AMM, BBJ, AJK VW 038903018F BO 0124515028 HC CA1588IR</p>
<p>ALB1591</p>  <p>ALB1476 ALB1476WA ALB1591WA ARB0251 PAL0232</p>  <p>12v 120amp a:69 b:28 c:77</p> <p>BMW M52B20, M52B25 320, 323, 325, 328 M54B22, M54226S1 520, 523, 525, 528 M54256S5, M54B30 530, 535, 540, 728 BM 12317501593 X5, Z3 BO 0124515050 HC CA1591IR</p>	<p>ALB1592</p>  <p>ALB1592RB ALB1592WA ARB0283 PAL0474</p>  <p>12v 100amp a:31.5 b:79 c:56.5</p> <p>OPEL, VAUXHALL, HOLDEN Z22SE, Z22YH Astra, Vectra Z20NET, Z20LET Signum, Speedster Zafira OP 13129850 BO 0124415009 HC CA1592IR</p>	<p>ALB1593</p>  <p>ALB1593RB ALB1593WA ARB0362</p> <p>24v 80amp a:110 b:80</p> <p>MERCEDES-BENZ OM354923 7t, 8t, Vario, 63 AMG OM364952 Actros, Atego, Atego 2 OM906911 Axor, Axor2, Unimog MB 0091549702 Citro, Econic BO 0120469115 HC CA1593IR</p>	<p>ALB1599</p>  <p>ALB1599WA PAL0223</p>  <p>12v 80amp a:90 b:58</p> <p>TOYOTA Europe 3SFE Avensis 2.0L TO 2706003070 BO 0123325013 HC JA1599IR</p>
<p>ALB1603</p>  <p>ARB0353 PAL0455</p>  <p>12v 70amp a:42 b:13.5 c:80</p> <p>NISSAN BD30Ti Trade NI 2310069T10 BO 6033GB4018 HC JA1603IR</p>	<p>ALB1605</p>  <p>ALB1605WA ARB0236 PAL0112</p>  <p>12v 80amp a:33.5 b:18 c:40</p> <p>TOYOTA 3ZZFE, 1ZZFE Corolla 4ZZFE Avensis TO 270600D160 BO 0124315016 HC JA1605IR</p>	<p>ALB1623</p>  <p>ALB1623WA ARB0261 PAL0400</p>  <p>12v 120amp a:92 b:56</p> <p>MERCEDES-BENZ M111951 180 M111952 MB A0111548402 BO 0124515045 HC CA1623IR</p>	<p>ALB1628</p>  <p>ALB1628WA ALB628WA ALV1628RB ARB0239 PAL0214</p>  <p>12v 98amp a:21 b:80 c:40</p> <p>RENAULT K4M690 Logan 1.6L F4R700 Espace 2.0L K7J701 RE 7700101274 BO 0124415007 HC CA1628IR</p>




















Alternators

Bosch

<p>ALB1630</p>  <p>ALB1630WA ARB0387</p> <p>12v 150amp b:70 c:59</p> <p>MERCEDES-BENZ 200, 208, 211 213, 216, 220, 300 308, 311, 313, 316 Sprinter, Vito</p> <p>OM611A OM611981, OM612981 M111948, OM611987 MB 0111547002 BO 0123520023 HC CA1630IR</p>	<p>ALB1632</p>  <p>ALB1632RB ALB1632WA ARB0200 PAL0404</p> <p>12v 150amp a:38 b:21</p> <p>BMW, LAND ROVER 5, 7, X 540, 740, 750 Range Rover 4.4L</p> <p>M62, M73 M62B35, M62B44 M73B54, M67D39 BM 12311705483 BO 01220AA1H0 HC CA1632IR</p>	<p>ALB1633</p>  <p>ALB1633WA ALM1633WA ARB0543 PAL0223</p> <p>24v 90amp a:84 b:58</p> <p>IVECO EuroStar EuroTech EuroTrakker Stalis, Trakker</p> <p>F3AE0681 F3AE0681D, F3BE0681 F3AE0681A, F3AE0681 IV 2995980 BO 0123525502 HC CA1633IR</p>	<p>ALB1634</p>  <p>ALB0005 ALB1634RB ALB1634WA ARB0201 PAL0405</p> <p>12v 150amp a:41 b:21</p> <p>MERCEDES-BENZ C 200, 220, 270 B 320, 400 600 Actros</p> <p>M137970 OM628960, OM611962 OM541946, OM646962 MB 0001500550 BO 0122AA0B0 HC CA1634IR</p>
<p>ALB1636</p>  <p>ALB1636WA ARB0255 PAL0231</p> <p>12v 105amp a:41 b:56 c:75</p> <p>FORD Transit 2.0L</p> <p>D3FA, ABFA F3FA, FIFA</p> <p>FO 1C1T10300AE BO 0124415016 HC CA1636IR</p>	<p>ALB1639</p>  <p>ALB1639RB ALB1639WA ARB0255 PAL0231</p> <p>12v 75amp a:39.5 b:55 c:74</p> <p>FORD Transit 2.4L</p> <p>D2FA, D2FE D4FA, DOFA F4FA, FXFA, H9FA FO 2C3U10300BB BO 0124315019 HC CA1639IR</p>	<p>ALB1644</p>  <p>ALB1644WA ARB0225 PAL0400</p> <p>12v 120amp a:39 b:14.5 c:61.5</p> <p>AUDI, SKODA, VW A2 Fabia Polo</p> <p>BNM, AMF, BNV BHC, ANY BAY, BNV, BMS VW 045903023A BO 0124515039 HC CA1644IR</p>	<p>ALB1648</p>  <p>ALB1648RB ALB1648WA ARB0220</p> <p>12v 105amp a:58.5 b:25 c:70.5</p> <p>FIAT, LANCIA Brava, Doblo, Marea Multipla, Stylo Lybra</p> <p>182B6000, 182A4000 185A3000, 186A4000 182B5098 FI 46532669 BO 0124325059 HC CA1648IR</p>
<p>ALB1654</p>  <p>ALB1654WA ARB0289 PAL0407</p> <p>12v 90amp a:29 b:62.5 c:41.5</p> <p>BMW 316 318</p> <p>N40B16A, N42B18 N46B18, N42B20 N42B20A BM 12317512151 BO 0124325062 HC CA1654IR</p>	<p>ALB1655</p>  <p>ALB1655WA ARB0389</p> <p>12v 100amp a:32 b:21 c:56</p> <p>VOLVO S90 V90 960 Series</p> <p>VO 9162423 BO 0123500006 HC CA1655IR</p>	<p>ALB1656</p>  <p>ALB1656WA ALV1656RB ARB0247 PAL0402</p> <p>12v 120amp a:82 b:56</p> <p>MERCEDES-BENZ 240, 280, 320 24t, 26t, 32, 35t Viano, Vito</p> <p>M112910, M112911 OM442951, OM440971 M112951 MB 0111542602 BO 0124515055 HC CA1656IR</p>	<p>ALB1657</p>  <p>ALB1657WA ARB0261 PAL0400</p> <p>12v 110amp a:39 b:14 c:61</p> <p>VW Lupo</p> <p>ARR VW 036903024 BO 0124325051 HC CA1657IR</p>
























Alternators

Bosch

<p>ALB1658</p>  <p>ALB1658RB ALB1658WA</p> <p>ARB0231</p> <p>12v 120amp a:54.5 b:34 c:57</p> <p>OPEL, RENAULT Astra, Corsa Astravan, Corsavan Tigra Megane</p> <p>Z14XEP, Z12XE Z10XEP K4M760 OP 13156053 BO 0124225041 HC CA1658IR</p>	<p>ALB1659</p>  <p>ALB1659WA</p> <p>24v 140amp b:16 c:180</p> <p>MERCEDES-BENZ U 500 O 530 O 500 O 403</p> <p>OM906955, OM457944 M476934, OM909921 MB 0091547202 BO 0120689567 HC CA1659IR</p>	<p>ALB1660</p>  <p>ALB1660WA</p> <p>ARB0655 PAL0407</p>  <p>12v 120amp a:30 b:63 c:42</p> <p>BMW 316 318</p> <p>N40B16A, N42B18 N46B18, N42B20 N42B20A, N46B20 BM 12317516101 BO 0124515098 HC CA1660IR</p>	<p>ALB1663</p>  <p>ALB1663WA ALB1663WA</p> <p>ARB0558 PAL0261</p>  <p>24v 90amp b:80</p> <p>MAN, NEOPLAN Lions Coach, Lions Star NG, NI, NU, SU Series Xt, XXt series Tourliner</p> <p>D2866LOH34 D0834LFL02 D2876LF02 MA 51261017234 BO 0123525501 HC CA1663IR</p>
<p>ALB1666</p>  <p>ALB1666WA</p> <p>ARB0298 PAL0260</p>  <p>24v 80amp b:77.5</p> <p>MERCEDES-BENZ Various Trucks ACTROS 1831-4148 2002-> ATEGO 714-1529 1998-> AXOR 2004-></p> <p>OM904908, OM904923 OM900911, OM924920 OM904905 MB 0111548602 BO 0124555001 HC CA1666IR</p>	<p>ALB1667</p>  <p>ALB1667WA</p> <p>ARB0381</p> <p>24v 140amp b:16 c:182</p> <p>VOLVO 9700 Series</p> <p>DH12D380 DH12D340 DH12D420 VO 9520621 BO 0120689514 HC CA1667IR</p>	<p>ALB1673</p>  <p>ALB1673WA</p> <p>ARB0963 PAL0211</p>  <p>12v 140amp a:44 b:20 c:83</p> <p>VOLVO S40, S60, S80 V40, V70 XC</p> <p>B4204S2, B4194T2 B4204T, B5244S2 B5244T5, B5254T4 VO 8602343 BO 0124525029 HC CA1673IR</p>	<p>ALB1678</p>  <p>ALB1678WA ALV1678WA</p> <p>ARB0261 PAL0400</p>  <p>12v 140amp a:29 b:14 c:60.5</p> <p>AUDI, SKODA, VW A4 A6 Passat Superb</p> <p>AVB, AVF AWX, BGW VW 028903029Q BO 0124525010 HC CA1678IR</p>
<p>ALB1679</p>  <p>ALB1679WA</p> <p>ARB0225 PAL0400</p>  <p>12v 120amp a:47 b:14 c:80</p> <p>IVECO 35C 50C 65C Daily</p> <p>814043S 814063 B14043C IV 500335719 BO 0124515044 HC CA1679IR</p>	<p>ALB1683</p>  <p>ALB1683WA</p> <p>ARB0271</p> <p>12v 140amp a:118 b:56</p> <p>SAAB 9-3 9-5</p> <p>B204E, B204I B205E, B204R B235E, B235R, B235L SA B205E BO 0124525016 HC CA1683IR</p>	<p>ALB1684</p>  <p>ALB1684WA</p> <p>ARB0225 PAL0400</p>  <p>12v 90amp a:46.5 b:14 c:78.5</p> <p>RENAULT VI Mascott</p> <p>814043k 814043C2586 814043N3585 RE 7700377092 BO 0124325052 HC CA1684IR</p>	<p>ALB1688</p>  <p>ALB1688WA</p> <p>ARB0252</p> <p>12v 120amp a:29.5 b:14.5 c:59</p> <p>ALFA ROMEO Alfa 147 Alfa 166 Alfa 156 Spider</p> <p>932A000 AR34201, AR36101 AR32405, 936A6000 FI 60672342 BO 0124515090 HC CA1688IR</p>




Alternators

Bosch

<p>ALB1689</p>  <p>ALB1665(89)W ALB1689WA</p> <p>ARB0261 PAL0400</p>  <p>12v 120amp a:92 b:56</p> <p>MERCEDES-BENZ 200 230</p> <p>M111955 M111957 M111981 MB 0111546802 BO 0124515046 HC CA1689IR</p>	<p>ALB1693</p>  <p>ALB1693WA</p> <p>ARB0298 PAL0260</p>  <p>24v 110amp b:80</p> <p>DAF 75, 85, 95 CF XF</p> <p>XF250M, PE228C PF183M, XF315M VF390M, XE355C DA 1697322 BO 0124655003 HC CA1693IR</p>	<p>ALB1694</p>  <p>ALB1694RB ALB1694WA</p> <p>ARB0298 PAL0260</p>  <p>24v 80amp b:80</p> <p>DAF 75, 85, 95 CF XF</p> <p>XF250M, PE228C PF183M, XF315M VF390M, XE355C DA 1697321 BO 0124555003 HC CA1694IR</p>	<p>ALB1695</p>  <p>ALB1695WA</p> <p>ARB0558 PAL0261</p>  <p>24v 55amp b:78.5</p> <p>MAN Various Trucks</p> <p>D0836LFL02 D2866LF22 D0834LFL03 MA 51261017231 BO 0123325500 HC CA1695IR</p>
<p>ALB1699</p>  <p>ALB1699RB ALB1699WA</p> <p>ARB0297 PAL0260</p>  <p>24v 70amp a:35 b:14 c:81</p> <p>IVECO EuroCargo</p> <p>F4AE0481C, F4AE0481D F4AE0681A, F4AE0681B F4AE3681E, F4AE3681D IV 4892318 BO 0124555005 HC CA1699IR</p>	<p>ALB1700</p>  <p>ALB1700WA</p> <p>ARB0225 PAL0400</p>  <p>12v 110amp a:40.5 b:14 c:81.5</p> <p>FIAT Ducato DIVECO Daily II NEW HOLLAND</p> <p>F1AE0481D F1AE0481C F1AE0481B IV 504009977 BO 0124325053 HC CA1700IR</p>	<p>ALB1701</p>  <p>ALB1701WA</p> <p>ARB0266 PAL0400</p>  <p>12v 200amp a:31 b:93.5 c:56</p> <p>MERCEDES-BENZ 200 220 270</p> <p>OM646951 OM611961 OM647961 MB 0121545902 BO 0124625002 HC CA1701IR</p>	<p>ALB1729</p>  <p>ALB1729WA</p> <p>ARB0261 PAL0400</p>  <p>12v 110amp a:39.5 b:14 c:61</p> <p>VW Golf Polo Caddy</p> <p>BUD, APE AHW, CMAA BCA, AUA VW 036903024N BO 0124325081 HC CA1729IR</p>
<p>ALB1730</p>  <p>ALB1730WA</p> <p>ARB0261 PAL0400</p>  <p>12v 140amp a:19 b:33.5 c:59</p> <p>OPEL Signum 3.2L Vectra 2.6L Vectra 3.2L</p> <p>Z32SE Y26SE OP 24436553 BO 0124525012 HC CA1730IR</p>	<p>ALB1731</p>  <p>ALB1731WA</p> <p>ARB0257</p> <p>12v 120amp a:50.5 b:33.5 c:55</p> <p>OPEL, VAUXHALL Omega B</p> <p>Y26SE Y32SE OP 9193117 BO 0124515049 HC CA1731IR</p>	<p>ALB1732</p>  <p>ALB1732WA</p> <p>ARB0861 PAL0400</p>  <p>12v 90amp a:91.5 b:56</p> <p>MERCEDES-BENZ 200 180 230</p> <p>M111957 M111952 M111982 MB A0121540302 BO 0124325045 HC CA1732IR</p>	<p>ALB1733</p>  <p>ALB1733WA</p> <p>ARB0261 PAL0400</p>  <p>12v 110amp a:39.5 b:14 c:61</p> <p>VW Golf Bora Lupo</p> <p>BAD ARR VW 036903024A BO 0124325050 HC CA1733IR</p>













Alternators

Bosch

<p>ALB1735</p>  <p>ARB0378</p> <p>12v 55amp a:92 b:56</p> <p>MERCEDES-BENZ U 90 U 100 811 809</p> <p>OM602941, OM364911 OM602948 OM364958 MB 0081541102 BO 0120488132 HC CA1735IR</p>	<p>ALB1736</p>  <p>ALB1736WA ARB0368</p> <p>12v 95amp b:80</p> <p>FENDT 800 Series 6.9 Diesel</p> <p>D286 MA 51261017217 BO 0120484024 HC CA1736IR</p>	<p>ALB1739</p>  <p>ALB1739WA ALB5097WA ARB0298 PAL0260</p> <p>24v 100amp a:114.5 b:79.5</p> <p>MERCEDES-BENZ Actros, Atega, Atega 2 Axor, Axor2 Citaro, Econic T1, Unimog</p> <p>OM904923 M113944 OM541944 MB 0111548602 BO 0124655001 HC CA1739IR</p> <p>W 15DFM L S</p>	<p>ALB1740</p>  <p>ALB1740WA ARB0716 PAL0474</p> <p>12v 120amp a:31.5 b:79 c:55.5</p> <p>HOLDEN, OPEL, VAUXHALIZ22SE, Z22YH Zafira, Speedster Astra, Signum Vectra, VX</p> <p>Z20NET, Z20LET OP 13129850 BO 0124325168 HC CA1740IR</p> <p>DFM L</p>
<p>ALB1744</p>  <p>ARB0365</p> <p>24v 65amp b:23 c:68</p> <p>SCANIA T 144 T 124 164 144</p> <p>DSC1413, DC1601 DSC1415, DSC1413 DT1202 SC 1409379 BO 0120468132 HC CA1744IR</p>	<p>ALB1747</p>  <p>ALB1747WA ARB0231</p> <p>12v 70amp a:53 b:33.5 c:56</p> <p>OPEL Astra Corsa Agila</p> <p>Z10XE, Z12XE Z14XEL, Z12XEP OP 13156052 BO 0124225001 HC CA1747IR</p>	<p>ALB1748</p>  <p>ALB1748WA ARB0231</p> <p>12v 100amp a:54 b:33.5 c:57</p> <p>OPEL Meriva Corsavan Corsa Astra</p> <p>Z14XEP Z12XE OP 93183435 BO 0124425010 HC CA1748IR</p>	<p>ALB1749</p>  <p>ALB1749WA ARB0225 PAL0400</p> <p>12v 150amp a:29.5 b:14 c:62</p> <p>PORSCHE Cayenne VW Touareg</p> <p>BHL, AZZ BHK, M4810 BMX VW 021903026B BO 0124615026 HC CA1749IR</p> <p>L DFM</p>
<p>ALB1751 <i>New</i></p>  <p>ARB0362</p> <p>24v 180amp b:15 c:181</p> <p>DAF MAN</p> <p>BOSCH T1 Series MN 81261016080 BO 0120689544 HC CA1751IR</p>	<p>ALB1754</p>  <p>ALB1754WA ARB0261 PAL0400</p> <p>12v 120amp a:27.5 b:70 c:56.5</p> <p>AUDI A4 BMW X</p> <p>ALT, AMB, AWA BFB, BKB M47N204D4 VW 06B903016AE BO 0124515059 HC CA1754IR</p> <p>L DFM</p>	<p>ALB1759</p>  <p>ALB1759WA ALV1759RB ALV1759WA ARB0238 PAL0400</p> <p>12v 120amp a:34.5 b:14 c:82.5</p> <p>AUDI, VW A4, A6, A8 Passat 1.8L Passat 2.0L</p> <p>ADP, AHL, ANA ALZ, ALT, BBJ BFF, AZM, AEB VW 06B903016AD BO 0124515025 HC CA1759IR</p> <p>L DFM</p>	<p>ALB1763</p>  <p>ALB1763WA ARB0261 PAL0400</p> <p>12v 150amp a:39 b:14.5 c:59</p> <p>FORD Galaxy VW Transporter, Multivan Sharan</p> <p>AUF, ACV, AXL AJT, AYY, AYC AYL, BKK, BDL VW 022903028A BO 0124525128 HC CA1763IR</p> <p>L DFM</p>





















Alternators

Bosch

<p>ALB1764</p>  <p>ALB1764WA ARB0266 PAL0400 L DFM</p> <p>12v 200amp a:34 b:93.5 c:55.5</p> <p>MERCEDES-BENZ 200, 250 270, 280 320</p> <p>OM646961 OM647961 OM648961 MB 0121549802 BO 0124625019 HC CA1764IR</p>	<p>ALB1765</p>  <p>ALB1765WA ALB1765WA ARB0231</p> <p>12v 120amp a:54.5 b:33.5 c:59</p> <p>Opel Astra 1.4 - 2.0 Zafira 1.6 - 1.8 Omega 2.2 Vectra 1.8 - 2.0</p> <p>X20XEV Z14XE X18XE1 OP 55556070 BO 0124515004 HC CA1765IR</p>	<p>ALB1769</p>  <p>ALB1769WA ARB0261 PAL0400 L DFM</p> <p>12v 150amp a:28 b:70 c:56.5</p> <p>AUDI A4 A6</p> <p>ALT, ALZ, AVJ BEX, BFB, BGB BKB, BPG, BUL VW 06B903016AC BO 0124615009 HC CA1769IR</p>	<p>ALB1770</p>  <p>ALB1770WA ARB0316</p> <p>24v 140amp b:16 c:180</p> <p>DAF 95.430 11.6 95.400 11.6 95.380 11.6 95.360 11.6</p> <p>WS315M, WS295 WS315L, WS282 WS315G, WS268G DA 1248660 BO 0120689546 HC CA1770IR</p>
<p>ALB1773</p>  <p>ALB1773WA ARB0289 PAL0407 COM</p> <p>12v 110amp a:30 b:63 c:41</p> <p>BMW 116, 118, 120 316, 318 Z4</p> <p>N46B18, N46B20 N40B16A, N42B18 N45B16A, N46B20B BM 12317521382 BO 0124325116 HC CA1773IR</p>	<p>ALB1775</p>  <p>ALB1775WA ARB4151 PAL0409 COM DFM</p> <p>12v 150amp a:32 b:70 c:56.5</p> <p>MERCEDES-BENZ E200</p> <p>M271941 M271956 MB 2711541002 BO 0124615042 HC CA1775IR</p>	<p>ALB1776</p>  <p>ALB1776WA ARB0861 PAL0413 L DFM</p> <p>12v 150amp a:81.5 b:56</p> <p>MERCEDES E series, S series CLK, CLS SL, SLK</p> <p>M113943, M113984 M112913, M112917 M112949 MB A0121541302 BO 0124615012 HC CA1776IR</p>	<p>ALB1782</p>  <p>ALB1782WA ALV0249 ARB0261 PAL0400 L DFM</p> <p>12v 140amp a:39 b:14 c:61.5</p> <p>AUDI, SEAT, SKODA, VW A3, A4, TT Ibiza, Leon, Toledo Passat, Golf, Jetta</p> <p>CMXA, CEPA, AXW CAYB, CLCA, BXE BMM, CEGA, CBBB VW 06F903023A BO 0124525091 HC CA1782IR</p>
<p>ALB1811</p>  <p>ALB1811WA ALV1811RB ARB0225 PAL0400 L DFM</p> <p>12v 140amp a:28 b:70 c:57</p> <p>AUDI, SEAT, SCODA, VW A3, A4, TT Altea, Leon, Toledo Octavia, Superb, Yeti Golf VI, Tiguan, Passat</p> <p>BYT, BZB, BWA CDAA, CCZA, CAWB ALZ, AMB, AVJ VW 06B903016AB BO 0124525009 HC CA1811IR</p>	<p>ALB1812</p>  <p>ALB1812RB ALB1812WA ARB0297 PAL0260 W 15DFM L S</p> <p>24v 90amp a:35 b:14 c:82</p> <p>IVECO 6.5t - 19t Various Trucks</p> <p>F4AE0481A F4AE0681D F4AE3681B IV 4892320 BO 0124655005 HC CA1812IR</p>	<p>ALB1813</p>  <p>ALB1813WA ARB0261 PAL0400 L DFM</p> <p>12v 150amp a:30 b:14 c:82</p> <p>AUDI, FAW-AUDI, SCODA VW, FAW-VW A4, A6, Passat-Santana Superb Passat</p> <p>AMM, ATX, AKC BDV, BAW, AYM BCZ, BDG, BFC VW 078903016R BO 0124615007 HC CA1813IR</p>	<p>ALB1815</p>  <p>ALB1815WA ARB0261 PAL0400 L DFM</p> <p>12v 110amp a:39 b:14 c:61</p> <p>AUDI, SEAT, SKODA, VW A2 Altea, Leon Fabia, Octavia Golf V, Caddy</p> <p>BAD, BXW, BCA AUA, BUD CGGA, CGGB VW 036903024E BO 0124325106 HC CA1815IR</p>























Alternators

Bosch

<p>ALB1817</p>  <p>ALB1817RB ALB1817WA</p> <p>ARB0261 PAL0400</p>  <p>12v 110amp a:30 b:14 c:61.5</p> <p>AUDI, SEAT, SKODA, VW A3 Cordoba, Ibiza Fabia, Octavia Golf IV, V, VI, Jetta, Polo</p> <p>CAXA, CAXC, CAVP BLF, BAG, BCF BLP, BTS VW 03C903023 BO 0124325044 HC CA1817IR</p>	<p>ALB1818</p>  <p>ALB1818WA</p> <p>ARB0225 PAL0400</p>  <p>12v 110amp a:38 b:14.5 c:60.5</p> <p>AUDI, SEAT, SKODA, VW A3 Altea, Ibiza, Leon Golf V, Golf VI, Jetta</p> <p>BSE, BSF, BGU AXW, BLR, BLX BLY, BMB, BVY VW 06F903023B BO 0124325129 HC CA1818IR</p>	<p>ALB1819</p>  <p>ALB1819WA ALB819WA</p> <p>ARB0261 PAL0400</p>  <p>12v 150amp a:40 b:14.5 c:61</p> <p>VW Touareg 2.5 VW Transporter 2.5 VW Multivan V 2.5 TDI</p> <p>BLK AXD VW 070903024A BO 0124615031 HC CA1819IR</p>	<p>ALB1820</p>  <p>ALB1820WA</p> <p>ARB0137 PAL0400</p>  <p>12v 180amp a:27.5 b:14.5 c:61</p> <p>VW Multivan Touareg Transporter</p> <p>AXD, AXE, BLJ BNZ, BPC, BAC BPE, BLK VW 070903024B BO 0121715004 HC CA1820IR</p>
<p>ALB1821</p>  <p>ALB1821WA ALB821WA</p> <p>ARB0231</p> <p>12v 120amp a:54.5 b:33.5 c:59</p> <p>OPEL Astra Combo Corsa Zafira</p> <p>Z18XE Z14XE Z16XEL OP 93177834 BO 0124515031 HC CA1821IR</p>	<p>ALB1823</p>  <p>ALB1823WA</p> <p>ARB0276 PAL0213</p>  <p>12v 150amp a:42.5 b:14.5 c:61.5</p> <p>RENAULT Clio Megane Scenic</p> <p>K9K712, K9K714 K4J730, K4J740 K9K732, F9Q803 RE 7701474326 BO 0124525028 HC CA1823IR</p>	<p>ALB1824</p>  <p>ALB1824WA</p> <p>ARB0276 PAL0213</p>  <p>12v 150amp a:32.5 b:14.5 c:61</p> <p>NISSAN, OPEL RENAULT, VAUXHALL Primastar Vivaro, Vel Satis Laguna, Master, Trafic</p> <p>F4R720, F4R722 F4R, G9T706 G9T600, F4R820 RE 7711135519 BO 0124525043 HC CA1824IR</p>	<p>ALB1825</p>  <p>ALB1825WA</p> <p>ARB0678 PAL0407</p>  <p>12v 150amp a:68.5 b:28 c:77.5</p> <p>BMW 3 5 7 x</p> <p>M47N204D4 M54B22 M54256S5 BM 12317519721 BO 0124525026 HC CA1825IR</p>
<p>ALB1827</p>  <p>ALB1827WA</p> <p>ARB0276 PAL0213</p>  <p>12v 150amp a:32.5 b:14.5 c:61</p> <p>NISSAN, OPEL, RENAULT VAUXHALL Movano, Vivaro Laguna, Master, Megane Scenic, Trafic, Vel Satis</p> <p>G9U754, G9U632 F4R714, F9Q804 F4R787, G9U650 OP 4405286 BO 0124525044 HC CA1827IR</p>	<p>ALB1828</p>  <p>ALB1828WA</p> <p>ARB0231</p> <p>12v 140amp a:51 b:33.5 c:57</p> <p>OPEL, SAAB, VAUXHALL Astra G, Omega B Vectra C, Zafira A Signum 40307</p> <p>Y20DTH Y22DTH, Y22DTR D223L OP 1204160 BO 0124525030 HC CA1828IR</p>	<p>ALB1831</p>  <p>ALB1831WA</p> <p>ARB0512</p> <p>12v 150amp a:85.5 b:56</p> <p>CLAAS JOHN DEERE 6000 Series Jaguar Diesel</p> <p>Various Models JD AL119537 BO 0123515500 HC CA1831IR</p>	<p>ALB1833</p>  <p>ALB1833WA</p> <p>ARB0231</p> <p>12v 120amp a:64 b:23 c:59.5</p> <p>ALFA ROMEO Alfa 159 OPEL Astra G 1.6 Vectra C 1.6 1.8</p> <p>Z16XEP Z18HER 939A4.000 OP 24447429 BO 0124425005 HC CA1833IR</p>
























Alternators

Bosch

<p>ALB1837</p>  <p>ALB1837WA ALB837WA</p> <p>ARB0225 PAL0400</p>  <p>12v 140amp a:40 b:14 c:81</p> <p>FIAT Ducato 2.3L IVECO L10 2.3L</p> <p>F1AE0481C IV 504009978 BO 0124525020 HC CA1837IR</p>	<p>ALB1840</p>  <p>ALB1840WA</p> <p>ARB0293 PAL0409</p>  <p>12v 200amp a:30 b:70 c:57.5</p> <p>MERCEDES-BENZ Viano Vito</p> <p>OM642982 OM646980, OM646981 OM646982, OM646983 MB 0131542102 BO 0124625022 HC CA1840IR</p>	<p>ALB1845</p>  <p>ALB1845WA ALB845WA</p> <p>ARB0387</p> <p>12v 150amp a:83 b:56</p> <p>MERCEDES-BENZ S 320, S 430 S 500, CL 500</p> <p>M113960 MB 0101542902 BO 0123520006 HC CA1845IR</p>	<p>ALB1846</p>  <p>ALB1846WA</p> <p>ARB0820 PAL0413</p>  <p>12v 200amp a:31 b:70.5 c:57</p> <p>MERCEDES-BENZ Sprinter Viano Vito</p> <p>OM646985, OM646981 OM646986, OM646 OM646990, OM646982 MB 0131541002 BO 0124625006 HC CA1846IR</p>
<p>ALB1847</p>  <p>ALB1847WA</p> <p>ARB0569 PAL0260</p>  <p>24v 80amp b:80</p> <p>MAN 18t, 19t 24t, 26t, 28t 32t, 33t, 35t 40t, 41t</p> <p>D2866LF27 D2876LF12 D2876LF25 MA 51261017254 BO 0124555014 HC CA1847IR</p>	<p>ALB1851</p>  <p>ALB1851WA</p> <p>ARB0298 PAL0260</p>  <p>24v 80amp a:18.5 b:85 c:35.5</p> <p>SCANIA K114, R380, 340, 380 400, 420, 440, 470 500, 560, 580, 620 230, 270, 280, 310</p> <p>DC1213, DC935 DC913, DC916 DC918, DC930 SC 0518064 BO 0124555008 HC CA1851IR</p>	<p>ALB1853</p>  <p>ALB1853WA</p> <p>ARB0297 PAL0260</p>  <p>24v 80amp a:43.5 b:13.5 c:106</p> <p>RENAULT VI, VOLVO Kerax, Magnum B, FH, FM Series 8700, 9700, 9900 Series S80</p> <p>DH12D340, DH12E340 B5244S2, D5252T B5204T3, DXI13 VO 11170134 BO 0124555009 HC CA1853IR</p>	<p>ALB1854</p>  <p>ALB1854WA</p> <p>ARB0225 PAL0400</p>  <p>12v 120amp a:47 b:14 c:80</p> <p>RENAULT VI European Trucks</p> <p>814043B3586 814043C2586 814043S3585 RE 7700377091 BO 0124515120 HC CA1854IR</p>
<p>ALB1858</p>  <p>ALB1858WA</p> <p>ARB0283 PAL0474</p>  <p>12v 100amp a:32 b:79 c:55</p> <p>OPEL, VAUXHALL Signum Vectra Vectra C</p> <p>Z20NET Z22YH Z22SE OP 6204118 BO 0124415026 HC CA1858IR</p>	<p>ALB1859</p>  <p>ALB1859RB ALB1859WA</p> <p>ARB0881 PAL0409</p>  <p>12v 200amp a:30.5 b:93 c:55.5</p> <p>MERCEDES-BENZ C200, C220 CLC220, CLK220 E220, E280, E320</p> <p>OM646962 OM646963 OM646966 MB A0141540702 BO 0124625045 HC CA1859IR</p>	<p>ALB1860</p>  <p>ALB1860RB ALB1860WA</p> <p>ARB0321 PAL0453</p>  <p>12v 120amp a:38 b:14 c:61</p> <p>RENAULT Clio Modus Twingo</p> <p>K9K752 K4J780 K4M801 RE 7701475896 BO 0124425013 HC CA1860IR</p>	<p>ALB1861</p>  <p>ALB1861WA ALB861WA</p> <p>ARB0963 PAL0211</p>  <p>12v 160amp a:45.5 b:20 c:83</p> <p>VOLVO S60 S80 V70 XC70, XC90</p> <p>B5204T5 D5244T B6294T VO 8602713 BO 0124625003 HC CA1861IR</p>
























Alternators

Bosch

ALB1863	ALB1867	ALB1868	ALB1870
 <p>ALB1863WA ARB0276 PAL0213</p> 	 <p>ALB1867WA ARB0247 PAL0413</p> 	 <p>ALB1868WA ARB0247 PAL0413</p> 	 <p>ALB1870WA ARB0569 PAL0260</p> 
12v 150amp a:32.5 b:14 c:61	12v 100amp a:18.5 b:81.5 c:44	12v 110amp a:21 b:81.5 c:44.5	24v 80amp b:80
RENAULT Laguna II 1.9 dCi F9Q718 F9Q752 F9Q754 RE 8200229907 BO 0124525047 HC CA1863IR	MINI Cooper Mini One W10B16A B14A BM 1231523897 BO 0124325108 HC CA1867IR	MINI Cooper One W10B16A BM 12317550319 BO 0124325158 HC CA1868IR	MAN Trucks EU D0834LFL40 D2676LF14 D2066LF12 MA 51261017249 BO 0124555013 HC CA1870IR
ALB1871	ALB1872	ALB1876	ALB1877
 <p>ALB011WA ALB1871WA ALB871 ARB0569 PAL0260</p> 	 <p>ALB1872WA ALV1872RB ARB0261 PAL0400</p> 	 <p>ALB1876WA ARB0276 PAL0213</p> 	 <p>ALB1877WA ARB0276 PAL0213</p> 
24v 110amp b:80	12v 120amp a:82 b:56	12v 150amp a:38 b:14.5 c:60.5	12v 150amp a:32.5 b:14.5 c:61
MAN 18t 26t 33t D2866LF28 D2876LF12 D2876LF13 MA 51261017246 BO 0124655009 HC CA1871IR	MERCEDES 240, 280, 320, 350 Viano, Vito 24t, 26t, 35t, 32t M112910 OM442989 M112951 MB 0111546402 BO 0124515056 HC CA1872IR	NISSAN, RENAULT Cube, Juke, Micra Note, NV200, Qashqai Megane, Scenic K9K, K9K700 K9K732, K9K728 K9K724, K9K276 RE 8200390667 BO 0124525082 HC CA1876IR	NISSAN OPEL RENAULT Movano Trafic G9U754, G9U632 F9Q674, G9U630 F9Q758 NI 2310000Q0H BO 0124525076 HC CA1877IR
ALB1880	ALB1882	ALB1883	ALB1887
 <p>ALB1880WA ALB880WA ARB0298 PAL0260</p> 	 <p>ALB1882WA ARB0231</p>	 <p>ALB1883WA ALB883WA ALM0429 ARB0297 PAL0260</p> 	 <p>ALB1887WA ARB0321 PAL0453</p> 
24v 100amp a:20 b:85 c:36	12v 100amp a:64 b:23 c:59.5	24v 110amp a:44.5 b:13.5 c:106	12v 120amp a:38.5 b:14.5 c:61.5
SCANIA 230 270 280 310 DC1213 DC911 SC 1763036 BO 0124655007 HC CA1880IR	OPEL, VAUXHALL Astra, Astra G, Astra H Zafira MK II, Zafira B Astravan Mk Z16XEP Z18XEP OP 6204205 BO 0124425020 HC CA1882IR	Renault 440.19 12.8 Renault 460.32 Volvo FH12/340 12/380 DXi13 D12D380 VO 20849352 BO 0124655012 HC CA1883IR	RENAULT Clio, Laguna Megane, Modus Scenic K4J780 K4M824 K4M762 RE 8200323137 BO 0124425034 HC CA1887IR

























Alternators

Bosch

<p>ALB1888</p>  <p>ALB1888WA ARB0011 PAL0213</p>  <p>12v 180amp a:41.5 b:21 c:46</p> <p>CITROEN, PEUGEOT C5 C6 407 607</p> <p>DT17ED4 DT17BTED4 PE 9652035480 BO 0121715001 HC CA1888IR</p>	<p>ALB1889</p>  <p>ALB1889WA ARB0236 PAL0112</p>  <p>12v 90amp a:29 b:19 c:36.5</p> <p>TOYOTA Yaris</p> <p>1KRFE TO 270600Q040 BO 0124225051 HC CA1889IR</p>	<p>ALB1894</p>  <p>ALB1894WA ARB0236 PAL0112</p>  <p>12v 90amp a:34 b:18 c:40.5</p> <p>TOYOTA Avensis Corolla</p> <p>3ZZFE ZER, ZZE E12J TO 270600D140 BO 0124325079 HC JA1894IR</p>	<p>ALB1907</p>  <p>ALB1907WA ALB807WA ARB0236 PAL0112</p>  <p>12v 100amp a:35 b:18 c:45</p> <p>TOYOTA Avensis 2.0L Avensis 2.4L</p> <p>1AZFS 2AZFSE TO 270600H070 BO 0124325085 HC CA1907IR</p>
<p>ALB1908</p>  <p>ALB1908WA ARB0885 PAL0407</p>  <p>12v 150amp a:32 b:70.5 c:56</p> <p>HYUNDAI, MERCEDES i30 C230, C280, C300, C350 CLC, CLK, CLS, SLK280 SLK350, Vito, Viano</p> <p>D4FB M272920, M272921 M272940, M272947 MB 2721540002 BO 0124525055 HC CA1908IR</p>	<p>ALB1909</p>  <p>ALB1909WA ALB909WA ARB0231</p> <p>12v 120amp a:69 b:33.5 c:57</p> <p>OPEL Zafira B 2.0 Astra H 2.0</p> <p>Z20LEH Z20LER OP 93199248 BO 0124425015 HC CA1909IR</p>	<p>ALB1912</p>  <p>ALB1912WA ALV1912WA ARB0261 PAL0400</p>  <p>12v 180amp a:39 b:14 c:61</p> <p>AUDI, SEAT, SKODA, VW A3, Exeo Superb Crafter, Passat</p> <p>CBAB, CBBB BMA, BMP, BLX BLY, BKP, AXZ VW 03G903023X BO 0124625028 HC CA1912IR</p>	<p>ALB1913</p>  <p>ALB1913WA ARB0225 PAL0400</p>  <p>12v 140amp b:14 c:80.5</p> <p>FIAT, IVECO Ducato, Massif 35C, 35S, 40C, 45C 50C, 60C, 65C</p> <p>F1CE0481D F1CE0441A F1CE0481F IV 504057813 BO 0124525064 HC CA1913IR</p>
<p>ALB1914</p>  <p>ALB1914WA ARB0086 PAL0212</p>  <p>12v 150amp a:42.5 b:21 c:45.5</p> <p>CITROEN, PEUGEOT C4, C5, C8, Jumpy 307, 407, 807 308, Expert</p> <p>EW7A EW10A PE 9649846780 BO 0124525063 HC CA1914IR</p>	<p>ALB1915</p>  <p>ALB1915WA ARB0225 PAL0400</p>  <p>12v 110amp b:14 c:82</p> <p>IVECO 35C15 35C18 35S18 40C15 40C15 45C15 50C15 60C15</p> <p>F1CE0481FA IV 504087183 BO 0124325122 HC CA1915IR</p>	<p>ALB1916</p>  <p>ALB1916WA ARB0226 PAL0474</p>  <p>12v 120amp a:33 b:79 c:56</p> <p>SAAB 40246 1.8 Turbo 40307 2.0 Turbo BioPower</p> <p>B207E B207L B205E SA 12757363 BO 0124425033 HC CA1916IR</p>	<p>ALB1917</p>  <p>ALB1917WA ARB0297 PAL0260</p>  <p>24v 80amp a:54 b:97 c:39</p> <p>BOVA, DAF, SOLARIS 122, 130, 131, 134 Cf, Sb, XF Vacanza</p> <p>MX300, MX340 MX375, MX265 XE280C, XE315C DA 1626130 BO 0124555018 HC CA1917IR</p>
























Alternators

Bosch

<p>ALB1918 <i>New</i></p> <p>ALB1918WA</p>  <p>ARB0321 PAL0453 </p> <p>12v 150amp a:32.5 b:14.5 c:60.5</p> <p>RENAULT Espace Scenic</p> <p>2.0L</p> <p>RE 8200474219 BO 0124525151 HC CA1918IR</p>	<p>ALB1919</p> <p>ALB1919WA</p>  <p>ARB0656 PAL0403 </p> <p>12v 150amp b:14 c:51.5</p> <p>FORD Galaxy Mondeo S-max</p> <p>FFWA, QYWA FFBA, KHBA QYBA FO 1420871 BO 0121615008 HC CA1919IR</p>	<p>ALB1922</p> <p>ALB1922RB ALB1922WA</p>  <p>ARB0026 PAL0400 </p> <p>12v 150amp a:41 b:93 c:74</p> <p>FORD, LAND ROVER Transit Defender</p> <p>H9FB, JKFA PHFA, PHFC SAFA FO 6C1T10300CB BO 0121615003 HC CA1922IR</p>	<p>ALB1923</p> <p>ALB1923WA</p>  <p>ARB0656 PAL0403 </p> <p>12v 150amp a:37.5 b:70 c:74</p> <p>FORD, VOLVO Galaxy Mondeo FlexFuel S-Max FlexFuel S80, V70</p> <p>B4204S4 B4204S3 VO 30667295 BO 0121615006 HC CA1923IR</p>
<p>ALB1928</p> <p>ALB1928RB ALB1928WA</p>  <p>ARB0026 PAL0400 </p> <p>12v 150amp a:42 b:93 c:74.5</p> <p>CITROEN, FIAT, FORD PEUGEOT Jumper, Ducato Transit Boxer</p> <p>22DTPUMA, 4HV P8FA, P8FB, QWFA PGFA, QVFA FO AC1T10300BB BO 0121615002 HC CA1928IR</p>	<p>ALB1930</p> <p>ALB1930WA</p>  <p>ARB0875 PAL0112 </p> <p>12v 90amp a:30.5 b:16.5 c:41</p> <p>TOYOTA Yaris 1.4</p> <p>1NDTV</p> <p>TO 270600N011 BO 0124225055 HC CA1930IR</p>	<p>ALB1939</p> <p>ALB1939WA</p>  <p>ARB0297 PAL0260 </p> <p>24v 110amp a:57 b:97 c:40.5</p> <p>BOVA, DAF, SOLARIS Various European Trucks CF Series, XF Series FA Vacanza</p> <p>MX300, MX340 MX265, MX375 XE280C DA 1649066 BO 0124655014 HC CA1939IR</p>	<p>ALB1940</p> <p>ALB1940WA</p>  <p>ARB0160 PAL0474 </p> <p>12v 100amp a:54 b:33.5 c:56.5</p> <p>OPEL Astra H 1.2 1.4 Corsa D 1.0 1.2</p> <p>Z12XEP Z14XEP OP 13222930 BO 0124325171 HC CA1940IR</p>
<p>ALB1944</p> <p>ALB1944WA</p>  <p>ARB0295 PAL0213 </p> <p>12v 150amp a:38 b:14.5 c:61.5</p> <p>RENAULT Grand Scénic Megane Scénic</p> <p>K4M761, K4J730 K4M782, K4M761 K4J730, K4M762 RE 8200327183 BO 0124525136 HC CA1944IR</p>	<p>ALB1960</p> <p>ALB1960WA</p>  <p>ARB0160 PAL0474 </p> <p>12v 120amp a:63 b:23 c:57.5</p> <p>OPEL, VAUXHALL Astra H, Vectra C Zafira B, Astra MK Signum Astravan Mk</p> <p>Z16XER Z16XEP Z18XER OP 6404271 BO 0124425050 HC CA1960IR</p>	<p>ALB1967</p> <p>ALB1967WA</p>  <p>ARB0656 PAL0403 </p> <p>12v 150amp a:33 b:33 c:91</p> <p>FORD VOLVO C30, C70 S40 V50</p> <p>D5244T8, B5244S B5244S4, B5254T7 B5254T7, B5254T3, D5244T8 FO 6M5T10300SA BO 0121615014 HC CA1967IR</p>	<p>ALB1968</p> <p>ALB1968WA ALB968WA</p>  <p>ARB0656 PAL0403 </p> <p>12v 150amp a:56.5 b:32 c:90</p> <p>Ford Mondeo IV 2.5 Ford S-Max 2.5 ST Volvo S80 II Volvo V70 Volvo XC60/70</p> <p>HUWA D5244T5 FO 30667118AB BO 0121615005 HC CA1968IR</p>

Alternators

Bosch

<p>ALB1970</p>  <p>ALB1970WA ARB0656 PAL0403 </p> <p>12v 150amp a:42 b:21 c:46</p> <p>FORD Galaxy S-Max</p> <p>AZWA QXWA QXWB FO 6G9N10300XB BO 0121615009 HC CA1970IR</p>	<p>ALB1973</p>  <p>ALB1973WA ALB973WA ARB0160 PAL0474 </p> <p>12v 120amp a:64 b:23 c:57</p> <p>OPEL Astra 1.6L Corsa 1.6L</p> <p>OP 6204218 BO 0124425060 HC CA1973IR</p>	<p>ALB1984</p>  <p>ALB1984WA ARB0313</p> <p>12v 150amp a:86 b:56</p> <p>JOHN DEERE 8000 Series 8120, 8220, 8320 8420, 8520 1994-></p> <p>6076 HRW35 JD RE185213 BO 0124615029 HC CA1984IR</p>	<p>ALB1985</p>  <p>ALB1985WA ARB0225 PAL0400 </p> <p>12v 140amp a:29 b:14.5 c:61</p> <p>AUDI, SEAT, VW Golf V Passat Tiguan Touran</p> <p>BMY, BLG CAVA, BLG BLF, CDGA VW 03C903023A BO 0124525093 HC CA1985IR</p>
<p>ALB1988</p>  <p>ALB1988WA ARB0587 PAL0210 </p> <p>12v 140amp a:44 b:20 c:82</p> <p>VOLVO S60 S80 V70 XC90</p> <p>B5254T4 B5234T7, B5244S6 B5244T5, B5254T2 VO 30658085 BO 0124525060 HC CA1988IR</p>	<p>ALB1994</p>  <p>ALB1994WA ARB0160 PAL0474 </p> <p>12v 140amp a:112.5 b:61</p> <p>OPEL, VAUXHALL Astra, Astravan Signum Vectra Zafira</p> <p>Z19DT Z19DTL Z19DTH OP 13229992 BO 0124425059 HC CA1994IR</p>	<p>ALB1997</p>  <p>ALB1997WA ARB0569 PAL0260 </p> <p>24v 120amp b:80</p> <p>MAN, NEOPLAN 18390 18310 10.5 18320 10.5 18350 10.5</p> <p>D2066LF04, D2066LF39 D2066LF14, D2066LF13 D2066LF35, D2066LF33 MA 51261017278 BO 0124655025 HC CA1997IR</p>	<p>ALB2000</p>  <p>ALB2000WA ARB0656 PAL0403 </p> <p>12v 150amp a:42.0 b:21 c:45.5</p> <p>FORD, VOLVO Mondeo S80 V70</p> <p>N7BA D4204T VO 30795169 BO 0121615028 HC CA2000IR</p>
<p>ALB2001</p>  <p>ALB2001WA ARB0656 PAL0403 </p> <p>12v 180amp a:61 b:32 c:92</p> <p>VOLVO V70 S80 XC70 XC60</p> <p>B5254T6, B5254T8 D5244T4 D5244T14 VO 36000038 BO 0121715008 HC CA2001IR</p>	<p>ALB2005</p>  <p>ALB005WA ALB2005WA ARB0160 PAL0474 </p> <p>12v 100amp a:112.5 b:61</p> <p>OPEL Insigna 2.0L</p> <p>A20DTH OP 13502583 BO 0124325221 HC CA2005IR</p>	<p>ALB2006</p>  <p>ALB2006WA ARB0666 PAL0212 </p> <p>12v 150amp a:25.5 b:80 c:50</p> <p>CITROEN, PEUGEOT C4, C5 Mini</p> <p>EP6DT EP6CDT N14B16C PE V755300980 BO 0121615012 HC CA2006IR</p>	<p>ALB2007</p>  <p>ALB2007WA ARB0197 PAL0407 </p> <p>12v 140amp a:27.5 b:70 c:57</p> <p>AUDI A4 A5 Q5</p> <p>CABA, CDHB, CAEA CABD CDNB, CDNC VW 06H903016L BO 0124525113 HC CA2007IR</p>










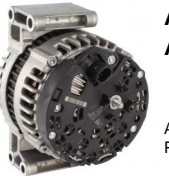





















Alternators

Bosch

<p>ALB2009</p>  <p>ALB2009WA ARB0881 PAL0407 </p> <p>12v 155amp a:29.5 b:63 c:41.5</p> <p>BMW 630 Z4</p> <p>N52B30A N52B25A</p> <p>BM 12317543083 BO 0124525083 HC CA2009IR</p>	<p>ALB2011 <i>New</i></p>  <p>ARB0197 PAL0407 </p> <p>12v 140amp a:38.5 b:14.5 c:61.5</p> <p>AUDI A1,A3,Q3,TT SEAT Ibiza,Leon VOLKSWAGEN Tiguan,Touareg Scipocco,Polo,Jetta SKODA Yeti,Fabia</p> <p>CFHC,CAYB,CAYC,CLN SMART BKD,CBDB,CFHC,CGG City CFGC,CAYA,CAYC,CFG Fortwo</p> <p>VW 03L903023A BO 0124525187 HC CA2011IR</p>	<p>ALB2024</p>  <p>ALB2024WA ARB0536 PAL0400 </p> <p>12v 85amp a:90.0 b:58</p> <p>OM660940</p> <p>MB A6601540902 BO 0124225020 HC CA2024IR</p>	<p>ALB2032</p>  <p>ALB2032RB ALB2032WA ARB0637 PAL0407 </p> <p>12v 180amp a:31.5 b:94 c:56.5</p> <p>MERCEDES-BENZ C200 C220 E200 E220</p> <p>OM646811, OM646820 OM646811 OM646821 MB A0131549002 BO 0121715029 HC CA2032IR</p>
<p>ALB2048</p>  <p>ALB2048WA ARB0362</p> <p>24v 55amp a:42 b:13.5 c:67.5</p> <p>BO 0120488316 MH ALB2048</p>	<p>ALB2065 <i>New</i></p>  <p>ARB0225 PAL0400 </p> <p>12v 110amp a:39 b:14 c:61</p> <p>SEAT Cordoba 2005-2009 1.5L, 1.9L SEAT Ibiza 2005-2010 BLS, BNM, BNV SKODA Fabia 2007- BMS, BSW, BWB SKODA Roomster 2006-2010 VW 045903023H VW Polo 2005-2009 BO 0124325142 HC CA2065IR</p>	<p>ALB2150 <i>New</i></p>  <p>ARB0255 PAL0231 </p> <p>12v 140amp a:50 b:32 c:60</p> <p>AUDI SKODA VOLKSWAGEN</p> <p>AFN,AVB AVG,BGW BPZ,AVF VW 028903029Q BO 0124525021 MH ALB2150</p>	<p>ALB2170</p>  <p>ALB2170WA ARB0369</p> <p>24v 50amp b:51</p> <p>KOMATSU, CASE Fork Lift 400, 800, 1000 series</p> <p>CU 3284392 BO 0120488206 CG 112170</p>
<p>ALB2212</p>  <p>12v 140amp a:29 b:13 c:62</p> <p>VOLKSWAGEN</p> <p>VW 04C903023L BO F000BL08F2</p>	<p>ALB2246</p>  <p>ALB2246WA</p> <p>12v 220amp a:41 b:33</p> <p>MERCEDES-BENZ CL Class 5.8L S Class 5.8L</p> <p>M 276.957 M 276.952 M 276.820 MB A1371500350 BO 0122468006 MH ALB2246</p>	<p>ALB2302</p>  <p>ALB2302WA ARB0386</p> <p>24v 120amp a:72 b:16 c:86</p> <p>IVECO EuroCargo EuroTech 300</p> <p>836046417 IV 4775918 BO 0120689538 CG 112302</p>	<p>ALB2690</p>  <p>ARB0261 PAL0406 </p> <p>12v 70amp a:64 b:53</p> <p>AUDI A4, AUDI A6 VW PASSAT</p> <p>AFN AJM ATJ VW 02690301546 BO 0124315018</p>













Alternators

Bosch

ALB2773	ALB3006	ALB3007	ALB3009
  <p>ALB2773WA ARB0352</p>	  <p>ALB3006WA ARB0615 PAL0450</p> 	  <p>ALB3007WA ARB0247 PAL0400</p> 	  <p>ALB3009RB ALB3009WA ARB0623 PAL0414</p> 
<p>12v 135amp b:14.5 c:100</p> <p>CASE JOHN DEERE NEW HOLLAND CUMMINS</p> <p>6CT, 6CTA CA 125849A1R BO 0120468055 CG 112773</p>	<p>12v 136amp a:42 b:14 c:67</p> <p>CHRYSLER DODGE Ram Pickup 5.7L</p> <p>CH 56028699AA BO 0124525006 MH ALB3006</p>	<p>12v 180amp a:82 b:56</p> <p>MERCEDES-BENZ ML500, G55 CL55, SL55 CLS55, R500</p> <p>AMG MB A0121548902 BO 0124625007 MH ALB3007</p>	<p>12v 180amp b:77 b:40</p> <p>FORD, VOLVO S-Max, Galaxy XC700, XC60, XC90 V60, S80, S60, V70 LANDROVER LR2(same eng)</p> <p>T6 VO 36000209 BO 0121715009 MH ALB3009</p>
ALB3010	ALB3014	ALB3015	ALB3016
  <p>ALB3010WA ARB0297 PAL0260</p> 	  <p>ALB3014WA ARB0637 PAL0415</p> 	  <p>ALB3015WA ARB0637 PAL0415</p> 	  <p>ALB3016WA ARB0624 PAL0414</p> 
<p>24v 70amp a:45 b:14 c:80</p> <p>IVECO Trucks Cristalis, Europolis Various Models</p> <p>IV 504013371 BO 0124555010 MH ALB3010</p>	<p>12v 180amp a:32 b:70 c:57</p> <p>MERCEDES-BENZ C-Class E-Class R-Class S-Class</p> <p>M272943 M273961 MB A0131545602 BO 0121715014 MH ALB3014</p>	<p>12v 180amp a:30 b:70 c:56</p> <p>MERCEDES-BENZ E-Class 280 CDI E-Class 320 CDI</p> <p>W211 MB A0131547002 BO 0121715015 MH ALB3015</p>	<p>12v 180amp a:25 b:63 c:43</p> <p>BMW 135 Series 3.0L 335 Series 3.0L 535 Series 3.0L</p> <p>BM 12317557789 BO 0121715016 MH ALB3016</p>
ALB3021	ALB3024	ALB3029	ALB3030
  <p>ALB3021WA ARB0656 PAL0415</p> 	<p>ALB3024 <i>New</i> ARB0701</p>	  <p>ALB3029WA ARB0313</p>	  <p>ALB3030WA ARB0225 PAL0400</p> 
<p>12v 150amp a:43 b:21 c:48</p> <p>FORD Mondeo 2.0L Mondeo 2.2L LANDROVER Freelander 2.2L</p> <p>2.0 DTCi 2.2 DTCi FO 1435647 BO 0121615021 MH ALB3021</p>	<p>VOLKSWAGEN POLO 1.4i POLO 1.6i</p> <p>CLPA CDDA CGGB VW 03C903024E BO F000BL0618 MH ALB3024</p>	<p>12v 200amp a:85 b:56</p> <p>JOHN DEERE Cotton Pickers Scrapers Tractors</p> <p>JD SE501834 BO 0124625029 MH ALB3029</p>	<p>12v 150amp a:124 b:80</p> <p>MERCEDES-BENZ CLAAS</p> <p>MB 0131542602 BO 0124615030 MH ALB3030</p>



Alternators

Bosch

<p>ALB3041</p>  <p>ALB3041WA ARB0231</p> <p>12v 120amp a:29 b:80 c:56</p> <p>ALFA ROMEO D56 Alfa 159 Alfa Brera Alfa Spider</p> <p>FO 60964260 BO 0124425041 MH ALB3041</p>	<p>ALB3042</p>  <p>ALB3042WA ARB0225 PAL0400</p> <p>12v 120amp a:41 b:14 c:82</p> <p>PORSCHE 911 Boxster</p> <p>PO 99660301205 BO 0124515042 MH ALB3042</p>	<p>ALB3049</p>  <p>ALB3049WA ARB0696 PAL0243</p> <p>12v 125amp a:51 b:57</p> <p>CHEVROLET V6 Impala 3.9L Monte Carlo 3.9L</p> <p>GM 15233597 BO 0124425049 WA 11236N</p>	<p>ALB3050</p>  <p>ALB3050WA ARB0044 PAL0415</p> <p>12v 180amp a:27 b:70 c:58</p> <p>AUDI AUK A8 BDW VW</p> <p>VW 06E903016T BO 0121715050 MH ALB3050</p>
<p>ALB3056</p>  <p>ALB3056WA ARB0225 PAL0400</p> <p>12v 150amp a:35 b:14 c:82</p> <p>PORSCHE 911 Series Carrera GT 5.7L Cayman 3.4L</p> <p>PO 99760301208 BO 0124525056 MH ALB3056</p>	<p>ALB3059</p>  <p>ALB3059WA ARB0225 PAL0400</p> <p>12v 120amp</p> <p>PORSCHE 911 Series Boxter 2.7L, 3.2L Cayman 3.4L</p> <p>PC 99760301201 BO 0124525057 WD ALT10561</p>	<p>ALB3072</p>  <p>ALB3072WA ARB0696 PAL0243</p> <p>12v 150amp a:70 b:57</p> <p>CADILLAC Escalade GMC, CHEVROLET Avalanche, Silverado Suburban, Tahoe Sierra, Yukon, Yukon XL</p> <p>GM 15200269 BO 0124525072 WA 11075N</p>	<p>ALB3074</p>  <p>ALB3074WA ARB5795</p> <p>12v 130amp a:84 b:56</p> <p>LAND ROVER Discovery 4.0L, 4.6L</p> <p>BO 0123510073 WA 13812N</p>
<p>ALB3102 <i>New</i></p>  <p>ARB0822 PAL0414</p> <p>12v 220amp a:30 b:70 c:60</p> <p>MERCEDES-BENZ S-Class</p> <p>MO642.862 M275.982</p> <p>ME A0131540602 BO 0121813102</p>	<p>ALB3105</p>  <p>ARB0822 PAL0407</p> <p>12v 220amp a:44 b:90 c:52</p> <p>MERCEDES-BENZ GL-CLASS (X164) GL420/GL450 06 M-CLASS (W164) ML420/ML450 06</p> <p>OM629.912 ME A6291500450 BO 0986047810</p>	<p>ALB3120 <i>New</i></p>  <p>ARB0822 PAL0414</p> <p>12v 220amp a:35 b:69 c:58</p> <p>MERCEDES-BENZ E-Class M-Class R-Class S-Class</p> <p>OM642.850 OM642.820 OM642.832 ME A0141541302 BO 0121813120</p>	<p>ALB3122</p>  <p>ARB0656 PAL0416</p> <p>12v 150amp a:41 b:21 c:47</p> <p>FORD, LAND ROVER Galaxy Mondeo S-Max Freelander</p> <p>FO 6G9N10300ADA BO 0121615121 MH ALB3122</p>

Alternators

Bosch

<p>ALB3150</p>  <p>ALB3150WA ARB0082 PAL0407 </p> <p>12v 220amp a:44 b:90 c:52</p> <p>MERCEDES-BENZ E-class 4.0L S-class 4.0L</p> <p>W211 W221</p> <p>MB A6291500050 BO 0121813004 MH ALB3150</p>	<p>ALB3154</p>  <p>ALB3154WA ARB0387</p> <p>12v 110amp a:87 b:56</p> <p>SAAB 9000</p> <p>B204E B308I B234L SA 4734026 BO 0123505017 CG 113154</p>	<p>ALB3170</p>  <p>ALB3170WA ARB0809</p> <p>12v 90amp a:30 b:70 c:59</p> <p>MERCEDES-BENZ Sprinter 3t - 5t</p> <p>OM646984 OM646985 OM646986 MB A6461540002 BO 0124325170 MH ALB3170</p>	<p>ALB3175</p>  <p>ALB3175WA PAL0407 </p> <p>12v 180amp a:43 b:21</p> <p>ROLS ROYSE BMW 7, 735, 745, 760 Phantom 6.75</p> <p>BM 12317523606 BO 01220AA160 MH ALB3175</p>
<p>ALB3186</p>  <p>ALB3186WA ARB0362</p> <p>24v 55amp b:14 c:83</p> <p>VOLVO FLC Series</p> <p>D4A140</p> <p>VO 3976608 BO 0120469032 CG 113186</p>	<p>ALB3187</p>  <p>ALB3187WA ARB0352</p> <p>12v 85amp a:40 b:17 c:70</p> <p>FIAT CITROEN LANCIA FERRARI</p> <p>154A048 154C6000 F106D, F120A FI 63307410 BO 0120484009 CG 113187</p>	<p>ALB3192</p>  <p>ALB3192WA ARB0225</p> <p>12v 110amp a:89 b:14 c:61</p> <p>AUDI, SKODA, VW AMAROK 2.0 2010-> TRANSPORTER V 2.0</p> <p>VW 06F903023L BO 0124325190 MH ALB3192</p>	<p>ALB3198</p>  <p>ALB3198WA ARB0260</p> <p>12v 160amp b:14 c:101</p> <p>CUMMINS FORD VOLVO INTERNATIONAL Trucks Various</p> <p>Cummins CU 3972732 BO 0124525085 CG 113198</p>
<p>ALB3225 <i>Old</i></p>  <p>ALB3225WA IB390</p> <p>12v 30amp</p> <p>VW 1500, 1600 Kaefer 180</p> <p>AG D, H, F, K AD VW 113903031G BO 0101302067 CG 111225</p>	<p>ALB3319</p>  <p>ALB3319WA ARB0511</p> <p>12v 150amp</p> <p>AUDI A6 A8 S8</p> <p>VW 038903018GV BO 0123520019 MH ALB3319</p>	<p>ALB3352</p>  <p>ALB3352WA ARB5795</p> <p>12v 150amp a:84 b:56</p> <p>LANDROVER Range Rover 4.0L Range Rover 4.6L</p> <p>RO ERR5834 BO 0123520022 WA 13813N</p>	<p>ALB3423</p>  <p>ALB3423RB ALB3423WA ARB0379 PAL0415 </p> <p>12v 180amp a:35 b:70 c:58</p> <p>MERCEDES-BENZ Sprinter 2500 Sprinter 3500 ML350 R350 4Matic</p> <p>V6 MB A2721540102 BO 0124625023 WA 11217N</p>



Alternators

Bosch

ALB3425	ALB3525	ALB3569	ALB3589 New
  <p>ALB3425WA ARB0701</p>	  <p>ALB3525WA ARB0915 PAL0450</p> 	  <p>ALB3569WA ARB0915 PAL0450</p> 	  <p>ALB3589 ARB0385</p>
<p>12v 110amp a:30 b:14 c:63</p> <p>VW Touareg, Touran Golf, Jetta Passat, Tiguan Scirocco, Polo</p> <p>VW 03C903024E BO F00BL0618 MH ALB3425</p>	<p>12v 132amp a:27 b:17 c:67</p> <p>JEEP Grand Cherokee 4.0L L6</p> <p>CH 56041322AB BO 0124525003 WA 13872N</p>	<p>12v 136amp a:24 b:13 c:68</p> <p>DODGE, JEEP Dakota Durango Grand Cherokee</p> <p>4.0I 4.7I</p> <p>CH 56041322 BO 0124525002 CG 113569</p>	<p>12v 120amp a:60 b:34 c:56</p> <p>SAAB 9-3 2.2 1998-2002</p> <p>D223L X22DTH</p> <p>SC 4665881 BO 0123510089 MH ALB3589</p>
ALB3615	ALB3616	ALB3626	ALB3707
  <p>ALB3615WA ARB0026 PAL0400</p> 	  <p>ALB3616WA ARB0656 PAL0416</p> 	  <p>ALB3626WA ARB0248</p>	  <p>ALB3707WA ARB0313</p>
<p>12v 150amp a:126 b:99 c:77</p> <p>FORD, VW Transit 2.3L</p> <p>FO 6C1T10300AB BO 0121615001 MH ALB3615</p>	<p>12v 140amp a:137 b:99</p> <p>FORD AUDI A6 Quatro 3.0L A8 Quatro 3.0L</p> <p>FO 6G9N10300DA BO 0121615007 MH ALB3616</p>	<p>12v 200amp a:93 b:70 c:60</p> <p>DODGE Sprinter Van 2.7L</p> <p>MB A0131541102 BO 0124625020 WA 12385N</p>	<p>12v 200amp b:56</p> <p>JOHN DEERE 7000 Series</p> <p>JD AL170947 BO 0124625031 CG 113707</p>
ALB3715	ALB3716	ALB3717	ALB3756
  <p>ALB002WA ALB3715WA ARB0656 PAL0416</p> 	  <p>ALB3716WA ARB0391 PAL0275</p> 	  <p>ALB3717WA ALB650WA ARB0637 PAL0415</p> 	  <p>ALB3756WA ARB0656 PAL0416</p> 
<p>12v 170amp a:117 b:107 c:89</p> <p>VOLVO S80 XC90</p> <p>VO 8603898 BO 0121715002 MH ALB3715</p>	<p>12v 90amp b:51</p> <p>THERMO KING Various Models YANMAR 400 Series</p> <p>TK486</p> <p>BO 0120484038 CG 113716</p>	<p>12v 180amp a:29 b:69 c:57</p> <p>MERCEDES-BENZ E350 ML350 S350 ML500</p> <p>MB A2721540802 BO 0121715006 MH ALB3717</p>	<p>12v 180amp a:52 b:15 c:48</p> <p>FORD VOLVO S80 2.0L V70 2.0L Freelander 2.2L</p> <p>FO 6G9N10300YC BO 0121715024 MH ALB3756</p>

Alternators

Bosch

<p>ALB3805 <i>New</i></p>  <p>12v 140amp a:25 b:14 c:60</p> <p>AUDI SEAT SKODA VW</p> <p>1.2L, 1.4L CPTA, CJZA, CMBA CXSA, CJZB, CHPA VW 04E903023J BO F000BL0805 MH ALB3805</p>	<p>ALB3807</p>  <p>ALB3807WA ARB0260</p> <p>12v 160amp b:14 c:103</p> <p>US TRUCKS CASE INTERNATIONAL MACK FREIGHTLINER</p> <p>OM611960 OM611980 OM611A, OM611LA BO 0124525085 CG 113807</p>	<p>ALB3813</p>  <p>ALB3813WA ARB0822 PAL0414 BSS NC</p> <p>12v 220amp a:30 b:71 c:53</p> <p>MERCEDES-BENZ S350 S450 S500 Sprinter</p> <p>M272.965 M273.922 M272.979 MB A0131540502 BO 0121813001 MH ALB3813</p>	<p>ALB3814</p>  <p>ALB3814WA ARB0822 PAL0414 BSS NC</p> <p>12v 220amp a:36 c:56</p> <p>MERCEDES-BENZ GL Class 3.0L Diesel ML Class 3.0L Diesel R Class 3.0L Diesel</p> <p>BO 0121813003 MH ALB3814</p>
<p>ALB3815</p>  <p>ALB3815WA ARB0822 PAL0414 BSS NC</p> <p>12v 220amp a:36 b:70 c:56</p> <p>MERCEDES-BENZ E - class S350 S450 S500</p> <p>MB 0131545502 BO 0121813006 MH ALB3815</p>	<p>ALB3878 <i>New</i></p>  <p>ALB3878WA ARB0321 PAL0453 2 1 COM</p> <p>12v 120amp a:32.5 b:14 c:61</p> <p>RENAULT Clio Modus</p> <p>RE 8200660043 BO 0124425039 HC CA1878IR</p>	<p>ALB3903 <i>New</i></p>  <p>12v 140amp a:28 b:70 c:58</p> <p>AUDI A3 1.8L, 2.0L 2012- SCODA Octavia 1.8L 2012-</p> <p>CJSA, CJSB CJXB, CJXC VW 06J903023G BO F000BL0803 MH ALB3903</p>	<p>ALB3940</p>  <p>ARB0391</p> <p>12v 85amp a:73 b:50</p> <p>HOLDEN TOYOTA</p> <p>HO 92032637 BO 0120484039</p>
<p>ALB4019</p>  <p>ALB4019WA ARB0261 PAL0400 L DFM</p> <p>12v 110amp a:39 b:14 c:61</p> <p>LDV Maxus 2.5L GAZ Maxus</p> <p>VM39C VM40C VM 38522319F BO 0124325178 CG 114019</p>	<p>ALB4034 <i>New</i></p>  <p>ALB4034WA</p> <p>12v 85amp a:38 b:13 c:66.5</p> <p>HOLDEN</p>	<p>ALB4036</p>  <p>ALB4036WA ARB0297 PAL0260 W 15DFM L S</p> <p>24v 100amp a:37 b:14 c:80</p> <p>DAF CF65 LF45 LF55</p> <p>CE136C, CE162C, CE1840 GR220 BE110C, BE123C DA 1387388 BO 0124555006 CG 114036</p>	<p>ALB4040</p>  <p>ARB0362</p> <p>24v 55amp a:79 b:51</p> <p>UNIVERSAL</p> <p>BO 0120484040 UP ALT2123</p>





















Alternators

Bosch

<p>ALB4041 <i>New</i></p> <p>ALB4041WA</p>  <p>ARB0391 PAL0275</p>  <p>S L</p> <p>12v 85amp a:38 b:13 c:67</p> <p>FORD</p> <p>BO 0120484042</p>	<p>ALB4076</p> <p>ALB4076WA</p>  <p>ARB0174 PAL0474</p>  <p>DFM L</p> <p>12v 120amp a:32 b:79 c:56</p> <p>OPEL Zafira</p> <p>Z22YH</p> <p>OP 13156055 BO 0124425026 CG 114076</p>	<p>ALB4125</p>  <p>12v 55amp a:35 b:10 c:90</p> <p>FORD RENAUT ROVER MG AUSTIN</p> <p>NWR, EX, 4AB 810.05, 807.10 844.12, BB FO 79BB10300AC BO 0120488210 AU GEU 2256</p>	<p>ALB4212</p>  <p>ALB020WA ALB4212WA</p> <p>ARB0297 PAL0260</p>  <p>W 15DFM L S</p> <p>24v 80amp b:17.5 c:54.5</p> <p>Volvo FH 12/340 Renault V.I. 500.26 500.26 520.25</p> <p>DXi13 D12D340 D12D420 VO 11170134 BO 0124555020 CG 114212</p>
<p>ALB4315 <i>New</i></p> <p>ALB4315WA</p>  <p>ARB0236 PAL0112</p>  <p>S4 I1 M L IG L</p> <p>12v 80amp a:53 c:42</p> <p>LEXUS ES 3.0I TOYOTA Camry 3.0I</p> <p>1MZFE</p> <p>TO 2706020230 BO 0124315015</p>	<p>ALB4351</p> <p>ALB4351WA</p>  <p>ARB0677</p> <p>12v 200amp b:14 c:101.2</p> <p>MACK VOLVO FREIGHTLINER PETERBILT Medium&Heavy Duty Trucks</p> <p>Cummins Mack Engines Caterpillar NH 87645567 BO 0124625044 CG 114351</p>	<p>ALB4565</p>  <p>12v 120amp b:51</p> <p>TERMOKING</p> <p>BO 0120484028 CG 114565</p>	<p>ALB4625</p> <p>ALB4625WA</p>  <p>ARB0293 PAL0417</p>  <p>BSS FR</p> <p>12v 200amp a:39 b:73 c:56</p> <p>MERCEDES-BENZ E400 4.0L G400 4.0L ML400 4.0L S400 4.0L</p> <p>MB A6281540102 BO 0124625017 MH ALB4625</p>
<p>ALB4775 <i>New</i></p>  <p>12v 70amp a:51 b:26 c:43</p> <p>TOYOTA</p> <p>TO 27060YA030 BO 9120061105 MH ALB4775</p>	<p>ALB5001 <i>New</i></p> <p>ARB0385</p> <p>12v 50amp</p> <p>BMW Motorcycles</p> <p>BM 12312306020 BO 0123105001 MH ALB5001</p>	<p>ALB5013 <i>New</i></p>  <p>ARB0257</p> <p>12v 140amp a:60 b:33 c:112</p> <p>OPEL Omega B</p> <p>Y26SE Y32SE</p> <p>OP 24436554 BO 0124525013 MH ALB5013</p>	<p>ALB5018 <i>New</i></p> <p>ALB5018WA</p>  <p>ARB0915 PAL0450</p>  <p>F1 F2</p> <p>12v 150amp a:40 b:70 c:56</p> <p>CHRYSLER PT CRUISER</p> <p>EDJ</p> <p>CH 05080464AB BO 0124615018 CG 114663</p>



Alternators

Bosch

<p>ALB5019</p>  <p>ARB0257</p> <p>12v 140amp a:60 b:33.5 c:56.5</p> <p>SAAB 9-5 3.0 TiD 01.2001-12.2007</p> <p>D308L</p> <p>SB 5350087 BO 0124525019 LU LRA02896</p>	<p>ALB5021</p>  <p>ALB5021WA</p> <p>ARB0121 PAL0260</p>  <p>24v: 120amp a:57 b:13 c:102</p> <p>VOLVO Heavy Duty Trucks FH, FM Series</p> <p>VO 20741686 BO 0124655021 WA 23868N</p>	<p>ALB5022 <i>New</i></p>  <p>ARB0642 PAL0407</p>  <p>12v 180amp a:26 b:70 c:57</p> <p>AUDI A6</p> <p>BDW, BDY BYU AUK VW 06E903016M BO 0121715022 MH ALB5022</p>	<p>ALB5025 <i>New</i></p>  <p>ARB0587 PAL0210</p>  <p>12v 160amp a:54 b:20 c:80</p> <p>VOLVO S 80 CX 90</p> <p>B6294S2 B6294T</p> <p>VO 30667893 BO 0124625025</p>
<p>ALB5030 <i>New</i></p>  <p>ALB5030WA</p> <p>ARB0545 PAL0232</p>  <p>12v 120amp a:80 b:25 c:76</p> <p>BM 12311407440 BO 0123515030 MH ALB5030</p>	<p>ALB5031 <i>New</i></p>  <p>ALB5031RB</p> <p>ARB0385</p> <p>12v 120amp a:56 b:13 c:82</p> <p>IVECO</p> <p>IV 500369176 BO 0123515031 MH ALB5031</p>	<p>ALB5032 <i>New</i></p>  <p>ARB0656 PAL0416</p>  <p>12v 180amp a:32 b:71 c:95</p> <p>VOLVO S80 XC90</p> <p>4.4L</p> <p>VO 30795210 BO 0121715032 MH ALB5032</p>	<p>ALB5033 <i>New</i></p>  <p>ARB0241 PAL0280</p>  <p>12v 105amp a:48 b:56 c:71</p> <p>PONTIAC LA1</p> <p>PO 22708250 BO 0124415033 GM 22708250</p>
<p>ALB5034 <i>New</i></p>  <p>ARB0656 PAL0416</p>  <p>12v 180amp a:57 b:39 c:62</p> <p>LANDROVER Freelander RANGE ROVER Evogue</p> <p>204PT</p> <p>RO BJ3210300CB BO 0125811034 MH ALB5034</p>	<p>ALB5036</p>  <p>ARB0231</p> <p>12v 120amp a:39 b:72 c:56</p> <p>FIAT Croma 2.2</p> <p>MA 944390480500</p> <p>FI 51734824 BO 0124425036</p>	<p>ALB5042 <i>New</i></p>  <p>ARB0225 PAL0400</p>  <p>12v 90amp a:40 b:13 c:62</p> <p>JOHN DEERE</p> <p>JD RE509648 BO 0124315042 MH ALB5042</p>	<p>ALB5045 <i>New</i></p>  <p>ARB0231</p> <p>12v 140amp a:60 b:32 c:56</p> <p>SAAB 9-5 3.0l 1998-</p> <p>B308E</p> <p>SA 5248794 BO 0124525018</p>

Alternators

Bosch

<p>ALB5046</p>  <p>ARB0231</p> <p>12v 140amp a:67 b:19 c:45</p> <p>OPEL Signum Vectra</p> <p>Y30DT Z30DT OP 93175988 BO 0124525046</p>	<p>ALB5056 <i>New</i></p>  <p>ALB5056WA</p> <p>F00M145 890.0453</p>  <p>12v 85amp a:53 b:27 c:66</p> <p>RENAULT TWINGO 1.2l 2007-</p> <p>D7F800 D4F764 D4F772 RE 8200519296 BO 0124225056 HC CA2066IR</p>	<p>ALB5057 <i>New</i></p>  <p>ARB0160 PAL0474</p>  <p>12v 120amp a:62 b:32 c:56</p> <p>OPEL Astra Corsa Meriva Combo</p> <p>Z14XEP A10XEP Z12XEP OP 13222931 BO 0124425057</p>	<p>ALB5058</p>  <p>12v 200amp b:55</p> <p>NEW HOLLAND L185, C185</p> <p>IV 50429006 BO 0124625058</p>
<p>ALB5061 <i>New</i></p>  <p>ARB0297 PAL0260</p>  <p>24v 70amp a:35 b:13 c:80</p> <p>CUMMINS</p> <p>CU 5259577 BO 0124555061</p>	<p>ALB5071 <i>New</i></p>  <p>ALB5071RB ALB5071WA</p> <p>ARB0044 PAL0415</p>  <p>12v 180amp a:39 b:14 c:61</p> <p>SEAT SKODA VOLKSWAGEN</p> <p>BO 0121715071 MH ALB5071</p>	<p>ALB5078 <i>New</i></p>  <p>ARB0635 PAL0212</p>  <p>12v 150amp a:23 b:13 c:55</p> <p>MINI Cooper Clubman Countryman</p> <p>N16B16A, N12B16A N18B16A, N14B16A N14B16C BM 12317604782 BO 0125711078 MH ALB5078</p>	<p>ALB5080 <i>New</i></p>  <p>ALB5080WA</p> <p>ARB0044 PAL0415</p>  <p>12v 180amp a:29 b:14 c:62</p> <p>AUDI Q7</p> <p>VW 059903018K BO 0121715080 MH ALB5080</p>
<p>ALB5082 <i>New</i></p>  <p>ARB0297 PAL0260</p>  <p>24v 90amp a:35 b:14 c:82</p> <p>CUMMINS</p> <p>CU 5259578 BO 0124655082 MH ALB5082</p>	<p>ALB5087 <i>New</i></p>  <p>ARB0160 PAL0474</p>  <p>12v a:55 b:33 c:60</p> <p>OPEL Corsa 1.4l Meriva 1.4l</p> <p>A14XER A14XEL A14NEL OP 1202195 BO 0124425087 MH ALB5087</p>	<p>ALB5089 <i>New</i></p>  <p>ALB5089WA</p> <p>ARB0427</p> <p>12v 90amp a:101 b:56</p> <p>BO 0124325089 MH ALB5089</p>	<p>ALB5091</p>  <p>ARB0297 PAL0260</p>  <p>24v 90amp a:40 b:13 c:83</p> <p>MITSUBISHI Canter</p> <p>4P10T4</p> <p>MI MK667723 BO 0124655091</p>




















Alternators

Bosch

<p>ALB5097 <i>New</i></p>  <p>ARB0703 PAL0260 </p> <p>24v 100amp b:80</p> <p>MERCEDES-BENZ Vario 4.2 Vario 4.3</p> <p>OM904964 OM904923 OM904908 ME A0141545402 BO 0124655097 MH ALB5097</p>	<p>ALB5098</p>  <p>ARB0225 PAL0400 </p> <p>12v 90amp a:115 b:80</p> <p>MERCEDES-BENZ</p> <p>MB A3761540302 BO 0124325098 NR 02325098</p>	<p>ALB5107 <i>New</i></p>  <p>ARB0637 PAL0415 </p> <p>12v 180amp a:24 b:70 c:58</p> <p>MERCEDES-BENZ C-Class E-Class CLK</p> <p>M156980, M156981 M156982, M156982 M156985 MZ A1561540102 BO 0121715107 MH ALB5107</p>	<p>ALB5108 <i>New</i></p>  <p>ARB0656 PAL0416 </p> <p>12v 150amp b:14 c:52</p> <p>FORD Galaxy Mondeo S-Max</p> <p>FFBA FFWA QYWA FO 6G9N10300UA BO 0121615108 WA 23979N</p>
<p>ALB5110 <i>New</i></p>  <p>ARB0632 PAL0407 </p> <p>12v 150amp a:39 b:63 c:41</p> <p>BMW 1,3,5,6 X1, X3</p> <p>2.5I 3.0I</p> <p>BM 12317550967 BO 0121615110 MH ALB5110</p>	<p>ALB5114 <i>New</i></p>  <p>ARB0656 PAL0416 </p> <p>12V 150amp a:75 b:33 c:55</p> <p>FORD kuga</p> <p>VOLVO C30, C 70, S 40</p> <p>D5204T B5244S5 HYDB FO 1541451 BO 0121615114 MH ALB5114</p>	<p>ALB5118 <i>New</i></p>  <p>ARB0024 PAL0414 </p> <p>12v 183amp a:29 b:62 c:44</p> <p>BMW X5</p> <p>N52B30 N52B30A</p> <p>BM 12317560985 BO 0121715118 LU LRA03487</p>	<p>ALB5122 <i>New</i></p>  <p>ARB0261 PAL0400 </p> <p>12v 120amp a:110 b:79</p> <p>VW</p> <p>VW 2T0903015 BO 0124515122 MH ALB5122</p>
<p>ALB5127 <i>New</i></p>  <p>ARB0666 PAL0212 </p> <p>12v 150amp a:22 b:79 c:50</p> <p>BMW MINI PEGEOT CITROEN</p> <p>EP6C EP6DTS EP6C BM 12317574365 BO 0121615127 PE V755300980</p>	<p>ALB5130 <i>New</i></p>  <p>ARB0225 PAL0400 </p> <p>12v 150amp a:52 b:13 c:80</p> <p>FIAT Ducato 15 2.3 JTD 2006-></p> <p>F1AE3481D F1AE0481D F1AE0481N IV 504204172 BO 0124525130 MH ALB5130</p>	<p>ALB5139</p>  <p>ARB0225 PAL0400 </p> <p>12v 75amp a:40 b:14 c:62</p> <p>VOLKSWAGEN GOLF III 2.0 (1H1) 11.91-08.97</p> <p>2E 97BA, ADY AGG, AKR</p> <p>BO 0124225040</p>	<p>ALB5147 <i>New</i></p>  <p>ARB0677</p> <p>12v 150amp a:80 b:56</p> <p>VALTRA N SERIES VALTRA T SERIES</p> <p>SIS V836673344 BO 0124525147 VAL 836673344</p>














Alternators

Bosch

<p>ALB5176 <i>New</i></p> <p>ALB5176WA</p>  <p>ARB0044 PAL0415</p>  <p>12v 180amp a:28 b:14 c:61</p> <p>AUDI A4 A6 Q7</p> <p>4F2, 4F5, 4FH C6, B8 8K2, 8K5 VW 059903018E BO 0121715176 MH ALB5176</p>	<p>ALB5188</p>  <p>12v 140amp a:30 b:15 c:62</p> <p>AUDI A1 A3 VOLKSWAGEN Golf Plus Passat</p> <p>CAXA,BWK,CNVA CAVA,CTHA,CNWB CAVD,CTHA,CTHD VW 03C903023SX BO 0124525188</p>	<p>ALB5303 <i>New</i></p>  <p>ARB0334</p> <p>12v 200amp a:40 b:54 c:56</p> <p>MERCEDES-BENZ</p> <p>OM646.820 OM646.821</p> <p>ME A0131545902 BO 0124625033 MH ALB5303</p>	<p>ALB5312</p>  <p>12v 120amp a:82 b:56 c:34</p> <p>HOLDEN COMMODORE Pick-up CHEVROLET CAPRICE Stufenheck</p> <p>BO 0986AN0512</p>
<p>ALB5526 <i>New</i></p> <p>ALB5526WA</p>  <p>ARB5220 PAL0212</p>  <p>12v 145amp a:40 b:20 c:46</p> <p>MINI One D 2009-2010 Cooper D 2007- MINI CLUBMAN Cooper D 2007-</p> <p>9HZ DV6TED4 1.6 L BM 12317794970 BO 0124525126 WA 20004N</p>	<p>ALB5543 <i>New</i></p>  <p>PAL0433</p>  <p>12v 115amp a:90 b:56 c:62</p> <p>MERCEDES-BENZ SSANGYONG</p> <p>G23D</p> <p>SS 1621543602 ME A0002655043 MH ALB5543</p>	<p>ALB5544 <i>New</i></p> <p>ALB5544WA</p>  <p>ARB0197 PAL0415</p>  <p>12v 140amp a:29 b:14 c:61</p> <p>SKODA Fabia 2007- Roomster 2007-</p> <p>BZG, CBZA CEVA, CGPA CHTA, CBZB VW 03D903025M BO 0124525544 MH ALB5544</p>	<p>ALB5545 <i>New</i></p> <p>ALB5545WA</p>  <p>ARB0225 PAL0400</p>  <p>12v 140amp a:30 b:14 c:61.5</p> <p>AUDI SKODA SEAT VOLKSWAGEN</p> <p>8XA, 8P1, 8PA, 8P7 5P1, 5P5, 5P8, 5K1 2CA, 2CH, 2KB, 2KJ VW 03F903023D BO 0124525545 MH ALB5545</p>
<p>ALB5557 <i>New</i></p> <p>ALB5557WA</p>  <p>ARB0121 PAL0260</p>  <p>24v 150amp b:14 c:108</p> <p>VOLVO TRUCK</p> <p>VO 20988293 BO 0124655057</p>	<p>ALB5711 <i>New</i></p>  <p>ARB0074 PAL0416</p>  <p>12v 150amp a:52 b:95 c:74</p> <p>CITROEN Jumper 2.2Hdi 11K&FT, KFV FORD Transitz 2.2TDCi 11-> DRFA, DRFB PEUGEOT Boxer 2.2Hdi 11-P&GFA, UHFA</p> <p>CI 9674987580 BO 0125711001 MS 210835</p>	<p>ALB6020</p>  <p>ARB0822</p> <p>12v 220amp a:32 b:69 c:61</p> <p>MERCEDES-BENZ S-Class</p> <p>M272975 M273924 M273968 ME 0009060200 BO 0121813123</p>	<p>ALB6139</p>  <p>12v 65amp a:26 b:50</p> <p>BMW</p> <p>M10B16,M10B18 M10B20,M30B28 M30B28,M30B32 BM 12311277226 BO 0120489041 HC CA1911R</p>




















Alternators

Bosch

<p>ALB6150 <i>New</i></p>  <p>ARB0261 PAL0400</p>  <p>12v 150amp a:37 b:15 c:59</p> <p>AUDI A4 VW PASSAT</p> <p>AVB, AVF, AWX BKE, BRB</p> <p>VW 028903029NX BO 0124615021 DR DRA0753</p>	<p>ALB7110 <i>New</i></p>  <p>ARB0074 PAL0416</p>  <p>12v 150amp a:52 c:74</p> <p>FORD Ranger FORD Transit</p> <p>GBVAJQW SAFA CYRA, DRRA FO CC1T10300CA BO 0125711046</p>	<p>ALB7667</p>  <p>12v 120amp a:32 b:14 c:60</p> <p>NISSAN Teana</p> <p>NI 231003TS3A BO F000BL0567</p>	<p>ALB7677</p>  <p>ALB7677WA</p> <p>12v 110amp a:30 b:14 c:61</p> <p>Volkswagen 2013 Golf 2012 Jetta 2010</p> <p>VW 04E903023P BO F000BL0677</p>
<p>ALB7790 <i>New</i></p>  <p>ARB0822</p> <p>12v 220amp a:33 b:69 c:58</p> <p>MERCEDES-BENZ S-Class</p> <p>OM642862 M156984 M275953 MB 0131540602 BO 0121813002 DR DRB7790</p>	<p>ALB8045 <i>New</i></p>  <p>ARB0355</p> <p>12v 115amp a:85 b:56</p> <p>SAAB 9000</p> <p>2.3L</p> <p>SA 9120981 BO 0120468045 WA 13281</p>	<p>ALB9106 <i>New</i></p>  <p>ALB9106WA</p> <p>PAL0260</p>  <p>24v 120amp a:26 b:80.5</p> <p>BO 0124655106 MH ALB9106</p>	<p>ALB9557 <i>New</i></p>  <p>ARB0386</p> <p>24v 140amp b:15 c:180</p> <p>MAN INDUSTRIAL</p> <p>EL262,NU263 RN313,NU35315M RN353,NL263</p> <p>BO 0120689557</p>
<p>ALB9566 <i>New</i></p>  <p>ALB9566WA</p> <p>PAL0260</p>  <p>24v 120amp a:26 b:80.5</p> <p>BO 0124655066 MH ALB9566</p>			





Alternators

Delco

<p>ALD0001</p>  <p>ALD0001WA</p> <p>24v 100amp b:24 c:103</p> <p>KENWORTH W900 Medium&Heavy Duty Trucks</p> <p>DR 19011185 WA 8576N</p>	<p>ALD0006</p>  <p>ALD0006WA</p> <p>ARD2104</p> <p>24v 60amp b:14 c:100</p> <p>CATERPILLAR 30SI WESTERN STAR Cummins WAUKESHA Caterpillar CUMMINS CU 3000347RX DR 1117746 CG 112261</p>	<p>ALD0007</p>  <p>ALD0007WA</p> <p>ARD2705 PAL0433</p>  <p>12v 100amp a:74 b:51</p> <p>CHEVROLET L35 GMC LS1 ISUZU IS 8104640840 OLDSMOBILE DR 10464084 CG 112665</p>	<p>ALD0010</p>  <p>ALD0010WA</p> <p>ARD2940 PAL0440</p>  <p>12v 70amp a:41 b:17 c:65.5</p> <p>MERCURY GM Engines Marine MERCUISER DW 219232 DR 19020601 CG 113685</p>
<p>ALD0011</p>  <p>ALD0011WA</p> <p>ARD2587 PAL0243</p>  <p>12v 160amp a:70 b:50</p> <p>CHEVROLET V6 Suburban V8 GMC Pickups FO 15093928 CADILLAC DR 15857608 CG 113774</p>	<p>ALD0012</p>  <p>ALD0012WA</p> <p>ARD2104</p> <p>24v 100amp b:14 c:101</p> <p>Various Industrial Cummins applications</p> <p>CU 3675104RX DR 19011175 CG 113778</p>	<p>ALD0019</p>  <p>ALD0019WA</p> <p>ARD2476 PAL0431</p>  <p>24v 70amp b:14 c:103</p> <p>CUMMINS ERF Engine EC11 4BT3.9 CU 4993343 6BT5.9-C DR 8700019 WP 8709N</p>	<p>ALD0034</p>  <p>ALD0034WA</p> <p>ARD2198 PAL0431</p>  <p>12v 70amp b:16</p> <p>Cummins B</p> <p>DR 19020207 WA 8720N</p>
<p>ALD0041</p>  <p>ALD0041WA</p> <p>ARD2940 PAL0440</p>  <p>12v 70amp a:40 b:16 c:65</p> <p>MERCURY GM 181ci - 4 Cyl Marine GM 542 ci - 8 Cyl</p> <p>FO 19020600 DR 19020604 WA 8465N</p>	<p>ALD0042</p>  <p>ALD0042WA</p> <p>PAL0440</p>  <p>12v 70amp a:40 b:16 c:66</p> <p>MERCURY GM Engines Marine MERCUISER</p> <p>DR 8630771 DR 19020611 WA 8461N</p>	<p>ALD0052</p>  <p>ALD0052WA</p> <p>24v 125amp a:35</p> <p>TRUCKS DELCO HUNGARY IKARUS Trucks EU AV VG921W DR 19025347 HC CA810IR</p>	<p>ALD0055</p>  <p>ALD0055WA</p> <p>ARD2104</p> <p>24v 75amp b:15 c:101</p> <p>CATERPILLAR Caterpillar 3306, 3406, 3408 Wheel Loaders Cummins KTA1150, V1710 Scrapers Off-road&Mining Trucks CT 5S9088 Haulpack Trucks DR 1117249 HC UA946IR</p>



Alternators

Delco

<p>ALD0123 <i>New</i></p>  <p>ARD2940 PAL0440</p>  <p>12v 70amp a:77 b:51</p> <p>CRUSADER Marine</p> <p>PT 20115016TBA DR 19020608 CG 113692</p>	<p>ALD0133 <i>New</i></p>  <p>ARD2940 PAL0440</p>  <p>12v 70amp a:72.5 b:51</p> <p>HYSTER Fork Lift</p> <p>YL 580026829 DR 19020606 CG 113694</p>	<p>ALD0160</p>  <p>ALD0160WA ARD2050</p> <p>12v a:50 b:22 c:59</p> <p>OPEL Probably can be used on UAZ Andoria</p> <p>OP 135549105 DR 8400160 MH ALD0160</p>	<p>ALD0170</p>  <p>ALD0170WA</p> <p>24v 65amp a:45 b:14 c:102</p> <p>DAEWOO Excavators Wheel Loaders</p> <p>DA 25029007 DR 390040 NR 029007</p>
<p>ALD0186</p>  <p>ARD9063 PAL0213</p>  <p>12v 100amp a:33 b:12 c:70</p> <p>OPEL Astra J 1.7 CDTI 2010-></p> <p>A17DTE A17DTF A17DTS OP 13500186 GM 13579662 LU LRA03418</p>	<p>ALD0204</p>  <p>ALD0204WA ARD2198 PAL0433</p>  <p>12v 95amp a:36 b:10</p> <p>CUMMINS Engines</p> <p>CU 3972730 DR 19020204 WA 8722N</p>	<p>ALD0262</p>  <p>ARD2701</p> <p>12v 100amp a:52 b:34 c:56</p> <p>OPEL, SAAB Astra 900 9000</p> <p>C18NZ, C20NE, C18XE C18XEL, X18XE B258I, B204E, B202S OPEL 6204007 DR 10479955 HC CA1051IR</p>	<p>ALD0274</p>  <p>ALD0274WA ARD2051 PAL0209</p>  <p>12v 140amp a:35 b:13.5 c:66.5</p> <p>OPEL Corsa Astra Meriva Zafira</p> <p>OP 6204275 DR 8400156 HC CA2017IR</p>
<p>ALD0391</p>  <p>ALD0391WA</p> <p>24v 60amp a:48 b:14 c:104</p> <p>DAEWOO Bus</p> <p>DA RK390095 MH ALD0391</p>	<p>ALD0393</p>  <p>ARD2410 PAL0281</p>  <p>12v 100amp a:73 b:51</p> <p>BUICK, GMC CHEVROLET C2500 C3500 G30, K2500</p> <p>DR 1105661 DR 10463097 HC UA953IR</p>	<p>ALD0420 <i>New</i></p>  <p>ARD2411 PAL0280</p>  <p>12v 140amp a:73.5 b:50.5</p> <p>CADILLAC CHEVROLET GMC HUMMER H1 US Passenger Cars</p> <p>4.3L V6 5.0L V8, 5.7L V8 6.5L V8, 7.4L V8 WI 90014241 DR 10463636 CG 112893</p>	<p>ALD0469 <i>New</i></p>  <p>PAL0431</p>  <p>12v 105amp</p> <p>BUICK Pontiac</p> <p>GM 25744164 DR 10480411 WA 8245N</p>

Alternators

Delco

<p>ALD0577 New</p>  <p>ARD6510</p> <p>12v 100amp a:63 b:23 c:56</p> <p>OPEL A16LET VAUXHALL A16XER Astra J 1.6 2009-> A18XER Astra J 1.8 2012-> OP 1202235 DR 13500577 MH ALD0577</p>	<p>ALD0861</p>  <p>ALD0861RB ALD0861WA</p> <p>ARD2701</p> <p>12v 70amp a:50.5 b:34 c:59</p> <p>MERCEDES-BENZ M278927, OM906941 Econic C14SE, C14NZ 500 X16SZR OPEL OP R1530001 Astra DR DRA8600N HC CA861IR</p>	<p>ALD0866</p>  <p>ALD0866WA</p> <p>12v 90amp a:63 b:32 c:58</p> <p>OPEL Antara 2.4L CHEVROLET Captiva 2.4L</p> <p>OP 4811551 GM 96866019 MH ALD0866</p>	<p>ALD0916</p>  <p>ALD0916WA</p> <p>D9212 PAL0512 </p> <p>12v 60amp a:75 b:51</p> <p>FIAT Allis Various Models JEEP, BUICK CHEVROLET, GMC CA 2S945 CADILLAC, PONTIAC DR 1100690 HC UA916</p>
<p>ALD0923</p>  <p>ALD0923WA</p> <p>ARD2410 PAL0281 </p> <p>12v 105amp a:73 b:51</p> <p>JEEP ERH Cherokee 4.0L L6 Comanche Pickup 4.0L Wagoneer 4.0L</p> <p>CR 53002898 DR 1101167 HC UA923IR</p>	<p>ALD0937</p>  <p>ALD0937WA</p> <p>ARD2410 PAL0281 </p> <p>12v 100amp a:74 b:51</p> <p>CHEVROLET LG4 Camaro</p> <p>DR 10463005 DR 1101137 HC UA937IR</p>	<p>ALD0938</p>  <p>ALD0938WA</p> <p>ARD2410 PAL0281 </p> <p>12v 100amp a:73 b:51</p> <p>BUICK, CADILLAC, GMC LGO CHEVROLET, PONTIAC OLDSMOBILE</p> <p>Eldorado, Fleetwood CU 3604669RX Beetta, G20, Lumina DR 10479902 HC UA938IR</p>	<p>ALD0939</p>  <p>ALD0939WA</p> <p>ARD2410 PAL0281 </p> <p>12v 100amp b:51</p> <p>AM GENERAL, BUICK LG4 CHEVROLET, GMC, OLDSMOBILE Hummer, Century Roadmaster, Camaro C1500, C2500</p> <p>DR 10480028 HC UA939IR</p>
<p>ALD0941</p>  <p>ARD2408 PAL0281 </p> <p>12v 100amp a:73 b:51</p> <p>CHEVROLET BUICK OLDSMOBILE</p> <p>DR 1105677 DR 1101158 HC UA941IR</p>	<p>ALD0942</p>  <p>ALD0942WA</p> <p>ARD2410 PAL0281 </p> <p>12v 100amp a:72.5 b:50</p> <p>BUICK, CHEVROLET LN2 Skyhawk Beretta Corsica Cavalier</p> <p>DR 10479815 DR 1101461 HC UA942IR</p>	<p>ALD0944</p>  <p>ARD2101 PAL0511 </p> <p>12v 100amp b:51</p> <p>JEEP LC3 CHEVROLET LG4 CASE INTERNATIONAL WI 90013081A Agricultural Techniks DR 1100589 HC UA944IR</p>	<p>ALD0945</p>  <p>ALD0945WA</p> <p>ARD2101 PAL0511 </p> <p>12v 78amp a:77 b:50.5</p> <p>BUICK 4L, 6L CHEVROLET OLDSMOBILE JEEP PONTIAC</p> <p>WI 90013145 DR 1101333 HC UA945IR</p>



















Alternators

Delco

<p>ALD0948</p>  <p>ALD0948WA ARD2030</p> <p>24v 45amp b:15 c:100</p> <p>FIAT Allis CASE</p> <p>FI 73113742 DR 1117655 HC UA948IR</p>	<p>ALD0958</p>  <p>ARD2410 PAL0281</p> <p>12v 105amp b:51</p> <p>CHEVROLET L19 Corvette</p> <p>DR 1101264 DR 1101127 HC UA958IR</p>	<p>ALD0964</p>  <p>ALD0964WA ARD2410 PAL0281</p> <p>12v 105amp a:72 b:51</p> <p>FORD Bronco BUICK US CHEVROLET US DR 1102607 PONTIAC US DR 10463214 HC UA964IR</p>	<p>ALD0967</p>  <p>ALD0967RB ALD0967WA ARD2702 PAL0430</p> <p>12v 105amp a:73 b:51</p> <p>CHEVROLET, GMC Astro 4.3 V6 Safari 4.3 V6</p> <p>DR 10480252 DR 10480017 HC UA967IR</p>
<p>ALD1053</p>  <p>ALD1053RB ALD1053WA ARD2708</p> <p>12v 100amp a:50 b:33 c:58</p> <p>ISUZU C14NZ OPEL, VAUXHALL X22SE Amigo, Rodeo 20NEJ Astra, Cors, Vectra OP 10480384 DR 10480225 HC CA1053IR</p>	<p>ALD1103</p>  <p>ALD1103RB ALD1103WA ARD2701</p> <p>12v 100amp a:51 b:34 c:56</p> <p>OPEL, SAAB, VAUXHALL C18NZ, C20NE Astra, Corsa, Omega B258L, B202S, B204E Frontera, Tigra, Vectra X20DTL, Y20DTL Calibra, Astravan, Zafira OP 6204006 900, 9000 DR 10479914 HC CA1103IR</p>	<p>ALD1109</p>  <p>ALD1109WA ARD2410 PAL0281</p> <p>12v 105amp a:73 b:51</p> <p>CHEVROLET LD2 Lumina V6 PONTIAC OLDSMOBILE</p> <p>DR 1101344 HC UA1109IR</p>	<p>ALD1110</p>  <p>ALD1110WA ARD2702 PAL0281</p> <p>12v 105amp a:39 b:14 c:55</p> <p>CHEVROLET L82 OLDSMOBILE PONTIAC BUICK</p> <p>DR 10463405 DR 10480119 HC UA1110IR</p>
<p>ALD1113</p>  <p>ALD1113WA ARD2410 PAL0281</p> <p>12v 105amp a:73 b:51</p> <p>BUICK L82 CHEVROLET LG6 OLDSMOBILE PONTIAC</p> <p>DR 10479097 DR 1102602 HC UA1113IR</p>	<p>ALD1115</p>  <p>ALD1115WA ARD2021</p> <p>12v 100amp b:14 c:101</p> <p>FORD US VOLVO GMC INTERNATIONAL</p> <p>FE X830100004 DR 10459052 HC UA1115IR</p>	<p>ALD1253</p>  <p>ALD1253RB ALD1253WA ARD2702 PAL0433</p> <p>12v 75amp a:46 b:27 c:68</p> <p>RENAULT D7F710, D7F720 Clio D7F700, D7F701 Kangoo D7F730, D7F726 Twingo RE 7700870818 DR 10480215 HC CA1253IR</p>	<p>ALD1385</p>  <p>ALD1385WA ARD2410 PAL0279</p> <p>12v 80amp a:46 b:12.5 c:81</p> <p>DAEWOO A15MF Espero G15MF Nexia</p> <p>DW 96224431 DR 10480000 HC CA1385IR</p>

Alternators

Delco

<p>ALD1386</p>  <p>ALD1386WA ARD2403 PAL0280</p>  <p>PL F S</p> <p>12v 80amp a:87 b:51</p> <p>DAEWOO C18LE Espero C20LE</p> <p>DW 96224432 DR 10479990 HC CA1386IR</p>	<p>ALD1396</p>  <p>ALD1396WA ARD2403 PAL0280</p>  <p>PL F S</p> <p>12v 75amp a:46 b:12.5 c:80.5</p> <p>DAEWOO A15MF Espero G15MF Nexia</p> <p>DW 96224431 DR 10480073 HC CA1396IR</p>	<p>ALD1473</p>  <p>ALD1473WA ARD2701</p> <p>12v 100amp a:52.5 b:34 c:58.5</p> <p>OPEL, VAUXHALL X17DTL Astra</p> <p>OP 1204054 DR 10480273 HC CA1473IR</p>	<p>ALD1538</p>  <p>ALD1538RB ALD1538WA ARD2702 PAL0433</p>  <p>S I L P</p> <p>12v 105amp a:72 b:51</p> <p>CHEVROLET, GMC LS1 Blazer, Express L56 Suburban, Camaro, G10 LO5 Jimmy, Sierra, Safari IS 8104636510 Savana, Sonoma, Yukon DR 10463651 HC UA1538IR</p>
<p>ALD1581</p>  <p>ALB1581RB ALD1581WA ARD2708</p> <p>12v 100amp a:54.5 b:33.5 c:59</p> <p>CHEVROLET, OPEL Z16XE, Z18XE VAUXHALL X14XE, X16SZR Astra, Corsa, Meriva X20XE, Z20LER Omega, Tigra, Vectra OP 55556070 Zafira, Combo DR 10480225 HC CA1581IR</p>	<p>ALD1600</p>  <p>ALA1600RB ALD1600RB ALD1600WA ARA1205 PAL0442</p>  <p>L TGR</p> <p>12v 65amp a:42 b:17 c:66</p> <p>CHEVROLET, DAEWOO F8CV Spark B10S Matiz B10S1 DAEW 96289030 DR 219235 HC JA1600IR</p>	<p>ALD1620</p>  <p>ALD1620WA ALD162WA ARD2104</p> <p>24v 70amp b:14.5 c:101.5</p> <p>CUMMINS 6CTA NEW HOLLAND 4BT3.9 KOMATSU SA6D114E-1 JOHN DEERE CU 3251135 DR 10459026 HC UA1620IR</p>	<p>ALD1671</p>  <p>ALD1671RB ALD1671WA ARD2403 PAL0278</p>  <p>L I S</p> <p>12v 85amp a:34.5 b:13 c:81</p> <p>CHEVROLET, DAEWOO A16DMS Rezzo, Tacuma A14SMS, Y15L Lanos A15SMS DA 96303556 DR 219139 HC CA1671IR</p>
<p>ALD1672</p>  <p>ALD1672WA ARD2403 PAL0278</p>  <p>L I S</p> <p>12v 85amp a:36 b:13 c:81</p> <p>DAEWOO A16DMS Nubira Rezzo/Tacuma</p> <p>DA 96258990 DR 219138 HC CA1672IR</p>	<p>ALD1677</p>  <p>ALD1677WA ARD2650 PAL0405</p>  <p>L DFM</p> <p>12v 190amp a:33 b:94 c:56</p> <p>MERCEDES-BENZ OM613960, OM612961 S 320, E 200, E 220 OM612963, OM611961 ML 270 2.7 Cdi OM613961 E 320 T 3.2 Cdi MB 0001501650 E 270 T 2.7 Cdi DR 10480403 HC CA1677IR</p>	<p>ALD1745</p>  <p>ALD1745WA ARD2403 PAL0278</p>  <p>L I S</p> <p>12v 80amp a:52 b:34 c:60.5</p> <p>CHEVROLET T20SED DAEWOO X20SED Rezzo T18SED, Z20L Lacetti DA 96206871 Nubira DR 219137 HC CA1745IR</p>	<p>ALD1838</p>  <p>ALD1838WA ARD2750 PAL0400</p>  <p>L DFM</p> <p>12v 190amp a:30 b:93 c:57</p> <p>MERCEDES-BENZ OM611962 C200 OM612962 C220 OM612966 C270 MB A0001501750 G270 DR DRA4035 HC CA1838IR</p>


Alternators

Delco

<p>ALD2010</p>   <p>ALD010WA ALD2010WA</p> <p>ARD2873 PAL0209</p>  <p>12v 100amp a:35 b:13 c:67</p> <p>OPEL ASTRA H 1.7L CORSA D 1.7L MERIVA 1.7L ZAFIRA B 1.7L</p> <p>OP 98031154 DR 8400159 HC CA2010IR</p>	<p>ALD2120</p>   <p>ALD2120WA</p> <p>PAL0243</p>  <p>12v 100amp a:54 c:63.5</p> <p>CHEVROLET Aveo 1, 4L 2011-</p> <p>GM 13500582 DR 1202120 MH ALD2120</p>	<p>ALD2475 <i>New</i></p>   <p>ARD2198 PAL0281</p>  <p>12v 95amp b:50</p> <p>CASE, NEW HOLLAND Skid Steer Loaders Track Loaders</p> <p>Case 432T/M3 Diesel Case 445T/M3 Diesel 334T Diesel CS 87038475 DR 19020208 WA 8721N</p>	<p>ALD2580 <i>New</i></p>   <p>ARD6510</p> <p>12v 140amp a:60 b:31 c:58</p> <p>CHEVROLET Cruze</p> <p>Z20DMH Z20S1</p> <p>GM 13502580</p>
<p>ALD2595 <i>New</i></p>   <p>ARD2062 PAL0243</p>  <p>12v 100amp a:73 c:55</p> <p>OPEL Astra J 1.6L Zafira C 1.8L CHEVROLET Cruze 1.6L</p> <p>A16XER, A18XER A18XEL, F18D4, 2H0 F16D3, F16D4, LXT OP 1204180 DR 13502595 MH ALD2595</p>	<p>ALD2614</p>   <p>ALD2614WA</p> <p>ARD2331</p> <p>12v 170amp b:80 c:126</p> <p>VOLVO INTERNATIONAL PETERBILT KENWORTH Medium&Heavy-duty Trucks</p> <p>VO 20731028 DR 8600127 CG 114359</p>	<p>ALD2630</p>   <p>ALD2630WA</p> <p>ARD2101 PAL0511</p>  <p>12v 63amp a:25 b:50.5</p> <p>CHEVROLET GMC PONTIAC CADILLAC INTERNATIONAL</p> <p>V6, V8, L6 Cummins Engines Caterpillar Engines CU 3604663RX DR 1100872 HC UA630IR</p>	<p>ALD2713</p>   <p>ARD2101 PAL0276</p>  <p>12v 105amp a:71 b:50.5</p> <p>FORD Various Models Agricultural JOHN DEERE</p> <p>9000 CA A130672Z DR 10479924 CG 111713</p>
<p>ALD2824</p>   <p>ALD2824WA</p> <p>ARD2331</p> <p>12v 145amp b:14 c:100</p> <p>FREIGHTLINER INTERNATIONAL KENWORTH MACK Trucks US</p> <p>CU 3604666AX DR 10459188 CG 112824</p>	<p>ALD2834</p>   <p>ALD2834WA</p> <p>D33QS</p> <p>12v 145amp b:13 c:101.5</p> <p>FORD Aerostar L 6000 L 7000 L 8000 L 9000</p> <p>Cummins DR 10459217 CG 112834</p>	<p>ALD2837</p>   <p>ARD2252 PAL0431</p>  <p>12v 130amp b:14 c:102</p> <p>MACK VOLVO</p> <p>CU 3972732 DR 19020903</p>	<p>ALD2850 <i>New</i></p>   <p>ARD2201 PAL0433</p>  <p>12v 105amp a:72.5 b:50.6</p> <p>CADILLAC, GMC CHEVROLET C / K / R / V SERIES PICKUPS Escalade Avalanche, Silverado</p> <p>4.3L(262) V6 4.8L(294) V8 5.3L(323) V8, 6.0L(364) V8 GM 90014359 DR 10464404 CG 112850</p>

Alternators

Delco

<p>ALD2853</p>  <p>ALD2853WA ARD2200 PAL0280</p>  <p>PL F S</p> <p>12v 130amp a:72 b:51</p> <p>CHEVROLET V8 1500, 2500 GMC Savana Express DR 15768830 C3500 DR 10464405 CG 112853</p>	<p>ALD2854</p>  <p>ARD2410 PAL0280</p>  <p>PL F S</p> <p>12v 105amp a:33.5 b:11.5 c:79</p> <p>CHEVROLET L32 Camaro LT1 PONTIAC Firebird DR 10463624 CG 111854</p>	<p>ALD2874 <i>New</i></p>  <p>ARD2445 PAL0280</p>  <p>PL F S</p> <p>12v 140amp a:36 b:13 c:50</p> <p>CHEVROLET TD60C OLDSMOBILE D6B PONTIAC VOLVO DE 10464403</p>	<p>ALD2884</p>  <p>ARD2410 PAL0280</p>  <p>PL F S</p> <p>12v 140amp a:73 b:51</p> <p>CHEVROLET V8 Caprice, Lumina Impala PONTIAC WI 90014130 Trans Sport DR 10479891 CG 112884</p>
<p>ALD2886</p>  <p>ARD2445 PAL0280</p>  <p>PL F S</p> <p>12v 140amp a:73 b:51</p> <p>CADILLAC V8 Deville Eldorado Seville WI 90014131 DR 10479995 CG 112886</p>	<p>ALD2985 <i>New</i></p>  <p>12v 120amp a:50 b:31 c:61</p> <p>CHEVROLET LF4 Epica 2.0l T20SED Epica 2.5l X20D1 GM 96492985 MH ALD2985</p>	<p>ALD2995</p>  <p>ALD2995WA ARD2021 PAL0511</p>  <p>1 2 L IG</p> <p>12v 160amp b:14 c:101</p> <p>KENWORTH, MACK Trucks US C Series, T Series, W Series CH Series, CL Series WI 90014109 DM Series, MR Series DR 10459336 CG 112995</p>	<p>ALD2998</p>  <p>ALD2998WA ARD2021 PAL0511</p>  <p>1 2 L IG</p> <p>12v 85amp b:14 c:101.5</p> <p>FORD, FRIEHLINER Cummins CATERPILLAR L 600, L 8000 L 7000 CU 3675109RX DR 10459099 CG 112998</p>
<p>ALD3002</p>  <p>ALD3002WA ARD2021</p> <p>12v 135amp b:14 c:102</p> <p>VOLVO INTERNATIONAL MACK KENWORTH CU 3675233RX DR 19011166 CG 113002</p>	<p>ALD3004</p>  <p>ALD3004WA ARD2021</p> <p>12v 135amp b:15 c:101</p> <p>VOLVO Cummins FORD Various Models CU 3675243RX DR 19011172 CG 113004</p>	<p>ALD3110</p>  <p>ALD3110WA ARD2579 PAL0280</p>  <p>PL F S</p> <p>12v 150amp a:40 b:25 c:26</p> <p>CHEVROLET, ISUZU, SAAB Trailblazer Ascender 9-7X IS 8152001100 BUICK, GMC DR 15200110 WA 8497N</p>	<p>ALD3155</p>  <p>ALD3155WA ARD2331</p> <p>12v 130amp b:13 c:101.5</p> <p>FORD 22SI INTERNATIONAL Caterpillar Engines Medium&Heavy Duty Trucks Cummins Engines US Trucks DR 19020380 DR 19020304 CG 113155</p>

Alternators

Delco

<p>ALD3159</p>  <p>ALD3159WA</p> <p>ARD2715 PAL0110</p>  <p>12v 105amp a:82 b:46</p> <p>HONDA J30A4 Accord J30A1 Acura</p> <p>HO 31100P8AA02 DR 10480228 CG 113159</p>	<p>ALD3430</p>  <p>12v 150amp a:30 b:14 c:61</p> <p>LANCIA 841AX Thesis 841AXC1101</p> <p>FI 71723410 DR 10480430 MH ALD3430</p>	<p>ALD3431</p>  <p>ALD3431WA</p> <p>ARD2301</p> <p>12v 200amp b:14 c:101</p> <p>STERLING Cummins Medium&Heavy Duty Trucks Caterpillar MBE900</p> <p>DR 19011104 WA 8432N</p>	<p>ALD3432</p>  <p>ALD3432WA</p> <p>ARD2021</p> <p>12v 160amp b:14 c:101</p> <p>VOLVO Cummins Various Models</p> <p>VO 90014072 DR 10459051 CG 113432</p>
<p>ALD3458</p>  <p>ALD3458WA</p> <p>24v 60amp a:45 b:15 c:101</p> <p>DAEWOO Excavator HYUNDAI Forklift</p> <p>DA 25026006 DR 390050 CG 113458</p>	<p>ALD3485</p>  <p>ALD3485WA</p> <p>PAL0400</p>  <p>12v 190amp a:40 b:20</p> <p>PORSCHE 4.5L Cayenne</p> <p>PO 94860301503 DR 10480485 MH ALD3485</p>	<p>ALD3502</p>  <p>ALD3502</p> <p>ARD2425 PAL0281</p>  <p>12v 124amp a:72 b:51</p> <p>CHEVROLET GMC P30</p> <p>DR 10817511 DR 1101818 CG 113502</p>	<p>ALD3521</p>  <p>ALD3521WA</p> <p>PAL0400</p>  <p>12v 150amp b:29 c:29</p> <p>VW BDN Passat 4.0L BDP</p> <p>VW 07D903021 DR 10480377 MH ALD3521</p>
<p>ALD3579</p>  <p>ALD3579WA</p> <p>ARD2021</p> <p>12v 145amp b:80 c:108</p> <p>INTERNATIONAL 22SI KENWORTH, MACK VOLVO FREIGHTLINER Various Truck Models</p> <p>DR 10459321 CG 113579</p>	<p>ALD3693</p>  <p>12v 70amp a:76 b:50</p> <p>CRUSADER HYSTER</p> <p>DR 19020614</p>	<p>ALD3777</p>  <p>ALD3777WA</p> <p>ARD2200 PAL0431</p>  <p>12v 145amp a:73 b:51</p> <p>CADILLAC, CHEVROLET GMC 5, 3 Engine 2003-2005</p> <p>OP 15226003 DR 15754097 CG 113777</p>	<p>ALD3995</p>  <p>24v 45amp a:80 b:50</p> <p>CUMMINS ENGINES 6BT5.9</p> <p>CU 3972731 DR 19020205 WA 8724N</p>













Alternators

Delco

<p>ALD3996</p>  <p>12v 60amp a:77 b:51</p> <p>CHEVROLET Captiva 3.2L 10HM OPEL Antara 3.2L Z32SEE DAEWOO Winstorm 3.2L</p> <p>OP 4808607 DR 96673046 CG 114235</p>	<p>ALD4235</p>  <p>ALD4235WA ARD2206</p> <p>12v 120amp a:32 b:24</p> <p>CHEVROLET Captiva 3.2L 10HM OPEL Antara 3.2L Z32SEE DAEWOO Winstorm 3.2L</p> <p>OP 4808607 DR 96673046 CG 114235</p>	<p>ALD4271</p>  <p>ALD4271WA ARD2104</p> <p>24v 75amp b:14.2 c:100</p> <p>CATERPILLAR Landbrug Various Models</p> <p>CA OR9938 DR 10459353 CG 114271</p>	<p>ALD4286 <i>New</i></p>  <p>ALD4286WA ARD2033</p> <p>12v 160amp b:80 c:108</p> <p>FREIGHTLINER 24SI INTERNATIONAL MACK PETERBILT VO 8600889 VOLVO DR 8600889 UP ALT1242</p>
<p>ALD4350</p>  <p>ALD4350WA ALV4350RB ARD2332 PAL0434 </p> <p>12v 85amp a:38 b:18 c:81</p> <p>CHEVROLET, DAEWOO F16D3 Aveo T18SED Kalos F14D3 Lacetti DA 96540541 Nubira DR 8600313 CG 114350</p>	<p>ALD4359</p>  <p>ALD4359WA ARD2021</p> <p>12v 170amp b:80 c:126</p> <p>VOLVO ISX Various Models 11.9</p> <p>VO 20731028 DR 8600015 CG 114359</p>	<p>ALD4412</p>  <p>ALD4412WA ARD2206 PAL0282 </p> <p>12v 85amp a:36 b:17.5 c:81</p> <p>CHEVROLET, DAEWOO F16D3 SUZUKI F14D3 Aveo, Nubira F18D3 Lacetti DA 96540542 Swift 1.6 2005- DR 96838439 CG 114412</p>	<p>ALD4472</p>  <p>ARA2318</p> <p>12v 85amp a:45 b:11 c:81</p> <p>DAEWOO Nexia</p> <p>GM 96914472</p>
<p>ALD4504</p>  <p>24v 45Amp a:45 b:14 c:99</p> <p>DAEWOO</p> <p>DA 30090100007 DR DRA0444N</p>	<p>ALD4534</p>  <p>ALD4534WA ARD2152 PAL0431 </p> <p>12v 160amp b:23 c:82</p> <p>VOLVO FREIGHTLINER MACK STERLING DR 8600403 Medium&Heavy-Duty Trucks DR 19020900 CG 114534</p>	<p>ALD4536</p>  <p>ALD4536WA ARD2152 PAL0431 </p> <p>12v 160amp b:14 c:101</p> <p>VOLVO VED 12 MACK Engines Medium&Heavy-Duty Trucks Cummins ISX CU 3972732 DR 19020901 CG 114536</p>	<p>ALD4538</p>  <p>ARD2332</p> <p>12v 200amp b:14 c:101</p> <p>Ford b-series Leece-Neville</p> <p>LN 2331GH DR 8600307 CG 114538</p>


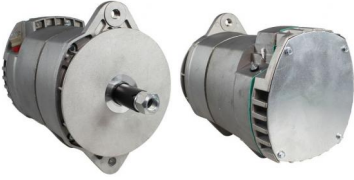



Alternators

Delco

<p>ALD4574</p>  <p>ALD4574WA ARD2331</p> <p>12v 170amp b:14 c:101</p> <p>KENWORTH PETERBILT Medium&Heavy-Duty Trucks</p> <p>DD 60 Series DR 8600125 CG 114574</p>	<p>ALD4575</p>  <p>ALD4575WA ARD2021</p> <p>12v 170amp b:14 c:101</p> <p>VOLVO Trucks</p> <p>36 SI Sr DR 8600082 CG 114575</p>	<p>ALD4577</p>  <p>ALD4577WA ARD2021</p> <p>12v 135amp b:24 c:101</p> <p>FREIGHTLINER INTERNATIONAL MACK VOLVO Medium&Heavy-Duty Truck</p> <p>Cummins Caterpillar Mack CU 3675219RX DR 10459279 CG 114577</p>	<p>ALD4579</p>  <p>ALD4579WA ARD2021</p> <p>12v 140amp b:14 c:102</p> <p>FORD VOLVO KENWORTH PETERBILT Medium&Heavy-Duty Truck</p> <p>Cummins Caterpillar DD 60 Series DR 10459610 CG 114579</p>
<p>ALD4580</p>  <p>ALD4580WA ARD2021</p> <p>12v 140amp b:14 c:102</p> <p>VOLVO FREIGHTLINER KENWORTH PETERBILT Medium&Heavy-Duty Trucks</p> <p>Cummins Caterpillar DD 60 Series DR 19011227 CG 114580</p>	<p>ALD4644</p>  <p>ALD4644WA ARD2200 PAL0430 PLIS</p> <p>12v 150amp a:43 b:24 c:27</p> <p>CHEVROLET GMC SAAB ISUZU OLDSMOBILE</p> <p>4.2L L6 DR 10464468 WA 8290N</p>	<p>ALD5209 <i>New</i></p>  <p>12v 110amp b:14 c:101</p> <p>FORD FREIGHTLINER INTERNATIONAL KENWORTH VOLVO</p> <p>FO F7HSAA DR 19011158 CG 113001</p>	<p>ALD5220</p>  <p>12v 100amp b:14 c:102</p> <p>FORD FREIGHTLINER KENWORTH MACK VOLVO</p> <p>FO F0HZ10346H DR E5HS10300BA CG 112264</p>
<p>ALD6136 <i>New</i></p>  <p>ALD6136WA</p> <p>12v 80amp a:38 b:15 c:68</p> <p>CHEVROLET Aveo</p> <p>B12D1 GM 96936136 MH ALD6136</p>	<p>ALD6153</p>  <p>12v 45amp a:75 b:55</p> <p>OPEL VAUXHALL</p> <p>12S,12N 11N,23B 30NE GM 1204018 DR 3472032 HC CA48IR</p>	<p>ALD7029 <i>New</i></p>  <p>ALD7029 ARD0118</p> <p>12v 120amp a:60 b:31 c:58</p> <p>CHEVROLET Captiva 2.0D 10.2006 Epica 2.0 VCDI 01.2007 Lacetti 2.0D 01.2007 Nubira 2.0D 01.2007</p> <p>CH 96627029 DR 96866018 DR DRA0573</p>	<p>ALD7042</p>  <p>24v 75amp b:23 c:103</p> <p>CATERPILLAR</p> <p>CA 8600232 DR 8600232</p>






Alternators

Delco

ALD7209 New	ALD7244 New	ALD8310 New	ALD8600
 <p style="text-align: right;">ARD2048</p>	 <p style="text-align: right;">ALD7244WA ARD2021</p>	 <p style="text-align: right;">ARD2033</p>	
<p>24v 45amp b:50</p> <p>KOMATSU</p> <p style="text-align: right;">KO 6736816110 DR 19020209 PR 2871A502</p>	<p>12v 75amp a:14 c:103</p> <p>CHEVROLET / GMC Caterpillar 3208 FORD Caterpillar 3306 Medium & Heavy trucks Caterpillar 3406 FO D4HF10300AA DR 1117244 CG 110416</p>	<p>12v 160amp b:14 c:101</p> <p>FORD 24SI FREIGHTLINER KENWORTH VOLVO DR 8600397 DR 8600310 UP ALT1243</p>	<p>12v 145amp b:12 c:101</p> <p>MACK VOLVO MA 2MJ516M3 DR 8600019</p>
ALD8680			
			
<p>12v 270amp b:14 c:101</p> <p>VOLVO MACK DAIMLER FORD VO LN 4867JB DR 8600280 FO 4C4010300NA</p>			

















Alternators

Denso

<p>ALN0028</p>  <p>ALN0028WA PAL0285</p>  <p>12v 140amp a:48 b:30</p> <p>CHRYSLER Country Voyager Caravan</p> <p>CH 04868431AB ND 4210000012 WA 13871N</p>	<p>ALN0032</p>  <p>ALN0032WA ARN6227 PAL0503</p>  <p>12v 45amp a:43.5 b:19</p> <p>DAIHATSU Charade</p> <p>CB22, CB20, CB90 CB23, CB60 CB61, CB80T DH 2706087705 ND 1002111401 HC JA160IR</p>	<p>ALN0033</p>  <p>ALN0033WA ARN6453 PAL0223</p>  <p>12v 80amp a:86 b:56</p> <p>LEXUS LS400</p> <p>4.0L</p> <p>TO 2706050190 ND 1012119150 WA 13669N</p>	<p>ALN0035</p>  <p>ALN0035WA PAL0450</p>  <p>12v 120amp a:47 b:30</p> <p>CHRYSLER Sebring 2.4L DODGE Stratus 2.4L</p> <p>L4</p> <p>CH 4606755AC ND 4210000232 WA 13868N</p>
<p>ALN0040</p>  <p>ALN0040WA PAL0450</p>  <p>12v 160amp a:25 b:12 c:69</p> <p>DODGE, JEEP Durango Commander Grand Cherokee Liberty</p> <p>CH 4801252AA ND 4210000040 WA 13913N</p>	<p>ALN0056</p>  <p>ALN0056WA</p> <p>12v 70amp a:49 b:27 c:40</p> <p>DAIHATSU Materia Sirion 1.3L Terios 1.3L YRV 1.3L</p> <p>M4 4WD M3</p> <p>DH 27060B1030 ND 1042108200 ND DAN979</p>	<p>ALN0063</p>  <p>ALN0063WA ARN6439 PAL0223</p>  <p>12v 80amp a:90.5 b:58</p> <p>TOYOTA MR2 2.0L MR2 2.2L</p> <p>3SGE SW20</p> <p>TO 2706074430 ND 1012115460 HC JA1418IR</p>	<p>ALN0070</p>  <p>ALN0070WA PAL0285</p>  <p>12v 150amp a:23 b:69 c:85</p> <p>CHRYSLER Grand Voyager 2.4L Voyager 2.4L DODGE Caravan 2.4L</p> <p>16V L4</p> <p>CH 4868324AA ND 4210000070 WA 22170R</p>
<p>ALN0073</p>  <p>ALN0073WA PAL0115</p>  <p>12v 100amp a:34 b:17 c:34</p> <p>TOYOTA RAV4 3.5L</p> <p>TO 2706031090 ND 1042102080 WA 11322R</p>	<p>ALN0075</p>  <p>ALN0075WA ARN6302 PAL0115</p>  <p>12v 130amp a:32 b:19 c:36</p> <p>TOYOTA RAV4 3.5L</p> <p>TO 2706031100 ND 1042104750 WA 11323R</p>	<p>ALN0079</p>  <p>ALN0079WA PAL0112</p>  <p>12v 150amp a:33 b:19 c:37</p> <p>TOYOTA Highlander 3.5L RAV4 3.5L</p> <p>TO 2706031161 ND 1042102140 WA 11325R</p>	<p>ALN0080</p>  <p>ALN0080WA PAL0218</p>  <p>12v 95amp a:87 b:58</p> <p>HONDA CRV 2.0L</p> <p>HO 31100P3FG52 ND 1012119820 WA 11101R</p>





















Alternators

Denso

<p>ALN0084</p>  <p>ALN0084WA PAL0223</p>  <p>12v 130amp a:35 b:16 c:46</p> <p>TOYOTA Highlander 2.4L</p> <p>TO 2706028130 ND 1042103141 WA 13963R</p>	<p>ALN0085</p>  <p>ALN0085WA PAL0112</p>  <p>12v 130amp a:17 b:11</p> <p>TOYOTA Sequoia 4.7L Tundra 4.7L</p> <p>TO 270600F040 ND 1042105120 WA 13994R</p>	<p>ALN0090</p>  <p>ALN0090WA PAL0450</p>  <p>12v 115amp a:26 b:12 c:68</p> <p>JEEP Wrangler 4.0 TJ Series 4.0L</p> <p>CH 56041685AA ND 1210003710 CG 113641</p>	<p>ALN0091</p>  <p>ALN0091WA ARN6015 PAL0113</p>  <p>12v 100amp a:90 b:57</p> <p>TOYOTA Tundra Pickup 4.7L</p> <p>TO 270600F060 ND 1042105110 WA 11153N</p>
<p>ALN0097</p>  <p>ALN0097WA</p> <p>12v 130amp a:35 b:18 c:48</p> <p>HONDA Odyssey Shuttle</p> <p>K24A</p> <p>ND 1042103971 ND 1042103970 MH ALN0097</p>	<p>ALN0098</p>  <p>ALN0098WA ARN6301 PAL0113</p>  <p>12v 130amp a:35 b:17 b:46</p> <p>TOYOTA Highlander 2.4L</p> <p>TO 2706028240 ND 1042104030 WAI 11084R</p>	<p>ALN0099</p>  <p>ALN0099WA</p> <p>12v 130amp a:33 b:20 c:36</p> <p>TOYOTA Crown GRS182 Mark X 2004-2008</p> <p>3GRFE</p> <p>TO 2706031033 ND 1042104060 MH ALN0099</p>	<p>ALN0100</p>  <p>ALN0100WA PAL0450</p>  <p>12v 136amp a:30 b:11 c:68</p> <p>DODGE, JEEP Durango Ram Pickup Grand Cherokee Liberty</p> <p>226 V6</p> <p>CH 04801251AA ND 4210000320 WA 13912N</p>
<p>ALN0101</p>  <p>ALN0101WA ARN6317 PAL0213</p>  <p>12v 150amp a:53 b:30</p> <p>JEEP Liberty 2.8L Cherokee 2.8L</p> <p>L4 Diesel</p> <p>CH 56044672AB ND 1042104240 WA 11114R</p>	<p>ALN0105</p>  <p>ALN0105WA</p> <p>12v 100amp a:85 b:21</p> <p>JEEP Cherokee 2.5L Grand Cherokee 2.5L</p> <p>DSL</p> <p>CH 38522255F ND 1002104510 WA 22148R</p>	<p>ALN0106</p>  <p>ALN0106WA ARN6323 PAL0113</p>  <p>12v 130amp a:35 b:20 c:38</p> <p>TOYOTA Avalon 3.5L Venza 3.5L LEXUS RX350 3.5L</p> <p>TO 270600P150 ND 1042104571 WA 11137R</p>	<p>ALN0108</p>  <p>ALN0108WA</p> <p>12v 130amp a:40 b:20 c:42</p> <p>TOYOTA Hiace 2.7L 2005-></p> <p>2TRFE</p> <p>TO 2706075350 ND 1042104281 MH ALN0108</p>












Alternators

Denso

<p>ALN0110</p>  <p>ALN0110WA PAL0115</p>  <p>12v 100amp a:35 b:17 c:46</p> <p>TOYOTA RAV4 V4 2.0L 2006-></p> <p>1AZFE</p> <p>TO 2706028330 ND 1042104760 MH ALN0110</p>	<p>ALN0111</p>  <p>ALN0111WA ARN6302 PAL0115</p>  <p>12v 100amp a:38 b:13 c:46</p> <p>TOYOTA RAV4</p> <p>TO 2706028300 ND 1042104790 MH ALN0111</p>	<p>ALN0113</p>  <p>ALN0113WA ARN6221 PAL0300</p>  <p>12v 55amp a:31 b:58</p> <p>HONDA ROVER</p> <p>HO 31100PE3762 ND 1002111381 HC JA113IR</p>	<p>ALN0119</p>  <p>ALN0119WA</p> <p>12v 100amp a:33 b:19 c:52</p> <p>TOYOTA Corolla Axio Auris</p> <p>TO 2706037020 ND 1042105270 MH ALN0119</p>
<p>ALN0120</p>  <p>ALN0120WA PAL0113</p>  <p>12v 100amp a:33 b:19 c:51</p> <p>TOYOTA, PONTIAC Corolla Vibe Matrix Scion</p> <p>TO 270600T040 ND 1042105493 WA 11385N</p>	<p>ALN0122</p>  <p>ALN0122WA ARN6301 PAL0113</p>  <p>12v 150amp a:39 b:18 c:34</p> <p>TOYOTA Sienna 3.5L Venza 3.5L</p> <p>A6 V6 2GRFE</p> <p>TO 270600P240 ND 1042105511 WA 11326N</p>	<p>ALN0124</p>  <p>ALN0124WA ARN6366 PAL0110</p>  <p>12v 130amp a:40 b:15 c:35</p> <p>HONDA ACURA TSX Accord</p> <p>HO 31100R40A01 ND 1042105890 WA 11390N</p>	<p>ALN0127</p>  <p>ALN0127WA</p> <p>ND 1042106251 MH ALN0127</p>
<p>ALN0134</p>  <p>ALN0134WA</p> <p>12v 130amp a:38 b:17 c:45</p> <p>TOYOTA Previa Camry 2.4L</p> <p>TO 2706028340 ND 1042104980 WA 23996N</p>	<p>ALN0135</p>  <p>ALN0135WA ARN6301 PAL0113</p>  <p>12v 80amp a:35 b:21 c:44</p> <p>TOYOTA Land Cruiser Prado 2.7 2002-2007</p> <p>2TR-FE</p> <p>TO 270600C020 ND 1042109000 MH ALN0135</p>	<p>ALN0137</p>  <p>ALN0137WA PAL0104</p>  <p>12v 50amp a:44 b:12 c:76</p> <p>DAIHATSU, TOYOTA Carina Celica</p> <p>2T, 2TB, 2TG 3T, 4AL, 18R 18RG, 21RC, 21RU</p> <p>TO 2702013060 ND 0210006640 HC JA137</p>	<p>ALN0138</p>  <p>ALN0138WA</p> <p>12v 80amp a:31 b:17 c:47</p> <p>TOYOTA Camry 2006/05-2010/10</p> <p>1AZFE</p> <p>TO 270600H140 ND 1042109040 MH ALN0138</p>























Alternators

Denso

<p>ALN0142</p>  <p>ALN0142WA ARN6434 PAL0503</p>  <p>12v 60amp a:90 b:58</p> <p>TOYOTA Camry Celica Corolla Starlet</p> <p>4AGEL 4AGELC 4AGEC, 1N TO 2706016013 ND 1002113401 HC JA142IR</p>	<p>ALN0143</p>  <p>ALN0143WA PAL0113</p>  <p>12v 90amp a:32 b:17 c:42</p> <p>TOYOTA Vios Yaris</p> <p>NCP93L, 2NZFE NCP91R, NCP9, TH 1NZFE, MA, PH TO 270600M040 ND 1042109081 MH ALN0143</p>	<p>ALN0145</p>  <p>ALN0145WA PAL0104</p>  <p>12v 40amp a:52 b:14.5 c:71.5</p> <p>TOYOTA Lite-Ace 1.8L DSL Town-Ace 1.8L DSL</p> <p>TO 2703064030 ND 1002102730 HC JA145</p>	<p>ALN0146</p>  <p>ALN0146WA</p> <p>12v 160amp a:25 b:11 c:70</p> <p>JEEP, DODGE CHRYSLER Commander, Liberty Durango, Nitro Aspen</p> <p>CH 56029914AD ND 4210000470 MH ALN0146</p>
<p>ALN0161</p>  <p>ALN0161WA ARN6434 PAL0301</p>  <p>12v 70amp a:90 b:58</p> <p>TOYOTA Camry Carina Celica Supra</p> <p>1SL, 2SEL 3SFE, 5SFE 1S, 1SEL, 3SGEL TO 2706063021 ND 100211704 HC JA161IR</p>	<p>ALN0167</p>  <p>ALN0167WA ARN6462 PAL0227</p>  <p>24v 40amp a:90 b:57.5</p> <p>KOMATSU PC200-6 6D102</p> <p>KO 6008613410 ND 1012114310 NR 024310</p>	<p>ALN0183</p>  <p>ALN0183WA ARN6217 PAL0301</p>  <p>24v 45amp a:55 b:15 c:71</p> <p>ISUZU</p> <p>6HH1 6HE1</p> <p>IS 8943947971 ND 1002115881 NR 025881</p>	<p>ALN0185</p>  <p>ALN0185WA PAL0110</p>  <p>12v 130amp a:79 b:42</p> <p>ACURA, HONDA MDX 3.5L (2004-02) Odyssey 3.5L (2004-03) Pilot 3.5L</p> <p>HO 31100PGKA01 ND 1042103090 WA 13918N</p>
<p>ALN0188</p>  <p>ALN0188WA ARN6253 PAL0300</p>  <p>12v 45amp a:42 b:20 c:67</p> <p>CHEVROLET, PONTIAC SUZUKI Sprint Firefly Samurai, Swift</p> <p>G13A G13BA G10, G10A SU 3140082610 ND 1002114070 HC JA188IR</p>	<p>ALN0189</p>  <p>ALN0189WA ARN6220 PAL0301</p>  <p>12v 60amp a:90 b:58</p> <p>TOYOTA Camry Celica</p> <p>2SEL 3SGEL, 2SEL 3SGELC, 1SL TO 2706016040 ND 1002111201 HC JA189IR</p>	<p>ALN0191</p>  <p>ALN0191WA ARN6315 PAL0110</p>  <p>12v 130amp a:48 b:18</p> <p>ACURA, HONDA MDX Odyssey Pilot Ridgeline</p> <p>RL TL HO 31100RDJA01 DN 1042103100 WA 11151N</p>	<p>ALN0193</p>  <p>ALN0193WA PAL0104</p>  <p>12v 50amp a:49.5 b:14.5 c:97</p> <p>TOYOTA Dyna Hiace Land Cruiser</p> <p>2L, 2LT 3L L TO 2703054140 ND 1002103820 HC JA193</p>

Alternators

Denso

<p>ALN0194</p>  <p>ALN0194WA</p> <p>ARN6920 PAL0105</p>  <p>12v 55amp a:33.5 b:14 c:62</p> <p>TOYOTA Camry Carina Corolla</p> <p>2CT, 2C 2CL, 1C 1CTL, 1CL TO 2702064020 ND 1002130760 HC JA194IR</p>	<p>ALN0200 <i>New</i></p>  <p>ALN0200WA</p> <p>12v 130amp a:21 b:13 c:61</p> <p>HONDA, SATURN Accord Vue</p> <p>HO 31100RDMA01 ND 1042103770 GM 12582024</p>	<p>ALN0202</p>  <p>ALN0202WA</p> <p>ARN6315 PAL0110</p>  <p>12v 130amp a:48 b:20 c:61</p> <p>HONDA Accord</p> <p>HO 31100RCBY01 ND 1042104480 WA 11062R</p>	<p>ALN0206</p>  <p>ALN0206WA</p> <p>ARN6335 PAL0110</p>  <p>12v 100amp a:36.5 b:20.5 c:38</p> <p>HONDA Accord 2.0L CR-V 2.0L</p> <p>V4 HO 31100RZPG01 ND 1042105370 HC CA2078IR</p>
<p>ALN0211</p>  <p>ALN0211WA</p> <p>ARN6450 PAL0219</p>  <p>12v 40amp a:43 b:24</p> <p>JOHN DEERE, YANMAR 4000 Series Tractors Diesel Engines</p> <p>4TNE84 JD AM879908 ND 1012111170 CG 113742</p>	<p>ALN0214</p>  <p>ALN0214WA</p> <p>ARN6001 PAL0223</p>  <p>12v 150amp a:95 b:58</p> <p>JOHN DEERE Sprayers</p> <p>JD RE186320 ND 1042103920 CG 113975</p>	<p>ALN0243</p>  <p>ALN0243WA</p> <p>PAL0450</p>  <p>12v 160amp a:44 b:14 c:68</p> <p>DODGE, CHRYSLER Durango Pickup Aspen</p> <p>5.7L (345) V8 CH 56028697AE ND 4210000210 WA 13988R</p>	<p>ALN0245</p>  <p>ALN0245WA</p> <p>PAL0296</p>  <p>12v 136amp a:25 b:12 c:69</p> <p>DODGE, MITSUBISHI Dakota Durango Ram Pickup Raider</p> <p>CH 56029700AD DN 4210000430 WA 11276N</p>
<p>ALN0279</p>  <p>ALN0279RB ALN0279WA</p> <p>12v 90amp a:45 b:17 c:54.5</p> <p>FIAT, LANCIA</p> <p>FI 51727338 DN 1012100870 HC CA2048IR</p>	<p>ALN0330</p>  <p>PAL0104</p>  <p>12v 35amp a:42 b:12 c:67.5</p> <p>DAIHATSU, SUZUKI TOYOTA Taft, Move, Charade Carry, LJ Carina, Celica</p> <p>12R, ED20, CB20 F8A 2T, 3T, 2TB, 4A-L TO 2702013030 ND 0210000719 HC JA118</p>	<p>ALN0346</p>  <p>ALN0346WA</p> <p>ARN6222 PAL0308</p>  <p>12v 60amp a:32.5 b:58</p> <p>DAIHATSU Applause Charade</p> <p>DH 2706087719000 DN 1012110370 HC JA14311R</p>	<p>ALN0351</p>  <p>ALN0351WA</p> <p>PAL0104</p>  <p>12v 55amp a:67 b:14 c:72</p> <p>DAIHATSU Fourtrack 2.8L Rocky 2.8L Rugger 2.8L</p> <p>DH 2703087605 ND 1210008281 HC JA1529</p>























Alternators

Denso

<p>ALN0360</p>  <p>ALN0360WA ARN6015 PAL0113</p>  <p>12v 130amp a:30 b:60.5</p> <p>LEXUS, TOYOTA GX470 LX470 4Runner Land Cruiser</p> <p>4.7L 2UZFE TO 2706050360 ND 1042104510 WA 11196R</p>	<p>ALN0401</p>  <p>ALN0401WA ARN6364</p> <p>12v 150amp a:42 b:17 c:52</p> <p>FORD Focus C-max 1.8L TDCi</p> <p>FO 4M5T10300BB ND 1042103850 DN DANDEN933</p>	<p>ALN0416 <i>New</i></p>  <p>ALN0416WA ARN6439 PAL0223</p>  <p>12v 60amp a:91 b:58</p> <p>TOYOTA T-100 Tacoma</p> <p>3.4L TO 2706062110 ND 1012110730 MH ALN0416</p>	<p>ALN0421 <i>New</i></p>  <p>ALN0421WA ARN6441 PAL0227</p>  <p>12v 80amp a:88 b:56.5</p> <p>LEXUS GS300 SC300 TOYOTA Supra</p> <p>2JZGE TO 2706046060 ND 1012115450 CG 113089</p>
<p>ALN0422 <i>New</i></p>  <p>ALN0422WA ARN6439 PAL0223</p>  <p>12v 80amp a:90 b:58</p> <p>TOYOTA Celica</p> <p>2.2L TO 2706074390 ND 1012110100 CG 113163</p>	<p>ALN0423 <i>New</i></p>  <p>ALN0423WA ARN6438 PAL0301</p>  <p>12v 80amp a:90 b:58</p> <p>TOYOTA MR2</p> <p>2.0L 2.2L TO 2706074320 ND 1002118870 CG 113201</p>	<p>ALN0424 <i>New</i></p>  <p>ALN0424WA PAL0450</p>  <p>12v 130amp a:28 b:12 c:68</p> <p>JEEP Cherokee Grabd Cherokee</p> <p>VMHR425CLIRX EXA CR 38522276 ND 1210004390 CG 114243</p>	<p>ALN0427 <i>New</i></p>  <p>ALN0427WA ARN6248 PAL0227</p>  <p>12v 90amp a:89 b:58</p> <p>ISUZU</p> <p>IZ 8972103730 ND 1022111740 WA 13875</p>
<p>ALN0432 <i>New</i></p>  <p>ALN0432WA PAL0104</p>  <p>24v 15amp a:48 b:12 c:76</p> <p>TOYOTA Land Cruiser</p> <p>B 2F 3B TO 2702078601 ND 0210004510 HC JA791</p>	<p>ALN0444 <i>New</i></p>  <p>ALN0444WA PAL0104</p>  <p>12v 30amp a:44.5 b:12.5 c:67</p> <p>DAIHATSU KOMATSU KUBOTA SUZUKI TOYOTA</p> <p>AD10, 12R F10A, 3KB, 3KC, 3KH TO 2702022012 ND 0210000081 CG 110137</p>	<p>ALN0459 <i>New</i></p>  <p>12v 180amp a:28 b:48 c:52</p> <p>LAND ROVER RANGE ROVER</p> <p>LR LR034013 ND 1042106420 ND DAN1112</p>	<p>ALN0471 <i>New</i></p>  <p>ALN0471 ARN6449 PAL0227</p>  <p>12v 100amp a:150.5 b:72</p> <p>HYUNDAI Accent 1.5l Getz 1.5l Matrix 1.5l</p> <p>D3EA D4FA KI 3730027602 ND 1002132993 CG 114201</p>


Alternators

Denso

<p>ALN0475 <i>New</i></p>  <p>12337R ARN6258 PAL0227</p>  <p>12v 40amp a:41 b:24</p> <p>KUBOTA STEINER</p> <p>BC 6669618 ND 1012111100 CG 114205</p>	<p>ALN0476 <i>New</i></p>  <p>12v 110amp a:32 b:11 c:56</p> <p>JEEP Cherokee R425DOHC</p> <p>JP 38522296F ND 1210003700 WA 24113R</p>	<p>ALN0546</p>  <p>ALN0546WA ARN6220 PAL0301</p>  <p>12v 75amp a:92 b:56</p> <p>ISUZU 4ZC1T Piazza 2.0L Impulse 2.0L</p> <p>TO 2706072170 ND 1002112410 HC JA546IR</p>	<p>ALN0551</p>  <p>ALN0551WA ARN6254 PAL0503</p>  <p>12v 40amp a:43 b:24</p> <p>DAIHATSU, ISEKI ED10 KUBOTA, PIAGGIO ED20, CD Cuore, Hijet CB, CB41 Porter DH 2706087202000 ND 1002111610 HC JA551IR</p>
<p>ALN0552</p>  <p>ALN0552WA ARN6220 PAL0301</p>  <p>12v 70amp a:90 b:58</p> <p>GEO, TOYOTA 4AFE Pizm 4ALC Carina 4AF Corolla TO 2706016100 Celica ND 1002117051 HC JA552IR</p>	<p>ALN0553</p>  <p>ALN0553WA ARN6250 PAL0301</p>  <p>12v 40amp a:90 b:58</p> <p>DAIHATSU, TOYOTA 1RZ Rocky 2Y Dyna 3Y Hiace TO 2706072080 ND 1002111620 HC JA553IR</p>	<p>ALN0554</p>  <p>ALN0554WA ARN6444 PAL0303</p>  <p>12v 65amp a:32 b:58</p> <p>HONDA Accord 2.0L Prelude 2.0L</p> <p>HO 31100PH3013 ND 1002112130 HC JA554IR</p>	<p>ALN0555</p>  <p>ALN0555WA ARN6444 PAL0303</p>  <p>12v 70amp a:90.3 b:58</p> <p>ACURA, HONDA C25A2 ROVER, STERLING C27A1 800 Legend HO 31100PH7014 ND 1002112550 HC JA555IR</p>
<p>ALN0578</p>  <p>ALN0578WA ARN6220 PAL0301</p>  <p>12v 55amp a:146.5 b:70.5</p> <p>TOYOTA 1C, 2C, CM36 Liteace CR27V</p> <p>TO 2704064051 ND 1002132220 HC JA578IR</p>	<p>ALN0657</p>  <p>ALN0657WA ARN6320 PAL0301</p>  <p>12v 60amp a:90 b:58.5</p> <p>TOYOTA 2RZE, 1RZ Hiace 3YC, 3Y Model F 5MGE Supra TO 2706043050 ND 1002111030 HC JA657IR</p>	<p>ALN0682</p>  <p>ALM0682WA ALN0682WA ARN6253 PAL0300</p>  <p>12v 50amp a:37.5 b:20 c:66</p> <p>SUZUKI G13B Swift G16A Vitara G16B X-90 SZ 3140050G10 ND 1002113800 HC JA682IR</p>	<p>ALN0696</p> <p>ALN0696WA ARN6444 PAL0303</p>  <p>12v 65amp a:90 b:58.5</p> <p>HONDA A20A4, BS, B20A5 Accord ES2, A18A1 Prelude A20A3, A20A1 HO 31100PH30130 ND 1002112011 HC JA696IR</p>























Alternators

Denso

<p>ALN0697</p>  <p>ALN0697WA ARN6221 PAL0300 IG </p> <p>12v 55amp a:92.5 b:58</p> <p>OPEL, ISUZU Midi 2.0L Campo 2.3L</p> <p>4ZC1, 4CZ1 23P, 4ZD1</p> <p>OP 94413997 ND 1002111330 HC JA697IR</p>	<p>ALN0751</p>  <p>ALN0751WA ARN6219 PAL0308 IG </p> <p>12v 60amp a:89.5 b:58</p> <p>HONDA Civic Concerto</p> <p>D13B1 D14A1</p> <p>HO 31100PM4Y003 ND 1002113850 HC JA751IR</p>	<p>ALN0752</p>  <p>IN6225 PAL0306 IG  FR</p> <p>12v 60amp a:35 b:58</p> <p>HONDA</p> <p>HO 31100PE7660 ND 1002111370 HC JA752IR</p>	<p>ALN0753</p>  <p>ALN0753WA ARN6224 PAL0302 IG  FR</p> <p>12v 60amp a:89.5 b:58.5</p> <p>HONDA Accord Civic CRX Legend</p> <p>B20A8 D16A6, D15B2, D13B1 D16A9, C25A2, C25A1 HO 31100PM5A01 ND 1002113590 HC JA753IR</p>
<p>ALN0759</p>  <p>ALN0759WA ARN6220 PAL0301 S  IG </p> <p>12v 70amp a:90.5 b:57</p> <p>HONDA Prelude Accord</p> <p>F20A2, B20A1 B20A3, B20A5 F20A6, B20A4 HO 31100PK1001 ND 1002113300 HC JA759IR</p>	<p>ALN0760</p>  <p>ALN0760WA ARN6224 PAL0303 S  IG  FR</p> <p>12v 70amp a:90 b:56.5</p> <p>HONDA Accord 2.0L Accord 2.2L</p> <p>F20A4, F20A7, F20A8 F20Z3, F22A3, F22A7 F22A8 HO 31100P0AAA010 ND 1002118720 HC JA760IR</p>	<p>ALN0763</p>  <p>ALN0763WA ARN6436 PAL0300 IG </p> <p>12v 45amp a:89.5 b:58</p> <p>DAIHATSU Charade 1.3L</p> <p>HCE, G100 G101, G102</p> <p>DH 2706087707000 ND 1002116040 HC JA763IR</p>	<p>ALN0764</p>  <p>ALN0764WA ARN6250 PAL0300 IG </p> <p>12v 45amp a:90 b:58</p> <p>DAIHATSU Charade Grand Move Pyzar</p> <p>HCE, HC, HDE G100, G101, G102 G200, G2002, G3 DH 2706087604 ND 1002111520 HC JA764IR</p>
<p>ALN0771</p>  <p>ALN0771RB ALN0771WA ARN6320 PAL0301 S  IG </p> <p>12v 65amp a:90 b:58</p> <p>HONDA Accord</p> <p>A16A1, A16A1, A20A1 A20A2, A20A3, A20A4 BS HO 31100PH1004 ND 1002112151 HC JA771IR</p>	<p>ALN0772</p>  <p>ALN0772WA ARN6444 PAL0303 S  IG  FR</p> <p>12v 70amp a:90 b:57</p> <p>HONDA Prelude 2.0L Prelude 2.1L</p> <p>B20A3, B20A4, B20A1 B20A5, B20A7, B20A9 B20A5 HO 31100PK2003 ND 1002113311 HC JA772IR</p>	<p>ALN0777</p>  <p>ALN0777WA PAL0104 N  I  F </p> <p>12v 55amp a:52 b:14.5 c:96.5</p> <p>TOYOTA, VW Dyna, Tacoma Hiace, Hilux LandCruiser Taro</p> <p>2L, 22R L, 3L H10, H20, J7 TO 2703054241 ND 1002103400 HC JA777</p>	<p>ALN0783</p>  <p>ALN0783WA ARN6434 PAL0301 S  IG </p> <p>12v 70amp a:90 b:58</p> <p>TOYOTA Camry Carina Celica Corolla</p> <p>1E, 1N, 2E, 2EE 3SGE, 4AGEL 7MGE, 4AL TO 2706074130 ND 100211778 HC JA783IR</p>























Alternators

Denso

<p>ALN0792</p>  <p>ALN0792WA ARN6254 PAL0503</p>  <p>12v 40amp a:47.5 b:20 c:67</p> <p>KOMATSU Fork Lift Various Models</p> <p>TO 2706096301 ND 1002114000 HC JA792IR</p>	<p>ALN0798</p>  <p>ALN0798WA ARN6251 PAL0300</p>  <p>12v 50amp a:38.5 b:20 c:66.5</p> <p>CHEVROLET, GEO PONTIAC, SUZUKI Swift Sprint Metro</p> <p>G10A G13A G13B SZ 3140070F60 ND 2706096301 HC JA798IR</p>	<p>ALN0799</p>  <p>ALN0799WA ARN6218 PAL0105</p>  <p>12v 60amp a:49 b:14 c:97</p> <p>VW, TOYOTA Taro 2.4 Diesel</p> <p>2L</p> <p>TO 2704054151 ND 1002130250 HC JA799IR</p>	<p>ALN0880</p>  <p>ALN0880WA ARN6254 PAL0503</p>  <p>12v 45amp a:95.5 b:58</p> <p>DAIHATSU, PIAGGIO Feroza 1.6l Porter 1.3l</p> <p>HDC HDE</p> <p>TO 2706087602 ND 1002113370 HC JA880IR</p>
<p>ALN0881</p>  <p>ALN0881WA ARN6436 PAL0301</p>  <p>12v 70amp a:146.5 b:69.5</p> <p>TOYOTA Hiace</p> <p>2L</p> <p>TO 2704054190 ND 1002115090 HC JA881IR</p>	<p>ALN0882</p>  <p>ALN0882WA ARN6434 PAL0301</p>  <p>12v 80amp a:91 b:58</p> <p>TOYOTA Corolla MR2</p> <p>3SGE 2EE 2E</p> <p>TO 2706074160 ND 1002117820 HC JA882IR</p>	<p>ALN0885</p>  <p>ALN0885WA ARN6220 PAL0301</p>  <p>12v 80amp a:32.5 b:58.2</p> <p>TOYOTA Supra</p> <p>TO 2706043130 ND 1002112840 HC JA885IR</p>	<p>ALN0960</p>  <p>ALN0960WA ARN6831</p> <p>12v 90amp a:34 b:13 c:54</p> <p>CHRYSLER, DODGE JEEP, PLYMOUTH Voyager, Lebaron Cherokee, Wrangler Acclaim, Sundance</p> <p>EDG, 300 R00 EGA CH 5234026 ND 1210003380 HC UA960IR</p>
<p>ALN0961</p>  <p>ALN0961WA ARN6831</p> <p>12v 120amp a:31 b:12 c:54</p> <p>JEEP CHRYSLER Lebaron Wrangler Cherokee</p> <p>EDG HX P00 CH 56041394AA ND 1210004050 HC UA961</p>	<p>ALN0970</p>  <p>ALN0970WA ARN6256 PAL0301</p>  <p>12v 35amp a:43 b:24</p> <p>TOYOTA</p> <p>5FG25</p> <p>TO 270607800371 ND 1002114540 HC JA970IR</p>	<p>ALN0971</p>  <p>ALN0971WA ARN6255 PAL0503</p>  <p>12v 35amp a:43 b:24</p> <p>DAIHATSU Mira, Cuore Hijet Bus, Hijet Box KUBOTA, AIXAM Industrial Engine, Diesel</p> <p>V1502, L5 L80, L81, L201 L501, S85 TO 270607800171 ND 1002111661 HC JA971IR</p>	<p>ALN0976</p>  <p>ALN0976WA ARN6439 PAL0223</p>  <p>12v 70amp a:52 b:28 c:41</p> <p>TOYOTA, LEXUS, GEO Rav4 Land Cruiser Corolla, Celica ES Saloon</p> <p>7AFE 4AFE F1, F2, SXA1 TO 2706015090 ND 1012110060 HC JA976IR</p>

Alternators

Denso

<p>ALN0978</p>  <p>ALN0978WA ARN6251 PAL0300</p>  <p>12v 45amp a:43 b:21.5</p> <p>DAIHATSU CB23 Charade 1.0 CB80T</p> <p>DH 2706087717000 ND 1002119331 HC JA978IR</p>	<p>ALN0981</p>  <p>ALN0981WA ARN6440 PAL0223</p>  <p>12v 70amp a:89.5 b:58.5</p> <p>TOYOTA 3SFE Camry 3SGE Carina 5SFE Picnic TO 2706074630 Rav4 ND 1012114420 HC JA981IR</p>	<p>ALN0982</p>  <p>ALN0982WA ARN6628 PAL0104</p>  <p>24v 25amp a:63 b:14.5 c:97</p> <p>TOYOTA B Land Cruiser 3B Bandeirante Pick Up J4, J7 Bandeirante TO 2703056150 ND 0210009980 HC JA982</p>	<p>ALN0984</p>  <p>ALN0984WA ARN6461 PAL0301</p>  <p>24v 30amp a:95 b:58</p> <p>TOYOTA 11B Dyna Carina Camry TO 2706058020 Celica ND 1002117170 HC JA984IR</p>
<p>ALN0988</p>  <p>ALN0988WA ARN6437 PAL0223</p>  <p>12v 70amp a:90 b:58.5</p> <p>TOYOTA 4EFE Corolla 7AFE Paseo Starlet</p> <p>TO 2706011280 ND 1012110340 HC JA988IR</p>	<p>ALN0989</p>  <p>ALN0989WA ARN6453 PAL0223</p>  <p>12v 70amp a:146.5 b:70</p> <p>TOYOTA 2L Hiace 2.4L</p> <p>TO 2704054320 ND 1002115250 HC JA989IR</p>	<p>ALN1003 <i>New</i></p>  <p>12v 75amp a:41 b:64 c:55</p> <p>ALFA RAMEO JTDM FIAT 178BX LANCIA</p> <p>FI 703009641 ND 1012111211 VA 2542671</p>	<p>ALN1017</p>  <p>12v 80amp a:28 b:19 c:37</p> <p>TOYOTA Auris Yaris Vitz TO 270600Y050 Blade ND 1042109260 MH ALN1017</p>
<p>ALN1111 <i>New</i></p>  <p>ALN1111WA PAL0450</p>  <p>12v 160amp a:53 b:23 c:31</p> <p>CHRYSLER DODGE</p> <p>GM 4896803AA DN 4210000251</p>	<p>ALN1119</p>  <p>ALN1119WA ARN6439 PAL0223</p>  <p>12v 80amp a:96 b:53</p> <p>TOYOTA 2C Carina</p> <p>TO 2706064130 ND 1012115130 HC JA1119IR</p>	<p>ALN1120</p>  <p>ALN1120WA ARN6251 PAL0300</p>  <p>12v 45amp a:92.5 b:58.5</p> <p>OPEL, VAUXHALL 4ZD1 Brava 23P Campo</p> <p>TO 2706087605 ND 1002114140 HC JA1120IR</p>	<p>ALN1121</p>  <p>ALN1121WA ARN6253 PAL0300</p>  <p>12v 50amp a:90 b:58</p> <p>DAIHATSU HD, HDE Applause 1.6L HCE Charade 1.3L</p> <p>TO 2706087106 ND 1002119190 HC JA1121IR</p>


Alternators

Denso

<p>ALN1123</p>  <p>ALN1123WA ARN6320 PAL0301 </p>	<p>ALN1129</p>  <p>ALN1129WA ARN6225 PAL0306 </p>	<p>ALN1134</p>  <p>ALB1134RB ALN1134WA PAL0223 </p>	<p>ALN1163</p>  <p>ALN1163WA ARN6224 PAL0302 </p>
<p>12v 70amp a:92.5 b:59</p> <p>VW 22R TOYOTA 22REC Taro 22RE 4 Runner VW J2706035061 Hilux ND 1002112031 HC JA1123IR</p>	<p>12v 70amp a:90 b:56.5</p> <p>HONDA, ROVER F18A3, F20Z2, F20Z1 Accord 1.8L, 2.0L, 2.3L H23A3, H23A3 620I 2.0L 623I 2.3L HO 31100P45901 ND 1012110151 HC JA1129IR</p>	<p>12v 80amp a:90 b:58</p> <p>TOYOTA 5SFE Camry 3SFE Carina RAV 4 TO 2706074590 Picnic ND 1012119680 HC JA1134IR</p>	<p>12v 80amp a:34 b:56.5</p> <p>HONDA Prelude Accord 2.2L HO 31100PT3Q01 ND 1002118151 HC JA1163IR</p>
<p>ALN1164</p>  <p>ALN1164WA ARN6436 PAL0301 </p>	<p>ALN1170</p>  <p>ALN1170WA ARN6256 PAL0301 </p>	<p>ALN1178</p>  <p>ALN1178WA ARN6439 PAL0223 </p>	<p>ALN1211 <i>New</i></p>  <p>ALN1211WA</p>
<p>12v 70amp a:90 b:58.5</p> <p>TOYOTA VZV21 Camry 2.0L Camry 2.5L TO 2706062012 ND 1002117460 HC JA1164IR</p>	<p>12v 50amp a:44 b:20 c:67</p> <p>TOYOTA 1DZ, 2DZ Fork Lift 1Z, 3F Lift Trucks 11Z TO 2706078305 ND 1002116960 HC JA1170IR</p>	<p>12v 70amp a:89 b:58</p> <p>TOYOTA 4EFE, 5EFE Corolla 7AFE Paseo 2EE, 1N Starlet TO 2706011320 ND 1012110052 HC JA1178IR</p>	<p>12v 55amp: a:44 b:21</p> <p>VOLVO JOHN DEERE JD TY25242 DN 1012112950 NR 022951</p>
<p>ALN1215</p>  <p>ALN1215WA PAL0310 </p>	<p>ALN1272</p>  <p>ALN1272WA ARN6433 PAL0309 </p>	<p>ALN1273</p>  <p>ALN1273WA ARN6221 PAL0300 </p>	<p>ALN1274</p>  <p>ALN1274WA ARN6257 PAL0218 </p>
<p>12v 90amp a:34 b:22 c:54</p> <p>CHRYSLER C00, 420X Stratus ECB, EDZ Voyager CH 4609415 ND 1210003510 HC UA1215</p>	<p>12v 70amp a:90 b:58</p> <p>HONDA B16A2, D16Y7, B16A1 Civic1.6L D16Y6, D16Y8 CRX 1.6L HO 31100PR3003 ND 1002118610 HC JA1272IR</p>	<p>12v 80amp a:32 b:58.5</p> <p>HONDA HO 31100P01G01 ND 1012110220 HC JA1273IR</p>	<p>12v 60amp a:32 b:58.5</p> <p>TOYOTA E10 Corolla Paseo Tercel TO 2706011250 ND 1012113030 HC JA1274IR</p>

























Alternators

Denso

<p>ALN1293</p>  <p>ALN1293WA ARN6452 PAL0227</p>  <p>12v 70amp a:90 b:58</p> <p>MERCEDES-BENZ SUZUKI Atego 2, Tourismo Grand Vitara Liana</p> <p>G13BB M13A J20A SZ 3140077E22 ND 1022115610 HC JA1293IR</p>	<p>ALN1295</p>  <p>ALN1295WA ARN6434 PAL0301</p>  <p>12v 80amp a:34 b:58.5</p> <p>TOYOTA LandCruiser 4.2L</p> <p>TO 2706017030 ND 1002118410 HC JA1295IR</p>	<p>ALN1354</p>  <p>ALN1354WA ARN6220 PAL0301</p>  <p>12v 70amp a:32.5 b:58</p> <p>TOYOTA Van</p> <p>2.2L</p> <p>TO 2706072170 ND 1002117590 HC JA1354IR</p>	<p>ALN1355 <i>New</i></p>  <p>ALN1355WA ARN6440 PAL0223</p>  <p>12v 80amp a:147 b:71</p> <p>FORD C-Max TOYOTA Hiace</p> <p>PNDA IQDA 2L, 3L TO 2704054350 ND 1002131920 HC JA1355IR</p>
<p>ALN1356</p>  <p>ALN1356WA ARN6452 PAL0227</p>  <p>12v 85amp a:88.5 b:58</p> <p>SUZUKI Vitara, Grand Vitara Wagon 2.5L (2000-99) XL7 2.7L (2001-2004)</p> <p>H20A G13BB M13A SU 3140052D10 ND 1022111430 HC JA1356IR</p>	<p>ALN1358</p>  <p>ALN1358WA ARN6254 PAL0503</p>  <p>12v 40amp a:45 b:24.5</p> <p>DAIHATSU Cuore</p> <p>ED10K</p> <p>DH 2706087211000 ND 1002114620 HC JA1358IR</p>	<p>ALN1367</p>  <p>ALN1367WA ARN6453 PAL0223</p>  <p>12v 80amp a:146.5 b:71</p> <p>TOYOTA Hiace</p> <p>2LT 2L</p> <p>TO 2704054280 ND 1002132240 HC JA1367IR</p>	<p>ALN1369</p>  <p>ALN1369WA ARN6440 PAL0223</p>  <p>12v 70amp a:90 b:58</p> <p>TOYOTA Previa</p> <p>2TZFE</p> <p>TO 2706076080 ND 1012110580 HC JA1369IR</p>
<p>ALN1372</p>  <p>ALN1372WA ARN6437 PAL0223</p>  <p>12v 80amp a:36 b:58 c:41</p> <p>TOYOTA LEXUS Corolla Celica Carina</p> <p>E10, E11 T19, T20 J18, H50 TO 2706062090 ND 1012115110 HC JA1372IR</p>	<p>ALN1408</p>  <p>ALN1408WA ARN6224 PAL0302</p>  <p>12v 90amp a:34.5 b:56.5</p> <p>HONDA Odyssey 2.2L 4x4 Accord 2.2L</p> <p>CE, CE1 CF, RA</p> <p>HO 31100P0AAA010 ND 1012115490 HC JA1408IR</p>	<p>ALN1410</p>  <p>ALN1410WA ARN6453 PAL0223</p>  <p>12v 70amp a:94 b:58</p> <p>TOYOTA Land Cruiser 3.4L, 3.0TD 964KZTE 4 Runner 3.0TD (93-96)</p> <p>5VZFE</p> <p>TO 2706067020 ND 1012110480 HC JA1410IR</p>	<p>ALN1414</p>  <p>ALN1414WA ARN6436 PAL0301</p>  <p>12v 80amp a:90 b:56.5</p> <p>HONDA Accord</p> <p>F20A2 F20A6</p> <p>HO CJP28 ND 1002118700 HC JA1414IR</p>






















Alternators

Denso

<p>ALN1417</p>  <p>ALN1417WA ARN6438 PAL0301 </p> <p>12v 90amp a:90 b:58</p> <p>TOYOTA MR2 2.0L MR2 2.2L</p> <p>3SGE</p> <p>TO 2706074180 ND 1002116360 HC JA1417IR</p>	<p>ALN1424</p>  <p>ALN1424WA ARN6452 PAL0227 </p> <p>12v 90amp a:143.5 b:70</p> <p>HONDA, LAND ROVER MG, ROVER Civic, Freelander MG, ZR, ZS 200, 400, 600</p> <p>20T2N</p> <p>RO YLE102080 ND 1002132790 HC JA1424IR</p>	<p>ALN1425</p>  <p>ALN1425RB ALN1425WA ARN6452 PAL0227 </p> <p>12v 80amp a:143 b:70</p> <p>HONDA LAND ROVER Accord Civic 25 2.0 iDT</p> <p>20T2N 20T2R</p> <p>HO 31100P5TG00 ND 1002132540 HC JA1425IR</p>	<p>ALN1428</p>  <p>ALN1428WA ARN6460 PAL0223 </p> <p>24v 30amp a:37 b:58</p> <p>TOYOTA Dyna 3.0L Dyna 3.7L</p> <p>11B</p> <p>TO 2706058220 ND 1012110600 HC JA1482IR</p>
<p>ALN1517</p>  <p>ALN1517WA ALN1517WA ARN6581 PAL0222 </p> <p>12v 90amp a:47.5 b:27 c:39</p> <p>TOYOTA Yaris 1.0</p> <p>1SZFE</p> <p>TO 2706023030 ND 1022119420 HC JA1517IR</p>	<p>ALN1534</p>  <p>ALN1534WA ARN6439 PAL0223 </p> <p>12v 80amp a:92 b:58</p> <p>TOYOTA Land Cruiser 4.2L Diesel</p> <p>1HDT 1HZ, 1HDFE 1HDFTE</p> <p>TO 2706017171 ND 101211527 HC JA1534IR</p>	<p>ALN1535</p>  <p>ALN1535WA ARN6437 PAL0223 </p> <p>12v 70amp a:90 b:58</p> <p>TOYOTA Hiace</p> <p>2RZE 3RZFE 2L</p> <p>TO 2706075100 ND 1012110521 HC JA1535IR</p>	<p>ALN1595</p>  <p>ALN1595WA ALN1595WA ARN6447 PAL0222 </p> <p>12v 90amp a:33 b:18 c:41.5</p> <p>TOYOTA Yaris Yaris Verso</p> <p>1NZFE NCP21</p> <p>TO 2706021020 ND 1022111960 HC JA1595IR</p>
<p>ALN1596</p>  <p>ALN1596WA PAL0218 </p> <p>12v 90amp a:90 b:58</p> <p>MG, ROVER ZS ZT 45 75</p> <p>20K4F 25K4F</p> <p>RO YLE102330 ND 1022111471 HC JA1596IR</p>	<p>ALN1604</p>  <p>ALN1604WA ARN6441 PAL0223 </p> <p>12v 80amp a:96 b:53</p> <p>TOYOTA Picnic Carina E</p> <p>3CTE</p> <p>TO 2706064170 ND 1012119360 HC JA1604IR</p>	<p>ALN1608</p>  <p>ALN1608WA ARN6581 PAL0218 </p> <p>12v 90amp a:90 b:58</p> <p>LAND ROVER Freelander ROVER 75</p> <p>K18 RJ LN</p> <p>RO YLE102290 ND 1022111461 HC JA1608IR</p>	<p>ALN1609</p>  <p>ALN1609WA ARN6254 PAL0503 </p> <p>12v 60amp a:48 b:29</p> <p>DAIHATSU Cuore Move Sirion</p> <p>EJDE K3VE2 EJVE</p> <p>DH 2706097203000 ND 1012112730 HC JA1609IR</p>



















Alternators

Denso

<p>ALN1613</p>  <p>ALN1613WA ARN6301 PAL0112</p>  <p>12v 100amp a:35.5 b:18 c:45.5</p> <p>TOYOTA Avensis Previa Rav 4</p> <p>1AZFE ACR3, 2AZFE XA2 TO 2706028070 ND 1042103780 HC JA1613IR</p>	<p>ALN1616 <i>New</i></p>  <p>ALN1616WA ARN6436 PAL0301</p>  <p>12v 120amp a:94.5 b:57,5</p> <p>JOHN DEERE</p> <p>6076TRW-06 6076TRW 6076A JD AL78690 DO 1002116030 HC JA1616IR</p>	<p>ALN1676</p>  <p>ALN1676WA ARN6554 PAL0218</p>  <p>12v 105amp a:38 b:83 c:43.5</p> <p>MINI Cooper Mini One</p> <p>W10B16A B14A ND 1022112220 BMW 12317509342 HC CA1676IR</p>	<p>ALN1703</p>  <p>ALD1703RB ALN1703WA ARN6441 PAL0223</p>  <p>12v 80amp a:34 b:22 c:40.5</p> <p>TOYOTA Celica Corolla MR2</p> <p>1ZZFE, 3ZZFE 1ZRFE, 4ZZFE TO 2706022120 ND 1022112020 HC JA1703IR</p>
<p>ALN1706</p>  <p>ALN1706RB ALN1706WA PAL0310</p>  <p>12v 90amp a:34 b:12 c:54.5</p> <p>CHRYSLER Voyager</p> <p>B00 L00 EGH CH 4686098 ND 1210003521 HC JA1706</p>	<p>ALN1707</p>  <p>ALN1707WA PAL0310</p>  <p>12v 120amp a:33 b:12 c:54.5</p> <p>CHRYSLER, DODGE Voyager Caravan</p> <p>B00 L00 EGH, EGP, EFA CH 4727329A ND 1210004160 HC JA1707</p>	<p>ALN1710</p>  <p>ALN1710WA PAL0227</p>  <p>12v 120amp a:34 b:12 c:54.5</p> <p>LAND ROVER DEFENDER</p> <p>TD5 10P CH 38522267F ND 1002132530 HC JA1710IR</p>	<p>ALN1719</p>  <p>ALN1719RB ALN1719WA ARN6445 PAL0110</p>  <p>12v 90amp a:91 b:56.5</p> <p>HONDA Prelude 2.0 Shuttle 2.3</p> <p>F20A4 H22A5 F23A7 HO CJU77 ND 1012119770 HC JA1719IR</p>
<p>ALN1720</p>  <p>ALN1720WA PAL0218</p>  <p>12v 75amp a:90 b:58</p> <p>HONDA HR-V 1.6</p> <p>D16W1 D16W5 HO CJX27 ND 1022111780 HC JA1720IR</p>	<p>ALN1721</p>  <p>ALN1721WA ARN6301 PAL0113</p>  <p>12v 130amp a:92 b:53</p> <p>TOYOTA Avensis Verso 2.0L Corolla 1.6L Previa Rav4 2.0L</p> <p>1CDFTV TO 2706027040 ND 1042103051 HC JA1721IR</p>	<p>ALN1722</p>  <p>ALN1722WA ARN6581 PAL0222</p>  <p>12v 70amp a:47.5 b:27 c:39</p> <p>TOYOTA Corolla Yaris</p> <p>2ZZGE 1SZFE TO 2706023010 ND 1022115250 HC JA1722IR</p>	<p>ALN1723</p>  <p>ALD1723RB ALN1723WA ARN6581 PAL0218</p>  <p>12v 90amp a:90 b:58</p> <p>LAND ROVER, MG, ROVER Freelander ZT 75</p> <p>ND 1022111451 LU LRB00468 HC JA1723IR</p>

Alternators

Denso

<p>ALN1724</p>  <p>ALN1724WA ARN6453 PAL0223</p>  <p>12v 120amp a:91.5 b:58</p> <p>TOYOTA Land Cruises</p> <p>1HDFTE</p> <p>TO 2706017230 ND 1012117870 HC JA1724IR</p>	<p>ALN1726</p>  <p>ALN1726WA ARN6335 PAL0110</p>  <p>12v 100amp a:40 b:41 c:45</p> <p>HONDA Accord Civic CR-V</p> <p>K24A3, K20A, K24A K20Z4</p> <p>HO 31100RTA003 ND 1042103291 HC JA1726IR</p>	<p>ALN1783</p>  <p>ALN1783WA ARN6372 PAL0112</p>  <p>12v 120amp a:96 b:53</p> <p>TOYOTA Avensis 2.0L Corolla 2.0L</p> <p>1CDFTV E11</p> <p>TO 2706027030 ND 1022110670 HC JA1783IR</p>	<p>ALN1787</p>  <p>ALN1787WA ARN6445 PAL0110</p>  <p>12v 105amp a:90 b:58</p> <p>HONDA S2000 2.0</p> <p>F20C</p> <p>HO CJV77 ND 1022111770 HC JA1787IR</p>
<p>ALN1792</p>  <p>ALN1792WA ARN6441 PAL0223</p>  <p>12v 90amp a:34 b:17 c:46</p> <p>TOYOTA RAV 4</p> <p>1AZFE</p> <p>TO 2706028110 ND 1022112120 HC JA1792IR</p>	<p>ALN1793</p>  <p>ALN1793WA ARN6447 PAL0222</p>  <p>12v 70amp a:33 b:18 c:41.5</p> <p>TOYOTA Yaris</p> <p>NCP10, NCP21 NLP10 NCP13</p> <p>TO 2706021010 ND 1022115380 HC JA1793IR</p>	<p>ALN1794</p>  <p>ALN1794WA ARN6447 PAL0222</p>  <p>12v 80amp a:33 b:18 c:41.5</p> <p>TOYOTA Yaris Yaris Verso Echo</p> <p>1NZFE 2NZFE</p> <p>TO 2706021030 ND 1022111950 HC JA1794IR</p>	<p>ALN1796</p>  <p>ALN1796WA ARN6455 PAL0112</p>  <p>12v 80amp a:95 b:58</p> <p>TOYOTA Hilux 2.5L Diesel Dyna 2.5L</p> <p>2KDFTV</p> <p>TO 2706030030 ND 1022115600 HC JA1796IR</p>
<p>ALN1797</p>  <p>ALN1797WA ARN6441 PAL0223</p>  <p>12v 100amp a:36 b:18.5 c:45.5</p> <p>TOYOTA Avensis 2.0 RAV 4 Highlander 2.4</p> <p>ST220 XA2 2AZFE</p> <p>TO 2706028060 ND 1012117410 HC JA1797IR</p>	<p>ALN1800</p>  <p>ALN1800WA ARN6581 PAL0222</p>  <p>12v 90amp a:48 b:27 c:39</p> <p>TOYOTA Yaris 1.0L Yaris 1.3L</p> <p>1SZFE 2SZFE</p> <p>TO 270600J020 ND 1022118200 HC JA1800IR</p>	<p>ALN1803</p>  <p>ALN1803WA PAL0221</p>  <p>12v 75amp a:90 b:56</p> <p>SUZUKI Ignis 1.5L Jimny 1.3L Liana 1.3L, 1.6L Swift 1.3L</p> <p>M15A M13A M16A SU 3140080G10 ND 1022112600 HC JA1803IR</p>	<p>ALN1809</p>  <p>ALN1809WA ARN6581 PAL0222</p>  <p>12v 70amp a:49 b:23 c:39</p> <p>TOYOTA Yaris</p> <p>1SZFE 2SZFE</p> <p>TO 270600J030 ND 1022118190 HC JA1809IR</p>
























Alternators

Denso

<p>ALN1822</p>  <p>ALN1822RB ALN1822WA</p> <p>ARN6442 PAL0211</p>  <p>12v 100amp a:49 b:21 c:56</p> <p>RENAULT, VOLVO Laguna 850 C70 S40</p> <p>N7Q700, B4164S B5202S, B5204T B5204T2, B5204T3 VO 9130217 ND 1012115570 HC CA1822IR</p>	<p>ALN1834</p>  <p>ALN1834RB ALN1834WA</p> <p>ARN6364 PAL0233</p>  <p>12v 150amp a:42.5 b:21 c:45.5</p> <p>FORD, MAZDA, VOLVO Focus, C-Max, Kuga C30, C70, S40, V50 3 Fusion</p> <p>HHJA, HHJB G6DA, G6DB G8DA, HHDB VO 30795423 ND 1042103523 HC CA1834IR</p>	<p>ALN1864</p>  <p>ALN1864RB ALN1864WA ALN864WA</p> <p>ARN6601 PAL0233</p>  <p>12v 120amp a:74 b:72 c:69</p> <p>Ford C-Max 2.0L 07-> Focus C-MAX 1.8L/2.0L (03-07) Focus II 1.8L/2.0L 04-></p> <p>CSDA QQDA FO 5M5T10300 ND 1042105800 HC CA1864IR</p>	<p>ALN1865</p>  <p>ALN1865WA</p> <p>ARN6601 PAL0233</p>  <p>12v 120amp a:42.5 b:21 c:45</p> <p>FORD, MAZDA, VOLVO C-Max, Focus, Fiesta Fusion, Kuga C30, C70 S40, V50</p> <p>D4164T, G6DE D4204T, G8DB HHJA, HHJB MZ Y60118300A ND 1042103513 HC CA1865IR</p>
<p>ALN1869</p>  <p>ALN1869WA ALN869WA</p> <p>ARN6330 PAL0218</p>  <p>12v 105amp a:55 b:83 c:43.5</p> <p>MINI Cooper Mini</p> <p>R50, R53 R50, R53</p> <p>BM 12317515030 ND 1022112231 HC CA1869IR</p>	<p>ALN1891</p>  <p>ALN1891WA</p> <p>ARN6447 PAL0222</p>  <p>12v 90amp a:31.5 b:16.5 c:41</p> <p>TOYOTA Yaris 1.4L Diesel Yaris Verso 1.4L Diesel Vitz 1.4L Diesel</p> <p>1NDTV P1 NCPL2 TO 2706033040 ND 1022112780 HC JA1891IR</p>	<p>ALN1892 <i>New</i></p>  <p>ALN1892WA</p> <p>ARN6447 PAL0222</p>  <p>12v 90amp a:31 b:16 c:41.5</p> <p>TOYOTA Yaris 1.4L</p> <p>TO 2706033030 ND 1022112770 HC JA1892IR</p>	<p>ALN1893</p>  <p>ALN1893WA</p> <p>ARN6447 PAL0222</p>  <p>12v 70amp a:31.5 b:16 c:41</p> <p>TOYOTA Yaris 1.4L Diesel Yaris Verso 1.4L Diesel Vitz 1.4L Diesel</p> <p>1NDTV P1 NCPL2 TO 2706033020 ND 1022115660 HC JA1893IR</p>
<p>ALN1925</p>  <p>ALN1925RB ALN1925WA ALN925WA</p> <p>ARE4131 PAL0233</p>  <p>12v 105amp a:10 b:72 c:53</p> <p>FORD C-Max Focus</p> <p>HWDA HXDA ASDA FI 63377407 ND 1022118355 HC CA1925IR</p>	<p>ALN1926</p>  <p>ALD1926RB ALF1926RB ALM1926CA</p> <p>ARN6601 PAL0233</p>  <p>12v 120amp a:74.5 b:72 c:68.5</p> <p>FORD Focus II 1.8/2.0 2004-> C-Max 1.8 2007-></p> <p>AODA, CSDB Q7DA QQDB FO 1530298 ND 1042103531 HC CA1926IR</p>	<p>ALN1929 <i>New</i></p>  <p>ALN1929</p> <p>PAL0112</p>  <p>12v 80amp a:47.5 b:27.5 c:39</p> <p>TOYOTA Yaris 1.3i 2006-</p> <p>2SZFE TO 270600J051 ND 1042109110 HC CA1929IR</p>	<p>ALN1931</p>  <p>ALN1931WA</p> <p>ARN6601 PAL0233</p>  <p>12v 150amp a:75 b:72.5 c:68</p> <p>VOLVO C30 S40 V50</p> <p>B4184S8 B4184S11 B4204S3 VO 30667072 ND 1042102750 HC CA1931IR</p>






Alternators

Denso

<p>ALN1935</p>  <p>ALN1935WA ARE4595 PAL0263</p>  <p>B+ D+ DFM</p> <p>12v 120amp a:41.5 b:65 c:55</p> <p>OPEL, VAUXHALL Astra H, Astra MK Corsa C, Corsa MKII Meriva, Tigra Astravan</p> <p>Z13DTH Y13DT, Y13DTJ Z13DT OP 6204201 ND 1022118630 HC CA1935IR</p>	<p>ALN1941</p>  <p>ALN1941WA ARN6601 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 120amp a:35 b:17 c:52</p> <p>FORD Focus C-Max</p> <p>KKDA FO 4M5T10300KB ND 1042103630 HC CA1941IR</p>	<p>ALN1942</p>  <p>ALN1942WA PAL0112</p>  <p>S+ I+ DFM IG+ I- L</p> <p>12v 90amp a:47.5 b:27.5 c:39</p> <p>TOYOTA Yaris II (P90) 2009-> Auris I (E150) 2010-></p> <p>2SZFE TO 270600J061 ND 1042102310 HC CA1942IR</p>	<p>ALN1949</p>  <p>ALN1949WA</p> <p>12v 80amp a:40.5 b:19.5 c:42</p> <p>CITROEN, PEUGEOT TOYOTA 107 Aygo C1</p> <p>1KRFE CFA, 384F TO 270600Q021 ND 1022118741 HC CA1949IR</p>
<p>ALN1950</p>  <p>ALN1950WA ARN6642 PAL0112</p>  <p>S+ I+ DFM IG+ I- L</p> <p>12v 100amp a:91 b:52.5</p> <p>TOYOTA Avensis Corolla Rav4 Estima</p> <p>1CDFTV E11, T22 E12J, E12U, E12T TO 2706027090 ND 1042103431 HC CA1950IR</p>	<p>ALN1951</p>  <p>ALN1951WA ARN6642 PAL0112</p>  <p>S+ I+ DFM IG+ I- L</p> <p>12v 90amp a:92 b:53</p> <p>TOYOTA Corolla</p> <p>E12J, E12U, E12 TO 2706027060 ND 1022112760 HC CA1951IR</p>	<p>ALN1952</p>  <p>ALN1952WA ARE4595 PAL0263</p>  <p>B+ D+ DFM</p> <p>12v 130amp b:61</p> <p>SAAB 9-3</p> <p>A19DTR Z19DT Z19DTH OP 12759595 ND 1012100162 HC CA1952IR</p>	<p>ALN1958</p>  <p>ALN1958WA ALN3711 ALN3711WA ARN6349 PAL0230</p>  <p>LI RC BVS</p> <p>12v 150amp a:22 b:50 c:48</p> <p>LAND ROVER Discovery 2.7 RangeRover2.7TDVMSport</p> <p>RO YLE500410 ND 1042103950 HC CA1958IR</p>
<p>ALN1962</p>  <p>ALN1962WA ALN962WA ARN6601 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 120amp a:9 b:72 c:51.5</p> <p>Ford Focus C-Max Focus II 1.4L/1.6L Volvo C30, S40, V50 1.6L</p> <p>VO 8603604 ND 1042104022 HC CA1962IR</p>	<p>ALN1964</p>  <p>ALN1964WA ALN964WA ARN6301 PAL0112</p>  <p>S+ I+ DFM IG+ I- L</p> <p>12v 100amp a:30 b:16 c:41</p> <p>TOYOTA Corolla 1.4 Diesel Auris 1.4 D-4D</p> <p>NDE150 E12 1NDTV TO 270600Q070 ND 1042104101 HC CA1964IR</p>	<p>ALN1965</p>  <p>ALN1965WA ALN965WA ARN6302 PAL0116</p>  <p>RLO I+ DFM IG+ I- L</p> <p>12v 100amp a:21.5 b:60 c:71</p> <p>TOYOTA Avensis D-4D Corolla D-4D</p> <p>2ADFHV TO 270600G011 ND 1042104521 HC CA1965IR</p>	<p>ALN1966</p>  <p>ALN1966WA ARN6601 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 150amp a:33.5 b:33 c:91.5</p> <p>VOLVO, FORD C70 S40 V50</p> <p>B5244S5, D5254T3 B5244S4 B5244S VO 1374082 ND 1042103560 HC CA1966IR</p>

Alternators

Denso

<p>ALN1969</p>  <p>ALN1969WA ALN969WA ARE4122</p> <p>12v 120amp a:16 c:50.5</p> <p>FIAT, LANCIA Bravo Delta</p> <p>198A4000 FI 63377426 ND 1012101080 HC CA1969IR</p>	<p>ALN1978</p>  <p>ALN1978WA ARE4741</p> <p>12v 70amp a:29 b:20 c:42</p> <p>CITROEN, PEUGEOT TOYOTA C1 107 Aygo</p> <p>1KRFE CFA, 384F TO 270600Q011 ND 1022118730 HC CA1978IR</p>	<p>ALN1980</p>  <p>ALN1980WA PAL0110</p>  <p>12v 120amp a:36 b:46 c:43.5</p> <p>HONDA Accord Civic CR-V FR-V</p> <p>N22A1 N22A2 HO 31100RBDE01 ND 1042104860 HC CA1980IR</p>	<p>ALN1987</p>  <p>ALE1987WA ALN1987WA ARE1027 PAL0474</p>  <p>12v 120amp a:41 b:64 c:55</p> <p>OPEL, SUZUKI, VAUXHALL Z13DTH Astra-H, Corsa, Meriva Swift, Wagon, Ignis Corsa, Agila</p> <p>Z13DTJ OP 13222936 ND 1012100970 HC CA1987IR</p>
<p>ALN1991 <i>New</i></p>  <p>ALN1991WA ARN6001 PAL0227</p>  <p>12v 140amp a:32.5 b:16 c:55</p> <p>SUZUKI Grand Vitara</p> <p>SZ 3140067J00 ND 1042104660 HC CA1991IR</p>	<p>ALN1999</p>  <p>ALN1999WA ARN6601 PAL0233</p>  <p>12v 150amp b:14 c:52</p> <p>FORD Focus II 1.8TDCi 04-> C-Max 1.8TDCi 07-></p> <p>KKDA FO 4M5T10300UC ND 1042102730 HC CA1999IR</p>	<p>ALN2016</p>  <p>ALN2016WA ARN6317 PAL0213</p>  <p>12v 150amp a:26 b:14 c:65</p> <p>FIAT, ALFA ROMEO Alfa 159 Brera 2.4 Spider 2.4 Croma 2.4</p> <p>939A3000 939A9000 AR 51734825 ND 1042105020 HC CA2016IR</p>	<p>ALN2021</p>  <p>ALN2021WA ARN6302 PAL0451</p>  <p>12v 160amp a:45.5 b:14 c:60</p> <p>CHRYSLER Voyager III (RG) 2.5/2.8 CRD</p> <p>ENR ENC ENJ CH 04868429AC ND 4210000081 HC CA2021IR</p>
<p>ALN2022</p>  <p>ALN2022WA ARN6441 PAL0223</p>  <p>12v 100amp a:90.5 b:58</p> <p>LEXUS IS200 IS300</p> <p>GXE10 JCE10 1GFE TO 2706070500 ND 1012117370 HC CA2022IR</p>	<p>ALN2027</p>  <p>ALN2027WA PAL0112</p>  <p>12v 100amp a:32 b:20 c:51</p> <p>TOYOTA Auris 1.6 Corolla</p> <p>ZRE51 ZRE151R TO 270600T020 ND 1042105350 HC CA2027IR</p>	<p>ALN2029</p>  <p>ALN2029WA ARN6302 PAL0116</p>  <p>12v 130amp a:23.5 b:60 c:71.5</p> <p>TOYOTA LEXUS, IS 220 RAV 4</p> <p>2ADFHV 2ADFTV 2ADFHV TO 2706026030 ND 1042104771 HC CA2029IR</p>	<p>ALN2036</p>  <p>ALN2036WA PAL0112</p>  <p>12v 100amp a:21.5 b:60 c:71</p> <p>TOYOTA Auris 2.0 Corolla 2.0</p> <p>ADE150 ADE150R TO 270600R011 ND 1042105140 HC CA2036IR</p>

Alternators

Denso

<p>ALN2050</p>  <p>ALN2050WA</p> <p>ARN6300 PAL0112</p>  <p>12v 150amp a:33 b:19 c:38</p> <p>LEXUS GS300 GS350 IS250 IS350</p> <p>TO 2706031050 ND 1042104680 WA 11196N</p>	<p>ALN2060</p>  <p>ALN2060</p> <p>ARN6300 PAL0112</p>  <p>12v 150amp a:27 b:20 c:36</p> <p>LEXUS GS350 3.5L IS250 2.5L IS350 3.5L</p> <p>TO 2706031060 ND 1042102060 WA 11196R</p>	<p>ALN2119 <i>New</i></p>  <p>ALN2119</p> <p>ARN6254 PAL0503</p>  <p>12v 45amp a:42 b:15 c:46</p> <p>SUBARU</p> <p>SU 23700KA301 ND 1002119200 MH ALN2119</p>	<p>ALN2121 <i>New</i></p>  <p>ALN2121</p> <p>PAL0110</p>  <p>12v 150amp a:50 b:20 c:37</p> <p>KIA, HYUNDAI Ix 35 2.0L 2010- Santa Fe II 2.2L 2009- Sorento II 2.2L 2009- Sportage 2.0L 2010-</p> <p>D4HA Diesel D4HB Diesel HY 373002F200 ND 1042101060 HC CA2121IR</p>
<p>ALN2125</p>  <p>ALN2125WA</p> <p>PAL0221</p>  <p>12v 45amp a:100 b:57</p> <p>KOMATSU CUMMINS</p> <p>3.3L Diesel 4BT3.3</p> <p>KO 6008611350 ND 1012111250 NR 021250</p>	<p>ALN2130 <i>New</i></p>  <p>ALN2130WA</p> <p>ARN6217</p> <p>24v 45amp a:60 b:15 c:72</p> <p>ISUZU</p> <p>IZ 1002130440 DN 1210001890 MH ALN2130</p>	<p>ALN2140</p>  <p>ALN2140WA</p> <p>PAL0223</p>  <p>12v 70amp a:34 b:18 c:40.5</p> <p>TOYOTA Corolla Combi Corolla Saloon Corolla Verso</p> <p>E12U E12T E12J TO 2706022140 ND 1022115640 HC CA2047IR</p>	<p>ALN2141</p>  <p>ALN2141WA</p> <p>ARN6250 PAL0301</p>  <p>12v 45amp a:90 b:58</p> <p>TOYOTA Corolla Starlet</p> <p>2ELC, 2E 2EL, 1EL 2EE TO 2706010100 ND 1002111280 HC JA141IR</p>
<p>ALN2180</p>  <p>ALN2180WA</p> <p>ARN6302 PAL0116</p>  <p>12v 100amp a:35 b:20 c:51</p> <p>TOYOTA Avensis Combi Blade Verso</p> <p>4D 1.6L, 1.8L, 2.0L</p> <p>TO 270600T050 ND 1042102180 DN DAN1011</p>	<p>ALN2220</p>  <p>ALN2220</p> <p>12v 130amp a:29 b:60 c:72</p> <p>TOYOTA Avensis</p> <p>T27</p> <p>TO 270600R040 ND 1042102220 DN DAN1045</p>	<p>ALN2252</p>  <p>ALN2252WA</p> <p>PAL0301</p>  <p>24v 25amp a:48 b:20 c:67</p> <p>TOYOTA Fork Lift</p> <p>5FD</p> <p>TO 270602306171 ND 1002116950 CG 112252</p>	<p>ALN2271</p>  <p>ALN2271</p> <p>12v 105amp a:41 b:63 c:56</p> <p>FIAT, OPEL LANCIA Astra H Corsa C Punto</p> <p>JTDM F08, F68 W5L AR 51854907 ND 1012101271 DN DAN1001</p>













Alternators

Denso

<p>ALN2320</p>  <p>PAL0116 </p> <p>12v 100amp a:47 b:20 c:42.5</p> <p>TOYOTA Auris D4D</p> <p>TO 270600N040 ND 1042102320 HC CA2097IR</p>	<p>ALN2321</p>  <p>ALN2321WA</p> <p>12v 140amp a:113 b:61</p> <p>ALFA ROMEO, LANCIA 940 Brera Guiletta Spider AR 51854898 Delta ND 1012101321 HC CA1995IR</p>	<p>ALN2343 <i>New</i></p>  <p>PAL0104 </p> <p>12v 55amp a:48 b:14 c:71</p> <p>TOYOTA 1.8L DSL CE70 Corolla 1.8L DSL CM Lite Ace</p> <p>TO 2703064010 ND 1002102343 HC JA143</p>	<p>ALN2381</p>  <p>ARE1027 PAL0474 </p> <p>12v 140amp a:16 b:24.5 c:50</p> <p>FIAT, LANCIA Grande Punto Doblo FI 51859041 Eva ND 1012101381 HC CA2070IR</p>
<p>ALN2440</p>  <p>ALN2440WA</p> <p>PAL0262 </p> <p>12v 120amp a:105 b:48</p> <p>MERCEDES-BENZ, FIAT W204, 204081 ALFA ROMEO, LANCIA JTDM C-class 350, 844 Mito FI 51793678 Musa, Delta ND 1012101101 HC CA2050IR</p>	<p>ALN2470</p>  <p>ALN2470WA</p> <p>12v 100amp a:29 b:19.5 c:37</p> <p>TOYOTA AURIS (06-12) COROLLA (06-) CRUISER (07-) TO 270600Y060 YARIS (05-) ND 1042102470 DN DAN1015</p>	<p>ALN2504 <i>New</i></p>  <p>12v 130amp a:27 b:11 c:69</p> <p>GM 1210004250 DN 1210004251</p>	<p>ALN2600</p>  <p>PAL0503 </p> <p>12v 55amp a:24 b:29</p> <p>DAIHATSU Taruna Terios 1.3L Copen 1.3L DH 2706087403000 ND 1012113450 WA 22894R</p>
<p>ALN2770</p>  <p>ALN2770WA</p> <p>12v 150amp a:26 b:13 c:65</p> <p>ALFA ROMEO Brera Spider 159</p> <p>JTS</p> <p>FI 50502479 ND 1042104840 DN DAN935</p>	<p>ALN2810 <i>New</i></p>  <p>12v 150amp a:26 b:50 c:50</p> <p>LAND ROVER 276DT Discovery IV 2.7 TD 2009-></p> <p>LR LR013843 DN 1042102810</p>	<p>ALN3001</p>  <p>12v 90amp a:48 b:18 c:43</p> <p>TOYOTA Auris Corolla Yaris</p> <p>TO 270600N100 DN 1042113000 DR DRA1095</p>	<p>ALN3020</p>  <p>ARN6441 PAL0223 </p> <p>12v 100amp a:64 b:31</p> <p>LEXUS, TOYOTA SC300 Supra</p> <p>TO 2706046121 ND 1012117020 WA 13547N</p>

Alternators

Denso

<p>ALN3051</p>  <p>ALN3051WA</p> <p>12v 120amp a:34 b:12 c:54</p> <p>CHRYSLER, JEEP ES Daytona ZJ Lebaron Lecar CH 5233608 Grand Cherokee ND 1210004000 CG 113051</p>	<p>ALN3061</p>  <p>ALN3061WA</p> <p>ARN6301 PAL0113</p> <p>12v 140amp a:26 b:17 c:35</p> <p>CADILLAC Deville 4.6L Seville 4.6L PONTIAC GM 25697765 Bonneville 4.6L ND 1042103060 WA 13919N</p>	<p>ALN3066</p>  <p>ALN3066</p> <p>PAL0310</p> <p>12v 90amp a:34 b:22 c:54.5</p> <p>CHRYSLER EGB Dodge EGE Plymouth Intrepid CH 4609034 ND 1210003480 CG 113066</p>	<p>ALN3069</p>  <p>ALN3069WA</p> <p>PAL0310</p> <p>12v 125amp a:34 b:22 c:54</p> <p>CHRYSLER EEB Sebring 2.4 EDZ Sebring 2.5I CH 4671320 ND 1210004210 CG 113069</p>
<p>ALN3070</p>  <p>ALN3070WA</p> <p>PAL0310</p> <p>12v 125amp a:34 b:22 c:54</p> <p>CHRYSLER EPD DODGE EEB, EWB Stratus ECB, EDZ Viper 8.0 CH 4609230AA Cirrus 2.5 ND 1210004260 CG 113070</p>	<p>ALN3071</p>  <p>ALN3071WA</p> <p>ARN6441 PAL0223</p> <p>12v 110amp a:36.5 b:13.5 c:65</p> <p>MAZDA V6 Millenia 2.5L Xedos 2.0L Xedos 2.5L MZ KL4718300 ND 1012117070 WA 13688N</p>	<p>ALN3076</p>  <p>ALN3076WA</p> <p>ARN6221 PAL0300</p> <p>12v 75amp a:91 b:58</p> <p>ISUZU 6VD1 Trooper OPEL, VAUXHALL Monterey A IS 8970348991 Monterey ND 1012110830 CG 113076</p>	<p>ALN3078</p>  <p>ALN3078WA</p> <p>ARN6437 PAL0223</p> <p>12v 80amp a:91 b:58</p> <p>LEXUS, TOYOTA 1FZFE LX 4.5L Land Cruiser 4.5L TO 2706066070 ND 101211527 CG 113078</p>
<p>ALN3079</p>  <p>ALN3079WA</p> <p>ARN6440 PAL0223</p> <p>12v 60amp a:89 b:58</p> <p>TOYOTA 3VZE 4 Runner 3.0 Pick Up 3.0 T100 TO 2706065040 Surf ND 1012110130 CG 113079</p>	<p>ALN3081</p>  <p>ALN3081WA</p> <p>ARN6441 PAL0223</p> <p>12v 80amp a:45 b:23 c:44</p> <p>LEXUS, TOYOTA 1MZFE ES Avalon Camry TO 270600A020 Solara ND 1012119100 CG 113081</p>	<p>ALN3085</p>  <p>ALN3085WA</p> <p>ARN6434 PAL0301</p> <p>12v 100amp a:90.5 b:58.5</p> <p>LEXUS 1UZFE LS TO 2706050010 ND 1002116350 CG 113085</p>	<p>ALN3090</p>  <p>ALN3090WA</p> <p>ARN6439 PAL0227</p> <p>12v 100amp a:89.5 b:58</p> <p>LEXUS 1UZFE LS TO 2706050080 ND 1012117180 CG 113090</p>






















Alternators

Denso

<p>ALN3091</p>  <p>24v 61amp a:58 b:58.5</p> <p>TOYOTA Dyna 400</p> <p>TO 27060E0020 ND 1022114090 UP ALT6180A</p>	<p>ALN3092</p>  <p>ALN3092WA</p> <p>ARN6441 PAL0223</p>  <p>12v 110amp a:40 b:13 c:67</p> <p>MAZDA Millenia 2.3L Xedos 2.3L</p> <p>MZ KJ0118300 ND 1012117090 UP ALT6093</p>	<p>ALN3108 <i>New</i></p>  <p>12v 150amp a:45 b:14 c:36</p> <p>HONDA Civic</p> <p>HO 31100RZ0G01 ND 1042118040 MH ALN3108</p>	<p>ALN3119 <i>New</i></p>  <p>12v 100amp a:42 b:30 c:60</p> <p>TOYOTA Auris</p> <p>TO 270600R090 ND 1042113140 MH ALN3119</p>
<p>ALN3121</p>  <p>ALN3121WA</p> <p>12v 170amp a:30 b:61 c:41</p> <p>BMW 318i 320i 116i</p> <p>E81, E82 E90, E91 E92, E93</p> <p>BM 12317550468 ND 1042106021 DN DAN1040</p>	<p>ALN3125 <i>New</i></p>  <p>12v 150amp a:115 b:60</p> <p>ALFA ROMEO FIAT Doblo Ducato</p> <p>FI 51808561 ND 1042101200 MH ALN3125</p>	<p>ALN3130</p>  <p>ALN3130WA</p> <p>ARN6434 PAL0301</p>  <p>12v 70amp a:32 b:58</p> <p>TOYOTA Carina Camry Celica Supra</p> <p>AT180 3SGTE</p> <p>TO 2706074130 ND 100211832 MH ALN3130</p>	<p>ALN3131</p>  <p>ALN3131WA</p> <p>ARN6302 PAL0451</p>  <p>12v 135amp a:18 b:68 c:80</p> <p>DODGE Caravan CHRYSLER Voyager</p> <p>RG L4</p> <p>CH 4727324AB ND 4210000030 WA 13867N</p>
<p>ALN3133</p>  <p>ALN3133WA</p> <p>ARN6001 PAL0223</p>  <p>12v 130amp a:90 b:57</p> <p>LEXUS LS430 SC430</p> <p>4.3L</p> <p>TO 2706050280 ND 1042103031 WA 13992N</p>	<p>ALN3140</p>  <p>ALN3140WA</p> <p>12v 70amp</p> <p>TOYOTA Land Cruiser Land Cruiser Prado</p> <p>1KZTE</p> <p>TO 2706067140 ND 1022112010 MH ALV3140</p>	<p>ALN3141</p>  <p>ARE9022</p> <p>24v 55amp b:14 c:84</p> <p>JCB Perkins</p> <p>PR 2871A701 ND 1022118140 WA 12814N (80 amp)</p>	<p>ALN3180</p>  <p>ALN3180RB ALN3180WA</p> <p>12v 150amp a:95 b:59</p> <p>RENAULT Satis Vel Satis</p> <p>RE 8973089961 ND 1042103180 MH ALN3180</p>

























Alternators

Denso

<p>ALN3202</p>  <p>PAL0105 </p> <p>24v 85amp a:62 b:16 c:69</p> <p>TOYOTA Coaster 4.2L</p> <p>TO 2706017131 ND 1012116091 CG 113202</p>	<p>ALN3210</p>  <p>ALN3210WA</p> <p>12v 150amp a:22.5 b:27 c:47</p> <p>LAND ROVER 3.6 TD</p> <p>368DT</p> <p>RO YLE500440 ND 1042104010 DN DAN989</p>	<p>ALN3218</p>  <p>ALN3218WA</p> <p>ARN6002 PAL0223 </p> <p>12v 130amp a:43 b:25 c:44</p> <p>LEXUS RX300</p> <p>1MZFE</p> <p>TO 2706020180 ND 1042103121 WA 13905N</p>	<p>ALN3240</p>  <p>ALN3240WA</p> <p>ARN6441 PAL0223 </p> <p>12v 90amp</p> <p>MAZDA Millenia</p> <p>MZ KLK118300 ND 1012117240 WA 13759N</p>
<p>ALN3242</p>  <p>ALN3242WA</p> <p>ARN6002 PAL0223 </p> <p>12v 130amp a:47 b:25 c:42</p> <p>TOYOTA Alphard Estima HighLander</p> <p>TO 2706020170 ND 1042103042 MH ALN3242</p>	<p>ALN3250</p>  <p>ALN250WA ALN3250WA</p> <p>PAL0115 </p> <p>12v 80amp a:29.5 b:19 c:36</p> <p>TOYOTA TOYOTA YARIS HATCHBACK 1.3, 10-></p> <p>TO 270600Y010 ND 1042109250 DN DAN1025</p>	<p>ALN3251</p>  <p>12v 210amp</p> <p>BMW 5 Series</p> <p>BMW 12317591271 ND 1042106250 MH ALN3251</p>	<p>ALN3261 <i>New</i></p>  <p>12v 150amp a:22 b:69 c:25</p> <p>CADILLAC LH2 LC3</p> <p>GM 25756440CY DN 1042103261</p>
<p>ALN3290</p>  <p>ALN3290WA</p> <p>PAL0115 </p> <p>12v 90amp a:29.5 b:19 c:36.5</p> <p>TOYOTA Yaris 1.0l Vitz 1.0l</p> <p>1NRFE</p> <p>TO 270600Y030 ND 1042109290 DN DAN1024</p>	<p>ALN3296</p>  <p>ALN3296WA</p> <p>PAL0296 </p> <p>12v 160amp a:30 b:15 c:60</p> <p>CHRYSLER Pacifica 4.0L DODGE Caravan 4.0L</p> <p>V6 241</p> <p>CH 04801480AB ND 4210000480 WA 11296N</p>	<p>ALN3300</p>  <p>ALN3300WA</p> <p>ARN6453 PAL0223 </p> <p>12v 100amp a:90 b:57</p> <p>LEXUS GS400 LS400 SC400</p> <p>4.0L</p> <p>TO 2706050230 ND 1012117300 WA 13715N</p>	<p>ALN3301</p>  <p>ALN3301WA</p> <p>PAL0451 </p> <p>12v 145amp a:31 b:14 c:61</p> <p>CHRYSLER Pacifica V6 3.5L</p> <p>CH 04868760AD ND 4210000301 WA 11063N</p>

Alternators

Denso

<p>ALN3311</p> <p>ALN3311WA</p>  <p>ARN6441 PAL0223</p>  <p>L IG S</p> <p>12v 100amp a:89 b:56</p> <p>LEXUS GS300</p> <p>TO 2706046270 ND 1012117800 WA 13791N</p>	<p>ALN3324</p> <p>ALN3324WA</p>  <p>ARN6003 PAL0280</p>  <p>P L F S</p> <p>12v 140amp a:61 b:44</p> <p>PONTIAC, BUICK Bonneville Lesabre</p> <p>3.8L</p> <p>GM 25758348 ND 1042103300 WA 11035N</p>	<p>ALN3358</p>  <p>PAL0450</p>  <p>F1 F2</p> <p>12v 117amp a:33 b:13.5 c:54</p> <p>JEEP, DODGE Cherokee 2.5L Wrangler 2.5L Dakota Pickup 2.5L</p> <p>CH 56005685AC ND 1210003620 CG 113358</p>	<p>ALN3364</p>  <p>ALN3364WA</p> <p>PAL0450</p>  <p>F1 F2</p> <p>12v 136amp a:33.5 b:13 c:54</p> <p>DODGE Person US Dakota Durango Ram Pickup</p> <p>CH 56027913AC ND 1210004351 CG 113364</p>
<p>ALN3365</p>  <p>ALN3365WA</p> <p>PAL0450</p>  <p>F1 F2</p> <p>12v 120amp a:26 b:12 c:68</p> <p>CHRYSLER Person US DODGE Person US Intrepid 2.7L Concorde 2.7L</p> <p>EER</p> <p>CH 4609999AB ND 1210004232 CG 113365</p>	<p>ALN3389</p>  <p>ALN3389WA</p> <p>ARN6015 PAL0113</p>  <p>S I L FR IG I L</p> <p>12v 150amp a:90 b:60</p> <p>TOYOTA Sequoia</p> <p>TO 270600F110 ND 1042103390 WA 11090N</p>	<p>ALN3390</p>  <p>PAL0227</p>  <p>L IG</p> <p>24v 70amp a:91 b:59</p> <p>TOYOTA Dyna</p> <p>TO 2706059390 ND 1022110470 UP ALT6183A</p>	<p>ALN3415</p>  <p>ALN3415WA</p> <p>ARN6691 PAL0450</p>  <p>F1 F2</p> <p>12v 120amp a:22 b:68 c:88</p> <p>CHRYSLER Sebring 2.4L, 2.7L DODGE Stratus 2.4L, 2.7L</p> <p>CH 04606755AA ND 4210000060 MH ALN3415</p>
<p>ALN3433</p>  <p>ALN3433WA</p> <p>ARN6445 PAL0113</p>  <p>S I L FR IG I L</p> <p>12v 110amp a:90.5 b:58.5</p> <p>ACURA RL</p> <p>C35A1</p> <p>HO 31100P5A003 ND 1012117270 CG 113433</p>	<p>ALN3440</p>  <p>ALN3440WA</p> <p>ARN6015 PAL0113</p>  <p>S I L FR IG I L</p> <p>12v 130amp a:89 b:60</p> <p>TOYOTA, LEXUS GX470 4Runner</p> <p>4.7L</p> <p>TO 2706050320 ND 1042103440 WA 13983N</p>	<p>ALN3442</p>  <p>ALN3442WA</p> <p>ARN6441 PAL0223</p>  <p>L IG S</p> <p>12v 100amp a:45 b:25 c:44</p> <p>LEXUS, TOYOTA ES300 Camry</p> <p>TO 2706020230 ND 1012117450 WA 13956N</p>	<p>ALN3450</p>  <p>ALN3450</p> <p>PAL0221</p>  <p>L IG C</p> <p>12v 70amp a:48 b:27 c:39</p> <p>DAIHATSU Sirion 1.3L Terios 1.3L YRV 1.3L</p> <p>N11, J1 M3J, M2 YRV, 4WD</p> <p>TO 2706097401 ND 1022115450 DN DAN977</p>

Alternators

Denso

<p>ALN3456 <i>New</i></p>  <p>12600074 70</p> <p>12v 120amp a:115 b:61</p> <p>FIAT 500</p> <p>312A1000 312A3000</p> <p>FI 51820622 ND 1012101331 DN DAN1083</p>	<p>ALN3460</p>  <p>ALN3460WA</p> <p>ARN6015 PAL0113</p>  <p>12v 130amp a:90 b:58</p> <p>TOYOTA, LEXUS LX 470 Land Cruiser</p> <p>4.7L 2UZFE</p> <p>TO 2706050330 ND 1042103460 WA 1293601ND</p>	<p>ALN3470</p>  <p>ALN3470WA</p> <p>ARN6300 PAL0113</p>  <p>12v 130amp a:39 b:18 c:32</p> <p>TOYOTA FJ Cruiser 4.0 Tacoma 4.0 Tundra 4.0</p> <p>TO 2706031010 ND 1042103470 WA 11139N</p>	<p>ALN3471</p>  <p>ALN3471WA</p> <p>ARN6323 PAL0113</p>  <p>12v 100amp a:33 b:19 c:37</p> <p>TOYOTA, LEXUS Avalon RX 330</p> <p>2GRFE</p> <p>TO 270600P140 ND 1042104470 WA 11136N</p>
<p>ALN3472</p>  <p>ALN3472WA ALN470WA</p> <p>12v 130amp a:22 b:24 c:50</p> <p>Toyota Landcruiser GRJ200, UZJ200, VDJ200</p> <p>4.5 V8 1VDFTV</p> <p>TO 2706051010 ND 1042105470 MH ALN3472</p>	<p>ALN3480</p>  <p>ALN3480WA</p> <p>ARN6441 PAL0223</p>  <p>12v 80amp a:35 b:17 c:47</p> <p>TOYOTA Camry 2.4 Solara 2.4</p> <p>TO 2706028170 ND 1022112480 WA 13958N</p>	<p>ALN3542</p>  <p>ALN3542WA</p> <p>12v 150amp a:84 b:48 c:69</p> <p>FORD Focus 2.0L Focus C-Max 2.0L</p> <p>FO 3M5T10300XC ND 1042103541 MH ALN3542</p>	<p>ALN3559</p>  <p>ALN3559WA</p> <p>PAL0450</p>  <p>12v 136amp a:27 b:12 c:68</p> <p>JEEP DODGE Dakota Durango Grand Cherokee</p> <p>CH 56041324AC ND 1210004250 CG 113559</p>
<p>ALN3560</p>  <p>ALN3560WA</p> <p>ARE4634</p> <p>12v 70amp a:90 b:57</p> <p>SUBARU, SUZUKI Justy 1.3L Ignis 1.3L</p> <p>G3X</p> <p>SU 3140086G00 ND 1022118560 HC CA2077IR</p>	<p>ALN3564</p>  <p>ALN3564WA</p> <p>PAL0450</p>  <p>12v 136amp a:34 b:13 c:54</p> <p>CHRYSLER DODGE Ram Durango</p> <p>CH 56028238AB ND 1210004470 CG 113564</p>	<p>ALN3571</p>  <p>ALN3571WA</p> <p>ARN6445 PAL0110</p>  <p>12v 80amp a:91 b:56</p> <p>HONDA ACURA Accord CL</p> <p>F23A5, F23A1, F23A4</p> <p>HO 31100PAAA01 ND 1012119990 CG 113571</p>	<p>ALN3607</p>  <p>ALN3607WA</p> <p>PAL0450</p>  <p>12v 136amp a:27 b:12 c:68</p> <p>JEEP Cherokee</p> <p>EKG</p> <p>CH 56028692AA ND 1210004540 CG 113607</p>












Alternators

Denso

<p>ALN3627</p>  <p>ALN3627WA ARN6439 PAL0223</p>  <p>12v 80amp a:34 b:18 c:40</p> <p>CHEVROLET L4 Prizm 1.8L TOYOTA Corolla 1.8L</p> <p>TO 270600D010 ND 1012119960 CG 113627</p>	<p>ALN3628</p>  <p>ALN3628WA ARN6445 PAL0110</p>  <p>12v 95amp a:89.5 b:58</p> <p>HONDA D15A1 Integra B20A3 Prelude B20A1</p> <p>HO 31100P3FJ01 ND 1022111260 CG 113628</p>	<p>ALN3630</p>  <p>ALN3630WA ARN6453 PAL0223</p>  <p>12v 80amp a:90 b:57</p> <p>TOYOTA 2.4L 4Runner 2.7L Tacoma</p> <p>TO 2706075160 ND 1012119630 WA 13885N</p>	<p>ALN3645</p>  <p>ALN3645WA ARN6445 PAL0110</p>  <p>12v 80amp a:89 b:58</p> <p>HONDA D16Y7, D16Y8, B16A2 Civic 1.6L</p> <p>HO 31100P2T003 ND 1012119250 CG 113645</p>
<p>ALN3651</p>  <p>ALN3651WA</p> <p>12v 120amp a:22.5 b:49 c:47</p> <p>LANDROVER 368DT RANGE ROVER SPORT</p> <p>RO YLE500430 ND 1042104651 DN DAN990</p>	<p>ALN3690</p>  <p>ALN3690WA ARN6349</p> <p>12v 150amp a:24 c:53</p> <p>LAND ROVER Discovery III 2.7L TD Range Rover Sport 2.7L TD</p> <p>RO YLE500190 ND 4280003691 DN DAN991</p>	<p>ALN3700 <i>New</i></p>  <p>ALN3700WA</p> <p>12v 120amp a:44 b:64 c:58</p> <p>ALFA ROMEO FIAT</p> <p>ND 1012101700 MH ALN3700</p>	<p>ALN3711</p>  <p>ARN6349 PAL0230</p>  <p>12v 150amp a:27 b:40 c:50</p> <p>LAND ROVER Discovery III 2.7L TD Range Rover Sport 2.7L TD</p> <p>RO YLE500200 ND 1042103711 WA 24028N</p>
<p>ALN3727</p>  <p>PAL0221</p>  <p>12v 70amp a:32 b:58</p> <p>DAIHATSU G200, G3 Charade G202, G301 Gran Move G203</p> <p>DH 2706087727000 ND 1022115270 DN DAN970</p>	<p>ALN3751</p>  <p>ALN3751WA ARN6301 PAL0113</p>  <p>12v 130amp a:45 b:25 c:44</p> <p>TOYOTA, LEXUS RX330 HighLander Sienna</p> <p>TO 2706020280 ND 1042103750 WA 11032N</p>	<p>ALN3755</p>  <p>12v 120amp a:76 b:48</p> <p>JAGUAR XK 8, 4.0</p> <p>DN 9761219755 DN DAN671</p>	<p>ALN3760</p>  <p>PAL0223</p>  <p>12v 80amp a:45 b:25 c:44</p> <p>TOYOTA V6 Camry 3.0L</p> <p>TO 2706020060 ND 1012119690 MH ALN3760</p>


Alternators

Denso

<p>ALN3762</p>  <p>PAL0221 </p> <p>12v 120amp a:54 b:32</p> <p>JAGUAR XJ XK 8 Vanden Plas</p> <p>NAW, NBW QDV QEV JA LNC1800AA ND 9761219763 MH ALN3762</p>	<p>ALN3763</p>  <p>ALN3763WA ARE4123</p> <p>12v 85amp b:13 c:82</p> <p>LAND ROVER, JCB TEREX TX860B 409ZX 2001-2008 MANITOU MLT735</p> <p>3.5I V8 DHMC RO YLE10099 ND 1022118161 CG 113763</p>	<p>ALN3790</p>  <p>ALN3790WA ARN6301 PAL0113 </p> <p>12v 100amp a:46 b:24 c:45</p> <p>TOYOTA Camry 3.0L Camry Solara 3.3L LEXUS RX330 3.3L</p> <p>1MZFE TO 270600A120 ND 1042104180 WA 11033R</p>	<p>ALN3800</p>  <p>ALN3800WA PAL0218 </p> <p>12v 115amp a:89 b:59</p> <p>LAND ROVER Freelander I 2.5i</p> <p>KV6MPI RO YLE102480 ND 1022110800 WA 11031N</p>
<p>ALN3803</p>  <p>ALN3803WA ARN6302 PAL0451 </p> <p>12v 160amp a:30 b:50.5</p> <p>CHRYSLER, DODGE VOYAGER Caravan Town & Country</p> <p>EGH EGM EGA CH 04868430AB ND 4210000021 CG 113803</p>	<p>ALN3804</p>  <p>ALN3804WA ARN6691 PAL0450 </p> <p>12v 160amp a:20 b:14 c:61</p> <p>JEEP Grand Cherokee Commander</p> <p>WI 90295559 ND 4210000363 CG 113804</p>	<p>ALN3860</p>  <p>ALN3860WA ALN860WA ARN6343 PAL0115 </p> <p>12v 140amp a:94 b:58.5</p> <p>JAGUAR X Type 2.5 3.0</p> <p>JA 1X4310300BD ND 1022110860 MH ALN3860</p>	<p>ALN3861</p>  <p>ALN3861WA ARN6453 PAL0223 </p> <p>12v 100amp</p> <p>LEXUS LX470 4.7L TOYOTA Land Cruiser 4.7L</p> <p>TO 2706050260 ND 1012117860 MH ALN3861</p>
<p>ALN3870</p>  <p>ALN3870WA ARN6343 PAL0115 </p> <p>12v 120amp a:98 b:59</p> <p>JAGUAR X-Type 2.5L X-Type 2.5L V6 X-Type 3.0L X-Type 3.0L V6</p> <p>CF1 FO 1X4310300CB ND 1022110870 WA 13926N</p>	<p>ALN3880</p>  <p>ALN3880WA ARN6301 PAL0113 </p> <p>12v 150amp b:17 c:45.5</p> <p>PONTIAC, TOYOTA Vibe Corolla Camry Matrix</p> <p>L4 TO 2706028310 ND 1042104880 WA 11195N</p>	<p>ALN3881</p>  <p>ALN3881WA ARN6301 PAL0113 </p> <p>12v 100amp a:37 b:18 c:45</p> <p>TOYOTA Camry 2.4 Highlander 2.4 Solara 2.4 Scion TC 2.4</p> <p>2AZFE TO 270600H100 ND 1042105330 WA 11034N</p>	<p>ALN3890</p>  <p>ALN3890WA PAL0113 </p> <p>12v 130amp a:32 b:19 c:38</p> <p>LEXUS ES350 3.5L RX350 3.5L TOYOTA High Lander 3.5L</p> <p>TO 2706031110 ND 1042104890 MH ALN3890</p>























Alternators

Denso

<p>ALN3893</p>  <p>ALN3893WA ARE4320 PAL0113</p>  <p>12v 90amp a:30 b:18 c:39.5</p> <p>E12J E12T</p> <p>TOYOTA AURIS 1.4L VVT COROLLA 1.4L VVT-i</p> <p>TO 270600D191 ND 1012100891 DN DAN1021</p>	<p>ALN3950</p>  <p>PAL0230</p>  <p>12v 150amp a:89 b:66 c:52</p> <p>LANDROVER 276DT</p> <p>LR YLE500420 ND 1042103951 DN DAN988</p>	<p>ALN3969</p>  <p>ALN3969WA ALN411WA ARN6015 PAL0112</p>  <p>12v 100amp a:96 b:59</p> <p>TOYOTA LandCruiser 3.0L DSL</p> <p>TO 2706030060 ND 1042103411 CG 113969</p>	<p>ALN3970</p>  <p>ALN3970WA ARN6004 PAL0110</p>  <p>12v 100amp a:57 b:16 c:42</p> <p>MINI One 1.4L Diesel 1ND R50 R53 BM 12317790879 ND 1042103732 CG 113970</p>
<p>ALN3989</p>  <p>ALN0071 ALN3989WA ARN6240 PAL0223</p>  <p>12v 50amp a:99 b:58</p> <p>TOYOTA Fork Lift Various Models</p> <p>TO 270607820371 ND 1012113731 CG 113989</p>	<p>ALN3990</p>  <p>ALN3990WA ARN6441 PAL0223</p>  <p>12v 80amp a:41 b:18 c:39</p> <p>TOYOTA, PONTIAC 2ZZGE Celica Corolla Matrix Vibe</p> <p>TO 2706022080 ND 1022111990 WA 13879N</p>	<p>ALN4002 <i>New</i></p>  <p>ALN4002WA</p> <p>12v 145amp a:42 b:13 c:69</p> <p>DODGE RAM STERLING</p> <p>CH 04801311AD DN 4210000510</p>	<p>ALN4050 <i>New</i></p>  <p>12v 150amp a:51 b:35 c:96</p> <p>VOLVO S40 2.4L S40 2.5L</p> <p>VO 8602920 ND 1042104050 WA 11093N</p>
<p>ALN4085</p>  <p>ARN6450 PAL0219</p>  <p>12v 40amp a:44 b:24</p> <p>KUBOTA RX502</p> <p>KU 1640464012 ND 1012111030 CG 114085</p>	<p>ALN4090</p>  <p>ARN6601 PAL0233</p>  <p>12v 120amp a:25 c:87</p> <p>FORD</p> <p>FO 5F9Z10346BA ND 1042104091 WA 11238R</p>	<p>ALN4097</p>  <p>ARN6348 PAL0219</p>  <p>12v 60amp a:99 b:57</p> <p>CUMMINS KOMATSU Various Models 4B</p> <p>Nippondenso equipped KO 6008611611 ND 1012112941 CG 114097</p>	<p>ALN4113</p>  <p>ALN4113WA ARN6462 PAL0227</p>  <p>24v 60amp a:90 b:58</p> <p>KOMATSU Fork lift Industrials</p> <p>Diesel Nippondenso equipped KO 6008616410 ND 1022114050 CG 114113</p>

Alternators

Denso

<p>ALN4190 <i>New</i></p>  <p>PAL0503 </p> <p>12v 60amp a:43.5 b:21.5</p> <p>ISEKI Agricultural</p> <p>IS 62812000150 ND 1012112040 CG 114190</p>	<p>ALN4210 <i>New</i></p>  <p>ALN4210WA ARN6324 PAL0243 </p> <p>12v 140amp a:40 b:24 c:24</p> <p>CADILLAC CTS</p> <p>2.8L V6 3.6L V6</p> <p>GM 25751145 DN 1042103191 WA 11044N</p>	<p>ALN4211 <i>New</i></p>  <p>12v 100amp a:28 b:18 c:38</p> <p>TOYOTA Corolla Yaris</p> <p>TO 270600Y130 ND 1042113090 MH ALN4211</p>	<p>ALN4214 <i>New</i></p>  <p>ALN4214WA ARN6015 PAL0113 </p> <p>12v 130amp a:69 b:37</p> <p>LEXUS GS430 LEXUS LS430</p> <p>ESF EZB V8 TO 2706050340 ND 1042104000 WA 11197N</p>
<p>ALN4218</p>  <p>ALN4218WA ARN6450 PAL0219 </p> <p>12v 55amp a:95 b:57</p> <p>CATERPILLAR Backhoe Loaders Track Tractor Wheel Loader</p> <p>Perkins 3054</p> <p>CA 1052811 ND 1012112240 CG 114218</p>	<p>ALN4220 <i>New</i></p>  <p>ALN4220WA ARN6324 PAL0243 </p> <p>12v 135amp a:35 b:22 c:36</p> <p>BUICK CHEVROLET PONTIAC</p> <p>GM 15139480 DN 1042104220</p>	<p>ALN4241</p>  <p>ALN4241WA PAL0227 </p> <p>12v 105amp a:90 b:58</p> <p>LAND ROVER Freelander</p> <p>18K4F</p> <p>RO YLE101890 ND 1012119920 CG 114241</p>	<p>ALN4251</p>  <p>ARN6254 PAL0503 </p> <p>12v 60amp a:43.5 b:21</p> <p>KUBOTA</p> <p>D950</p> <p>KU 1661564011 ND 1012112850 CG 114251</p>
<p>ALN4256 <i>New</i></p>  <p>ALN4256WA ARN6449 PAL0219 </p> <p>12v 70amp a:92.5 b:58.5</p> <p>KUBOTA Agricultural vehicles Industrial vehicles</p> <p>KU 1926064012 ND 1012110690 CG 114256</p>	<p>ALN4263</p>  <p>ALN4263WA ARN6450 PAL0219 </p> <p>12v 50amp a:44 b:21</p> <p>JOHN DEERE Various Models</p> <p>Diesel</p> <p>KU 1749064010 ND 1012113410 CG 114263</p>	<p>ALN4270 <i>New</i></p>  <p>12v 150amp a:26 b:22 c:62</p> <p>LAND ROVER Discovery 4</p> <p>LR 8W8310300BA ND 1042101470 MH ALN4270</p>	<p>ALN4330 <i>New</i></p>  <p>ALN4330WA ARN6324 PAL0243 </p> <p>12v 140amp a:43 b:22 c:35</p> <p>CHEVROLET Cobalt PONTIAC Pursuit</p> <p>2.2L L4</p> <p>GM 22737105 ND 1042104330 WA 11140N</p>




















Alternators

Denso

<p>ALN4360 <i>New</i></p> <p>ALN4360WA</p>  <p>ARN6324 PAL0243</p>  <p>12v 140amp a:60 b:32 c:56</p> <p>BUICK</p> <p>CM 25764632 DN 1042104360</p>	<p>ALN4362</p> <p>ALN4362WA</p>  <p>PAL0223 ARN6453</p> <p>12v 80amp b:58</p> <p>TOYOTA 5VZFE 4 Runner Hilux Land Cruiser</p> <p>TO 2706062160 ND 1012114131 CG 114362</p>	<p>ALN4363</p> <p>ALN4363WA</p>  <p>ARN6460 PAL0223</p>  <p>24v 60amp a:92 b:58.5</p> <p>TOYOTA BU222LT80 Dyna EU Trucks</p> <p>TO 2706058260 ND 1012117910 CG 114363</p>	<p>ALN4364</p>  <p>ARN6046 PAL0470</p>  <p>24v 70amp a:98 b:58</p> <p>CATERPILLAR 914G Diesel Wheel Loaders Caterpillar 3054</p> <p>CT 3E7772 ND 1012117920 CG 114364</p>
<p>ALN4369</p>  <p>ARN6440 PAL0223</p>  <p>12v 100amp a:147 b:20</p> <p>TOYOTA 3L Hilux Hiace Land Cruiser</p> <p>TO 2704054360 ND 1002131930 CG 114369</p>	<p>ALN4372</p>  <p>PAL0103</p>  <p>12v 50amp a:50 b:14 c:97</p> <p>TOYOTA 2L Hilux 4x4 2.0L</p> <p>TO 27030YE010 ND 1002104620 CG 114372</p>	<p>ALN4380 <i>New</i></p> <p>ALN4380WA</p>  <p>PAL0110</p>  <p>12v 150amp a:48 b:32 c:110</p> <p>CADILLAC</p> <p>CM 25766345 DN 1042104380 WA 11037N</p>	<p>ALN4381</p>  <p>12v 136amp a:24 b:69 c:86</p> <p>CHRYSLER DODGE</p> <p>CH 05033756AB ND 4210000380 WA 11285N</p>
<p>ALN4411 <i>New</i></p>  <p>PAL0503</p>  <p>12v 40amp a:61 b:29</p> <p>ARCTIC CAT Lombardini Engines Motorcycles</p> <p>LO 1157326 DN 1012113720 MH ALE4411</p>	<p>ALN4433</p> <p>ALN4433WA</p>  <p>ARN6453 PAL0223</p>  <p>12v 80amp</p> <p>TOYOTA 4.7L LEXUS LX470 LANDCRUISER</p> <p>TO 2706050250 ND 102211137 CG 114433</p>	<p>ALN4434</p> <p>ALN4434WA</p>  <p>ARN6453 PAL0223</p>  <p>12v 100amp a:91 b:58</p> <p>TOYOTA 2UZFE Tundra Pickup 4.7L Sequoia 4.7L</p> <p>TO 270600F020 ND 1022110610 CG 114434</p>	<p>ALN4470 <i>New</i></p>  <p>12v 70amp a:85 b:58</p> <p>TOYOTA 3SFE Camry Picnic</p> <p>TO 2706074470 ND 1012110640 MH ALN4470</p>

















Alternators

Denso

<p>ALN4550 <i>New</i></p>  <p>12v 150amp a:19 b:14 c:61</p> <p>JEEP Commander 5.7L Grand Cherokee 5.7L Grand Cherokee 6.1L</p> <p>ESF EZB CH 56044380 ND 4210000550 HC 113802</p>	<p>ALN4560 <i>New</i></p> <p>ALN4560WA</p>  <p>ARN6329 PAL0110 </p> <p>12v 150amp a:64 b:26 c:80</p> <p>CHEVROLET</p> <p>CM 10335498 DN 1042104560</p>	<p>ALN4584</p> <p>ALN4584WA</p>  <p>ARN6445 PAL0110 </p> <p>12v 110amp a:95 b:63</p> <p>ACURA TL 2.5L</p> <p>HO 31100P1RA02 ND 1012119860 CG 114584</p>	<p>ALN4593</p> <p>ALN4593WA</p>  <p>ARN6441 PAL0223 </p> <p>12v 100amp</p> <p>LEXUS RX300 3.0 US Market</p> <p>3.0L TO 2706020110 ND 1012117840 CG 114593</p>
<p>ALN4594</p> <p>ALN4594WA</p>  <p>ARN6445 PAL0110 </p> <p>12v 130amp a:80 b:45</p> <p>HONDA Odyssey</p> <p>3.5L HO 31100P8FA01 ND 1012117851 CG 114594</p>	<p>ALN4595</p> <p>ALN4595WA</p>  <p>ARN6441 PAL0223 </p> <p>12v 100amp a:45 b:25 c:45</p> <p>TOYOTA Sienna 3.0</p> <p>TO 270600A040 ND 1012117750 CG 114595</p>	<p>ALN4670 <i>New</i></p> <p>ALN4670WA</p>  <p>a:148 b:70</p> <p>TOYOTA Hiace</p> <p>TO 2704054670 ND 1002133041</p>	<p>ALN4683</p> <p>24v 80amp b:13 c:103</p> <p>CATERPILLAR DAIHATSU</p> <p>CA 1779953 DN 1012118271</p>
<p>ALN4708 <i>New</i></p>  <p>PAL0503 </p> <p>12v 50amp a:47 b:29</p> <p>DAIHATSU</p> <p>K3VE HEEJ DA 2706087402 DN 1012113450 TO 2706087402</p>	<p>ALN4713</p>  <p>12v 150amp a:33.5 b:19.5 c:36.5</p> <p>TOYOTA</p> <p>TO 270600P183 ND 1042104713</p>	<p>ALN4730 <i>New</i></p>  <p>ARN6450 PAL0219 </p> <p>12v 40amp b:22</p> <p>KUBOTA STEINER</p> <p>V1505BH KU 1667864011 DN 1002114730 MH ALN4730</p>	<p>ALN4770 <i>New</i></p>  <p>ARN6449 PAL0219 </p> <p>12v 80amp a:87 b:57</p> <p>Various Industrials TOYOTA Hiace</p> <p>2RZE MI 32A6804722 DN 1022119050 CG 114770</p>










Alternators

Denso

<p>ALN4910 <i>New</i></p>  <p>ALN4910WA ARN6011 PAL0223</p>  <p>L IG S</p> <p>12v 140amp a:85 b:58</p> <p>FORD LINCOLN</p> <p>FO 3W4Z10346AA DN 1042104910</p>	<p>ALN5010 <i>New</i></p>  <p>ALN5010WA PAL0450</p>  <p>F1 F2</p> <p>12v 150amp a:35 b:11 c:54</p> <p>CHRYSLER DODGE</p> <p>CH 56029915AB DN 4210000150</p>	<p>ALN5015 <i>New</i></p>  <p>ALN5015WA</p> <p>24v 50amp a:50 b:13 c:70</p> <p>NISSAN Trucks</p> <p>FEB68 FE6T NE6 NI 23100Z5602 NI 2310095015 MH ALN5015</p>	<p>ALN5040 <i>New</i></p>  <p>ALN5040WA</p> <p>12v 140amp a:87 b:55</p> <p>JAGUAR</p> <p>FO 2W9310300AA DN 1042105040 JA 02C2P1974</p>
<p>ALN5068</p>  <p>12v 145amp a:46 b:26 c:34</p> <p>CHEVROLET</p> <p>CE 96673483 DN DAN1068</p>	<p>ALN5090 <i>New</i></p>  <p>ALN5090WA ARN6301 PAL0113</p>  <p>S I L FR IG I L</p> <p>12v 150amp a:37 b:22 c:46</p> <p>TOYOTA</p> <p>TO 270600S020 DN 1042105090</p>	<p>ALN5214 <i>New</i></p>  <p>PAL0503</p>  <p>I IG L</p> <p>24v 25amp a:47 b:20 c:68</p> <p>TOYOTA Lift Trucks</p> <p>TO 2706096300 ND 1002114103 WA 12210N</p>	<p>ALN5215 <i>New</i></p>  <p>12v 40amp a:45 b:13 c:73</p> <p>CATERPILLAR</p> <p>CT 7N6118 ND 0210007360 CG 111796</p>
<p>ALN5361</p> <p>12v 150amp a:45 b:28 c:26</p> <p>JAGUAR LAND ROVER</p> <p>AJ126 508PN 508PS JA 8W8310300AB DN 1042105361 LR LR011231</p>	<p>ALN5380 <i>New</i></p>  <p>ALN5380WA ARN6329 PAL0243</p>  <p>L I M C R F R B R</p> <p>12v 150amp a:55 b:25 c:81</p> <p>CHEVROLET Impala 2008 3.9l</p> <p>GM 15846253 DN 1042105380</p>	<p>ALN5435</p>  <p>12v 150Amp a:50 b:21</p> <p>JOHN DEERE</p> <p>JD AM880701 DN 1012112200 YA 12905277220</p>	<p>ALN5540 <i>New</i></p>  <p>ALN5540WA</p> <p>12v 80amp a:85 b:56</p> <p>DAIHATSU TOYOTA</p> <p>K3VE</p> <p>TO 2706097505 ND 1022115540 MH ALN5540</p>






Alternators

Denso

<p>ALN5910 <i>New</i></p>  <p>ARN6601 PAL0233</p>  <p>12v 150amp a:50 b:35 c:55</p> <p>VOLVO C70, S40, V50 HYUNDAI KIA</p> <p>B5244S4, B5244S5 B5254T3 VO 36001463 ND DAN1059</p>	<p>ALN5920 <i>New</i></p> <p>ALN5920WA</p> <p>PAL0110</p>  <p>12v 130amp</p> <p>ACURA 3.5L HONDA 3.7L Pilot Odyssey TO 31100RGWA01 RIDGELINE ND 1042105920 WA 11391R</p>	<p>ALN6032 <i>New</i></p>  <p>ARN6436 PAL0301</p>  <p>12v 120amp a:94.5 b:57.5</p> <p>JOHN DEERE Agricultural machines</p> <p>JD AL78690 ND 1002116030 HC JA864IR</p>	<p>ALN6065</p>  <p>24v 50amp a:44 b:20 c:68</p> <p>Hyundai Truck R60-5 DH605</p>
<p>ALN6072</p>  <p>24v 20amp a:40 b:21</p> <p>HYUNDAI RH80</p>	<p>ALN6100 <i>New</i></p>  <p>ALN6100WA</p> <p>ARN6343 PAL0233</p>  <p>12v 200amp a:39 b:53 c:76</p> <p>FORD PICKUP 6.4 (2008-2010)</p> <p>FO 7C3Z10346EA DN 1042106100</p>	<p>ALN6110 <i>New</i></p>  <p>12v 90amp a:30 b:19 c:52</p> <p>TOYOTA 1ZRFE Aups Corolla</p> <p>TO 270600T010 DN DAN1061</p>	<p>ALN6160 <i>New</i></p>  <p>ALN6160WA</p> <p>12v a:42 b:20 c:41</p> <p>BUICK CHEVROLET GMC SATURN</p> <p>GM 20838975 DN 042106160</p>
<p>ALN6250 <i>New</i></p>  <p>ARN6460 PAL0223</p>  <p>12v 70amp a:90 b:57</p> <p>TOYOTA Coaster Bus CHRYSLER</p> <p>TO 2706017120 ND 1002116250 UP ALT6183</p>	<p>ALN6280 <i>New</i></p>  <p>12v 220amp a:35 b:27 c:22</p> <p>LAND ROVER 448DT Range Rover III 4.4 TDV8 Range Rover IV 4.4 SDV8 2010-></p> <p>LR LR055316 ND 1042106280 DN DAN1110</p>	<p>ALN6360 <i>New</i></p>  <p>ARN3099 PAL0410</p>  <p>12v 160amp a:41 b:20 c:43</p> <p>RANGE ROVER 2.2 Diesel Evoque</p> <p>FO BJ3210300AC ND 1042106360</p>	<p>ALN6671 <i>New</i></p>  <p>PAL0104</p>  <p>12v 50amp a:43.5 b:12 c:66.5</p> <p>DAIHATSU 2A Charmant 3A TOYOTA 4A Tercel TO 2702015022 Corolla ND 201006671 HC JA138IR</p>

Alternators

Denso

<p>ALN7030 <i>New</i></p>  <p>12v 100amp a:55 b:21</p> <p>FI 98445488 ND 1012117030 NR 027030</p>	<p>ALN7080 <i>New</i></p>  <p>PAL0110 </p> <p>12v 90amp a:31 b:20 c:52</p> <p>TOYOTA 1.6L Auris 1.8L Corolla</p> <p>TO 270600T080 ND z DN DAN1057</p>	<p>ALN7212</p>  <p>12v 65amp a:48 b:29</p> <p>DAIHATSU Copen</p> <p>DH 27060972120000 TO 27060972120 DN DAN975</p>	<p>ALN7502 <i>New</i></p>  <p>12v 65amp a:46 b:27 c:39.5</p> <p>TOYOTA 1.3l DAIHATSU Atrai Bus</p> <p>TO 2706097502 ND 1022115460 DN DAN978</p>
<p>ALN7603</p>  <p>12v 45amp a:66 b:13 c:111</p> <p>DAIHATSU DL ROCKY Hard Top 2.8L DL50 Wildcat 2.8L DL51 Fourtrak 2.8L DH 2703087603 DN 1002102220</p>	<p>ALN7706 <i>New</i></p>  <p>PAL0104 </p> <p>12v 45amp a:28 b:14 c:65</p> <p>DAIHATSU 1.0L DSL Charade TOYOTA</p> <p>TO 2703087706 ND 1002103240 HC JA190</p>	<p>ALN7887 <i>New</i></p>  <p>12v 95amp a:90 b:55</p> <p>HONDA Accord F23Z5 ISUZU</p> <p>HO 31100PEAA01 ND 1022111020 CG 113612</p>	<p>ALN7890</p>  <p>ALN7890WA ARN6289 PAL0113 </p> <p>12v 120amp a:40.5 b:73 c:74.5</p> <p>JAGUAR</p> <p>JG XR8310300BC ND 1012117890 HC CA2073IR</p>
<p>ALN7910 <i>New</i></p>  <p>ARN6439</p> <p>12v 80amp a:35 b:17 c:41</p> <p>TOYOTA 4ZZ-FE Auris 1.4L 3ZZ-FE avensis 1.6L 1.8 L Corolla 1.4L 1.6L</p> <p>TO 2706022260 ND 1042108190 DN DAN1079</p>	<p>ALN7946</p>  <p>PAL0301 </p> <p>12v 35amp a:40 b:24</p> <p>JOHN DEERE INDUSTRI</p> <p>JD AT195649 DN 1012111242</p>	<p>ALN8010 <i>New</i></p>  <p>PAL0450 </p> <p>12v 150amp a:34 b:13 c:62</p> <p>CHRYSLER</p> <p>CH 4608826AA DN 4210000180</p>	<p>ALN8410 <i>New</i></p>  <p>12v 80amp a:40 b:17 c:32</p> <p>TOYOTA GGN15, GGN25 Hilux GRJ71, GRJ79 Land Cruiser GRJ120, GRJ125 Fortuner TO 2706031011 ND 1042108410 MH ALN8410</p>

Alternators

Denso

ALN8910 New	ALN9031 New	ALN9150	ALN9181 New
	 <p>ALN9031WA ARN6890 PAL0206</p> 		 <p>ALN9181WA</p>
<p>12v 120amp a:75 b:34</p> <p>ALFA ROMEO 199B6000 Mito 312A2000 FIAT Punto FI 51922437 500L DN 1042113250 FI 51922437</p>	<p>12v 90amp a:42 b:12 c:81</p> <p>ISUZU 4JA1 4JH1 4JK1 IZ 8980060840 ND 1072109031 MH ALN9031</p>	<p>12v 80amp a:59 b:27 c:39</p> <p>TOYOTA 3SZVE Avanza K3VE TO 27060BZ100 DN 1042109150</p>	<p>12v 80amp a:30 b:19 c:51</p> <p>TOYOTA 2NZFE Yaris TO 270600M070 DN 1042109181</p>
ALN9212 New	ALN9213 New	ALN9221	ALN9940 New
 <p>ALN9212WA ARN6343 PAL0233</p> 	 <p>ALN9213WA PAL0450</p> 	 <p>ARN6308 PAL0110</p> 	 <p>ALN9940WA ARN6439 PAL0219</p> 
<p>12v 150amp a:48 b:24</p> <p>FORD LINCOLN FO 9L3T10300CB DN 1042101110</p>	<p>12v 130amp a:34 b:12 c:62</p> <p>CHRYSLER DODGE CH 04606622AA DN 4210000120</p>	<p>12v 70amp a:91.5 b:70</p> <p>ND 1042109021</p>	<p>12v 110amp a:92 b:58</p> <p>YANMAR 6LP Marine YA 1002119940 ND 1002119940 CG 113715</p>


Alternators

Ford

<p>ALF0057</p>  <p>ALF0057WA ARM3268 PAL0238</p>  <p>12v 75amp a:36 b:78</p> <p>FORD MERCURY</p> <p>FO E83Z10346A FO E8DZ10346A HC JA1168IR</p>	<p>ALF0394 <i>New</i></p>  <p>ARF2540</p> <p>12v 100amp a:104.5 b:76.5</p> <p>FORD LINCOLN MERCURY US Passenger Cars</p> <p>2.4L, 3.0L 4.2L 5.0L, 5.8L FO E1BF10300CA FO D9BF10300AA CG 112914</p>	<p>ALF0434 <i>New</i></p>  <p>ARF2540</p> <p>12v 70amp b:76.5</p> <p>AMC FORD LINCOLN MERCURY</p> <p>FO D7OF10300AA FO D8VF10346CA HC UA969</p>	<p>ALF0439 <i>New</i></p>  <p>12v 120amp a:40 b:14 c:52</p> <p>FORD Focus 1.8L C-Max 1.8L</p> <p>KKDA KKDB</p> <p>FO 4M5T10300AB MH ALF0431</p>
<p>ALF0928 <i>Old</i></p>  <p>ALF0928WA ARF2540</p> <p>12v 90amp b:76</p> <p>FORD LINCOLN MERCURY</p> <p>FO D5ZF10300AA FO E8DF10300CA HC UA928</p>	<p>ALF0962</p>  <p>ALF0962WA ARF2479 PAL0237</p>  <p>12v 95amp a:37 b:55 c:62</p> <p>FORD, MAZDA US MERCURY US Aerostar, Bronco, E B2300, B2500, B3000, B400MF GL308RM Tracer</p> <p>FO F07U10300AA HC CA962IR</p>	<p>ALF0963</p>  <p>ALF0963WA ARF2794 PAL0237</p>  <p>12v 130amp a:40 b:55 c:74</p> <p>FORD Explorer V6 E Series E, F</p> <p>FO F2TU10300AF FO F3UU10300AF HC UA963IR</p>	<p>ALF1005</p>  <p>12v 78amp a:21 b:92</p> <p>CHRYSLER DODGE</p> <p>CH 5213540 CH 5213762 HC UA956</p>
<p>ALF1034</p>  <p>ALF1034WA ARF2786 PAL0236</p>  <p>12v 95amp a:47 b:57</p> <p>FORD Mondeo 1.8 Mondeo 2.5</p> <p>FO 1021397 FO 97BB10300BD HC CA1034IR</p>	<p>ALF1210</p>  <p>ALF1210WA ARF2190 PAL0237</p>  <p>12v 75amp a:95.5 b:76</p> <p>FORD Mustang F 250 E 350</p> <p>FO F0TU10300EA FO E79F10300BA HC UA1210IR</p>	<p>ALF1316</p>  <p>ALF1316WA ARF2786 PAL0236</p>  <p>12v 130amp a:49.5 b:25.5</p> <p>FORD, MERCURY Mondeo Contour Cougar Mystique</p> <p>SEA SEB FO 96BB10300BA FO F5RU10346BC HC CA1316IR</p>	<p>ALF1340</p>  <p>ALE1340RB ALF1340WA ALN1340RB ARE4131 PAL0238</p>  <p>12v 80amp a:11.5 b:71.5</p> <p>FORD Focus 1.4 Focus 1.6</p> <p>FYDA, FYDB, FYDC HWDA, FXDA, FYDD FXDB, FXDC, FXDD FO 1073090 FO 98AB10300GL HC CA1340IR</p>

Alternators

Ford

<p>ALF1635</p>   <p>ALF1635WA</p> <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 115amp a:40 b:55 c:74</p> <p>FORD Mondeo 1.8 Mondeo 2.0</p> <p>CGBA, CGBB CHBA, CHBB CJBA, CJBB VI 2015001004 FO 1S7T10300CF HC CA1635IR</p>	<p>ALF1638</p>   <p>ALF1638RB ALF1638WA ALF638WA</p> <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 115amp a:39 b:55 c:74</p> <p>Ford Mondeo III 1.8L/2.0L/2.0L 2.2TDCi/2.5L V6 (00-07) CJBB Jaguar X-TYPE 2.0D/2.2D 01-> VI 2015001005 FO 1S7T10300BB HC CA1638IR</p>	<p>ALF1737</p>   <p>ALM1737WA</p> <p>ARM3503 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 70amp a:9.5 b:72 c:53</p> <p>FORD, MAZDA Fiesta Fusion 2</p> <p>FXJA, FXJB FYJA, FYJB M7JA, M7JB MAZD C40118300 FO 2S6T10300CB HC CA1737IR</p>	<p>ALF1758</p>   <p>ALF1758WA ALF758WA</p> <p>ARF2610 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 90amp a:40 b:55 c:74</p> <p>FORD Ka 1.3L</p> <p>A9A, A9B VI 2015001001 FO 2S6T10300FA HC CA1758IR</p>
<p>ALF1777</p>   <p>ALF1777RB ALF1777WA</p> <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 80amp a:42 b:21 c:45.5</p> <p>FORD, MAZDA Fiesta 1.4i Fusion 1.4i 2 1.4i</p> <p>F6JA F6JB VI 2015001002 FO 1140135 HC CA1777IR</p>	<p>ALF1779</p>   <p>ALB1779WA ALF1779WA</p> <p>ARB0255 PAL0231</p>  <p>LDFM S</p> <p>12v 110amp a:40 b:55 c:74</p> <p>FORD Transit 2.4i</p> <p>D2FA, D4FA D2FB, D2FE F4FA, DOFA VI 2015001007 FO 2C1T10300BA HC CA1779IR</p>	<p>ALF1780</p>   <p>ALM1780WA</p> <p>ARM3503 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 105amp a:11 b:72 c:52</p> <p>FORD, MAZDA Fiesta Fusion 2</p> <p>FXJA, FXJB, FYJA FUJA, FUJB, FYJB M7JA, M7JB MAZD C40118300 FO 2S6T10300DC HC CA1780IR</p>	<p>ALF1839 <i>New</i></p>   <p>ALF1839</p> <p>PAL0237</p>  <p>A S I</p> <p>12v 75amp a:41.5 b:13 c:66.5</p> <p>FORD Ranger MAZDA B2500 Pickup</p> <p>2.5L T DSL WL MZ WL8118300 FO F8RU10300BA HC CA1839IR</p>
<p>ALF1857</p>   <p>ALF1857RB ALF1857WA</p> <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 125amp b:14 c:69</p> <p>FORD Focus 1.8i Tourneo 1.8i Transit 1.8</p> <p>C9DC, C9DA C9DB, BHDA BHDB, HCPA VI 2015001008 FO 2T1U10300AF HC CA1857IR</p>	<p>ALF1989</p>   <p>ALF1989WA</p> <p>ARE4135 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 105amp b:14.5 c:52</p> <p>FORD C-Max Focus</p> <p>KKDA VO 30667017 FO 4M5T10300LC HC CA1989IR</p>	<p>ALF2034</p>   <p>ALF2034WA ALF234WA</p> <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 90amp a:39 b:55 c:74</p> <p>Ford Fiesta, Ka 1.3L, 1.6L</p> <p>BAJA, A9JA, CDRA VO 2015001001 FO 2S6T10300FA HC CA2034IR</p>	<p>ALF2585</p>   <p>ALF2585WA</p> <p>ARF2479 PAL0237</p>  <p>A S I</p> <p>12v 130amp a:50 b:26</p> <p>FORD, MERCURY Super Cab Super Duty Super Lightning Thunderbird 4.6</p> <p>99W FO F75U10300CA FO F7PU10346KA CG 112585</p>





Alternators

Ford

<p>ALF2836</p>  <p>ALF2836WA ARF2190 PAL0237</p> <p>12v 65amp b:76</p> <p>FORD, MERCURY Escort, Taurus 2.5L Tempo, Cougar 3.8L EXP 1.9L, Lynx 1.9L Ranger 2.9L, Sable</p> <p>FO E39F10346BA FO E43F10300EA CG 112836</p>	<p>ALF2918</p>  <p>ALF2918WA ARF2795 PAL0237</p> <p>12v 95amp a:43 b:54 c:77</p> <p>FORD Escort 2.0l ZX 2.0l</p> <p>FO F7PU10300JA FO F7PZ10346JA CG 112918</p>	<p>ALF2921</p>  <p>ALF2921WA ARF2479 PAL0237</p> <p>12v 95amp a:50 b:26</p> <p>FORD, LINCOLN MERCURY Crown 4.6L Town Car 4.6L Grand Marquis 4.6L</p> <p>FO F1VY10346B FO F3VU10300AA CG 112921</p>	<p>ALF2924</p>  <p>ALF2924WA ARF2479 PAL0237</p> <p>12v 130amp a:102.5 b:76</p> <p>FORD US E F</p> <p>FO F6PU10346XA FO F2UZ10346B CG 112924</p>
<p>ALF2928</p>  <p>ALF2928WA ARF2479 PAL0237</p> <p>12v 95amp b:76</p> <p>FORD US Aerostar E F</p> <p>MF GL353 FO F69U10300AA CG 112928</p>	<p>ALF2929</p>  <p>ALF2929WA ARF2479 PAL0237</p> <p>12v 95amp a:97 b:76</p> <p>LINCOLN US Town Car 5.0l</p> <p>FO F0VU10300AA CG 112929</p>	<p>ALF2931</p>  <p>ALF2931WA ARF2479 PAL0237</p> <p>12v 130amp a:97 b:77</p> <p>FORD Taurus 3.0 GL</p> <p>FO GL329 FO F3DU10300BB CG 112931</p>	<p>ALF2932</p>  <p>ALF2932WA ARF2785 PAL0236</p> <p>12v 130amp a:49 b:25.5</p> <p>FORD Crown 4.6 Crown 4.6 S</p> <p>WI 90025067 FO F5AU10300AA CG 112932</p>
<p>ALF2940</p>  <p>ALF2940WA ARF2479 PAL0237</p> <p>12v 95amp a:48.5 b:25.5</p> <p>FORD E F</p> <p>WI 90025084 FO F6PZ10346RA CG 112940</p>	<p>ALF2942</p>  <p>ALF2942WA ARF2796 PAL0238</p> <p>12v 130amp a:49.5 b:30.5</p> <p>FORD Crown Explorer</p> <p>FO F5OU10300FB FO F5OY10346A CG 112942</p>	<p>ALF2943</p>  <p>ALF2943WA ARF2798 PAL0238</p> <p>12v 130amp a:49 b:30.5</p> <p>FORD Crown Mustang LINCOLN</p> <p>V8 FO F6LU10300CA FO F6ZU10300BB CG 112943</p>	<p>ALF2944</p>  <p>ALF2944WA ARF2796 PAL0238</p> <p>12v 130amp a:75 b:45</p> <p>FORD, MERCURY Taurus 3.0l US Sable 3.0l</p> <p>MF GL335 FO F6DU10300BB CG 112944</p>




















Alternators

Ford

<p>ALF2946</p>  <p>ALF2946WA ARF2798 PAL0238 A D I</p> <p>12v 130amp a:39.5 b:55.5 c:56</p> <p>FORD, MERCURY Explorer 4.0I US Explorer 5.0I US Mountaineer 4.0I US Mountaineer 4.0I US</p> <p>WI 90025086 FO F77U10300AB CG 112946</p>	<p>ALF2947</p>  <p>ALF2947WA ARF2600 PAL0228 I D A</p> <p>12v 135amp a:49 b:26</p> <p>FORD, MERCURY Crown Grand Marquis</p> <p>WI 90025093 FO F8AU10300AC CG 112947</p>	<p>ALF2949</p>  <p>ALF2949WA ARF2600 PAL0228 I D A</p> <p>12v 110amp a:40 b:55 c:74</p> <p>FORD Excursion F</p> <p>WI 90025092 FO F81U10300EB CG 112949</p>	<p>ALF2951</p>  <p>ALF2951WA ARF2359 PAL0233 FR SIG A LI RC A</p> <p>12v 105amp a:98 b:76.5</p> <p>FORD Windstar</p> <p>FO XF2U10300AB FO XF2Z10346AA CG 112951</p>
<p>ALF2952</p>  <p>ALF2952WA ARF2602 PAL0229 I FR A</p> <p>12v 105amp a:34 b:14 c:63</p> <p>FORD, MERCURY</p> <p>FO 98BB10300CC FO F8RZ10346CC CG 112952</p>	<p>ALF2954</p>  <p>ALF2954WA ARF2600 PAL0233 FR SIG A LI RC A</p> <p>12v 105amp a:50 b:25.5</p> <p>FORD Mustang</p> <p>FO XR3U10300AA FO XR3U10300AB CG 112954</p>	<p>ALF2956</p>  <p>ALF2956WA ARF2601 PAL0233 FR SIG A LI RC A</p> <p>12v 130amp a:39.5 b:55.5 c:74</p> <p>FORD V6 Windstar 3.8L</p> <p>FO XF2U10300BC FO XF2Z10346BA CG 112956</p>	<p>ALF2958</p>  <p>ALF0413 ALF2958WA ARF2359 PAL0228 I D A</p> <p>12v 110amp a:34 b:14 c:63.5</p> <p>FORD US, MAZDA US L4 Escape 2.0L Focus 2.0L Tribute 2.0L</p> <p>FO 1L8U10300AC FO 1L8Z10346AB CG 112958</p>
<p>ALF2959</p>  <p>ALF2959WA ARF2601 PAL0229 I FR A</p> <p>12v 110amp a:40 b:55 c:40</p> <p>FORD US L4 Focus 2.0I MAZDA TRIBUTE 3.0L</p> <p>FO 98AB10300FC FO 98AZ10346FA CG 112959</p>	<p>ALF2961</p>  <p>ALF2961WA ARF2603 PAL0229 I FR A</p> <p>12v 110amp a:40.5 b:55 c:74</p> <p>FORD US, MAZDA US V6 Escape 3.0L Tribute 2.0L Tribute 3.0L</p> <p>FO 1L8U10300CD FO 1L8Z10346CB CG 112961</p>	<p>ALF2962</p>  <p>ALF2962WA ARF2479 PAL0237 A S I</p> <p>12v 130amp a:50 b:26</p> <p>FORD V8 Crown 4.6L V10 F Series 5.4L Super Cab V10 Gas</p> <p>FO F65U10300BB FO F85U10300BA CG 112962</p>	<p>ALF3046 <i>New</i></p>  <p>ALF3046 ARF2606 PAL0229 I FR A</p> <p>12v 135amp a:44 b:25</p> <p>FORD Expedition 4.6L(281) V8 LINCOLN Navigator 5.4L(330) V8</p> <p>FO 3L7410300AA FO 3L7410346AA WA 8303N</p>










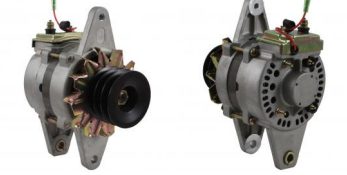


Alternators

Ford

<p>ALF3146 <i>New</i></p>  <p>ARF2797 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 130amp a:45 b:70 c:78</p> <p>FORD Escape MAZDA Tribute MERCURY Mariner</p> <p>2.3L(140) L4</p> <p>FO 6L8Z10346MA FO 5L8T10300MC WA 8404N</p>	<p>ALF3171</p>  <p>ALF3171WA</p> <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 115amp a:40 b:22 c:74</p> <p>FORD Focus 2.3I US</p> <p>2.3L 4-140</p> <p>FO 1S7T10300AA FO 1S7Z10346AA WA 8439R</p>	<p>ALF3173</p>  <p>ALF3173WA</p> <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 115amp a:41 b:55 c:86.5</p> <p>FORD Mondeo 2.5L</p> <p>FO 1S7T10300DA FO 1S7T10300DB CG 113709</p>	<p>ALF3236</p>  <p>ALF3236WA</p> <p>ARF2479 PAL0237</p>  <p>A S I</p> <p>12v 75amp a:28 b:13 c:66</p> <p>FORD US, MERCURY US Escort Tempo Tracer</p> <p>FO F0CU10300AA FO F3CU10346AC CG 113236</p>
<p>ALF3403</p>  <p>ALF3403WA</p> <p>ARF2797 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 130amp a:23 b:75 c:85</p> <p>FORD, MAZDA, MERCURY V6 US CARS Tribute 3.0L Mariner 3.0L Escape 3.0L</p> <p>FO 5L8T10300KC FO 5L8Z10346KA MH ALF3403</p>	<p>ALF3544</p>  <p>ALF3544WA</p> <p>PAL0231</p>  <p>LDFM S</p> <p>12v 95amp a:39.5 b:55.5 c:74</p> <p>FORD Transit 2.4L DI Tourneo 2.4L 2000-2001</p> <p>D4FA, F4FA D2FE, H9FA D2FA, FXFA</p> <p>CG 113544</p>	<p>ALF3649 <i>New</i></p>  <p>ARF2611 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 105amp a:49 b:55 c:74</p> <p>FORD Fiesta 2.0I 2005- N4JB</p> <p>FO 1343649 FO 5S6Y10300AA WA 8533N</p>	<p>ALF4103 <i>New</i></p>  <p>ARF2786 PAL0236</p>  <p>I S A</p> <p>12v 130amp a:35 b:12 c:81</p> <p>FORD</p> <p>UP ALT1710 FO F4PU10300AA DR F4PU10300AA</p>
<p>ALF4603</p>  <p>ARF2795 PAL0237</p>  <p>A S I</p> <p>12v 130amp a:98 b:75</p> <p>FORD Taurus 3.0L Windstar 3.0I v6</p> <p>FO F3PU10346CA CG 112936</p>	<p>ALF5005</p>  <p>ALB5005</p> <p>12v 135amp a:45 b:25</p> <p>FORD LINCOLN MERCURY</p> <p>FO 3W1Z10346CA BO 0986UR0505</p>		

















Alternators

Hitachi

<p>ALH0039</p>  <p>ALH0039WA ARH5212</p> <p>12v 40amp a:42 b:13 c:80</p> <p>NISSAN King Cab Pick Up Urvan 2.2 Lift Trucks</p> <p>SD22, SD23 SD25 NI 23099R8109 HI LR140130B HC JA565IR</p>	<p>ALH0043</p>  <p>ALH0043WA PAL0503</p> <p>12v 45amp a:42 b:13 c:67</p> <p>SUBARU Justy 1.0L, 1.2L Libero</p> <p>EF10, EF12 SU 23700KA021 HI LR145701 HC JA652IR</p>	<p>ALH0045</p>  <p>ALH0045WA ARH5747</p> <p>12v 130amp a:40 b:12 c:90</p> <p>NISSAN, INFINITI Amada 5.6L Pathfinder 4.0L Titan 5.6L QX56 5.6L</p> <p>NI 23100EA20A HI LR1130703A MH ALH0045</p>	<p>ALH0050</p>  <p>ALH0050WA ARH5741 PAL0224</p> <p>12v 110amp a:31 b:13 c:80</p> <p>NISSAN, SUZUKI Equator Pickup 2.5L Frontier Pickup 2.5L</p> <p>NI 23100EA00B HI LR1110724B MH ALH0050</p>
<p>ALH0078</p>  <p>ALH0078WA PAL0500</p> <p>24v 15amp a:43 b:14 c:80</p> <p>NISSAN Lift Trucks</p> <p>SD33T Diesel Engine NI 23100L6001 HI LT21537C WA 12116N</p>	<p>ALH0082</p>  <p>ALH0082WA ARH5251 PAL0305</p> <p>12v 60amp a:42 b:13 c:77</p> <p>HONDA, ISUZU Passport 2.6 Amigo Pick Up Rodeo</p> <p>4ZE1 IS 2912763360 HI LR160725B CG 112978</p>	<p>ALH0104</p>  <p>ALH0104WA ARH5210 PAL0501</p> <p>12v 50amp a:42 b:13 c:80.5</p> <p>NISSAN Bluebird Cherry Micra Sunny</p> <p>Z20E, L20B Z20, Z22, Z24 A14S, E15, A15S NI 23100H7700 HI LR15098 HC JA104IR</p>	<p>ALH0109</p>  <p>ALH0109WA ARH5210 PAL0501</p> <p>12v 55amp a:41 b:13 c:80</p> <p>Subaru Leone</p> <p>EA82 EA65 EA71 SU 429907340 HI LR150110 HC JA109IR</p>
<p>ALH0116</p>  <p>ALH0116WA ARH5215 PAL0502</p> <p>12v 35amp a:42 b:13.5 c:81.5</p> <p>MAZDA B 1800 323 E</p> <p>H816 D5 NA IS 5812003381 HI LR135126 HC JA116IR</p>	<p>ALH0150</p>  <p>ALH0150WA ARH5708</p> <p>24v 45amp a:45 b:14 c:71</p> <p>NISSAN PK310</p> <p>NI 2310097068 HI LR24020B MH ALH0150</p>	<p>ALH0151</p>  <p>ALH0151WA ARH5708</p> <p>24v 45amp a:50 b:15 c:70</p> <p>NISSAN FD6, FD6T, FE6B, FE6C FE6T, PD6H, PE6, PE6H PE6T, PE6TA, PE6TC PF6H, RE8, RE10, R</p> <p>NI 2310096074 HI LR23512B HI ALH0151</p>	<p>ALH0166</p>  <p>ALH0166WA ARH5242 PAL0200</p> <p>12v 70amp a:35.5 b:20 c:81.5</p> <p>NISSAN Prairie Sunny Pulsar Stanza</p> <p>CA20E, CA16S CA16D, CA20S CA18D NI 23100D4400 HI LR170715 HC JA166IR</p>
























Alternators

Hitachi

<p>ALH0180</p>  <p>ALH0180WA</p> <p>ARH5212 PAL0502</p>  <p>12v 60amp a:50 b:13 c:84.5</p> <p>FORD, KIA, MAZDA Econovan Besta E</p> <p>R203, R207 R2 RF MZ R21318300B HI LR160412 HC JA180IR</p>	<p>ALH0207</p>  <p>ALH0207WA</p> <p>PAL0503</p>  <p>12v 60amp a:45 b:13 c:82</p> <p>YANMAR Engine</p> <p>3TG66 3TG72 YA 12390077210 HI LR160735B CG 112671</p>	<p>ALH0216</p>  <p>ALH0216WA</p> <p>RVH001 PAL0200</p>  <p>12v 80amp a:46 b:25 c:80</p> <p>KOMATSU, YANMAR WB</p> <p>YA 12391077210 HI LR180763 CG 114262</p>	<p>ALH0369</p>  <p>12v 50amp a:38 b:13 c:98.5</p> <p>ISUZU</p> <p>IS 8941503960 HI LT150196 HC JA681</p>
<p>ALH0382</p>  <p>ALH0382WA</p> <p>ARH5205 PAL0200</p>  <p>12v 70amp a:41 b:13 c:77.5</p> <p>OPEL Corsa</p> <p>4EC1 T4EC1 IS 8970430640 HI LR170419 HC JA871IR</p>	<p>ALH0390</p>  <p>ALH0390WA</p> <p>12v 50amp a:45 b:13 c:81</p> <p>ISUZU HYUNDAI DH55</p> <p>IS 8972012810 HI LR150715 NR 023180</p>	<p>ALH0442 <i>New</i></p>  <p>ALH0442WA</p> <p>ARH5811 PAL0500</p>  <p>12v 35amp a:38.5 b:11.5 c:80.5</p> <p>CHEVROLET KOMATSU NISSAN SUBARU TCM</p> <p>A10S A12, A14 H20PU NI 2310091004 HI LT12506 CG 110128</p>	<p>ALH0470 <i>New</i></p>  <p>12v 90amp a:42 b:12 c:67</p> <p>NISSAN Cube</p> <p>CR14DE NI 23100CT00B HI LR190765B MH ALH0470</p>
<p>ALH0577</p>  <p>ALH0577WA</p> <p>ARH5212 PAL0502</p>  <p>12v 50amp a:51 b:13 c:80.5</p> <p>FORD MAZDA Econovan E</p> <p>RF R203, R207 MZ R20118300A HI LR150407 HC JA577IR</p>	<p>ALH0660</p>  <p>ALH0660WA</p> <p>ARH5205 PAL0200</p>  <p>12v 50amp a:42 b:13 c:80.5</p> <p>NISSAN King Cab 2.7L Pick Up 2.5L Terrano 2.7L</p> <p>TD25 TD27 TD27T NI 2310043Q04 HI LR150428 HC JA660IR</p>	<p>ALH0661</p>  <p>ALH0661WA</p> <p>ARH5204 PAL0100</p>  <p>12v 50amp a:49 b:13 c:98.5</p> <p>CHEVROLET US, ISUZU USC223 ISUZU, OPEL Luv, Pick Up, Trooper Campo, Trooper</p> <p>4JA1 OP 94405044 HI LR150201 HC JA661IR</p>	<p>ALH0669</p>  <p>12v 60amp a:30 b:13 c:80</p> <p>NISSAN</p> <p>NI 2309909W10 HI LR16097B HC JA669IR</p>













Alternators

Hitachi

<p>ALH0672</p>  <p>ALH0672WA ARH5253 PAL0200 </p> <p>24v 35amp a:42 b:13 c:80.5</p> <p>NISSAN SD33T Patrol 2.8L L28 Patrol 3.2L SD33 Patrol 3.3L NI 23100C8604 HI LR235402 HC JA672IR</p>	<p>ALH0673</p>  <p>ALH0673WA ARH5252 PAL0305 </p> <p>12v 70amp a:42 b:13 c:80</p> <p>OPEL, VAUXHALL 15D, 15DT Corsa 1.5L 4EC1, T4EC1 Nova Novavan OP 1204062 HI LR170411 HC JA673IR</p>	<p>ALH0678</p>  <p>ALH0678WA ARH5205 PAL0200 </p> <p>12v 70amp a:42.5 b:13.5 c:78</p> <p>NISSAN TD23 King Van 2.3L TD25 King Van 2.5L SD23 Urvan 2.3L NI 2310002N14 Urvan 2.5L HI LR170408 HC JA678IR</p>	<p>ALH0680</p>  <p>ALH0680WA ARH5252 PAL0305 </p> <p>12v 50amp a:42 b:13 c:75</p> <p>BEDFORD, ISUZU 22DIE VAUXHALL 4FD1, 4FC1T Midi W Series OP 6204057 HI LR150438 HC JA680IR</p>
<p>ALH0695</p>  <p>ALH0695WA ARH5243 PAL0501 </p> <p>12v 65amp a:25 b:13 c:81</p> <p>SUBARU XT 1.8L SB 23700AA050 HI LR165704 HC JA695IR</p>	<p>ALH0698</p>  <p>ALH0698WA ALM0698RB ARH5247 PAL0307 </p> <p>12v 70amp a:46 b:13 c:81.5</p> <p>SUBARU EJ20, EJ22 Legacy EJ18, EJ18SPI EJ20GN, EJ20EMPI SB 23700AA090 HI LR170732 HC JA698IR</p>	<p>ALH0701</p>  <p>ALH0701WA ARH5746 PAL0200 </p> <p>12v 130amp a:37 b:13 c:80.5</p> <p>INFINITI, NISSAN V8 QX56 Armada Pathfinder Titan NI 23100SS100 HI LR1130701 WA 11120N</p>	<p>ALH0735</p>  <p>12v 90amp a:40 b:12 c:76</p> <p>GREATWALL NISSAN GW 3701020AE07 VA SG9S122 VA 442127</p>
<p>ALH0754</p>  <p>ALH0754WA ARH5210 PAL0200 </p> <p>12v 60amp a:42 b:13 c:80.5</p> <p>NISSAN Z24, Z24I King Cab L28 Patrol RB30S Pick Up NI 2310005G05 Terrano HI LR160140B HC JA754IR</p>	<p>ALH0761</p>  <p>ALH0761WA ARH5252 PAL0305 </p> <p>12v 50amp a:48 b:13 c:80.5</p> <p>ISUZU, OPEL 4JA1 VAUXHALL 4JB1T Campo, Trooper 4JG2T Monterey OP 94382059 Brava HI LR150434 HC JA761IR</p>	<p>ALH0762</p>  <p>ALH0762WA ARH5248 PAL0200 </p> <p>12v 80amp a:38 b:25 c:82</p> <p>INFINITI, NISSAN KA24E G20 2.0I SR20DI 100, Sunny SR20DE Prairie, Altima NI 2310030R60 Primera, Axxess HI LR180725 HC JA762IR</p>	<p>ALH0767</p>  <p>ALH0767WA ARH5238 PAL0200 </p> <p>12v 90amp a:38 b:13.5 c:82</p> <p>INFINITI, NISSAN VG30E M30 Maxima 3.0I NI 2310034E00 HI LR190709 HC JA767IR</p>














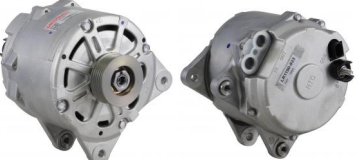





Alternators

Hitachi

<p>ALH0769</p>  <p>ALH0769WA ARH5205 PAL0200</p> <p>12v 70amp a:42 b:13 c:80.5</p> <p>NISSAN Almera Primera Sunny</p> <p>CD20 NI 231000E400 HI LR170417 HC JA769IR</p>	<p>ALH0773</p>  <p>ALH0773WA ARH5205 PAL0200</p> <p>12v 70amp a:31 b:13 c:80</p> <p>NISSAN King Van</p> <p>NI 2310006N00 HI LR170406 HC JA773IR</p>	<p>ALH0776</p>  <p>ALH0776WA ARH5205 PAL0200</p> <p>12v 70amp a:42 b:13.5 c:80.5</p> <p>NISSAN King Van 2.4 i King Vanette 2.4 i Urvan 2.4</p> <p>Z24i, Z24S NI 2310017C00 HI LR17022 HC JA776IR</p>	<p>ALH0780</p>  <p>ALH0780WA ARH5205 PAL0200</p> <p>12v 60amp a:42.5 b:13 c:78.5</p> <p>NISSAN Pick Up Terrano Cabstar</p> <p>TD23 TD25 TD27 NI 2310002N13 HI LR160426 HC JA780IR</p>
<p>ALH0860</p>  <p>ALH0860 PAL0407</p> <p>12v 190amp a:28 b:14 c:60</p> <p>PORSCHE Cayenne</p> <p>PO 94860302500 HI LR1190938 MH ALH0860</p>	<p>ALH0863</p>  <p>ALH0863WA ARH5254 PAL0304</p> <p>12v 70amp a:42 b:13.5 c:80.5</p> <p>OPEL, VAUXHALL Astra 1.7L Combo 1.7L Corsa 1.5L, 1.7L Cavalier 1.7L</p> <p>17DT, 4EE1 15D, 17D, X17D X15DT, T4EC1 OP 97041790 HI LR170420 HC JA863IR</p>	<p>ALH0873</p>  <p>ALH0873RB ALH0873WA ARH5252 PAL0305</p> <p>12v 60amp a:48 b:13 c:80.5</p> <p>OPEL, ISUZU Campo Commodore Monterey Trooper</p> <p>25H 4JG2T OP 97074611 HI LR160446 HC JA873IR</p>	<p>ALH0874</p>  <p>ALH0874WA ARH5205 PAL0305</p> <p>12v 70amp a:42 b:13 c:80.5</p> <p>OPEL Kadett 1.5L</p> <p>15DT T4EC1 OP 1204084 HI LR170415 HC JA874IR</p>
<p>ALH0904</p>  <p>ALH0904 PAL0407</p> <p>12v 190amp a:29 b:14 c:60</p> <p>AUDI, VW Phaeton Touareg Quattro A8</p> <p>CASA CASC VW 059903015PX HI LR1190904C MS 210782</p>	<p>ALH0909</p>  <p>ALH0909 PAL0400</p> <p>12v 190amp a:29 b:14 c:60</p> <p>AUDI, VW Touareg S4 A4</p> <p>VR6 BBK VW 079903021E HI LR1190909B MS 210784</p>	<p>ALH0912</p>  <p>ALH0912 PAL0400</p> <p>12v 190amp a:39 b:14 c:59</p> <p>VW Phaeton Touareg</p> <p>BKS CATA VW 059903023 HI LR1190912 MS 210781</p>	<p>ALH0915</p>  <p>ALH0915 PAL0400</p> <p>12v 190amp a:76</p> <p>PORSCHE Cayenne S TURBO S 4.5L MPI 2006</p> <p>M022Y M4850 M4800 PO 94860301504 HI LR1190915B MS 210780</p>

Alternators

Hitachi

<p>ALH0933</p>  <p>PAL0407 </p> <p>12v 190amp a:37.5 b:14 c:59</p> <p>AUDI BUH RS6 BI-Turbo A6</p> <p>VW 07L903015DX HI LR1190933 MS 210783</p>	<p>ALH0952 <i>New</i></p>  <p>12v 190amp a:91 b:72</p> <p>PORSCHE VW</p> <p>PO 94860303300 HI LR1190952 MH ALH0952</p>	<p>ALH0974</p> <p>ALH0974WA</p>  <p>ARH5245 PAL0200 </p> <p>12v 65amp a:38 b:25 c:82</p> <p>NISSAN GA16I, GA14DS 100 1.6I GA16DE Primera 1.6I GA16DS Sunny 1.4I, 1.6I NI 231000E700 NX, Pulsar, Sentra HI LR165708 HC JA974IR</p>	<p>ALH0975</p> <p>ALH0975WA</p>  <p>ARH5762 PAL0200 </p> <p>12v 90amp a:36 b:25 c:82</p> <p>NISSAN C23M Serena SR20DE</p> <p>NI 231000C800 HI LR190719 HC JA975IR</p>
<p>ALH0990</p>  <p>ALH0990RB ALH0990WA ALH990WA</p> <p>ARH5766 PAL0284 </p> <p>12v 110amp a:38.5 b:13 c:82</p> <p>Nissan Maxima 2.0 3.0 VQ20DE Nissan Murano 3.5 VQ35DE VQ30DE NI 2310031U01 HI LR1110705 HC JA990IR</p>	<p>ALH1000</p>  <p>12v 125amp a:38 b:11 c:88</p> <p>NISSAN QD32 Terrano TD27 Navara Datsun</p> <p>NI 23100VE000 HI LR1125705B</p>	<p>ALH1001</p>  <p>12v 190amp a:28 b:13 c:61</p> <p>VOLKSWAGEN BKS Touareg 4.2TD CATA</p> <p>VW 059903018AX HI 2506146</p>	<p>ALH1002</p>  <p>12v 80amp a:39 b:11 c:81</p> <p>NISSAN QG18DE Pathfinder 3.3L 1997</p> <p>NI 231004M505 HI LR22584B</p>
<p>ALH1004</p>  <p>24v 80amp a:51 b:16 c:79</p> <p>ISUZU NLR-85</p> <p>IS 8980298892 HI LR280707C</p>	<p>ALH1122</p> <p>ALH1122WA</p>  <p>ARH5248 PAL0200 </p> <p>12v 70amp a:42.5 b:12.5 c:82.5</p> <p>NISSAN VG30E King Cab Terrano</p> <p>NI 2310012G01 HI LR170734 HC JA1122IR</p>	<p>ALH1171</p> <p>ALH1171WA</p>  <p>ARH5716 PAL0305 </p> <p>24v 25amp a:32.5 b:13 c:79.5</p> <p>ISUZU 4BG1 N Series 3.6L 4BE1 N Series 4.3L NKR 3.6L</p> <p>IS 8944046520 HI LR225408 HC JA1171IR</p>	<p>ALH1172</p> <p>ALH1172RB ALH1172WA ALV1172RB</p>  <p>ARH5776 PAL0202 </p> <p>12v 70amp a:41.5 b:13 c:81</p> <p>AC, OPEL, VAUXHALL 17D, 17DR ME 3000 3.0I X17DT Astra 1.7L, Corsa 1.7L 15D, 15DT Vectra 1.7L, Combo 1.7L OP 97150200 Astravan, Corsavan HI LR170505 HC JA1172IR</p>

Alternators

Hitachi

<p>ALH1182</p>  <p>ALH1182WA ARH5767 PAL0200 </p> <p>12v 70amp a:38 b:13 c:81.5</p> <p>NISSAN Almera 1.6L Primera 1.6L Sunny 1.6L</p> <p>GA16DE GA16DS GA14DE NI 231000M003 HI LR170748 HC JA1182IR</p>	<p>ALH1290</p>  <p>ALH1290WA ALH290WA ARH5584 PAL0305 </p> <p>12v 80amp a:49 b:13 c:85</p> <p>Isuzu Trooper Opel Monterey Frontera</p> <p>4JB1T 4JA1T TD OP 1204170 HI LR180501 HC JA1290IR</p>	<p>ALH1357</p>  <p>ALH1357WA ARH5774 PAL0284 </p> <p>12v 100amp a:38.5 b:13 c:82</p> <p>NISSAN, INFINITI Maxima I30</p> <p>VQ30DE, A33 VQ25DE VQ20DE NI 231002Y006 HI LR1100725C HC JA1357IR</p>	<p>ALH1370</p>  <p>ALH1370RB ALH1370WA ARH5433 PAL0202 </p> <p>12v 100amp a:42 b:13 c:79</p> <p>OPEL Astra Combo Vectra</p> <p>X17DT X17D 4EE1, TC4EE1 OP 6204043 HI LR1100501 HC JA1370IR</p>
<p>ALH1374</p>  <p>ALH1374WA ARH5761 PAL0200 </p> <p>12v 80amp a:38 b:25 c:81</p> <p>VW, NISSAN Passat Serena Vanette</p> <p>AFB GA16DE NI 231000C000 HI LR180735 HC JA1374IR</p>	<p>ALH1406</p>  <p>ALH1406WA ARH5762 PAL0200 </p> <p>12v 70amp a:41.5 b:25 c:81.5</p> <p>NISSAN Terrano Navara</p> <p>R20 NI 231000F610 HI LR170741 HC JA1406IR</p>	<p>ALH1423</p>  <p>ALH1423WA ARH5314 PAL0200 </p> <p>12v 60amp a:17 b:25 c:81</p> <p>NISSAN Pick Up 2.4 Frontier Xterra</p> <p>KA24DE NI 231000S300 HI LR170766 HC JA1423IR</p>	<p>ALH1516</p>  <p>ALH1516WA ARH5744 PAL0200 </p> <p>12v 60amp a:42.5 b:13 c:81</p> <p>NISSAN King Cab Pickup</p> <p>TD25 TD25Ti TD27 NI 231007T400 HI LR160728 HC JA1516IR</p>
<p>ALH1521</p>  <p>ALH1521RB ALH1521WA ALH521WA ARH5769 PAL0202 </p> <p>12v 100amp a:35.5 b:13 c:66.5</p> <p>HONDA, OPEL Civic 1.7i CTDI Astra G 1.7i Corsa 1.7 DT</p> <p>Z17DTL Y17DT Y17DTL IS 8971891133 HI LR1100502 HC JA1521IR</p>	<p>ALH1526</p>  <p>ALH1526WA ARH5769 PAL0202 </p> <p>12v 70amp a:35 b:13 c:68</p> <p>OPEL, VAUXHALL Astra, Combo Corsa, Meriva Corsavan</p> <p>Y17DT Y17DTL OP 1204157 HI LR170509 HC JA1526IR</p>	<p>ALH1528</p>  <p>ALH1528WA ARH5766 PAL0200 </p> <p>12v 90amp a:42 b:13 c:81</p> <p>NISSAN Primera 2.0L Terrano 2.7L</p> <p>CD20T TD27Ti NI 231002J600 HI LR1100705 HC JA1528IR</p>	<p>ALH1602</p>  <p>ALH1602WA ARH5738 PAL0200 </p> <p>12v 90amp a:37.5 b:13 c:80</p> <p>NISSAN Patrol 3.0L Terrano 3.0L</p> <p>ZD30 ZD30DDTi NI 23100VC100 HI LR190752 HC JA1602IR</p>




















Alternators

Hitachi

<p>ALH1606</p>  <p>ALH1606RB ALH1606WA ALM1606RB</p> <p>ARH5738 PAL0200 </p> <p>12v 90amp a:38 b:25 c:80.5</p> <p>NISSAN SR20DE Almera 2.0L Primera 2.0L</p> <p>NI 231004M611 HI LR190747 HC JA1606IR</p>	<p>ALH1607</p>  <p>ALH1607RB ALH1607WA ALM1607</p> <p>ARH5738 PAL0200 </p> <p>12v 80amp a:39 b:13 c:81</p> <p>NISSAN QG16DE Almera 1.5L Almera 1.8L Primera 1.6L Primera 1.8L</p> <p>QG18DE QG15DE NI 231004M510 HI LR180762B HC JA1607IR</p>	<p>ALH1610</p>  <p>ALH1610WA</p> <p>ARH5758 PAL0203 </p> <p>12v 70amp a:37 b:13 c:66</p> <p>MAZDA Denio 1.3L</p> <p>HI LR170764 HC JA1610IR</p>	<p>ALH1611</p>  <p>ALH1611WA</p> <p>ARH5738 PAL0200 </p> <p>12v 100amp a:41.5 b:13 c:81</p> <p>NISSAN YD22DDT Almera 2.2</p> <p>NI 23100BN300 HI LR1100724 HC JA1611IR</p>
<p>ALH1702</p>  <p>ALH1702WA</p> <p>ARH5766 PAL0200 </p> <p>12v 80amp a:42 b:13 c:81</p> <p>NISSAN CD20 Almera 2.0L</p> <p>NI 231008E100 HI LR1100705 HC JA1702IR</p>	<p>ALH1712</p>  <p>ALH1712WA</p> <p>ARH5745 PAL0200 </p> <p>12v 110amp a:33.5 b:13.5 c:62</p> <p>NISSAN QR20DE Primera X-Trail</p> <p>QR25DE NI 23100AU400 HI LR1110713 HC JA1712IR</p>	<p>ALH1790</p>  <p>ALH1790RB ALH1790WA</p> <p>ARH5738 PAL0200 </p> <p>12v 65amp a:38 b:25 c:66.5</p> <p>NISSAN CG10DE Micra 1.0i Micra 1.4i</p> <p>CGA3DE NI 23100AN000 HI LR165714 HC JA1790IR</p>	<p>ALH1801</p>  <p>ALH1801WA</p> <p>ARH5432 PAL0503 </p> <p>12v 65amp a:50 b:13 c:85</p> <p>MAZDA R2 E 2000 2.2 E 2200 2.2</p> <p>MZ R2M318300A HI LR160452D HC JA1801IR</p>
<p>ALH1899</p>  <p>ALH1899RB ALH1899WA ALH9899WA</p> <p>ARH5669 PAL0209 </p> <p>12v 100amp a:35.5 b:13 c:66.5</p> <p>OPEL, VAUXHALL Z17DTL Astra 1.7L Astravan 1.7L</p> <p>OP 6204199 HI LR1100508 HC JA1899IR</p>	<p>ALH1900</p>  <p>ALH1900WA</p> <p>ARH5669 PAL0209 </p> <p>12v 110amp b:12.5 c:66.5</p> <p>OPEL Z17DTH Astra D17DTL Combo Corsa</p> <p>OP 97363833 HI LR1110503 HC JA1900IR</p>	<p>ALH1901</p>  <p>ALH1901RB ALH1901WA</p> <p>ARH5769 PAL0202 </p> <p>12v 100amp a:35 b:13 c:65.5</p> <p>OPEL, VAUXHALL Z17DTH Combo 1.7L Corsa 1.7L Meriva 1.7L</p> <p>OP 6204183 HI LR1100503 HC JA1901IR</p>	<p>ALH2079 <i>New</i></p>  <p>ARH5767 PAL0200 </p> <p>12v 70amp a:42 b:13 c:78.5</p> <p>NISSAN TD27TI Terrano II 2.7i</p> <p>NI 231007F700 HI LR170752C HC CA2079IR</p>













Alternators

Hitachi

<p>ALH2163</p>  <p>ALH2163WA</p> <p>ARH5242 PAL0200</p>  <p>12v 60amp a:39 b:13 c:81</p> <p>NISSAN Sunny</p> <p>E13S, E15S E16i, E10S GA16i NI 2310053A00 HI LR160715 HC JA163IR</p>	<p>ALH2198</p>  <p>ALH2198WA</p> <p>ARH5529 PAL0501</p>  <p>12v 60amp a:41.5 b:13 c:80.5</p> <p>NISSAN Cherry Patrol 280 Vanette</p> <p>E15ET L28 L28E, A15 NI 23100V0101 HI LR16082 HC JA198IR</p>	<p>ALH2288</p>  <p>ARH5215</p> <p>12v 40amp a:34 b:13 c:80</p> <p>NISSAN</p> <p>NI 23100D0101 HI LR135108 HC JA105IR</p>	<p>ALH2304</p>  <p>12v 100amp a:40 b:13 c:82</p> <p>NISSAN</p> <p>VG33E</p> <p>NI 231000W404 HI LR1100716E CG 113425</p>
<p>ALH2310</p>  <p>12v 60amp a:40 b:12 c:81</p> <p>NISSAN Laurel Pick up</p> <p>RD28 LD28 SD25 NI 2310010G03 HI LR140419T VA 437845</p>	<p>ALH2503</p>  <p>ALH2503WA</p> <p>ARH5055 PAL0305</p>  <p>24v 50amp a:45 b:18 c:79</p> <p>ISUZU 4HJ1 4FG1 4HF1</p> <p>IS 8971160880 HI LR250503 MH ALH2503</p>	<p>ALH2510</p>  <p>ALH2510WA</p> <p>ARH5783 PAL0208</p>  <p>12v 80amp a:42 b:18 c:79</p> <p>ISUZU CHEVROLET GMC Medium&Heavy Duty Truck</p> <p>4HE1 S 2902768000 HI LR180510 MH ALH2510</p>	<p>ALH2673</p>  <p>ALH2673WA</p> <p>ARH5057 PAL0217</p>  <p>12v 70amp a:44.5 b:13 c:81.5</p> <p>OPEL, ISUZU Trooper 3.0L Monterey 3.0L</p> <p>4JX1 4JX1T IS 8971453863 HI LR160734B CG 112673</p>
<p>ALH2708</p>  <p>ALH2708WA</p> <p>ARH5083</p> <p>24v 50amp a:53 b:17 c:77</p> <p>ISUZU NLR85</p> <p>IS 8980750260 HI LR250708E UP ALT3150</p>	<p>ALH2750 <i>New</i></p>  <p>ARH5741 PAL0224</p>  <p>12v 110amp a:38 b:13 c:82</p> <p>NISSAN Frontier Pickup Pathfinder Xterra</p> <p>4.0L NI 23100EA201 HI LR1110725 WA 11121N</p>	<p>ALH2903</p>  <p>ALH2903WA</p> <p>12v 190amp a:30 b:15 c:60</p> <p>AUDI, VW Q7 Phaeton Touareg</p> <p>VW 021903016A HI LR1190919 MH ALH2903</p>	<p>ALH2967</p>  <p>PAL0200</p>  <p>12v 50amp a:42 b:13 c:80.5</p> <p>NISSAN Pathfinder</p> <p>Z24 Z24I NI 2310080W00 HI LR150194B CG 112967</p>

























Alternators

Hitachi

<p>ALH2968</p>  <p>ALH2968WA ARH5205 PAL0200</p> <p>12v 60amp a:42 b:13 c:80</p> <p>NISSAN D21 3.0l Pathfinder 3.0l</p> <p>VG30 VG30l</p> <p>NI 2310002E10 HI LR160151 CG 112968</p>	<p>ALH2981</p>  <p>ALH2981WA ARH5766 PAL0216</p> <p>12v 110amp a:24 b:13 c:69</p> <p>INFINITI Q45 4.1L</p> <p>VH41DE</p> <p>NI 231006P000 HI LR1110707G CG 112981</p>	<p>ALH3096 <i>New</i></p>  <p>12v 190amp a:25 b:13 c:61</p> <p>AUDI A8 Q7</p> <p>VW 059903015T HI LR1190916</p>	<p>ALH3161</p>  <p>ALH3161WA ARH5766 PAL0216</p> <p>12v 125amp a:38.5 b:12.5 c:88</p> <p>NISSAN INFINITI Maxima I30</p> <p>VQ30DE</p> <p>HI LR1125702 HI LR1125702B CG 113161</p>
<p>ALH3190</p>  <p>ALH3190WA ARH5037 PAL0206</p> <p>24v 50amp a:37 b:17 c:79</p> <p>ISUZU, HITACHI NPR 6.3 1998-></p> <p>IS 8971701631 HI LR250510 CG 113190</p>	<p>ALH3347</p>  <p>ALH3347WA ARH5430 PAL0502</p> <p>12v 20amp a:42.5 b:14.5 c:80.5</p> <p>ISUZU Motor Engine Industrial</p> <p>3KC1</p> <p>IS 5812003580 HI LR12023 CG 113347</p>	<p>ALH3367</p>  <p>ALH3367WA ARH5744 PAL0200</p> <p>12v 90amp a:91 b:58</p> <p>ISUZU, HONDA Amigo 3.2 Rodeo 3.2 Axiom Passport</p> <p>6VD1</p> <p>IS 2902768300 HI LR190744 CG 113367</p>	<p>ALH3371</p>  <p>ALH3371WA ARH5782 PAL0200</p> <p>12v 80amp a:37 b:13 c:82</p> <p>NISSAN 200 Sentra</p> <p>GA16DE E16</p> <p>NI 231003M200 HI LR180751 CG 113371</p>
<p>ALH3372</p>  <p>ALH3372WA ARH5314 PAL0200</p> <p>12v 100amp a:38.5 b:13 c:81.5</p> <p>NISSAN Sentra 1.8L</p> <p>QG18DE</p> <p>NI 231005M000 HI LR1100722 CG 113372</p>	<p>ALH3373</p>  <p>ALH3373WA ARH5314 PAL0200</p> <p>12v 100amp a:36 b:25 c:81</p> <p>NISSAN Pathfinder Altima</p> <p>VQ35</p> <p>NI 231009E000 HI LR1100709B CG 113373</p>	<p>ALH3374</p>  <p>ALH3374WA ARH5782 PAL0200</p> <p>12v 90amp a:40 b:12 c:81</p> <p>NISSAN Pathfinder 3.3</p> <p>VG33E</p> <p>NI 231000W000 HI LR190729 CG 113374</p>	<p>ALH3375</p>  <p>ALH3375WA ARH5782 PAL0200</p> <p>12v 90amp a:38 b:13 c:81.5</p> <p>NISSAN Pathfinder 3.3</p> <p>VG33E</p> <p>NI 231000W001 HI LR190737 CG 113375</p>







Alternators

Hitachi

<p>ALH3401</p>  <p>ALH3401WA PAL0503 </p> <p>12v 40amp a:41.5 b:20 c:67</p> <p>YANMAR Motor KUBOTA JOHN DEERE</p> <p>3TG66 3TG72</p> <p>HI AM878581 HI LR140714B CG 113401</p>	<p>ALH3412</p>  <p>ALH3412WA ARH5252 PAL0305 </p> <p>12v 70amp a:45 b:13.5 c:82</p> <p>ISUZU N Series</p> <p>4BD1</p> <p>IS 8941754180 HI LR170410 CG 113412</p>	<p>ALH3413</p>  <p>ALH3413WA ARH5252 PAL0305 </p> <p>12v 70amp a:47.5 b:14 c:82</p> <p>ISUZU N Series 3.9L</p> <p>4BD1</p> <p>IS 8970237331 HI LR170418B CG 113413</p>	<p>ALH3417</p>  <p>ALH3417WA ARH5707 PAL0503 </p> <p>24v 25amp a:43 b:14 c:81.5</p> <p>NISSAN Various Models</p> <p>NI 2310051H00 HI LR22584T CG 113418</p>
<p>ALH3418</p>  <p>ALH3418WA PAL0406 </p> <p>12v 190amp a:27 b:14 c:61</p> <p>VW Passat</p> <p>3B3 3B6 W8 VW 07C903018V HI LR1190949 MH ALH3418</p>	<p>ALH3419</p>  <p>ALH3419WA PAL0200 </p> <p>12v 100amp a:38 b:25 c:81.5</p> <p>NISSAN US Sentra</p> <p>SR20DE</p> <p>NI 231004M800 HI LR1100723 CG 113419</p>	<p>ALH3420</p>  <p>ALH3420WA ARH5744 PAL0200 </p> <p>12v 110amp a:36.5 b:13 c:82</p> <p>NISSAN Pathfinder 3.5L 2002-> Infiniti QX4 3.5L 2002-></p> <p>VQ35</p> <p>NI 231003W400 HI LR1110712 CG 113420</p>	<p>ALH3422</p>  <p>ALH3422WA ARH5767 PAL0200 </p> <p>12v 70amp a:43 b:13 c:82</p> <p>NISSAN Pathfinder 3.0L Terrano 3.0L D21 PickUp 3.0L</p> <p>WD21</p> <p>NI 231000S200 HI LR170745B CG 113422</p>
<p>ALH3424</p>  <p>ALH3424WA ARH5782 PAL0200 </p> <p>12v 90amp a:38 b:13 c:81</p> <p>NISSAN Pathfinder 3.3L Infiniti QX4 3.3L</p> <p>VG33E</p> <p>NI 231000W001 HI LR190737 CG 113375</p>	<p>ALH3427</p>  <p>ALH3427WA ARH5738 PAL0200 </p> <p>12v 80amp a:40 b:14 c:83</p> <p>NISSAN Frontier 3.3 Xterra 3.3</p> <p>VG33ER</p> <p>NI 231004S100 HI LR180756B CG 113427</p>	<p>ALH3508</p>  <p>ALH3508WA ARH5037 PAL0206 </p> <p>24v 80amp a:34 b:13 c:79</p> <p>ISUZU Elf Bogdan</p> <p>4HF1 4HE1</p> <p>IS 8973515740 HI LR280508 MH ALH3508</p>	<p>ALH3512</p>  <p>ALH3512WA ARH5037 PAL0206 </p> <p>24v 60amp a:34 b:13 c:78</p> <p>ISUZU Elf Bogdan</p> <p>IS 8973515730 HI LR260512 MH ALH3512</p>























Alternators

Hitachi

<p>ALH3522</p>  <p>PAL0400 </p> <p>12v 190amp a:58 b:19 c:116</p> <p>VW Phaeton 5.0L Diesel Touareg 5.0L Diesel</p> <p>VW 07Z903021E HI LR1190913 MH ALH3522</p>	<p>ALH3556</p>  <p>ARH5772 PAL0311 </p> <p>12v 70amp a:93 b:58</p> <p>HONDA, ISUZU Passport 3.2 EX Passport 3.2 LX</p> <p>6VD1</p> <p>IS 8971307760 HI LR170755 CG 113556</p>	<p>ALH3563</p>  <p>ALH3563WA ARH5772 PAL0311 </p> <p>12v 90amp a:90.5 b:56.5</p> <p>HONDA Passport</p> <p>6VD1</p> <p>OP 97204326 HI LR190743 CG 113563</p>	<p>ALH3643</p>  <p>ALH3643WA ARH5772 PAL0311 </p> <p>12v 60amp a:93 b:58</p> <p>HONDA, ISUZU Passport 2.6 DX Rodeo 2.6</p> <p>4ZE1</p> <p>IS 2902766000 HI LR160729C CG 113643</p>
<p>ALH3698</p>  <p>ALH3698WA PAL0200 </p> <p>12v 90amp a:45 b:13 c:81</p> <p>ISUZU, OPEL Trooper 3.0I Diesel Monterey 3.0I Diesel</p> <p>4JX1</p> <p>IS 8972159922 HI LR190750 CG 113698</p>	<p>ALH3702</p>  <p>ALH3702WA ARH3702 PAL0200 </p> <p>12v 135amp a:37.5 b:13 c:81.5</p> <p>RENAULT, VAUXHALL Master 3.0 Wovan 3.0</p> <p>NI 23100DB000 HI LR1130702 HC CA2082IR</p>	<p>ALH3708</p>  <p>ALH3708WA ARH5258 PAL0503 </p> <p>12v 90amp</p> <p>HONDA Motorcycles GL1500</p> <p>HO 31100MT2005 HI LR140708 MH ALH3708</p>	<p>ALH3902</p>  <p>PAL0408 </p> <p>12v 190amp a:25 b:13 c:61</p> <p>AUDI A6 A8 V8 Chain</p> <p>BVJ BAR</p> <p>VW 079903015X HI LR1190902 MH ALH3902</p>
<p>ALH3907</p>  <p>PAL0413 </p> <p>12v 190amp a:30 b:14 c:59</p> <p>VW Phaeton Touareg</p> <p>BRK BKL VW 07C903021NX HI LR1190907E MS 210785</p>	<p>ALH3908</p>  <p>PAL0413 </p> <p>12v 190amp a:27 b:13 c:59</p> <p>VW AUDI Touareg Phaeton Q7</p> <p>BHK, BRJ AZZ, BKJ BMV, BMX VW 021903026N HI LR1190908 MS 210777</p>	<p>ALH3909</p>  <p>PAL0413 </p> <p>12v 190amp a:30 b:14 c:59</p> <p>AUDI A6 A8</p> <p>BXA BSM</p> <p>VW 079903021F HI LR1190910B MS 210787</p>	<p>ALH3911</p>  <p>PAL0413 </p> <p>12v 190amp a:29 b:14 c:59</p> <p>VW Touareg 6.0L V12 2006-></p> <p>BJN CFRA</p> <p>VW 07C903021MX HI L1190911 MS 210789</p>

















Alternators

Hitachi

<p>ALH3914</p>  <p>PAL0413 </p> <p>12v 190amp a:28 b:13 c:59</p> <p>VW Touareg AUDI Q7</p> <p>BHK, BRJ AZZ, BKJ BMW, BMX VW 077903023C HI LR1190914 MS 210778</p>	<p>ALH3920</p>  <p>PAL0413 </p> <p>12v 190amp a:27 b:14 c:59</p> <p>AUDI A4 RS4 V8 4.2L FSI</p> <p>BNS VW 079903021H HI LR1190920 MS 210779</p>	<p>ALH3928</p>  <p>PAL0407 </p> <p>12v 190amp a:28 b:14 c:59</p> <p>VW Touareg</p> <p>BJN CFRA VW 07C903023X HI LR1190928 MS 210792</p>	<p>ALH3932</p>  <p>PAL0413 </p> <p>12v 190amp a:28 b:14 c:59</p> <p>AUDI, VW A8 Q7 Phaeton</p> <p>BBJ BHK BMK VW 079903015GV HI LR1190932B MS 210786</p>
<p>ALH3939</p>  <p>PAL0407 </p> <p>12v 190amp a:30 b:13 c:59</p> <p>AUDI A6 V10 5.2 LTR. FSI</p> <p>VW 07L903015BX HI LR1190939 MS 210791</p>	<p>ALH4014</p>  <p>ALH4014WA ARH5055 PAL0305 </p> <p>24v 60amp a:43 b:17 c:78</p> <p>ISUZU N Series</p> <p>4HF1 4HG1 4HJ1 IS 8971753901 HI LR260502 CG 114014</p>	<p>ALH4182 <i>New</i></p>  <p>PAL0470 </p> <p>12v 140amp a:35 b:13 c:61</p> <p>NISSAN X-Trail 2.0L</p> <p>NI 23100EN00B HI LR1140802F MH ALH4802</p>	<p>ALH4209</p>  <p>PAL0503 </p> <p>12v 60amp a:42 b:13 c:81</p> <p>YANMAR KOMATSU ForkLift Industrial Engine</p> <p>4TNE94 YA 12990077211 HI LR160743 CG 114209</p>
<p>ALH4236</p>  <p>ALH4236WA ALH4414WA HT2501 ARH5708</p> <p>24v 45amp a:50 b:14 c:90</p> <p>NISSAN Trucks HINO Trucks</p> <p>PE6A FE6 NI 23100Z5719 SA 02021520220</p>	<p>ALH4366</p>  <p>ALH4366WA ARH5253 PAL0305 </p> <p>24v 40amp a:44 b:13 c:79</p> <p>ISUZU Trucks Various models</p> <p>IS 8970292260 HI LR240405 CG 114366</p>	<p>ALH4414</p>  <p>ALH4414WA ALW4414WA ARH5707</p> <p>24v 55amp a:50 b:14 c:90</p> <p>NISSAN Trucks HINO Trucks</p> <p>UD520 EF550 EK100 PS 021425070 HI LR23572 CG 114414</p>	<p>ALH4426</p>  <p>ALH4426WA ARH5716 PAL0305 </p> <p>24v 40amp a:29.5 b:13 c:78</p> <p>ISUZU N Series</p> <p>4BC2 IS 8943367280 HI LR240401 CG 114426</p>



Alternators

Hitachi

<p>ALH4427</p>  <p>ALH4427WA PAL0305 </p> <p>12v 100amp a:48.5 b:13 c:85</p> <p>ISUZU N Series</p> <p>3100</p> <p>IS 8971674881 HI LR180508B CG 114427</p>	<p>ALH4428</p>  <p>ALH4428WA PAL0200 </p> <p>12v 100amp a:47 b:13 c:85</p> <p>ISUZU NHR 5.0</p> <p>4JH1</p> <p>IS 8979673011 HI LR180512T CG 114428</p>	<p>ALH4706 <i>New</i></p>  <p>ALH4706WA ARH5113 PAL0213 </p> <p>12v 150amp a:35 b:13 c:84</p> <p>RENAULT Espace 3.5L Vel Satis 3.5L</p> <p>V6</p> <p>RE 8200207287 HI LR1150706 MH ALH4706</p>	<p>ALH4802</p> <p>12v 60amp a:49 b:13 c:41</p> <p>ISUZU D-Max 2.5L,3.0L Rodeo 2.5L OPEL CAMPO 2.5L</p> <p>4JA1-TC 4JH1-TC 4JA1 IS 8972402701 HI LR160-502E CG 114802</p>
<p>ALH5072 <i>New</i></p>  <p>ALH5072WA</p> <p>24v 50amp:</p> <p>NISSAN Industrial CD41 CW41 TD20 TK20 U20 U30</p> <p>NI 2310096102 HI LT22523C NR 020022</p>	<p>ALH5403 <i>New</i></p>  <p>ARH5716 PAL0102 </p> <p>24v 25amp a:42 b:13.5 c:81</p> <p>NISSAN Patrol 3.2l Diesel Patrol 3.3l Diesel</p> <p>SD33 SD33T</p> <p>NI 23099C6802 HI LR225403 HC JA187IR</p>	<p>ALH6442 <i>New</i></p>  <p>ARH5252 PAL0305 </p> <p>12v 70amp a:58 b:13 c:78</p> <p>MAZDA Familia</p> <p>IZ 8970883942 HI LR160442 MH ALH6442</p>	<p>ALH8921 <i>New</i></p>  <p>ALH8921WA</p> <p>24v 80amp: a:55 b:16 c:80</p> <p>ISUZU</p> <p>4HK1</p> <p>IZ 8980298921 HI LR280708B HM ALH0708</p>
<p>ALH9090</p>  <p>12v 190amp a:30 b:13 c:61</p> <p>AUDI A8</p> <p>VW 07C903021H HI LR1190905</p>	<p>ALH9760 <i>New</i></p>  <p>12v 90amp a:45 b:13 c:65</p> <p>NISSAN March Micra</p> <p>CR14DE K12E</p> <p>NI 23100AX001 HI LR190760B MH ALH9760</p>	<p>ALH9907 <i>New</i></p>  <p>PAL0413 </p> <p>12v 190amp a:30 b:12 c:62</p> <p>AUDI A4 A4 Cabrio</p> <p>BBK G15B G4DJ</p> <p>VW 079903021D HI LR1190909B MH ALB9907</p>	

Alternators

Iskra

<p>ALI0076</p>  <p>ALI0076WA ARB0350</p> <p>12v 33amp a:76.5 b:56</p> <p>CASE, CLAAS, DEUTZ-FAHR2L912, F5L912 FENDT, GOLDONI F3L912, F6L912 Agricultural F4L912 Industrials RE 7700012723 Fork Lift IS 11201096 HC CA76IR</p>	<p>ALI0267</p>  <p>ALI0267WA ARI9702</p> <p>12v 95amp b:56</p> <p>SAME, VALTRA 620DS, 620DW Agricultural machine 634DS Titan 634DA 8000 Series IS 11201666 IS 11203098 HC CA1629IR</p>	<p>ALI0448 <i>New</i></p>  <p>ALI0448WA</p> <p>24v 55amp a:74 b:50</p> <p>Trucks Beifang Benchi SINOTRUK, HOWO HANIA OE VG1560090011 SHAANXI IS 11203592 MH ALI0448</p>	<p>ALI0463 <i>New</i></p>  <p>16915184</p> <p>12v 120amp b:14 c:82.5</p> <p>MASSEY FERGUSON Agricultural MA 4271312M93 IS AAK5189 CG 114049</p>
<p>ALI0613</p>  <p>ALI0613WA ARB0350 PAL0294</p> <p>12v 34amp a:56 b:27</p> <p>MASSEY FERGUSON Agriculture 245, 254 255, 260 MF 1618474M91 275, 285 IS 11201095 HC CA613IR</p>	<p>ALI3195</p>  <p>ALI3195WA</p> <p>24v 100amp a:43 b:14 c:101</p> <p>KAVZ Buses CUMMINS PAZ Buses CU C3415609 IS AAN5190 MH ALI3195</p>	<p>ALI3243</p>  <p>12v 150amp a:27 b:56</p> <p>CASE FPT NEF NEW HOLLAND NH 87573243 IS 11203734 IS AAN5333</p>	<p>ALI3334</p>  <p>ALI3334WA ARI9509</p> <p>24v 55amp b:56</p> <p>DEUTZ BF6M2012C 6.1L KHD BF4M2012C 4.0L KH 01181739 IS AAK5334 MH ALI3334</p>
<p>ALI3712</p>  <p>ALI3712WA 16908833</p> <p>12v 120amp a:27 b:14 c:101</p> <p>NEW HOLLAND CS6090 IS AAK5712 IS 11203566 MH ALI3712</p>	<p>ALI3738</p>  <p>ALI3738WA ARI9509</p> <p>24v 55amp b:56</p> <p>DEUTZ KHD LIEBHERR 314 Excavator KH 1182167 IS AAK5565 CG 113738</p>	<p>ALI3768</p>  <p>ALI3768WA 16908833</p> <p>12v 95amp b:56</p> <p>MERCEDES-BENZ OM441915, OM603972 SSANGYONG OM401979, M111975 200, 208, 210, 230 OM401984, OM601940 250, 300, 26t KH 01182038 310, 350, 48t, 35t IS AAK5567 CG 113768</p>	<p>ALI3811</p>  <p>12v 120amp a:24 b:50</p> <p>IVECO F2CE9684C NEW HOLLAND F4HE9684D F4GE9684R IV 504193811 IS 11203434 IS AAK5581</p>

Alternators


Iskra

<p>ALI3836</p>  <p>ALI3836WA</p> <p>24v 80amp b:56</p> <p>DEUTZ Tractors</p> <p>Deutz</p> <p>KH 1181735 IS AAN5836 MH ALI3836</p>	<p>ALI3999</p>  <p>ALI3999WA</p> <p>ARB0352</p> <p>12v 150amp b:14 c:103.5</p> <p>JOHN DEERE, CASE NEW HOLLAND, CUMMINS 6CTAA 500, 600, 700 2000 Series 7000 Series</p> <p>6CTA, 6CT IS IA1058 IS IA1169 CG 113999</p>	<p>ALI4000 <i>New</i></p>  <p>ALI4000WA</p> <p>16915221</p> <p>12v 120amp a:83 b:56</p> <p>CLAAS Agricultural</p> <p>RE 7700071558 IS AAK5533 CG 114000</p>	<p>ALI4115</p>  <p>ALI4115</p> <p>ARI1638</p> <p>12v 95amp a:30 b:14 c:80</p> <p>JCB MOSA</p> <p>JCB 35008648 IS 11204115 IS AAK5807</p>
<p>ALI4513 <i>New</i></p>  <p>ALI4513WA</p> <p>16915221</p> <p>12v 95amp a:83 b:56</p> <p>CLAAS Agricultural MERCEDES-BENZ Sprinter RENAULT Agricultural</p> <p>OM651957 6059D 6068D, 6068T RE 7700048828 IS AAK5157 CG 114513</p>	<p>ALI4881</p>  <p>16915184</p> <p>12v 95amp a:39 b:14 c:83</p> <p>FERMEC TEREX</p> <p>Perkins</p> <p>FR 6106495M91 IS 11201881</p>	<p>ALI5331 <i>New</i></p>  <p>16908881</p> <p>12v 175amp b:13 c:104</p> <p>NEW HOLLANDER MASSEY-FERGUSON</p> <p>Cummins CNH</p> <p>NH 87677208 IS 11203741 MH ALI5331</p>	<p>ALI5364 <i>New</i></p>  <p>ALI5364WA</p> <p>16908866</p> <p>12v 120amp b:56</p> <p>VALTRA 6750 S230, S260 T120, T130, T140, T160 T170, T180, T190</p> <p>645D VT 836666039 IS AAK5364 CG 113610</p>
<p>ALI5813</p>  <p>ALI5813</p> <p>12v 95amp a:28 b:13 c:82</p> <p>JCB 2CX, 3CX/PLUS/CLL 4CX, DIESELMAX</p> <p>JCB444</p> <p>JB 32008648 IS 11204215</p>	<p>ALI6412</p>  <p>ALI6412</p> <p>24v 55amp a:32 b:14 c:82</p> <p>DEUTZ KHD</p> <p>TCD2008</p> <p>KHD 04114696 IS 11203893 IS AAK5594</p>	<p>ALI6850 <i>New</i></p>  <p>ALI6850WA</p> <p>16915221</p> <p>12v 120amp a:77 b:50</p> <p>CLAAS Agricultural</p> <p>RE 7700068501 IS 11203181 CG 113986</p>	<p>ALI8176</p>  <p>ALI8176</p> <p>12v 150amp a:33 b:13 c:83</p> <p>NEW HOLLAND T6,T7 CASE Puma Maxxum</p> <p>NEF Tier 4 NEF Tier 3 FPT NEF CA 87708176 IS IA1378</p>

Alternators

LEEC

ALC0419 *New*

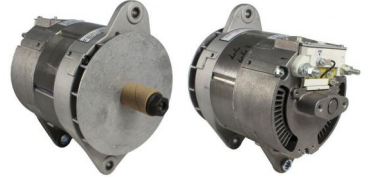





































ALC0419WA

24v 140amp **b:14** **c:101.5**

JOHN DEERE **4.5L 115HP**
Harvesters **6.8L 173HP**
 8.1L 215HP, 9.0L 240HP
 JD FO45287
 LC A0014727JB
 CG 112560

Alternators

LU

<p>ALL0293 <i>Old</i></p>  <p>ALL0293WA</p> <p>ARL7223 D+  PAL0294 B+  B+ </p> <p>12v 65amp a:34.5 b:11 c:81</p> <p>FORD Escort Sierra Fiesta</p> <p>NE, REF, RED, NES LSF, N4B, N4A, LCS LUH, LSE, YTR, NRD FO 84BB10300AB LU 61920315 HC CA293IR</p>	<p>ALL0305</p>  <p>ALL0305WA ALL305WA</p> <p>ARL7223 D+  PAL0294 B+  B+ </p> <p>12v 55amp a:35 b:11 c:83</p> <p>Ford Escort MAN NL Series ROVER 200 CATERPILLAR 4810 JCB, CASE</p> <p>F6B D2066LUH42, D2066LUH43 14K4C FO 82FB10300BB LU LRA00375 HC CA305IR</p>	<p>ALL0306</p>  <p>ALL0306WA ALL306WA</p> <p>ARL7223 D+  PAL0294 B+  B+ </p> <p>12v 55amp a:36 b:11.5 c:82.5</p> <p>FORD Escort Sierra ROVER 100</p> <p>RTB NEJ 14K2A RO YLE10018 LU LRA00376 HC CA306IR</p>	<p>ALL0309</p>  <p>ARL7223 D+  PAL0294 B+  B+ </p> <p>12v 70amp a:23 b:11 c:78</p> <p>FORD Transit</p> <p>4AB 4BA 4CA FO 894FX10300BA LU 24230 CG CA611IR</p>
<p>ALL0311</p>  <p>ALL0311WA ALL311WA</p> <p>ARL7223 D+  PAL0294 B+  B+ </p> <p>12v 55amp a:34 b:11 c:83</p> <p>FORD Transit</p> <p>4AB 4BA 4CA FO 894F10300BA LU LRA00780 HC CA311IR</p>	<p>ALL0312</p>  <p>ARL7219</p> <p>12v 75amp a:35.5 b:11.5 c:83</p> <p>FORD 2000 Series 3000 Series 4000 Series 6000 Series</p> <p>175CID, 256CID 183CID, 401CID 201CID FO E7NN10B376AA LU 54022337 HC CA707IR</p>	<p>ALL0325</p>  <p>ALL0325WA ALL325WA</p> <p>ARL7223</p> <p>12v 70amp a:37 b:11 c:83</p> <p>FORD Escort MAN NL Series RANGE ROVER</p> <p>LJB D2066LUH41 31D RO YLE10088 LU LRA00381 HC CA325IR</p>	<p>ALL0515</p>  <p>ALL0515WA</p> <p>PAL0281  P L I S</p> <p>12v 140amp a:95 b:56</p> <p>SSANGYONG SPORTS 2.0L KYRON 2.0L, 2.7L REXTON 2.7L, 2.9L</p> <p>GAB SS 6651540002 LU LRA2366 WA 235133R</p>
<p>ALL0560</p>  <p>ALL0560WA</p> <p>ARL7223</p> <p>12v 70amp a:36.5 b:11 c:83</p> <p>FORD, LAND ROVER LDV, ROVER GROUP Escort, Fiesta Defender, Range Rover Montego</p> <p>LTC, LUH, LHA FUD, FUG, F4A FUJ, F6E, 23L RO YLE10105 LU LRA517 HC CA560IR</p>	<p>ALL0561</p>  <p>ALL0561WA ALL561WA</p> <p>ARL7223 D+  PAL0294 B+  B+ </p> <p>12v 55amp a:43.5 b:11.5 c:83</p> <p>FORD Escort Fiesta Orion</p> <p>MF EGL232 LU LRA00122 HC CA561IR</p>	<p>ALL0562</p>  <p>ALL0562WA</p> <p>ARL7223  PAL0265  W D+ B+</p> <p>12v 70amp b:11.5 c:81</p> <p>FORD Sierra Transit</p> <p>N8C, N9C, N8A NCA, NBA, N9E FO 89BX10300HB LU 54022600 HC CA562IR</p>	<p>ALL0564</p>  <p>ALL0564WA</p> <p>ARL7223 D+  PAL0294 B+  B+ </p> <p>12v 65amp a:37 b:11.5 c:81</p> <p>ROVER NISSAN 800, 200 Montego Bluebird</p> <p>20T4G, 20HD, 20M4F C27A2, 20HDM16 C27A1, 20H, CA16 RO YLE10067 LU 54022428 HC CA564IR</p>



















Alternators

LU

<p>ALL0582</p>  <p>ALL0582WA ARL7223 D+ PAL0294 B+ PAL0294 B+</p> <p>12v 65amp a:35 b:11 c:82</p> <p>ROVER 20HS 820 20HD 800 RO YLE10035 LU 54022390 HC CA582IR</p>	<p>ALL0584</p>  <p>ALL0584WA ARL7223 D+ PAL0265 B+ PAL0265 W D+ B+</p> <p>12v 55amp a:43 b:11.5 c:83</p> <p>FORD RFL Sierra RFB P 100 RFA FO 89FF10300CC LU 54055205 HC CA584IR</p>	<p>ALL0600</p>  <p>ALL0600WA ARL7223 D+ PAL0294 B+ PAL0294 B+</p> <p>12v 55amp a:35 b:11 c:83</p> <p>AUSTIN, FORD, LDV 20E, 20HC81 MASSEY FERGUSON, MG BB, 20HA50AA ROVER, VAUXHALL 12H, 20H Carlton RO YLE10066 Maestro, Montego LU LRA00460 HC CA600IR</p>	<p>ALL0628</p>  <p>ARL7219</p> <p>12v 65amp a:36 b:10.5 c:81.5</p> <p>LAND ROVER, ROVER 38A, 31A, 30A PEUGEOT, JAGUAR LFZ, 37D, 38D, 40D Defender, Range Rover XK34, 8L, XK42 XJ 6, 306 LR RTC5218E 2000 LU LRA00495 HC CA628IR</p>
<p>ALL0650</p>  <p>ALL0650WA ARL7223 D+ PAL0294 B+ PAL0294 B+</p> <p>12v 70amp a:34.5 b:11.5 c:83</p> <p>FORD NAV, LAT Escort N6T, RTF Fiesta RTH, STR Orion MF 3701913M92 Transit LU LRA00967 HC CA650IR</p>	<p>ALL0717</p>  <p>ALL0717WA ARL7223 D+ PAL0265 B+ PAL0265 W D+ B+</p> <p>12v 70amp a:43.5 b:11 c:83</p> <p>FORD NRA Scorpio N9D, N8D Sierra NEL RO YLE10105 LU LRA00463 HC CA717IR</p>	<p>ALL0719</p>  <p>ALL0719WA ARL7223 D+ PAL0265 B+ PAL0265 W D+ B+</p> <p>12v 70amp a:33 b:11 c:83</p> <p>FORD Tansit 4FA 4DA 4HB FO 924F10300AA LU 54022495 HC CA719IR</p>	<p>ALL0756</p>  <p>ARL7223</p> <p>12v 67amp a:37 b:25.5 c:82</p> <p>NISSAN GA16DE Primera 1.6i GA16DS NI 2310071J00 LU LRA527 HC JA756IR</p>
<p>ALL1028</p>  <p>ALL1028WA ARL7223 D+ PAL0294 B+ PAL0294 B+</p> <p>12v 70amp a:33.5 b:12.5 c:83</p> <p>FORD 4AB Transit 2.5L Diesel 4BA 4CA FO 864F10300FD LU 24188 HC CA1028IR</p>	<p>ALL1029</p>  <p>ALL1029WA ARL7223 D+ PAL0294 B+ PAL0294 B+</p> <p>12v 70amp a:33.5 b:12.5 c:88</p> <p>FORD 4AB Transit 4BA 4CA FO 864F10K359FD LU 24264 HC CA1029IR</p>	<p>ALL1030</p>  <p>ALF1030RB ARL7223 D+ PAL0265 B+ PAL0265 W D+ B+</p> <p>12v 55amp a:34 b:11 c:83</p> <p>FORD 4EC, 4GF, 4GC, 4FA Transit 2.5 Tdi 4EB, 4EA, 4HC, 4DA Transit 2.5 Diesel Di 4GA, 4EC, 4HB, 4CC FO 914F10K359AA LU LRA02682 HC CA1030IR</p>	<p>ALL1031</p>  <p>ARL7223 D+ PAL0265 B+ PAL0265 W D+ B+</p> <p>12v 70amp a:34 b:11 c:83</p> <p>FORD 4HC, SCC 4HC Scorpio 2.5L Diesel 4FA, VM Transit 2.5L Diesel 4GA FO 924X10300AB LU LRA02716 HC CA1031IR</p>

Alternators

LU

<p>ALL1046</p>  <p>ALL1046WA ARL7223 PAL0265</p>  <p>12v 70amp b:12 c:81</p> <p>FORD Sierra Transit Scorpio</p> <p>N8D, N9D, N8C NRI, N9F NRA, N8A FO 89BB10300HB LU 54022322 HC CA1046IR</p>	<p>ALL1050</p>  <p>ALL1050WA ARL7225 PAL0294</p>  <p>24v 30amp a:33.5 b:11 c:83.5</p> <p>DAF, LDV 45 Roadrunner</p> <p>CS119 CT119 CN96 PK 2871A007 LU LRA935 HC CA1050IR</p>	<p>ALL1330</p>  <p>ALL1330WA ARL7224</p> <p>12v 70amp a:36 b:11.5 c:82.5</p> <p>FORD Agricultural 2000, 3000 Series 4000, 6000 Series 7000, 8000 Series</p> <p>175CID 201CID 401CID FO E7NN10B376AA LU LRA522 HC CA1330IR</p>	<p>ALL1457</p>  <p>ALB1457WA ARL7223 PAL0294</p>  <p>12v 70amp a:33.5 b:10.5 c:84</p> <p>AUSTIN-HEALEY Sprite 1.1 Sprite 1.3</p> <p>HE 8EL737662001 LU 66021070 HC CA1457IR</p>
<p>ALL1458</p>  <p>ALL1458WA PAL0294</p>  <p>24v 55amp a:115 b:80</p> <p>UNIVERSAL MERCEDES-BENZ HANOMAG MOTOROLA Marine</p> <p>HE 8EL737663001 LU NAB903 HC CA1458IR</p>	<p>ALL1468</p>  <p>ALL1468WA ARL7225 PAL0294</p>  <p>24v 33amp a:29 b:10.5 c:79</p> <p>UNIVERSAL</p> <p>HE 8EL737673001 LU NAB901 HC CA1468IR</p>	<p>ALL1508</p>  <p>ALL1508WA ARL7223</p> <p>12v 70amp a:35 b:11.5 c:83</p> <p>FORD Escort 1.3L</p> <p>J4B</p> <p>FO 95FB10300AA LU LRB00489 HC CA1508IR</p>	<p>ALL1550</p>  <p>ALL1550WA ARL7223 PAL0294</p>  <p>12v 70amp a:34 b:11 c:85</p> <p>Various Marine ISUZU MARINE 3LB1, 4J65, 4JG1, 4L35 4L42, 4L55, 4LB1, 4LC1, 4LEPT 66021126M MOTOROLA MARINE LU LEA0441 HC CA1550IR</p>
<p>ALL2112</p>  <p>ALL2112WA ARL7223 PAL0294</p>  <p>12v 70amp a:45 b:11.5 c:82.5</p> <p>YANMAR Marine Various Models</p> <p>2QM20</p> <p>PK 2871A145 LU LRA01178 CG 112112</p>	<p>ALL3152 <i>New</i></p>  <p>12v 90amp a:44.5 b:13.5 c:82</p> <p>Various marine</p> <p>LU NAB9000M CG 113152</p>	<p>ALL3713 <i>New</i></p>  <p>12v 80amp a:45.5 b:11 c:83</p> <p>LISTER Marine</p> <p>LU 47020058 CG 113713</p>	







Alternators

Magneti Marelli

<p>ALE0029</p>  <p>ALE0029WA</p> <p>12v 120amp a:39 b:64 c:57</p> <p>FIAT Punto Multijet</p> <p>FI 51855875 MM 63377029 MH ALE0029</p>	<p>ALE0102</p>  <p>ALE0102</p> <p>12v 140amp a:43 b:23 c:55</p> <p>LANCIA Thesis Turbo</p> <p>841AX 841AXA1B03</p> <p>FI 46816974 MM 46774428 DN DAN512</p>	<p>ALE0129</p>  <p>ALE0129WA</p> <p>12v 55amp a:44.5 b:16.5 c:66</p> <p>FIAT, LANCIA 124, 125, 131, 132, 230 Beta Regata Ducato</p> <p>132AC000, 125B000 131A6000, 132C2000 149B1000, 149C2000 FI 4424346 MM 63305403 HC CA129IR</p>	<p>ALE0212</p>  <p>ALE0212WA ALE212WA</p> <p>24v 27amp a:45 b:17 c:63</p> <p>KHD Fiat, Iveco</p> <p>804045 821022</p> <p>KH 98417208 MM 63320025 HC CA212IR</p>
<p>ALE0252</p>  <p>ALE0252WA ALE252WA</p> <p>12v 55amp a:52 b:23.5 c:74.5</p> <p>FIAT Strada X-1/9</p> <p>ARE4106</p> <p>FI 77320410 MM 63321003 HC CA252IR</p>	<p>ALE0255</p>  <p>ALE0255WA</p> <p>12v 45amp a:33 b:17 c:61</p> <p>FIAT, ALFA ROMEO AR 8 131, 132 Ducato Panda</p> <p>814461, 814465 814421, 8140.61200 141A000, 141AE FI 2022607 MM 63305206 HC CA255IR</p>	<p>ALE0307</p>  <p>ALE0307WA</p> <p>12v 45amp a:53 b:24</p> <p>FIAT, LANCIA 127 230 Panda A 112</p> <p>100GL048, A112A2000 131AZ000, 131BZ0C0 100GL3000, 1170A1046 FI 77110411 MM 63307108 HC CA307IR</p>	<p>ALE0316</p>  <p>ALE0316WA ALE316WA</p> <p>12v 55amp a:49 b:17 c:64</p> <p>ALFA ROMEO FIAT IVECO</p> <p>814461 6132AZ2000 VM81A FI 4721589 MM 63321042 HC CA316IR</p>
<p>ALE0317</p>  <p>ALE0317WA</p> <p>12v 55amp a:102 b:56</p> <p>MERCEDES-BENZ Actros 35t RENAULT R19, Clío</p> <p>OM541940, OM542944 OM442951, OM442980 OM616917, OM401912 RE 7700780507 MM 63321178 HC CA317IR</p> <p>ARE4118 PAL0292</p> 	<p>ALE0350</p>  <p>ALE0350WA</p> <p>12v 45amp a:57 b:32.5</p> <p>FIAT, LANCIA Panda 600 Serie Tipo Y</p> <p>156A4000, 156A3100 156A2100, 804502 160A3000, 156A2100 FI 46231657 MM 63320001 HC CA350IR</p>	<p>ALE0355</p>  <p>ALE0355WA</p> <p>12v 65amp a:50 b:17 c:65</p> <p>FIAT, ALFA ROMEO 131, 132 Ducato Argenta 33, 75</p> <p>814465, 814461, VM82A 814421, 814027, VM80A 81446150081, VM81A FI 46231758 MM 63320024 HC CA355IR</p>	<p>ALE0506</p>  <p>ALE0506WA ALE506WA</p> <p>12v 65amp a:47 b:16.5 c:64</p> <p>FERRARI 308 GTBI 2.9L FIAT, LANCIA 124 Spider 2.0L Zagato 2.0L</p> <p>F106D F120A AR67501 FI 82357795 MM 63221024 HC CA506IR</p>

Alternators

Magneti Marelli

<p>ALE0572</p>  <p>ALE0572WA ARE4110</p> <p>12v 55amp a:57.5 b:32</p> <p>FIAT, LANCIA Panda Uno Tipo Y</p> <p>156A2246, 176B2000 156A2048, 146A4044 160A3000, 156C046 FI 7565832 MM 63320034 HC CA572IR</p>	<p>ALE0596</p>  <p>ALE0596WA ALE0596WA ARE4110</p> <p>12v 65amp a:50 b:24 c:74</p> <p>FIAT, LANCIA Elba Tetra Delta Prisma</p> <p>FI 77603411 MM 63321156 HC CA596IR</p>	<p>ALE0642</p>  <p>ALE0642WA ARE4110</p> <p>12v 55amp a:48 b:18 c:65</p> <p>ALFA ROMEO, FIAT, IVECO AR 8 Ducato Daily I Zeta</p> <p>8140072712 280A1000 FI 4799364 MM 63320024 HC CA642IR</p>	<p>ALE0822</p>  <p>ALE0822WA ARE4110</p> <p>12v 50amp a:23 b:22 c:78</p> <p>FIAT Cinquecento 0.7L</p> <p>170A000 170A046 FI 7708433 MM 63321160 HC CA822IR</p>
<p>ALE0834</p>  <p>ALE0834WA ARE4110</p> <p>12v 65amp a:49 b:24 c:74</p> <p>FIAT Uno 1.4L</p> <p>146C1000 146A8046 FI 4470266 MM 63321151 HC CA834IR</p>	<p>ALE0851</p>  <p>ALE0851WA ARE4110</p> <p>12v 65amp a:55 b:32</p> <p>FIAT, LANCIA 600 Serie, Cinquecento Panda, Seicento Y</p> <p>156C046 176B2000 141C2000 FI 7713141 MM 63320040 HC CA851IR</p>	<p>ALE0890</p>  <p>ALE0890RB ALE0890WA ARE4121</p> <p>12v 65amp a:54 b:32</p> <p>CITROEN, FIAT, FORD LANCIA, PEUGEOT Jumpy, Doblo, Palio Panda, Punto Y, Expert</p> <p>220A2000 178E2000 188A4000 FI 7779915 MM 63321600 HC CA890IR</p>	<p>ALE0891</p>  <p>ALE0891WA ARE4123 PAL0265 W D+ B+</p> <p>12v 100amp a:32 b:14 c:84</p> <p>FORD, NEW HOLLAND Tractors 5640, 6640 7740, 7840 8240, 8340</p> <p>FO F0NN10B376BB MM 63321285 HC CA891IR</p>
<p>ALE0893</p>  <p>ALE0893WA ARE4110</p> <p>12v 55amp a:54 b:24</p> <p>FIAT Cinquecento Panda Seicento</p> <p>1170A1046 170A1000 170A1046 FI 46231650 MM 63321165 HC CA893IR</p>	<p>ALE1083</p>  <p>ALE1083RB ALE1083WA ALF0856 ARE4123 PAL0265 W D+ B+</p> <p>12v 70amp a:33 b:14 c:76</p> <p>FORD Escort</p> <p>RFD, RFK, RFS RVA, RTF, RTH FO 91FF10300JA MM 63341695 HC CA1083IR</p>	<p>ALE1084</p>  <p>ALE1084WA ARE4121</p> <p>12v 65amp a:41 b:17 c:83</p> <p>CITROEN, FIAT PEUGEOT Brava, Jumpy Palio Punto</p> <p>176A3000 176B7000 220A2000, 1580SPI PE 5705GV MM 63321615 HC CA1084IR</p>	<p>ALE1085</p>  <p>ALE1085WA ARE4123 PAL0265 W D+ B+</p> <p>12v 100amp a:33 b:14 c:83</p> <p>FORD Scorpio 2.9L V6 24V</p> <p>BOB, BRG FO 95GB10300LA MM 63221344 HC CA1085IR</p>

Alternators

Magneti Marelli

<p>ALE1100</p>  <p>ALE1100WA ARE4123 PAL0265  W D+ B+</p> <p>12v 85amp a:39 b:14 c:70</p> <p>ROVER 220 420 620 820</p> <p>20M4, 20T4H 20T4G, 20HD 22HDM16 RO YLE10128 MM 63321351 HC CA1100IR</p>	<p>ALE1153</p>  <p>ALE1153WA ARE4121</p> <p>12v 65amp a:62 b:32</p> <p>FIAT, LANCIA PEUGEOT, Expert Doblo, Palio, Punto Y</p> <p>223A5000, 188A4000 178E2000, DHX 178B5000, 840A3000 FI 46407646 MM 63321234 HC CA1153IR</p>	<p>ALE1154</p>  <p>ALE1154WA ARE4121</p> <p>12v 75amp a:44 b:33 c:84</p> <p>FIAT, LANCIA Doblo, Palio Punto, Strada Y</p> <p>176B2000, 176A7000 840A3000 223A5000 FI 46407647 MM 63321235 HC CA1154IR</p>	<p>ALE1158</p>  <p>ALE1158WA ARE4121</p> <p>12v 65amp a:41 b:17 c:54</p> <p>FIAT Brava</p> <p>182A5000 182A3000</p> <p>FI 7781077 MM 63321277 HC CA1158IR</p>
<p>ALE1159</p>  <p>ALE1159WA ARE4121</p> <p>12v 90amp a:45 b:17 c:55</p> <p>ALFA ROMEO Alfa 156, Alfa 166 GT, GTV Spider</p> <p>AR00515 932A2000 AR32301 FI 46430528 MM 63321287 HC CA1159IR</p>	<p>ALE1160</p>  <p>ALE1160RB ALE1160WA ARE4121</p> <p>12v 65amp a:44.5 b:17.5 c:54</p> <p>FIAT, LANCIA Barchetta, Brava Marea, Punto Strada Y</p> <p>840A4000 183A1000 182A3000 FI 46231670 MM 63321729 HC CA1160IR</p>	<p>ALE1161</p>  <p>ALE1161WA ARE4121</p> <p>12v 85amp a:41.5 b:17 c:82</p> <p>CITROEN, FIAT Jumpy Palio, Punto Scudo, Strada</p> <p>176A3000 176A5000 176B7000 FI 46540294 MM 63321618 HC CA1161IR</p>	<p>ALE1174</p>  <p>ALE1174WA ARE4634</p> <p>12v 80amp a:37.5 b:13 c:81.5</p> <p>NISSAN Primera</p> <p>GA16DE</p> <p>NI 231002F000 MM 63321356 HC JA1174IR</p>
<p>ALE1175</p>  <p>ALE1175WA</p> <p>12v 80amp a:38 b:25 c:81</p> <p>NISSAN Primera</p> <p>SR20DE P11</p> <p>NI 231002F210 MM 63321705 HC JA1175IR</p>	<p>ALE1189</p>  <p>ALE1189WA ARE4121 PAL0266  B+ D+</p> <p>12v 100amp a:44 b:22.5 c:55</p> <p>FIAT, LANCIA Brava, Marea Punto Delta, Lybra</p> <p>182A1000 182A2000 AR32302, 182A7000 FI 46428730 MM 63320333 HC CA1189IR</p>	<p>ALE1190</p>  <p>ALE1190WA ARE4121</p> <p>12v 75amp a:44 b:17 c:55</p> <p>FIAT Bravo Marea Marengo</p> <p>182A2000 182A7000 182A8000 FI 46428729 MM 63321613 HC CA1190IR</p>	<p>ALE1191</p>  <p>ALE1191WA ARE4123 PAL0265  W D+ B+</p> <p>12v 100amp a:31 b:14 c:83.5</p> <p>LAND ROVER Discovery Range Rover</p> <p>12L 14L 256T</p> <p>RO AMR4248 MM 63321321 HC CA1191IR</p>













Alternators

Magneti Marelli

<p>ALE1196</p>  <p>ALE1196RB ALE1196WA</p> <p>ARE4121</p> <p>12v 65amp a:59 b:25 c:71</p> <p>FIAT Palio Punto Siena</p> <p>178B2000, 178B2016 178B3000 176A9000 FI 46231698 MM 63321625 HC CA1196IR</p>	<p>ALE1199</p>  <p>ALE1199RB ALE1199WA</p> <p>ARE4129</p> <p>12v 100amp a:41 b:22 c:82.5</p> <p>CITROEN, FIAT Jumpy Palio Punto, Scudo Strada</p> <p>176A5000 178B5000 220A2000 FI 46420966 MM 63321332 HC CA1199IR</p>	<p>ALE1208</p>  <p>ALE1208RB ALE1208WA</p> <p>ARE4129 PAL0266</p> <p>12v 95amp a:41 b:22 c:54.5</p> <p>CITROEN, FIAT, LANCIA Barchetta, Brava Coupe, Marea Multipla, Punto Dedra, Kappa</p> <p>182B4000 188A6000 AR67601 FI 46765835 MM 63321241 HC CA1208IR</p>	<p>ALE1216</p>  <p>ALE1216WA</p> <p>ARE4129 PAL0266</p> <p>12v 85amp a:44.5 b:22 c:55</p> <p>ALFA ROMEO, FIAT, LANCIA Alfa145, Alfa146 Alfa155, Bravo, Marea Marengo, Barchetta Dedra, Delta, Kappa</p> <p>182A2000 838A1000 AR67106 FI 46231671 MM 63321313 HC CA1216IR</p>
<p>ALE1217</p>  <p>ALE1217WA</p> <p>ARE4123 PAL0265</p> <p>12v 70amp a:33 b:17 c:65</p> <p>FORD, MAZDA Escort Fiesta 121</p> <p>RTJ RFD, RFK RVA FO 96FF10300DB MM 63321244 HC CA1217IR</p>	<p>ALE1218</p>  <p>ALE1218RB ALE1218WA</p> <p>ARE4121</p> <p>12v 85amp a:41 b:17 c:54.5</p> <p>FIAT Bravo 2.0 Coupe 2.0 Marea 2.0</p> <p>182A1000 175A3000 FI 46404424 MM 63321398 HC CA1218IR</p>	<p>ALE1219</p>  <p>ALE1219WA</p> <p>ARE4129</p> <p>12v 85amp a:59 b:25 c:71</p> <p>FIAT Palio Punto Siena</p> <p>178B3000 178B5000 176A9000 FI 46420963 MM 63321253 HC CA1219IR</p>	<p>ALE1220</p>  <p>ALE1220RB ALE1220WA ALV1220RB</p> <p>ARE4121 PAL0266</p> <p>12v 75amp a:58.5 b:25 c:71</p> <p>FIAT, LANCIA Brava, Marea Palio, Siena Dedra, Delta</p> <p>182A4000 172B3000 182A6000 FI 46231698 MM 63321607 HC CA1220IR</p>
<p>ALE1221</p>  <p>ALE1221WA</p> <p>ARE4121</p> <p>12v 85amp a:58.5 b:25 c:72</p> <p>FIAT, LANCIA Brava, Marea Dedra, Delta</p> <p>182A4000 182A3000 182A6000 FI 46428734 MM 63321328 HC CA1221IR</p>	<p>ALE1222</p>  <p>ALE1222WA</p> <p>12v 85amp a:41 b:22 c:55</p> <p>FIAT, LANCIA Bravo 2.0 Coupe 2.0 Marea 2.0 Lybra 2.0</p> <p>182B7000 182B3000 182B7000, 185A8000 FI 46413021 MM 63321329 HC CA1222IR</p>	<p>ALE1223</p>  <p>ALB1223RB ALE1223RB ALE1223WA</p> <p>ARE4121 PAL0266</p> <p>12v 100amp a:44.5 b:22 c:55</p> <p>ALFA ROMEO, FIAT, LANCIA Alfa 145, 146, 147, 155, 156 GTV, Spider, Lybra Brava, Coupe, Marea Punto, Multipla, Kappa</p> <p>1839A7000 AR67601 182B4000 FI 46305329 MM 63321423 HC CA1223IR</p>	<p>ALE1230</p>  <p>ALE1230WA</p> <p>ARE4123 PAL0265</p> <p>12v 100amp a:33.5 b:13.5 c:82.5</p> <p>FORD Transit</p> <p>NSF NSG NSH FO 95VB10300BC MM 63321347 HC CA1230IR</p>

Alternators

Magneti Marelli

<p>ALE1233</p>  <p>ALE1233WA</p> <p>ARE4123 PAL0265</p> <p>12v 100amp a:55.5 b:17 c:63</p> <p>FIAT, LANCIA, ALFA ROMEO R67203, 159A4046 Alfa 155 836A3000 Coupe 835C2000 Tempra FI 7762899 Dedra MM 63321231 HC CA1233IR</p>	<p>ALE1252</p>  <p>ALE1252WA</p> <p>ARE4123 PAL0265</p> <p>12v 100amp a:40 b:14 c:70</p> <p>ROVER 20HD, T16 800 20HDM16 820 20T4H RO YLE101850 MM 63321333 HC CA1252IR</p>	<p>ALE1258</p>  <p>ALE1258RB ALE1258WA</p> <p>ARE4121 PAL0266</p> <p>12v 75amp a:41 b:17 c:82</p> <p>FIAT 230A2000 Ducato 1.9 230A3000 230A4000 FI 1305709080 MM 63321617 HC CA1258IR</p>	<p>ALE1305</p>  <p>ALE1305WA</p> <p>ARE4421 PAL0266</p> <p>12v 65amp a:75 b:56</p> <p>CITROEN, FIAT HDZ, HDY PEUGEOT KFX, DHX Berlingo, Saxo, Xsara NFT, NFZ Ducato PE 9631324980 106, 306, Partner MM 63321671 HC CA1305IR</p>
<p>ALE1311</p>  <p>ALE1311RB</p> <p>ARE4129</p> <p>12v 100amp a:44.5 b:22 c:54.5</p> <p>LANCIA 838A3000 Kappa 2.4 838A7000 FI 46430530 MM 63321245 HC CA1311IR</p>	<p>ALE1313</p>  <p>ALE1313WA</p> <p>ARE4121</p> <p>12v 75amp a:44.5 b:17.5 c:54.5</p> <p>FIAT, LANCIA 840A2000, 182A3000 Marea 185A2000 Coupe 183A1000 Barchetta FI 46448433 Bravo 1.4L MM 63321640 HC CA1313IR</p>	<p>ALE1318</p>  <p>ALE1318WA</p> <p>ARE4121 PAL0266</p> <p>12v 65amp a:90 b:58.5</p> <p>ROVER 18K4K, 16K4F 25 D16Y2, 11K2D 100 14K2A, 14K2D 200 RO YLE101520 400 MM 63321239 HC CA1318IR</p>	<p>ALE1337</p>  <p>ALE1337WA</p> <p>ARE4123 PAL0265</p> <p>12v 100amp a:31 b:14 c:83</p> <p>LAND ROVER 12L Discovery 14L Range Rover 256T RANGE ROVER II RO YLE10075 2.5D/2.5TD (94-03) MM 63321321 HC CA1337I</p>
<p>ALE1348</p>  <p>ALE1348WA</p> <p>ARE4129</p> <p>12v 100amp a:41 b:22.5 c:82</p> <p>FIAT 230A2000, 230A3000 Ducato 1.9L Diesel FI 46434931 MM 63320305 HC CA1348IR</p>	<p>ALE1349</p>  <p>ALE1349WA</p> <p>ARE4850 PAL0266</p> <p>12v 65amp b:32</p> <p>FIAT, LANCIA 182B2000, 188A5000 Brava 1.2, Bravo 1.2 176B9000, 178C4066 Punto 1.2, Marea 1.2 188A4000, 176B9000 Siena 1.2, Strada 1.2 FI 46437412 Palio 1.2, Y 1.2 MM 63321626 HC CA1349IR</p>	<p>ALE1350</p>  <p>ALE1350WA</p> <p>ARE4595</p> <p>12v 85amp a:44 b:32.5 c:83.5</p> <p>FIAT LANCIA 176B9000 Punto 1.2 182B2000 Marea 1.2 Brava 1.2 FI 46758245 Bravo 1.2, Y 1.2 MM 63321782 HC CA1350IR</p>	<p>ALE1379</p>  <p>ALE1379WA</p> <p>ARE4127 PAL0265</p> <p>12v 100amp a:32 b:14 c:84</p> <p>FORD Landbrug 5000 Series 7000 Series 6000 Series FO F0NN10B376BB 8000 Series MM 63321346 HC CA1379IR</p>

Alternators

Magneti Marelli

<p>ALE1380</p>  <p>ALE1380WA ARE4123 PAL0265</p>  <p>W D+ B+</p> <p>12v 100amp a:31.5 b:14 c:70</p> <p>LANCIA, LAND ROVER 35D, 36D, 37D Ardea 38D, 42D Defender Discovery RO YLE10124 Range Rover MM 63321240 HC CA1380IR</p>	<p>ALE1435 <i>Old</i></p>  <p>ALE1435WA ARE4110</p> <p>12v 55amp a:44.5 b:16 c:63.5</p> <p>FIAT, LANCIA 146B2000 Elba 149B4000 Tipo 149B3000, 831D000 Fiorino FI 46446292 Prisma MM 63320003 HC CA1435IR</p>	<p>ALE1451</p>  <p>ALE1451WA ARE4121</p> <p>12v 100amp a:41 b:17.5 c:54.5</p> <p>FIAT, LANCIA 182A1000 Bravo 2.0 175A3000 Coupe 2.0 182B7000 Lybra 2.0 FI 46439036 MM 63321426 HC CA1451IR</p>	<p>ALE1475</p>  <p>ALE1475WA ALE475WA ARE4131 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 90amp b:17 c:69</p> <p>Ford Focus I F9DA 1.8TDCI/2.0L 16V (99-04) FFDA FO 1M5T10300BA MM 63321746 HC CA1475IR</p>
<p>ALE1483</p>  <p>ALE1483WA ARE4131 PAL0233</p>  <p>FR SIG A LI RC A</p> <p>12v 80amp a:33 b:14 c:62</p> <p>FORD, LISTER ALDA Focus 1.8L HMDA Focus 2.0L EYDC, EDDC Marine FO 98AB10300DJ MM 63321678 HC CA1483IR</p>	<p>ALE1487</p>  <p>ALE1487WA ARE4121 PAL0265</p>  <p>W D+ B+</p> <p>12v 85amp a:91 b:58</p> <p>ROVER 16K4F 200, 218 18K4K 400, 416 D16Y2 RO YLE101530 MM 63321239 HC CA1487IR</p>	<p>ALE1488</p>  <p>ALE1488WA ARE4121 PAL0266</p>  <p>B+ D+</p> <p>12v 65amp a:36.5 b:14 c:75</p> <p>AUSTIN, ROVER 12A2D Mini 1.3 12A2E 12A2L RO YLE101790 MM 63321636 HC CA1488IR</p>	<p>ALE1558</p>  <p>ALE1558WA ARE4121 PAL0266</p>  <p>B+ D+</p> <p>12v 100amp a:43.5 b:22 c:55</p> <p>ALFA ROMEO, FIAT, LANCIA R2302, 937A4000 Alfa 145, 146, 147, 156 182B4000, 182B9000 GT, Brava, Doblo, Lybra 223A7000, 192A8000 Marea, Marengo FI 46544329 Multipla, Punto, Stilo MM 63321826 HC CA1558IR</p>
<p>ALE1565</p>  <p>ALE1565RB ALE1565WA ARE4121 PAL0266</p>  <p>B+ D+</p> <p>12v 75amp a:41 b:17 c:82.5</p> <p>CITROEN, FIAT 1580SPI Jumpy 220A2000 Scudo FI 46430111 MM 63321620 HC CA1565IR</p>	<p>ALE1625</p>  <p>ALE1625RB ALE1625WA ARE4121 PAL0266</p>  <p>B+ D+</p> <p>12v 75amp a:90 b:58</p> <p>SMART M160E6ALB03 Smart 0.6 M160E6ALB04 M160E6ALB05 MB 1601540101 MM 63341896 HC CA1625IR</p>	<p>ALE1647</p>  <p>ALE1647WA ARE4595</p> <p>12v 60amp a:60.5 b:32</p> <p>FIAT 188A5000 Punto 1.2L FI 46530261 MM 63321713 HC CA1647IR</p>	<p>ALE1649</p>  <p>ALE1649WA ALN1649RB PAL0277</p>  <p>L</p> <p>12v 90amp b:17 c:69.5</p> <p>FORD RTN Fiesta 1.8 RTQ RTP FO 1122105 MM 63341711 HC CA1649IR</p>









Alternators

Magneti Marelli

<p>ALE1651</p>  <p>ALE1651RB ALE1651WA</p> <p>ARE4128 PAL0266</p>  <p>W B+ B+</p> <p>12v 85amp a:39.5 b:14 c:70</p> <p>ROVER 200 400 600</p> <p>20T4H 20M4F 20T4G RO YLE10083 MM 63320317 HC CA1651IR</p>	<p>ALE1696</p>  <p>ALE1696RB ALE1696WA ALE696WA</p> <p>ARE4121 PAL0266</p>  <p>B+ D+</p> <p>12v 65amp a:44.5 b:17 c:55</p> <p>FIAT Doblo 1.9l Palio 1.9l Stada 1.9l</p> <p>223A6000 188A2000 FI 46782218 MM 63321833 HC CA1696IR</p>	<p>ALE1697</p>  <p>ALE1697WA</p> <p>ARE4121</p> <p>12v 90amp a:44.5 b:17 c:54.5</p> <p>FIAT Doblo, Multipla Palio, Strada Punto, Stilo</p> <p>223A7000 186A9000 182B4000 FI 46774430 MM 63321819 HC CA1697IR</p>	<p>ALE1698</p>  <p>ALE1698RB ALE1698WA</p> <p>ARE4595 PAL0266</p>  <p>B+ D+</p> <p>12v 120amp a:44.5 b:22 c:54.5</p> <p>ALFA ROMEO, FIAT, LANCIA Alfa 147, Alfa 156 Brava, Bravo, Idea Marea, Marengo, Muso Lybra, Kappa, Stilo</p> <p>82B4000 186A6000 841G000, 937A2000 FI 46748353 MM 63321859 HC CA1698IR</p>
<p>ALE1734</p>  <p>ALE1734WA</p> <p>ARE4594 PAL0262</p>  <p>PHIN B+ D+</p> <p>12v 75amp a:90 b:58</p> <p>SMART Cabrio, City Crossblade Fortwo, Roadster Smart</p> <p>M160921 M160E6ALB04 M160910 MB 1601540301 MM 63321658 HC CA1734IR</p>	<p>ALE1742</p>  <p>ALE1742WA</p> <p>ARE4579 PAL0266</p>  <p>B+ D+</p> <p>12v 85amp a:17.5 b:24 c:50.5</p> <p>FIAT, LANCIA Brava, Idea Panda, Stilo Punto Y, Ypsilon</p> <p>188A5000 843A1000 184A4000 FI 46554404 MM 63377007 HC CA1742IR</p>	<p>ALE1743</p>  <p>ALE1743WA</p> <p>ARE4121 PAL0266</p>  <p>B+ D+</p> <p>12v 90amp a:44 b:17.5 c:54.5</p> <p>ALFA ROMEO Alfa 156 Alfa 166 GT</p> <p>AR32104 932A2000 AR36301 FI 46430528 MM 63321729 HC CA1743IR</p>	<p>ALE1753</p>  <p>ALE1753WA</p> <p>ARE4123 PAL0266</p>  <p>B+ D+</p> <p>12v 120amp a:45 b:22 c:54.5</p> <p>FIAT, LANCIA Stilo Lybra</p> <p>192A4000 839A4000, 839A7000 839A9000 FI 46543023 MM 63321431 HC CA1753IR</p>
<p>ALE1760</p>  <p>ALE1760WA</p> <p>PAL0277</p>  <p>12v 80amp a:33 b:14 c:53.5</p> <p>FORD Fiesta Courier 1.8TD DI 2000</p> <p>RTN RTP RTQ FO YS6110300CA MM 63321758 HC CA1760IR</p>	<p>ALE1766</p>  <p>ALE1766WA ALN1766RB</p> <p>ARE4595 PAL0266</p>  <p>B+ D+</p> <p>12v 75amp a:16.5 b:24 c:50</p> <p>CITROEN, FIAT, LANCIA C4, Strada Albea, Idea Panda, Punto Musa, Y</p> <p>RFN 188A4000 350A1000 FI 46542889 MM 63321718 HC CA1766IR</p>	<p>ALE1772</p>  <p>ALE1772WA ALF1772 ALF1772WA</p> <p>PAL0277</p>  <p>12v 90amp a:32.5 b:14 c:54</p> <p>FORD Fiesta 1.6l Fiesta 1.8l</p> <p>RTN RTQ RTP FO 1117829 MM 63321778 HC CA1772IR</p>	<p>ALE1830</p>  <p>ALE1830WA</p> <p>ARE4595</p> <p>12v 75amp a:60 b:32</p> <p>FIAT Stilo 1.2 Punto 1.2</p> <p>188A5000 FI 46554405 MM 63321763 HC CA1830IR</p>

Alternators

Magneti Marelli

<p>ALE1843</p>  <p>ALE1843WA ALN1843RB</p> <p>ARE4121 PAL0266  B+ D+</p> <p>12v 60amp a:53.5 b:32.5</p> <p>FIAT, LANCIA Panda, Punto 1.2L Seicento 1.1L, Ypsilon 1.2L Idea 1.2L Doblo 1.2L</p> <p>187A1000, 188A5000 188A4000 176B2000, 223A5000 FI 46800158 MM 63321848 HC CA1843IR</p>	<p>ALE1844</p>  <p>ALE1844WA ALN1844RB</p> <p>ARE4121 PAL0266  B+ D+</p> <p>12v 70amp a:54 b:32</p> <p>FIAT, LANCIA Doblo 1.2L, Ypsilon 1.2L Panda, Seicento 1.1L Palio 1.2L, Punto 1.2L Strada 1.2L</p> <p>178B5000, 187A1000 176B2000, 188A4000 223A5000, 188A4000 FI 46843093 MM 63377001 HC CA1844IR</p>	<p>ALE1849</p>  <p>ALE1849WA ALN1849RB</p> <p>ARE4595 PAL0266  B+ D+</p> <p>12v 65amp b:17 c:65</p> <p>NEW HOLLAND IVECO Daly II</p> <p>8140.07.2700 8140.07.2712 8140.47R.2790 IV 99457074 MM 63321458 HC CA1849IR</p>	<p>ALE1884</p>  <p>ALE1884WA ALN1884RB</p> <p>ARE4595 PAL0266  B+ D+</p> <p>12v 105amp a:112.5 b:61.5</p> <p>FIAT, OPEL, VAUXHALL Croma Astra, Signum Vectra, Zafira Astravan</p> <p>Z19DTL Z19DTH Z19DT OP 93169028 MM 63377492 HC CA1884IR</p>
<p>ALE1885</p>  <p>ALE1885WA ALN1885RB</p> <p>ARE4595 PAL0266  B+ D+</p> <p>12v 120amp a:113 b:61</p> <p>FIAT, ALFA ROMEO OPEL Bravo, Croma, Punto Alfa 159 Astra, Stilo</p> <p>939A1000, Z19DTH 937A4000, Z19DTJ 939A8000, 937A8000 FI 73503235 MM 63377004 HC CA1885IR</p>	<p>ALE1886</p>  <p>ALE1886WA ALN1886RB</p> <p>ARE4595 PAL0266  B+ D+ DFM</p> <p>12v 70amp a:67.5 b:32</p> <p>ALFA-ROMEO, FIAT LANCIA Mito, 500 Brava, Doblo, Panda Punto, Albea, Siena</p> <p>199A6000 198A4000 350A1000 FI 51700675 MM 63377011 HC CA1886IR</p>	<p>ALE1890</p>  <p>ALE1890RB ALN1890WA</p> <p>ARE4595 PAL0263  B+ D+ DFM</p> <p>12v 130amp a:113 b:61</p> <p>OPEL, SAAB, VAUXHALL Astra, Signum Vectra, Zafira 9-3 Astra</p> <p>Z19DTH, Z19DTL Z19DTJ, Z19DT OP 13117236 MM 63377491 HC CA1890IR</p>	<p>ALE1955</p>  <p>ALE1955WA ALN1955RB</p> <p>ARE1027 PAL0474  DFM L</p> <p>12v 70amp a:40 b:64 c:55</p> <p>OPEL, VAUXHALL Corsa D Corsa Mk II</p> <p>Z13DTH Z13DTJ OP 1204426 MM 63377423 HC CA1955IR</p>
<p>ALE1956</p>  <p>ALE1956WA ALN1956RB</p> <p>ARE1027 PAL0474  DFM L</p> <p>12v 100amp a:39 b:64 c:55</p> <p>OPEL, VAUXHALL Corsa D Corsa Mk II</p> <p>Z13DTH Z13DTJ OP 6204258 MM 63377424 HC CA1956IR</p>	<p>ALE1995</p>  <p>ALE1995WA ALN1995RB</p> <p>ARE4595 PAL0266  B+ D+</p> <p>12v 140amp a:113 b:61</p> <p>SUZUKI FIAT Bravo SX4 Alfa</p> <p>D19AA 198A5000 198A3000, 939A7000 FI 71746673 MM 63321940 HC CA1995IR</p>	<p>ALE1998</p>  <p>ALE1998WA ALN1998RB ALN1998WA</p> <p>ARE4595 PAL0266  B+ D+</p> <p>12v 105amp a:65.5 b:32</p> <p>FIAT Stilo 1.4L</p> <p>188A4000 FI 51714792 MM 63377031 HC CA1998IR</p>	<p>ALE3005</p>  <p>ALE3005WA ALN3005RB</p> <p>ARE4128 PAL0265  W D+ B+</p> <p>12v 100amp a:31 b:31 c:83</p> <p>ROVER, GM Land Rover 90/110 DHMC 3.5L V8</p> <p>JCB 32008648 PER 2871A309 DN DAN649</p>






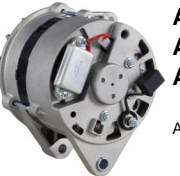

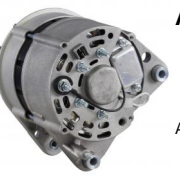




Alternators

Magneti Marelli

<p>ALE3025</p>  <p>ALE3025WA ARE4128 PAL0265</p> <p>12v 120amp a:31.5 b:14 c:70</p> <p>LANCIA, LAND ROVER 35D, 36D, 37D, 38D Ardea 42D Defender Discovery RO YLE10124 Range Rover MM 63321240 DN DAN016</p>	<p>ALE3361 <i>New</i></p>  <p>12v 100amp a:74 b:48</p> <p>ROVER 825i V6 2.5i RV YLE101800 MM 63321261 WA 22664R</p>	<p>ALE3465</p>  <p>ALE3465WA ARE4128 PAL0265</p> <p>24v 80amp b:13 c:85</p> <p>HYSTER Perkins CATERPILLAR Excavator M322C 3056E 6.0L 366ci CA 2253147 MM 63307466 DN DAN652</p>	<p>ALE3621</p>  <p>ALE3621WA</p> <p>12v 115amp a:33.5 b:14 c:83.5</p> <p>FORD E5FA Transit E5FC CASE MXU100 MXU110 4-274 D FO 1C1T10300BB NEW HOLLAND TS100A MM 63321817 CG 113621</p>
<p>ALE3967</p>  <p>ALE3967WA ARE4135</p> <p>12v 120amp b:13 c:83</p> <p>CATERPILLAR Perkins Backhoe Loaders 420D PK 2871A305 MM 63377464 CG 113967</p>	<p>ALE3968</p>  <p>12v 90amp a:54.5 b:32.5</p> <p>FIAT 187AXB Seicento 187AXB1A FI 46736968 MM 63321760 HC CA2059IR</p>	<p>ALE3987</p>  <p>ALE3987WA ARE4595</p> <p>12v 140amp a:45 b:22 c:54</p> <p>ALFA ROMEO, FIAT 937A5000 LANCIA 192A1000 Alfa 156 841C000, 841G000 Stilo FI 46774429 Thesis MM 63321862 HC CA2062IR</p>	<p>ALE5571 <i>New</i></p>  <p>12v 70amp a:34 b:14 c:84</p> <p>FORD Transit T12 Transit T15 MM 63395571</p>
<p>ALE7302</p>  <p>12v 45amp a:46 b:17 c:61</p> <p>FIAT, SEAT FI 77138410 MM 63303100 HC CA120</p>	<p>ALE7417 <i>New</i></p>  <p>ALE7417WA ARE4774</p> <p>12v 60amp a:91 b:57</p> <p>SUZUKI Swift II 1.0 1996-2001 Swift II 1.3 2001-> SU 3140083E10 MM 63321774</p>	<p>ALE7902 <i>New</i></p>  <p>12v 55amp a:46 b:17 c:64</p> <p>MM 63399902</p>	<p>ALE8901 <i>New</i></p>  <p>12v 70amp a:66 b:31</p> <p>FIAT 182B2000 Brava 1.2L 176B9000 Punto1.2L 223A5000 FI 46407649 MM 63321286 CA CAL30189GS</p>

Alternators

Magneton

ALG0292		ALG0300		ALG1455		ALG1626			
									
ALG0292WA		ALG0300WA		ALG0850 ALG0850WA ALG1455WA		ALG1626WA			
ARG8291		ARG8541		ARG8291		ARG8291			
12v	55amp	a:32	b:50.5	12v	55amp	a:25	b:26.5	c:65	
12v	70amp	a:48	b:27	c:66	12v	90amp	a:33	b:14	c:66
SKODA 105 110 120 ZETOR Tractors	7421 OHV 74212X SK 443113516184 MG 443113516180 HC CA292IR	SKODA Felicia Combo Pickup	SK 443113516632 MT 443113516634 HC CA589IR	SKODA Favorit 1.3l Felicia 1.3l Forman 1.3l	136B 781135 AMG, AMH VW 047903015J MG 443113516630 HC CA1455IR	SKODA Felicia 1.3l	135B, 135M 136B AMH, AMG, AMJ VW 047903015M MG 443113516591 HC CA1626IR		
ALG3543		ALG3552							
									
ALG3543WA		ALG3552WA ALG552WA							
ARG8291		ARG8480							
12v	55amp	a:77.5	b:51	12v	120amp	a:77	b:51		
JOHN DEERE Various Models Skid Steer Loaders	JD RE501634 MG 443113515241 CG 113543	Case 100 170 CBX	MG 9515112 MG 9515122 CG 113552						

























Alternators

Mando

<p>ALA0014</p>  <p>ARA1510</p> <p>12v 70amp a:39 b:13 c:67</p> <p>KIA Sephia Mentor Roadster</p> <p>FB</p> <p>KI 0K24718300 MD TA000A26401 MH ALA0014</p>	<p>ALA0016</p>  <p>ALA0016WA</p> <p>ARA1094 PAL0200 </p> <p>12v 110amp a:42 b:19 c:61</p> <p>KIA Carnival 2.5L Sedona 2.5L</p> <p>FL V6</p> <p>KI OK55818300 MD AB111125 VA 600016</p>	<p>ALA0234</p>  <p>ARV9160</p> <p>12v 120amp a:10 b:13 c:41.5</p> <p>HYUNDAI i30</p> <p>CW</p> <p>HY 373002A600 VA TG12C090 HC CA2133IR</p>	<p>ALA0236 <i>New</i></p>  <p>ALA0236WA</p> <p>ARA1100</p> <p>24v 70amp a:41 b:13.5 c:81</p> <p>COUNTY E BOGDAN BUS KIA POWER COMBI</p> <p>NB NQ N3</p> <p>HD 3730041751 MD AD270365 VA 600820</p>
<p>ALA0239 <i>New</i></p>  <p>ALA0239WA</p> <p>24v 70amp a:35 b:13 c:56</p> <p>HYUNDAI</p> <p>HD AC270542 HD 3730093000 MH ALA0239</p>	<p>ALA0348</p>  <p>ALA0348WA</p> <p>ARA1785 PAL0502 </p> <p>12v 55amp a:25 b:13 c:48</p> <p>HYUNDAI, MITSUBISHI</p> <p>MI A2T06991 MD AB160A HC JA146IR</p>	<p>ALA0377</p>  <p>ALA0377WA</p> <p>ARA1563 PAL0240 </p> <p>12v 120amp a:27 b:17 c:49</p> <p>KIA Sorento 3.5 HUNDAI Terracan</p> <p>G6CU</p> <p>HD 3730039450 MD TA000A49601 MS 210377</p>	<p>ALA0785 <i>New</i></p>  <p>24v 50amp a:45 b:18 c:81</p> <p>HYUNDAI HD160 HD170</p> <p>HY 3730093200 MD TA0002655587 MH ALA0785</p>
<p>ALA0803</p>  <p>ARM3279 PAL0200 </p> <p>12v 45amp a:30 b:13 c:64.5</p> <p>KIA Pride 1.3L FORD Festiva 1.3L MAZDA 121 1.3L</p> <p>MZ B11518300 MD AB150017 HC JA803IR</p>	<p>ALA0877</p>  <p>ALA0877WA</p> <p>ARM3691 PAL0200 </p> <p>12v 75amp a:45.5 b:13.5 c:54.5</p> <p>KIA, MAZDA Rio Sephia Shuma MX, Xedos</p> <p>B69, B6D D4FA, B5, B6 T8D, B5D</p> <p>KI 0K20118300B MD AB170094 HC JA877IR</p>	<p>ALA0879</p>  <p>ALA0879WA</p> <p>ARM3217 PAL0200 </p> <p>12v 75amp a:34 b:13 c:54.5</p> <p>HYUNDAI Accent Elantra Lantra Matrix</p> <p>G4EH, G4EK, G4GC G4BB, G4EA, 4G61 G4GC, G4GBG</p> <p>HD 3730022023 MD AB175054 HC JA879IR</p>	<p>ALA0888</p>  <p>ALA0888WA</p> <p>ARM3217 PAL0200 </p> <p>12v 75amp a:41.5 b:13 c:55</p> <p>HYUNDAI H1 H100</p> <p>G4CS</p> <p>HD 3730032131 MD AB175052 HC JA888IR</p>

Alternators

Mando

<p>ALA0994</p>  <p>ALA0994WA ARA1058 PAL0200 </p> <p>12v 90amp a:35.0 b:13 c:54.5</p> <p>HYUNDAI Accent Elantra</p> <p>G4EH G4CP HD 3730022200 MD AB190058 HC JA994IR</p>	<p>ALA1276</p>  <p>ALA1276 PAL0200 </p> <p>12v 50amp a:42 b:13 c:65</p> <p>KIA B3 Pride 1.3L FORD Festiva 1.3L SAIPA KI KK33918300 MD AB150021 HC JA1276IR</p>	<p>ALA1366</p>  <p>ALA1366RB ALA1366WA ARA1422 PAL0501 </p> <p>12v 65amp a:45 b:13 c:54.5</p> <p>HYUNDAI H100 2.5 D4BA D4BB HD 3730042017 MD AC165531 HC JA1366IR</p>	<p>ALA1518</p>  <p>ALA1518WA ALA1518WA ARA1620 PAL0200 </p> <p>12v 110amp a:44 b:12 c:56</p> <p>HYUNDAI D4CB H-1 2.5 CRDI D4BF Porter 2.5 TD D4BH HD 3730042357 MD AF111364 HC JA1518IR</p>
<p>ALA1537</p>  <p>ALA1537WA ALM1537RB ARM3277 PAL0200 </p> <p>12v 70amp a:38 b:13 c:66.6</p> <p>KIA FE Sportage 2.0L FEDI Retona 2.0L KI 0K01118300 MD AB170035 HC JA1537IR</p>	<p>ALA1539</p>  <p>ALA1539WA ARY9035 PAL0200 </p> <p>12v 75amp a:46 b:13 c:80</p> <p>KIA J3 Carnival 2.9L DSL Sedona 2.9L TD KI OK55318300B MD AF185381 HC JA1539IR</p>	<p>ALA1618</p>  <p>ALA1618WA ALA618WA ARA1422 PAL0501 </p> <p>12v 65amp a:45 b:13 c:54.5</p> <p>Hyundai D4BA, D4BB H100 2.5L D4BF, D4BX Galopper 2.5L Diesel Grace HD 3730047400 MD AD165206 HC JA1618IR</p>	<p>ALA1637</p>  <p>ALV1637WA ARV1516 PAL0214 </p> <p>12v 75amp a:53.5 b:27 c:66.5</p> <p>RENAULT F3R768, F3R742, F3R768 Espace D7F744, D7F746, D7F720 Kangoo D7F702, D7F704, D7F700 Twingo NI 2310000Q1C VA SG9B120 HC CA1637IR</p>
<p>ALA1709</p>  <p>ALA1709WA ARA1551 PAL0200 </p> <p>12v 110amp a:47.5 b:13 c:80.5</p> <p>HYUNDAI J3 Terracan 2.9L TD KIA CRDi, HPDi Carnival II 2.9L HD 373004X000 MD TA000A61201 HC JA1709IR</p>	<p>ALA1711</p>  <p>ALA1711WA ARA1620 PAL0200 </p> <p>12v 75amp a:42 b:13 c:55</p> <p>KIA D4BH Pregio HYUNDAI H1 2.5L Starex 2.5L KI 3730042456 MD AF175363 HC JA1711IR</p>	<p>ALA1715</p>  <p>ALA1715WA ARA1796 PAL0200 </p> <p>12v 60amp a:38 b:13 c:48.5</p> <p>HYUNDAI G4HC Atos 1.0L G4HC-E G4HC Atos Prime 1.0L HD 3730002503 MD AB160108 HC JA1715IR</p>	<p>ALA1716</p>  <p>ALA1716WA ARA1422 PAL0501 </p> <p>12v 75amp a:42.5 b:13.5 c:55</p> <p>HYUNDAI D4BH Galopper 2.5L D4BA MITSUBISHI Diesel Galopper 2.5L HD 3730047500 MD AF175385 HC JA1716IR</p>





Alternators

Mando

<p>ALA1717</p>  <p>ALA1717WA PAL0501 </p> <p>12v 90amp a:42.5 b:13 c:55</p> <p>HYUNDAI TERRACAN 2.5 TD 12.01-> D4BA GALLOPER I 2.5 TD D4BH GALLOPER II (JK-01) 2.5 TDHD 3730042860 MD AF190216 HC JA1717IR</p>	<p>ALA1718</p>  <p>ALA1718WA ARA1126 PAL0240 </p> <p>12v 95amp a:38.5 b:13 c:67</p> <p>HYUNDAI D4EA, G4GCG Santa Fe 2.0L G4JPG, G4JPS Santa Fe 2.4L Trajet 2.0L HD 3730038700 MD AB195141 HC JA1718IR</p>	<p>ALA1784</p>  <p>ALA1784WA ARA1094 PAL0200 </p> <p>12v 90amp a:37.5 b:13.5 c:67</p> <p>KIA TB Carens I 1.8L Carens II 1.8L KI 0K9B118300 MD AB190110 HC JA1784IR</p>	<p>ALA1785</p>  <p>ALA1785WA ARA1094 PAL0200 </p> <p>12v 80amp a:37.5 b:13 c:66.5</p> <p>KIA GA6D Rio 1.5L A5D Rio 1.6L A3E Shuma 1.6L KI 0K30D18300 MD AB180140 HC JA1785IR</p>
<p>ALA1786</p>  <p>ALA1786WA ARA1794 PAL0200 </p> <p>12v 80amp a:38 b:13 c:67.5</p> <p>KIA T8 Clarus 1.8L FE Clarus 2.0L 16V KI 0K19T18300A MD AB180092 HC JA1786IR</p>	<p>ALA1788</p>  <p>ALA1788WA ARA1028 PAL0200 </p> <p>12v 80amp a:34.5 b:13 c:54.5</p> <p>HYUNDAI Accent 1.3L, 1.5L, 1.6L G4AE Coupe 2.0L G4GR KIA HD 3730022600 Sportage 2.0L MD AB180128 HC JA1788IR</p>	<p>ALA1789</p>  <p>ALA1789RB ALA1789WA ARA1224 PAL0206 </p> <p>12v 90amp a:34 b:13 c:54</p> <p>HYUNDAI Accent 1.6L G4EA Tucson 2.0L G4EE KIA HD 3730022650 Rio 1.6L MD AB190147 HC JA1789IR</p>	<p>ALA1798</p>  <p>ALA1798WA ARA1798 PAL0204 </p> <p>12v 70amp a:37.5 b:13 c:47.5</p> <p>HYUNDAI, KIA Getz G4HD Picanto G4HG HD 3730002550 MD TA000A55601 HC JA1798IR</p>
<p>ALA1804</p>  <p>ALA1804WA ALV1804RB ARA1551 PAL0200 </p> <p>12v 110amp a:42.5 b:16 c:55</p> <p>HYUNDAI H1 2.5L D4CB Starex 2.5L Diesel KIA HD 373004A110 Sorento 2.5L MD AF111382 HC JA1804IR</p>	<p>ALA1807</p>  <p>ALA1807WA ARA1563 PAL0242 </p> <p>12v 110amp a:38 b:13 c:65</p> <p>HYUNDAI G4BP, G4JSG Santa Fe 2.4L G4GCG, G4JP Sonata 2.4L G4GC, 4G64 Kia KI 3730037250 Sorento 2.4L VA SG9B025 HC JA1807IR</p>	<p>ALA1903</p>  <p>ALA1903WA ARA1531 PAL0206 </p> <p>12v 120amp a:43.5 b:23 c:44</p> <p>HYUNDAI G6BAG Santa Fe 2.7L G6BA Sonata 2.7L KIA HD 3730037800 Sportage 2.7L MD A0002605490 HC JA1903IR</p>	<p>ALA1927</p>  <p>ALA1927WA ARA1544 PAL0226 </p> <p>12v 90amp a:34 b:13 c:54.5</p> <p>HYUNDAI G4GCG i30 G4GC KIA HD 3730023650 Ceed 2.0 MD A0002655635 Pro Ceed 2.0 HC CA1927IR</p>
















Alternators

Mando

<p>ALA1938</p>  <p>ALA1938WA PAL0206 </p> <p>12v 90amp a:32.5 b:13.5 c:51</p> <p>HYUNDAI, KIA NISSAN Getz Picanto Kubistar</p> <p>D3EA D3FA K9K710 KI 373002A010 MD A0002655103 HC CA1938IR</p>	<p>ALA2020</p>  <p>ALA2020WA ARV1882 PAL0207 </p> <p>12v 90amp a:33.5 b:15 c:50</p> <p>KIA Ceed 1.4L Pro Ceed 1.4L HYUNDAI i30</p> <p>G4FA, G4FC HD 373002B101 MD A0002655447 HC CA2020IR</p>	<p>ALA2023</p>  <p>ALA2023RB ALA2023WA ARV1866 PAL0442 </p> <p>12v 80amp a:38.5 b:15 c:63.5</p> <p>CHEVROLET, DAEWOO Aveo Kalos Matiz</p> <p>F12S3 B12S1 B12S3 GM 96404263 MD A0002655866 HC CA2023IR</p>	<p>ALA2194 <i>New</i></p>  <p>ALA2194WA ARA3530 PAL0244 </p> <p>12v 90amp a:33 b:14 c:51</p> <p>HYUNDAI i20 KIA Ceed Venga</p> <p>G4FA G4FAF HY 373002B500 VA 442194</p>
<p>ALA2380</p>  <p>ALA2380WA</p> <p>12v 90amp a42 c:66</p> <p>KIA Carens 1.6L Rondo 1.6L</p> <p>KI 373002X000 MD AB190150 ME 210380</p>	<p>ALA2501 <i>New</i></p>  <p>12v 110amp a:43 b:13 c:54.5</p> <p>MITSUBISHI Galoooper Delica Pajero</p> <p>4D56 HY 3730042501 VA TA000A45101 VA 603048</p>	<p>ALA3011 <i>New</i></p>  <p>12v 50amp a:45 b:12 c:81</p> <p>HYUNDAI KIA 8 TON TRUCK</p> <p>KI 3730083011 MD TA0002655976 MH ALA3011</p>	<p>ALA3043 <i>New</i></p>  <p>PAL0200 </p> <p>12v 70amp a:38 b:13 c:46</p> <p>KIA MAZDA 626 >1992</p> <p>HY K95418300 MD TA000A07101 MH ALA3043</p>
<p>ALA3201</p>  <p>ALA3201WA ARA1551</p> <p>12v 110amp a:42 b:16 c:56</p> <p>HYUNDAI Porter 2 2010-></p> <p>HD 373004A201 MD TA000A63601 VA 600868</p>	<p>ALA3366 <i>New</i></p>  <p>12v 70amp a:28 b:13 c:67</p> <p>MITSUBISHI Eclipse Galante Lancer 1.8 1992-></p> <p>VA 603049</p>	<p>ALA3421</p>  <p>24v 180amp a:48 b:18 c:151</p> <p>HYUNDAI Universe Space 2004-> Aero queen KIA GRANBIRD 2011-></p> <p>HD 3730084421 VA 603040 MH ALA3421</p>	<p>ALA3446</p>  <p>ALA3446WA ARA1544 PAL0226 </p> <p>12v 110amp a:43 b:20 c:58</p> <p>KIA, HYUNDAI Sorento 2.4L Sportage 2.0L Santa Fe 2.4L IX35 2.0L, 2.4L</p> <p>KI 373002G400 VA 2606446 MH ALV3446</p>







Alternators

Mando

<p>ALA3500</p>  <p>ALA3500WA</p> <p>ARA3738 PAL0204</p>  <p>24v 50amp a:42 b:18 c:81</p> <p>HYUNDAI D4D11 HD65 HD72 HD78</p> <p>HD 3730045500 MD TA000A64401 VA 603005</p>	<p>ALA3503</p>  <p>24v 60amp a:38 b:13 c:70</p> <p>HYUNDAI Heavy Duty Truck 8 TON CLASS [W3] 11 TON CLASS [W1] 23 TON CLASS [W2]</p> <p>HY 3730093500 MD TA000A14001 VA 603044</p>	<p>ALA3633</p>  <p>12v 55amp a:56 b:27.5</p> <p>CRUSADER YAMAHA Marine Various Marine Various Models</p> <p>8 Cyl 305CL 5.0L</p> <p>YA 19140010 MD A000B0341 CG 113633</p>	<p>ALA3652</p>  <p>12v 110amp a:43.5 b:23 c:44.5</p> <p>KIA Sportage 2.5L HYUNDAI Santa Fe 2.5L Sonata 2.5L</p> <p>ALA3652WA ALA652WA</p> <p>ARA1525 PAL0206</p>  <p>G6BVG G6BAG G6BA HD 3730037110 MD AB195116 CG 113652</p>
<p>ALA3653</p>  <p>ALA3653WA</p> <p>ARA1563 PAL0242</p>  <p>12v 120amp a:43 b:17 c:48</p> <p>KIA Amanti 3.5L Opirus 3.5L HYUNDAI Santa Fe 3.5L</p> <p>G6CTG, G6CU, 6GCU G6DA</p> <p>HY 3730039405 MD AB112112 CG 113653</p>	<p>ALA3701</p>  <p>24v 40amp a:40 b:13 c:82</p> <p>HYUNDAI County Mighty</p> <p>UB NQ UD</p> <p>HD 3730041701 MD AD250453 VA 600856</p>	<p>ALA3710</p>  <p>12v 75amp a:40 b:16 c:56</p> <p>HYUNDAI H100 2.5L TD</p> <p>HD 3730042710 MD TA000A64201 MH ALA3710</p>	<p>ALA3752</p>  <p>12v 90amp a:44 b:12.5 c:55</p> <p>HYUNDAI H100 Porter MITSUBISHI Galloper 2.5L</p> <p>AG</p> <p>HD 3730047502 MD TA000A58301 MH ALA3752</p>
<p>ALA3802</p>  <p>12v 90amp a:92 b:56</p> <p>SSANGYONG Musso 2.9L Musso Sports 2.9L</p> <p>SS 6621543402</p>	<p>ALA3830 <i>New</i></p> <p>24v 50amp</p> <p>ALA3830WA</p> <p>KIA D6DA19 HYUNDAI D6DA22</p> <p>KI 0K87T18300A MD TA000A50101 MH ALA3830</p>	<p>ALA4203 <i>New</i></p>  <p>12v 110amp a:41 b:13 c:31</p> <p>HYUNDAI Porter 2 Mobis H100</p> <p>D4CB</p> <p>HY 373004A203</p> <p>MH ALA4203</p>	<p>ALA5201</p>  <p>12v 110amp a:42 b:20 c:57</p> <p>HYUNDAI Sonata 2.0L 2.4L KIA Magentis 2.0L</p> <p>ALV5201WA</p> <p>ARA1550 PAL0226</p>  <p>G4KA G4KD G4KC HY 3730025201 VA TG11C076 KI CA2122IR</p>






















Alternators

Mando

ALA5600 New	ALA5633 New	ALA5900 New	ALA6220 New
	 <p style="text-align: right;">ALA5633WA</p> <p style="text-align: right;">ARV1882 PAL0204</p> 	 <p style="text-align: right;">ALA5900WA</p> <p style="text-align: right;">ARA1715</p>	
<p>12v 110amp a:44 b:20 c:58</p> <p>KIA HYUNDAI ix35 tucson</p> <p style="text-align: right;">KI 3730025600 MH ALA5600</p>	<p>12v 70amp a:35 b:14 c:48</p> <p>HYUNDAI i10 1.3L 2008- i20 1.3L 2008-</p> <p style="text-align: right;">G4LA</p> <p style="text-align: right;">KI 3730003100 MD 2655633 HC CA2128IR</p>	<p>12v 75amp a:35 b:13 c:56</p> <p>HYUNDAI H100 Galopper 2000-></p> <p style="text-align: right;">KI 3730035900 MD TA0002655986 MH ALA5900</p>	<p>12v 120amp a;35 b:13 c:52</p> <p>KIA Soul 1.6L 2009-</p> <p style="text-align: right;">D4FB</p> <p style="text-align: right;">KI 373002A150 MD 2606220 MH ALA6220</p>
<h2 style="margin: 0;">ALA9000 New</h2>			
 <p style="text-align: right;">ALV9000</p>			
<p>12v 65amp a:73 b:50</p> <p>VOLVO</p> <p style="text-align: right;">VO 3860082 MD TA000B53101 MH ALV9000</p>			




















Alternators

Mitsubishi

<p>ALM0036</p>  <p>ALM0036WA</p> <p>ARM3505 PAL0225</p>  <p>12v 110amp a:39 b:84 c:55</p> <p>MAZDA 6</p> <p>3.0L</p> <p>MZ AJ5718300A MI A3TJ0291 WA 11007N</p>	<p>ALM0037</p>  <p>ALM0037WA</p> <p>12v 210amp a:33 b:15 c:63</p> <p>RENAULT Espace IV Velsatis</p> <p>RE 8200477100 MI A4TJ0391 MH ALM0037</p>	<p>ALM0051</p>  <p>ALM0051WA</p> <p>ARM3217 PAL0200</p>  <p>12v 60amp a:42 b:13 c:82</p> <p>NISSAN Bluebird Silvia Laurel</p> <p>CA18S, CA20S CA18T, CA18ET CA20E NI 2310002E10 MI A2T45799 HC JA778IR</p>	<p>ALM0061</p>  <p>ALM0061WA</p> <p>ARM3505 PAL0225</p>  <p>12v 110amp a:45 b:60 c:77</p> <p>MAZDA CX-7 2.3L</p> <p>MZ L33G18300 MI A3TJ1191 WA 11330N</p>
<p>ALM0065</p>  <p>ALM0065WA</p> <p>ARM3290 PAL0502</p>  <p>12v 40amp a:42 b:13 c:82</p> <p>MITSUBISHI Fork Lift FG 20 FG 30 FG 25 Hyster, Sumitomo, Yale</p> <p>MZ S5SN18300 MI A007T03277A CG 111495</p>	<p>ALM0067</p>  <p>ALM0067WA</p> <p>12v 110amp a:53 b:27 c:66</p> <p>RENAULT Logan 1.4L Sandero 1.4L Clio 1.4L Megane 1.4L</p> <p>K4M720 K4M724 MI A2TC1791 MH ALM0067</p>	<p>ALM0068</p>  <p>ALM0068WA</p> <p>ARM3547 PAL0224</p>  <p>12v 130amp a:43 b:13 c:77</p> <p>NISSAN Altima 3.5L Maxima 3.5L Murano 3.5L</p> <p>NI 23100JA11A MI A3TJ1791 WA 11341N</p>	<p>ALM0071 <i>New</i></p>  <p>ALM0071WA</p> <p>PAL0200</p>  <p>12v 65amp a:46 b:13 c:54</p> <p>MITSUBISHI Delica</p> <p>4D56 MI MD339608 MI A2TN1683 CG 114367</p>
<p>ALM0072 <i>New</i></p>  <p>ALM0072WA</p> <p>ARM7110 PAL0241</p>  <p>12v 90amp a:43.5 b:13 c:45.5</p> <p>SMART (MMC) Fortwo</p> <p>M132910 M132930 MB 1321540001 MI A5TG0991 HC CA2012IR</p>	<p>ALM0074 <i>New</i></p>  <p>ALM0074WA</p> <p>PAL0200</p>  <p>12v 120amp a:37.5 b:12 c:80</p> <p>NISSAN Cabstar, Interstar ZD30 OPEL Movano J9, H9, F9 ZD3200 RENAULT Master, Mascott ZD3202, ZD3A600 ED, HD, UD, FD NI 23100DC000 MI A2TG0281 HC CA2081IR</p>	<p>ALM0081</p>  <p>ALM0081WA</p> <p>ARM3304</p> <p>12v 140amp a:31 b:12 c:55</p> <p>CHRYSLER DODGE, JEEP Compass, Patriot Avenger, Caliber Sebring</p> <p>CH 4801477AA MI A3TJ2581 MH ALM0081</p>	<p>ALM0089</p>  <p>ALM0089WA</p> <p>ARM3341 PAL0240</p>  <p>12v 85amp</p> <p>CHRYSLER Sebring 3.0L DODGE Stratus 3.0L MITSUBISHI, Galant 3.0L</p> <p>V6 CH 90273269 MI MD362301 WA 13886N</p>






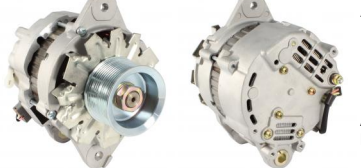
















Alternators

Mitsubishi

<p>ALM0094</p>  <p>ALM0094WA</p> <p>ARM3529 PAL0233</p>  <p>PAL0500</p> <p>12v 150amp a:55 b:24 c:57</p> <p>FORD, MERCURY Fusion 2.3L MERCURY Milan 2.3L</p> <p>L4 FO 6E5T10300AB MI A3TJ0891ZC CG 113781</p>	<p>ALM0103</p> <p>12v 50amp a:29 b:13 c:80</p> <p>NISSAN ISUZU CHEVROLET Campo Cherry, Sunny</p> <p>IS 8941271860 MI AH2250C31 HC JA103</p>	<p>ALM0115</p>  <p>ALM0115WA</p> <p>ARM3216 PAL0502</p>  <p>12v 50amp a:24 b:13 c:55</p> <p>MITSUBISHI US, EU DODGE US HYUNDAI EU PLYMOUTH US</p> <p>4G16 G15B KI 3730024010 MI MD099624 CG 110660</p>	<p>ALM0148</p>  <p>ALM0148WA</p> <p>ARM3205 PAL0502</p>  <p>12v 45amp a:44.5 b:13 c:53.5</p> <p>DODGE, MAZDA MITSUBISHI, PLYMOUTH Galant L200, L300 Pajero, Canter</p> <p>4D56 4D55T, 4D56T 4D55 HE 8EL726295001 MI A5T15584 HC JA148IR</p>
<p>ALM0149</p>  <p>ARM3295 PAL0503</p>  <p>12v 40amp a:40 b:15 c:41</p> <p>MITSUBISHI, VETUS Inboard Engines CASE, CUB CADET NEW HOLLAND Excavators, Tractors</p> <p>L2A L2E MI A7TA0171 MI 30A6800101 NR 020171</p>	<p>ALM0154</p>  <p>12v 50amp a:21 b:13 c:74</p> <p>ISUZU, CUMMINS Inboard Engines Stern Drives Diesel Engines</p> <p>103CI IZ 8972477180 MI A7TA2991 NR 022991</p>	<p>ALM0157</p>  <p>ALM0157WA</p> <p>24v 50amp a:41 b:13 c:81</p> <p>MITSUBISHI Industrial CATERPILLAR EXCAVATOR 317B, 318B, 318C</p> <p>MI 3436802300 MI A4TU3687 NR 023586</p>	<p>ALM0159</p>  <p>ARM3216 PAL0502</p>  <p>12v 65amp a:38.5 b:13 c:48</p> <p>DODGE, HYUNDAI MITSUBISHI, PLYMOUTH Colt, Stellar Cordia, Galant Lancer, Mirage</p> <p>4G16 4G32TC G21BT HY 3730021320 MI A2T41991 HC JA159IR</p>
<p>ALM0168</p>  <p>ALM0168WA</p> <p>ARM3846 PAL0204</p>  <p>24v 40amp a:41 b:13 c:81</p> <p>MITSUBISHI Fuso KOBELCO SK200-5 SK200-6</p> <p>MI ME088887 MI A3TN5399 NR 025399</p>	<p>ALM0169</p>  <p>ALM0169WA</p> <p>ARM3102</p> <p>24v 35amp a:40 b:13 c:56</p> <p>MITSUBISHI Industrial CATERPILLAR Mini Excavator</p> <p>308B MI ME108147 MI A3TA8199 NR 028199</p>	<p>ALM0171</p>  <p>ALM0171WA</p> <p>ARM3204 PAL0503</p>  <p>12v 40amp a:29 b:13 c:66</p> <p>SUBARU Rex 0.5L, 0, 7L SUZUKI Carry 1.0L Alto 0.8L</p> <p>EK23 EK42 F10A SU 429906300 MI A1T33771 HC JA171IR</p>	<p>ALM0173</p>  <p>ARM3265 PAL0200</p>  <p>12v 60amp a:42.5 b:13 c:67</p> <p>KIA, MAZDA Pride 323</p> <p>E3, B5, E5, B6, B50 B53, B65M, B68 E5E2, E5E3, B3 MZ B67518300 MI A002T05772 HC JA173IR</p>


















Alternators

Mitsubishi

<p>ALM0199</p>  <p>ALM0199WA ARM3216 PAL0502</p>  <p>12v 55amp a:29 b:13 c:47</p> <p>HYUNDAI Pony MITSUBISHI Colt Lancer</p> <p>HD 3730021320 MI A5T43271 HC JA199IR</p>	<p>ALM0209</p>  <p>ALM0209WA ARM3212 PAL0502</p>  <p>24v 30amp a:42.5 b:13.5 c:80.5</p> <p>MITSUBISHI Truck FU, FV FP, K FS FT</p> <p>8DC8, 6DC2 8DC9, 8DC2 8DC10 MI ME070120 MI A2T72189 CG 113196</p>	<p>ALM0213</p>  <p>ALM0213WA AEM8574</p> <p>24v 50amp a:60 b:13 c:70</p> <p>HITACHI JOHN DEERE Excavators ZX330 6HK1</p> <p>6BG1T BB-6WG1X BB-6WG1T JD AT263669 MI A4TU5485 CG 113886</p>	<p>ALM0260</p>  <p>ALM0260WA ARM3286 PAL0502</p>  <p>24v 50amp a:31 b:12 c:81</p> <p>CATERPILLAR 320 Excavator</p> <p>MI ME150143 MI A4T66786 MH ALM0260</p>
<p>ALM0261</p>  <p>ALM0261WA ARM3381 PAL0227</p>  <p>12v 70amp a:31 b:22</p> <p>CHEVROLET, SUZUKI Vitara Tracker</p> <p>SU 3140065D00 MI A5TA4291 WA 13781N</p>	<p>ALM0273</p>  <p>ALM0273WA ARM3850</p> <p>12v 80amp a:90 b:58</p> <p>SUZUKI Grand Vitara Swift</p> <p>SU 3140065J10 MI A5TG0291 HC CA2004IR</p>	<p>ALM0280</p>  <p>ALM0280WA ARM3472 PAL0224</p>  <p>12v 110amp a:46 b:13 c:80</p> <p>SUBARU Legacy Forester Impreza Outback</p> <p>SU 23700AA520 MI A3TG0491 HC CA2084IR</p>	<p>ALM0303</p>  <p>ALM0303 ARM3210 PAL0291</p>  <p>12v 80amp a:18 b:27 c:64.5</p> <p>PEUGEOT</p> <p>PE 9152017480 MI A3T45292 HC CA5971R</p>
<p>ALM0331</p>  <p>ALM0331WA ARM3951 PAL0101</p>  <p>12v 35amp a:39.5 b:12.5 c:80.5</p> <p>MAZDA 1000 1300 323</p> <p>PC TC UC MZ 293618300 MI A1T30477 CG 110133</p>	<p>ALM0349</p>  <p>ALM0349 ARM3204 PAL0502</p>  <p>12v 50amp a:42 b:13 c:47</p> <p>HYUNDAI, MITSUBISHI Pony, Stellar Celeste, Colt Galant, L 300</p> <p>G13B, 4G33, G32B 4G32, 4G12, 4G11 4G12T MI A2T23171 MI A2T12371 HC JA150IR</p>	<p>ALM0361</p>  <p>ALM0361WA ARM3345 PAL0203</p>  <p>12v 70amp a:38 b:13 c:67</p> <p>MAZDA 323 1.6L</p> <p>MZ ZM3918300 MI A2TB7191 HC JA1799</p>	<p>ALM0363</p>  <p>ALM0363WA ARM3952 PAL0200</p>  <p>12v 65amp a:30 b:13.5 c:65</p> <p>MAZDA 323 1.7L</p> <p>MZ PN4018300 MI A2T18479 HC JA668IR</p>













Alternators

Mitsubishi

<p>ALM0371</p>  <p>ARM3216 PAL0502</p>  <p>12v 60amp a:26 b:13.5 c:47</p> <p>MITSUBISHI DODGE PLYMOUTH Colt Mirage</p> <p>MI MD111607 MI A2T03691 CG JA693IR</p>	<p>ALM0375</p>  <p>ARM3262 PAL0200</p>  <p>12v 60amp a:24 b:13 c:81</p> <p>NISSAN Micra</p> <p>NI 2310030B10 MI A5T01497 HC JA768IR</p>	<p>ALM0379</p>  <p>ARM3276 PAL0200</p>  <p>12v 55amp a:36 b:13 c:67.5</p> <p>SUBARU Justy</p> <p>EF10 EF12</p> <p>SB 23700KA230 MI A1T03792 HC JA774IR</p>	<p>ALM0385</p>  <p>ARM3952 PAL0101</p>  <p>12v 35amp a:42.5 b:12 c:67</p> <p>ISEKI, MITSUBISHI Agricultural 200, 2100 Fork Lift FG TORO Mowers</p> <p>MI MD017645 MI A1T22074 HC JA872</p>
<p>ALM0386</p>  <p>ARM3204 PAL0502</p>  <p>12v 55amp a:41 b:12.5 c:80.5</p> <p>MAZDA 626 929</p> <p>H6, MA NA, HEE HE3 MZ HE4518300 MI A2T23474 HC JA884IR</p>	<p>ALM0413 <i>New</i></p>  <p>ARM3847 PAL0200</p>  <p>12v 50amp a:43 b:12 c:82</p> <p>MAZDA Industrial</p> <p>Diesel</p> <p>MZ SLR418300 MI A2T38776 CG 114415</p>	<p>ALM0430 <i>New</i></p>  <p>PAL0260</p>  <p>24v 150amp a:45 b:18 c:96</p> <p>SCANIA Buses</p> <p>SC 1794114 MI A9TU6499 MH ALM0430</p>	<p>ALM0433 <i>New</i></p>  <p>ARM3204 PAL0502</p>  <p>12v 50amp a:42 b:13 c:80</p> <p>FORD Econovan 1.4L MAZDA 121 1.1L 323 1.1L, 1.3L, 1.5L</p> <p>E1, E3, E5 B1, B116 UC MI A3T21474 HC JA795IR</p>
<p>ALM0445 <i>New</i></p>  <p>ARM3216 PAL0502</p>  <p>12v 65amp a:33 b:13 c:65</p> <p>MAZDA 626</p> <p>MZ F62118300 MI A2T46596 HC JA191IR</p>	<p>ALM0481 <i>New</i></p> <p>ALM0481WA</p>  <p>PAL0213</p>  <p>12v 185amp a:30 b:14 c:58</p> <p>NI 231002179R MI A3TX0481 MH ALM0481</p>	<p>ALM0491</p> <p>12v 90amp a:40 b:13 c:66</p> <p>MITSUBISHI L 200 2.5L</p> <p>4D56HD</p> <p>MI 1800A007 MI A5TG0491 LU LRA03337</p>	<p>ALM0532</p> <p>ALM0532WA</p>  <p>ARM3210 PAL0291</p>  <p>12v 80amp a:46.5 b:27 c:65</p> <p>CITROEN PEUGEOT 405 305 205, BX</p> <p>XUD9Y, XUD7TE XUD9A XUD9 PE 920313880 MI A3T45191A HC CA532IR</p>










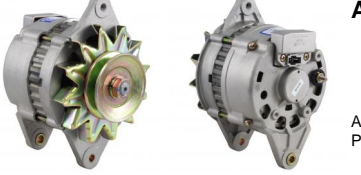


Alternators

Mitsubishi

<p>ALM0559</p>  <p>ARM3266 PAL0502</p> <p>12v 65amp a:29 b:13 c:64</p> <p>MAZDA Pickup 929 2.2L</p> <p>MZ F21018300 MI A2T04677 HC JA559IR</p>	<p>ALM0575</p>  <p>ALM0575WA</p> <p>ARM3265 PAL0200</p> <p>12v 70amp a:43.5 b:13 c:66</p> <p>FORD FE, F68, F2 MAZDA F8, F2L1 Probe 2.2L 626 2.2L MX6 2.2L</p> <p>FO E92Z10346A MI A2T05892 HC JA575IR</p>	<p>ALM0583</p>  <p>ALM0583WA</p> <p>ARM3232 PAL0291</p> <p>12v 80amp a:46 b:27 c:65.5</p> <p>CITROEN, PEUGEOT A8A 405 BAZ, D6A BX AJZ, AJZ PE 9559976380 MI A2T34598 HC CA583IR</p>	<p>ALM0585</p>  <p>ALM0585WA</p> <p>ARM3282 PAL0200</p> <p>12v 60amp a:45 b:14 c:54</p> <p>MITSUBISHI 4D56 L200 4D56T L300 Pajero KI 3730042200 Shogun MI A2T01483 HC JA585IR</p>
<p>ALM0598</p>  <p>ALM0598WA</p> <p>ARM3217 PAL0200</p> <p>12v 60amp a:37.5 b:13 c:55</p> <p>MITSUBISHI, HYUNDAI 4G15, G13B Lancer, Colt, Galant 4G64, 4G37, G64B Lantra, Scoupe, Pony G15B, G4DG, G4DJ MI MD111149 MI A2T09291 HC JA598IR</p>	<p>ALM0599</p>  <p>ALM0599WA</p> <p>ARM3277 PAL0200</p> <p>12v 65amp a:43 b:13.5 c:66</p> <p>FORD, MAZDA NA, B64F, B3 MX BP31, BP22 323 F2EGI, BG, B3E 929 MZ B61V18300 MI A5T01777 HC JA599IR</p>	<p>ALM0614</p>  <p>ALM0614WA</p> <p>ARM3990</p> <p>12v 90amp a:42.5 b:27.5 c:65</p> <p>CITROEN, PEUGEOT XUD11ATE, XUD11A 605 XU10J2TE, XU10J2Z XM XU10MZ, XU10J2K CI 9603552680 MI A4T03292B HC CA614IR</p>	<p>ALM0653</p>  <p>ALM0653WA</p> <p>ARM3278 PAL0200</p> <p>12v 65amp a:38 b:25 c:81.5</p> <p>NISSAN GA16L, GA16I Sunny 1.4I e16I Sunny 1.6I GA14S Pulsar 1.6I NI 2310077A00 Sentra 1.6I MI A5T00192 HC JA653IR</p>
<p>ALM0659</p>  <p>ARM3263 PAL0200</p> <p>12v 50amp a:38.5 b:13 c:81</p> <p>NISSAN K10 Micra 1.2L</p> <p>NI 2310017B10 MI A5T22997 HC JA659IR</p>	<p>ALM0663</p>  <p>ALM0663WA</p> <p>ARM3205 PAL0502</p> <p>12v 55amp a:46 b:13 c:54</p> <p>MITSUBISHI 4D55 Galant 2.3I Diesel 4D55T L300 2.3I Diesel Pajero 2.3I Diesel</p> <p>MI MD087246 MI A2T43583 HC JA663IR</p>	<p>ALM0664</p>  <p>ALM0664WA</p> <p>ARM3217 PAL0200</p> <p>12v 65amp a:34.5 b:13.5 c:78</p> <p>DODGE, EAGLE, HYUNDAI G4CP, G4CR MITSUBISHI, PLYMOUTH 4G61, 4G63 Colt, Galant, Lancer G4CN, 4G67 2000, Laser, Summit KI 3730033000 Talon, Lantra, Sonata MI A3T03493 HC JA664IR</p>	<p>ALM0666</p>  <p>ALM0666RB ALM0666WA</p> <p>ARM3217 PAL0200</p> <p>12v 60amp a:38 b:13 c:48</p> <p>EAGLE, MITSUBISHI 4G32 PLYMOUTH 4G37 Galant, Lancer Space Wagon KI 3730021013 Eclipse, Talon, Lazer MI A2T09691 HC JA666IR</p>

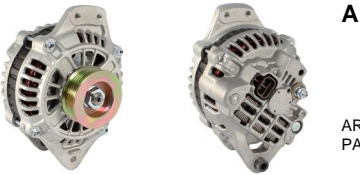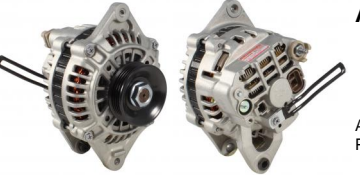





















Alternators

Mitsubishi

<p>ALM0667</p>  <p>ALM0667WA</p> <p>ARM3217 PAL0200</p> <p>12v 40amp a:30 b:13.5 c:48</p> <p>MITSUBISHI</p> <p>MI MD108022 MI A2T02671 HC JA667IR</p>	<p>ALM0670</p>  <p>ALM0670WA</p> <p>ARM3217 PAL0200</p> <p>12v 65amp a:42 b:13 c:54.5</p> <p>MITSUBISHI</p> <p>L 200 L 300 Pajero Starion</p> <p>G63B, G54B 4G64, G64B</p> <p>MI MD106712 MI A2T02577 HC JA670IR</p>	<p>ALM0671</p>  <p>ALM0671WA</p> <p>ARM3217 PAL0200</p> <p>12v 75amp a:35 b:13.5 c:77.5</p> <p>MITSUBISHI, HYUNDAI</p> <p>Colt, Galant, Lancer Lantra, Santamo, Sonata</p> <p>4G67, 4G61 4G63, 4G67 G4CN, G4CP, G4CR KI 3730033030 MI A3T03392 HC JA671IR</p>	<p>ALM0674</p>  <p>ALM0674WA</p> <p>ARM3281 PAL0200</p> <p>12v 65amp a:44.5 b:13.5 c:54.5</p> <p>MITSUBISHI</p> <p>L300 Shogun</p> <p>4D56 4D56T 4D65T MI MD140189 MI A2T17783 HC JA674IR</p>
<p>ALM0683</p>  <p>ALM0683WA</p> <p>ARM3217 PAL0200</p> <p>12v 90amp a:24 b:13 c:55</p> <p>MITSUBISHI, HYUNDAI</p> <p>Sonata Sigma Diamante</p> <p>G6AT F16A, F07W 6G72 KI 3730035020 MI A3T04292 HC JA683IR</p>	<p>ALM0684</p>  <p>ALM0684WA</p> <p>ARM3217 PAL0200</p> <p>12v 90amp a:35 b:13 c:78</p> <p>DODGE, EAGLE, HYUNDAI</p> <p>KIA, MITSUBISHI</p> <p>Lantra, Santamo Eclipse, Galant Sonata, Lancer</p> <p>4G63, G4CPD 4G67, G4CP G4CR, G4CN KI 3730033103 MI A3T45691 HC JA684IR</p>	<p>ALM0685</p>  <p>ALM0685WA</p> <p>ARM3217 PAL0200</p> <p>12v 75amp a:39 b:13 c:55</p> <p>DODGE, MITSUBISHI</p> <p>Pajero 3.0I Raider 3.0I Ram 3.0I Mighty 3.0I, Montero 3.0I</p> <p>6G72</p> <p>MI MD141855 MI A3T02193 HC JA685IR</p>	<p>ALM0689</p>  <p>ALM0689WA</p> <p>ARM3217 PAL0200</p> <p>12v 75amp a:38 b:13 c:55</p> <p>MITSUBISHI, HYUNDAI</p> <p>Colt, Sapporo Lancer, Space Wagon Lantra, Pony Scoupe</p> <p>4G15, G15B 4G13, G4DG 4G63, G4DJ KI 3730024510 MI A2T09493 HC JA689IR</p>
<p>ALM0690</p>  <p>ALM0690WA</p> <p>ARM3217 PAL0200</p> <p>12v 75amp a:23 b:13 c:55</p> <p>HYUNDAI</p> <p>Sonata 2.0I Sonata 2.4I</p> <p>G4CPU G4CP G4CS KI 3730032511 MI A2T14792 HC JA690IR</p>	<p>ALM0691</p>  <p>ALM0691WA</p> <p>ARM3217 PAL0200</p> <p>12v 70amp a:28 b:13 c:82</p> <p>NISSAN</p> <p>300 ZX</p> <p>NI 2310015P12 MI A2T48176B HC JA691IR</p>	<p>ALM0694</p>  <p>ALM0694WA</p> <p>ARM3830 PAL0200</p> <p>12v 65amp a:38 b:13 c:64.5</p> <p>FORD Aspire MAZDA, 121 KIA, Sephia</p> <p>DB, B3</p> <p>MZ B3C718300 MI A5T03391 HC JA694IR</p>	<p>ALM0699</p>  <p>ALM0699WA</p> <p>ARM3277 PAL0200</p> <p>12v 60amp a:42 b:13 c:66.5</p> <p>KIA MAZDA 323 Sephia</p> <p>B6 BP, BPC BP31, BP52, BP22 MZ B67518300B MI A2T35177 HC JA699IR</p>
























Alternators

Mitsubishi

<p>ALM0739</p>  <p>ALM0739WA ARM3232 PAL0265  W D+ B+</p> <p>12v 90amp a:33 b:14 c:81.5</p> <p>FORD Orion Fiesta Escort</p> <p>RQB, RQC RDA, RDB, RKC L1K, L1E FO 92AB10300JB MI A2TA2492 HC CA739IR</p>	<p>ALM0755</p>  <p>ALM0755WA ARM3830 PAL0200 </p> <p>12v 80amp a:36.5 b:13.5 c:67</p> <p>FORD, Probe MAZDA MX 626</p> <p>99C FS FP, KL MZ FS0518300C MI A2T33191ZC HC JA755IR</p>	<p>ALM0765</p>  <p>ALM0765 ARM3209 PAL0200 </p> <p>12v 60amp a:43 b:13 c:81</p> <p>NISSAN Bluebird Vanette</p> <p>LD20 LD20II</p> <p>NI 2310005E21 MI A3T35278 HC JA765IR</p>	<p>ALM0770</p>  <p>ALM0770RB ALM0770WA ARM3217 PAL0200 </p> <p>12v 50amp a:29 b:13 c:54.5</p> <p>MITSUBISHI</p> <p>MI MD109166 MI A2T06871 HC JA770IR</p>
<p>ALM0775</p>  <p>ALL775WA ALM0775WA ARM3281 PAL0200 </p> <p>12v 50amp a:44.5 b:13.5 c:54</p> <p>MITSUBISHI Pajero 2.5L Diesel L300 2.5L Diesel</p> <p>4D56 4D56T</p> <p>MI MD124234 MI A2T01384 HC JA775IR</p>	<p>ALM0782</p>  <p>ALM0782WA ARM3284 PAL0200 </p> <p>12v 80amp a:37 b:25 c:81</p> <p>NISSAN 200 SX</p> <p>S13, SR20DE CA18DET, CA18DE</p> <p>NI 2310035F10 MI A2T14694 HC JA782IR</p>	<p>ALM0805</p>  <p>ALM0805WA ARM3277 PAL0200 </p> <p>12v 60amp a:41.5 b:13 c:66.5</p> <p>MAZDA MIATA MX5 1.6L</p> <p>B64F B6</p> <p>MZ B61P18300C MI A5T01577 HC JA805IR</p>	<p>ALM0806</p>  <p>ALM0806WA ARM3830 PAL0200 </p> <p>12v 90amp a:37 b:13 c:67</p> <p>FORD, MAZDA Probe Xedos 323, 626 MX</p> <p>KL KF, KF1 FS, K819, K838 MZ K80118300B MI A3T08491 HC JA806IR</p>
<p>ALM0832</p>  <p>ALM0832WA ARM3990</p> <p>12v 120amp a:15 b:27 c:65</p> <p>CITROEN, PEUGEOT XANTIA 2.0L XM 2.0L, 2.1L, 3.0L 605 2.0L, 2.1L, 3.0L</p> <p>UKZ, UFZ, P9A RFZ, RDZ, R5A RGY, RGX, R6A PE 9610871080 MI A4TA0092C HC CA832IR</p>	<p>ALM0835</p>  <p>ALM0835 ARM3990</p> <p>12v 90amp a:42.5 b:27 c:64.5</p> <p>CITROEN, PEUGEOT XM 2.1L DSL XM 2.1L TDSL 605 2.1L TDSL</p> <p>PHZ P9A PE 9618673980 MI A4T02893B HC CA835IR</p>	<p>ALM0865</p>  <p>ALM0865WA ARM3217 PAL0220 </p> <p>12v 45amp a:29 b:13 c:52</p> <p>MITSUBISHI Pickup DODGE Ram Pickup</p> <p>2.0L 2.4L</p> <p>MI MD166174 MI A2T02271 HC JA865IR</p>	<p>ALM0870</p>  <p>ALM0870WA ARM3217 PAL0200 </p> <p>12v 90amp a:39 b:13 c:55</p> <p>HYUNDAI, MITSUBISHI Galloper, H1, H100 Satellite, Starex L300 Pajero</p> <p>G6AT, G64B 6G72 G4CS KI 3730036030 MI A3T08293 HC JA870IR</p>

























Alternators

Mitsubishi

<p>ALM0876 New</p>  <p>ARM3847 PAL0200 </p> <p>12v 75amp a:35 b:13 c:64.5</p> <p>MAZDA 626</p> <p>MZ RFG118300 MI A2TN0678 HC JA876IR</p>	<p>ALM0878</p>  <p>ALM0878WA ALM878WA</p> <p>ARM3282 PAL0200 </p> <p>12v 75amp a:45.5 b:13.5 c:54.5</p> <p>MITSUBISHI Pajero 2.5 4D56TD</p> <p>MI MD160671 MI A3T08183 HC JA878IR</p>	<p>ALM0883</p>  <p>ARM3282 PAL0200 </p> <p>12v 75amp a:35 b:13 c:65</p> <p>MAZDA 626 2.0L</p> <p>MZ RF7118300H MI A3T01872 HC JA883IR</p>	<p>ALM0930</p>  <p>ALM0930WA</p> <p>24v 90amp a:40 b:13 c:102</p> <p>VOLVO RENAULT</p> <p>RE 20466316 MI A4TR5392 NR 029305</p>
<p>ALM0972</p>  <p>ALM0972WA</p> <p>ARM3213 PAL0502 </p> <p>24v 25amp a:45.5 b:13.5 c:80.5</p> <p>MISUBISHI Canter Diesel</p> <p>4D30A 4D31</p> <p>KI 3730041010 MI A5T70283 HC JA972IR</p>	<p>ALM0973</p>  <p>ALM0973WA</p> <p>ARM3217 PAL0200 </p> <p>12v 75amp a:41.5 b:13 c:55</p> <p>MITSUBISHI L300 Pajero Van</p> <p>4G63 4G64 G63B</p> <p>MI MD111233 MI A3T41876 HC JA973IR</p>	<p>ALM0980</p>  <p>ALM0980WA</p> <p>ARM3839 PAL0306 </p> <p>12v 70amp a:90 b:58</p> <p>HONDA Civic 1.5i Civic 1.6i</p> <p>D15B2, D15Z1 D15B7, D16Y7 D16Y8, D16Z6 HO 31100P04G05 MI A5T04292 HC JA980IR</p>	<p>ALM0983</p>  <p>ALM0983WA</p> <p>ARM3282 PAL0200 </p> <p>12v 75amp a:43 b:13 c:54</p> <p>MITSUBISHI L300 2.5L DSL</p> <p>4D56</p> <p>MI MD141119 MI A3T00599 HC JA983IR</p>
<p>ALM0995</p>  <p>ALM0995WA</p> <p>ARM3832 PAL0200 </p> <p>12v 110amp a:23.5 b:17.5 c:55.5</p> <p>HYUNDAI, MITSUBISHI Sonata Sigma 3000</p> <p>6G72 G6AT</p> <p>KI 3730035570 MI A3T12291 HC JA995IR</p>	<p>ALM1126</p>  <p>ALM1126RB ALM1126WA</p> <p>ARM3832 PAL0200 </p> <p>12v 75amp a:37 b:13 c:55.5</p> <p>DODGE, HYUNDAI MITSUBISHI Accent, Scoupe Colt, Galant, Lancer Space Runner</p> <p>G4EH 4G92 4D68</p> <p>MI MD361621 MI A2T38491 HC JA1126IR</p>	<p>ALM1130</p>  <p>ALM1130WA</p> <p>ARM3282 PAL0200 </p> <p>12v 75amp a:42.5 b:13.5 c:54.5</p> <p>MITSUBISHI L200 2.5L Diesel L300 2.5L Lancer 2.0L Diesel</p> <p>4D56 4D56T 4D68</p> <p>MI MD147246 MI A3T04999 HC JA1130IR</p>	<p>ALM1133</p>  <p>ALM1133WA</p> <p>ARM3847 PAL0200 </p> <p>12v 75amp a:51 b:13 c:55</p> <p>MITSUBISHI Colt Lancer Space Runner Space Wagon</p> <p>4D68 4D68T</p> <p>MI MD309843 MI A2TN2476A HC JA1133IR</p>


Alternators

Mitsubishi

<p>ALM1137</p>  <p>ALM1137WA</p> <p>ARM3358 PAL0273</p>  <p>12v 70amp a:42 b:21 c:25</p> <p>FORD Puma 1.4L, 1.7L Fiesta 1.2L, 1.4L MAZDA 121</p> <p>MHB, FHE FHF, FHA FHD, DHD MZ 1E0518300 MI A5TA2591 HC CA1137IR</p>	<p>ALM1167</p>  <p>ALM1167WA</p> <p>ARM3280 PAL0200</p>  <p>12v 75amp a:35 b:13 c:78.5</p> <p>DODGE, EAGLE MITSUBISHI, PLYMOUTH Colt, Summit, Expo Eclipse, Galant L200, Space Gear</p> <p>4G63 4G64 MI MD190819 MI A2T81791 HC JA1167IR</p>	<p>ALM1173</p>  <p>ALM1173WA</p> <p>ARM3830 PAL0200</p>  <p>12v 90amp a:32 b:13 c:49.5</p> <p>MITSUBISHI Galant 2.0L</p> <p>6A12 MI MD194470 MI A3T11991 HC JA1173IR</p>	<p>ALM1177</p>  <p>ALM1177WA</p> <p>ARM3277 PAL0200</p>  <p>12v 80amp a:30 b:13 c:65</p> <p>MAZDA, MERCURY 929 MPV Capri</p> <p>F21 F2E, F2C JE MZ N35018300 MI A2T17574 HC JA1177IR</p>
<p>ALM1179</p>  <p>ALM1179WA</p> <p>ARM3847 PAL0200</p>  <p>12v 65amp a:42.5 b:13 c:55</p> <p>MITSUBISHI L300</p> <p>4D56 MI MD306648 MI A2TN0399 HC JA1179IR</p>	<p>ALM1180</p>  <p>ALM1180WA</p> <p>ARM3832 PAL0200</p>  <p>12v 90amp a:23.5 b:17 c:53</p> <p>MITSUBISHI Pajero 3.0l Pajero 3.5l Montero 3.0l Montero 3.5l</p> <p>6G72 6G74 DOHC24V MI MD350608 MI A3TA0791 HC JA1180IR</p>	<p>ALM1181</p>  <p>ALM1181WA</p> <p>ARM3832 PAL0200</p>  <p>12v 75amp a:38 b:13 c:48</p> <p>MERCEDES-BENZ MITSUBISHI Colt, Lancer 220 Actros</p> <p>4G13 OM611961 OM541974 MI MD309334 MI A5T07591 HC JA1181IR</p>	<p>ALM1183</p>  <p>ALM1183WA</p> <p>ARM3847 PAL0200</p>  <p>12v 65amp a:42 b:13 c:54.5</p> <p>MITSUBISHI Pajero 2.5 L200 2.5 L400 2.5</p> <p>4D56TD 4D56 4D56T MI MD366050 MI A2T82899A HC JA1183IR</p>
<p>ALM1184</p>  <p>ALM1184WA</p> <p>ARM3282 PAL0200</p>  <p>12v 90amp a:45 b:13 c:54.5</p> <p>MITSUBISHI Pajero 2.5l</p> <p>4D56TD MI MD339609 MI A3T07483 HC JA1184IR</p>	<p>ALM1188</p>  <p>ALM1188WA</p> <p>ARM3830 PAL0200</p>  <p>12v 70amp a:38 b:13.5 c:66.5</p> <p>MAZDA 323 MX KIA Sephia</p> <p>B3, BPC, B6, B5 Z5DE, BPF1 BPZE, B6D MA B6BF18300 MI A2T39391 HC JA1188IR</p>	<p>ALM1271</p>  <p>ALM1271WA</p> <p>ARM3847 PAL0200</p>  <p>12v 75amp a:42 b:13 c:55</p> <p>MITSUBISHI Pajero L 200 L 400</p> <p>4D56TD 4D56 MI MD327514 MI A2TN1199 HC JA1271IR</p>	<p>ALM1279</p>  <p>ALM1279WA</p> <p>ARM3832 PAL0200</p>  <p>12v 90amp a:37 b:13 c:54.5</p> <p>MITSUBISHI Colt Galant 1.8L</p> <p>4G92 4G93 MI MD190812 MI A2T38291 HC JA1279IR</p>

























Alternators

Mitsubishi

<p>ALM1281 New</p>  <p>ARM3847 PAL0200 </p> <p>12v 105amp a:49 b:13 c:56</p> <p>MITSUBISHI Space Wagon 2.0L 92-98</p> <p>4D68T</p> <p>MI MD340511 MI A3TN1281 NR 021281</p>	<p>ALM1283</p>  <p>ALM1283WA</p> <p>ARM3345 PAL0203 </p> <p>12v 70amp a:26 b:13 c:64.5</p> <p>KIA, MAZDA MERCEDES-BENZ Sephia</p> <p>B3 Z5DE BPZE MZ Z59918300C MI A2TB0091 HC JA1283</p>	<p>ALM1284</p>  <p>ALM1284WA</p> <p>ARM3832 PAL0200 </p> <p>12v 90amp a:35 b:13 c:79</p> <p>MITSUBISHI Galant 2.4L Space Wagon</p> <p>E75A E55A N43W, N33W MI MD194482 MI A2T80591ZC HC JA1284IR</p>	<p>ALM1287</p>  <p>ALH1287RB ALM1287RB ALM1287WA</p> <p>ARM3362 PAL0200 </p> <p>12v 80amp a:38.5 b:25 c:81</p> <p>NISSAN Almera 2.0l Primera 2.0l 200 2.0l Sentra 2.0l</p> <p>SR20DE SR20DI NI 231000M800 MI A2T82491 HC JA1287IR</p>
<p>ALM1288</p>  <p>ALM1288WA</p> <p>ARM3832 PAL0200 </p> <p>12v 60amp a:24 b:13 c:53</p> <p>MITSUBISHI CHRYSLER</p> <p>MI MD175811 MI A2T35091 HC JA1288IR</p>	<p>ALM1291 New</p>  <p>ALM1291</p> <p>ARM3345 PAL0203 </p> <p>12v 100amp a:35 b:13 c:65</p> <p>MAZDA RX 8</p> <p>13B-MSP</p> <p>MA N3H118300A MI A3TG1291A</p>	<p>ALM1317</p>  <p>ALM1317WA</p> <p>ARM3757 PAL0274 </p> <p>12v 95amp a:34 b:13 c:82</p> <p>FORD Transit</p> <p>4HA, 4HD, 4ED 4FA, 4FB, 4FD 4GA, 4GF, 4GE FO 98VB10K359BA MI A3TN1791 HC CA1317IR</p>	<p>ALM1353</p>  <p>ALM1353WA</p> <p>ARM3830 PAL0200 </p> <p>12v 80amp a:25.5 b:13 c:64.5</p> <p>MAZDA Protege 1.8L 323 1.8L</p> <p>BA</p> <p>MZ BPD318300 MI A2T39291 HC JA1353IR</p>
<p>ALM1373</p>  <p>ALM1373WA</p> <p>ARM3285 PAL0200 </p> <p>12v 90amp a:6 b:17.5 c:53.5</p> <p>HYUNDAI, MITSUBISHI Sonata 3000GT Galant Sigma</p> <p>V6</p> <p>KI 3730035810 MI A4T01893 HC JA1373IR</p>	<p>ALM1375</p>  <p>ALM1375WA</p> <p>ARM3854 PAL0200 </p> <p>12v 75amp a:41 b:13 c:55</p> <p>MITSUBISHI Pajero 2.8L Canter 2.8L, 3.0L</p> <p>4M40</p> <p>MI ME200696 MI A3T08699 HC JA1375IR</p>	<p>ALM1376</p>  <p>ALM1376RB ALM1376WA</p> <p>ARM3854 PAL0200 </p> <p>12v 90amp a:42.5 b:13 c:54.5</p> <p>MITSUBISHI Pajero 2.8l Diesel</p> <p>4M40</p> <p>MI MD200695 MI A3T09199 HC JA1376IR</p>	<p>ALM1407</p>  <p>ALM1407WA</p> <p>ARM3830 PAL0200 </p> <p>12v 75amp a:46.5 b:13 c:78.5</p> <p>SUBARU Forester Impreza Legacy</p> <p>EJ18 EJ20</p> <p>SU 23700AA202 MI A2T39091 HC JA1407IR</p>
















Alternators

Mitsubishi

<p>ALM1409</p>  <p>ALM1409WA</p> <p>ARM3345 PAL0203</p>  <p>12v 80amp a:27 b:13 c:64.5</p> <p>MAZDA FP 323 ZM 626 FS7E MX, Premacy, Xedos MZ FP3418300 Protégé MI A2TB0191 HC JA1409IR</p>	<p>ALM1412</p>  <p>ALM1412WA</p> <p>ARM3992 PAL0200</p>  <p>12v 35amp a:30 b:13 c:80</p> <p>NISSAN Lift Trucks H15, H20, H25 TCM Lift Trucks H20, H25 Gas Engine</p> <p>NI 2310050K10 MI A7T03371A HC JA1412IR</p>	<p>ALM1413</p>  <p>ALM1413WA</p> <p>ARM3543 PAL0200</p>  <p>12v 50amp a:30 b:13 c:80</p> <p>NISSAN Lift Trucks H20 TCM Lift Trucks H25</p> <p>NI 2310050K15 MI A7T03771A HC JA1413IR</p>	<p>ALM1416</p>  <p>ALM1416WA</p> <p>ARM3832 PAL0200</p>  <p>12v 70amp a:29.5 b:13 c:64.5</p> <p>MAZDA L4 MPV 3.0l 929 2.2l MERCURY FO F2JY10346A Capri MI A2T13977X HC JA1416IR</p>
<p>ALM1419</p>  <p>ALM1419WA ALM419WA</p> <p>ARM3847 PAL0200</p>  <p>12v 90amp a:42.5 b:13 c:53.5</p> <p>HYUNDAI, MITSUBISHI D4BF H1 2.5L Diesel 4D56TD Starex 2.5L Diesel 4D56 L200 2.5L Diesel MI MD320354 Pajero 2.5L Diesel MI A3TN0699 HC JA1419IR</p>	<p>ALM1427</p>  <p>ALM1427WA</p> <p>ARM3212 PAL0502</p>  <p>24v 30amp a:44 b:13.5 c:81</p> <p>MITSUBISHI 4D31T Canter 3.3L 4D31</p> <p>MI ME017562 MI A2T72383 HC JA1427IR</p>	<p>ALM1474</p>  <p>ALM1474RB ALM1474WA</p> <p>ARM3358 PAL0273</p>  <p>12v 70amp a:11 b:72 c:52</p> <p>FORD DHA, DHB, DHC, DHD Fiesta 1.2L, 1.4L, 1.6L FXDA, FXDC, FXDB, FXDD Focus 1.4L, 1.6L FHD, FHF, L1W Puma 1.4L, 1.6L FO 98MF10300CA MI A5TA4391 HC CA1474IR</p>	<p>ALM1513</p>  <p>ALM1513WA</p> <p>ARM3830 PAL0200</p>  <p>12v 80amp a:41.5 b:13 c:65</p> <p>MAZDA RF, WLT MPV 2.0l Diesel RF3F MPV 2.5l Diesel RF4F MZ WL1118300 MI A2TA1099 HC JA1513IR</p>
<p>ALM1514</p>  <p>ALM1514WA</p> <p>ARM3850 PAL0111</p>  <p>12v 70amp a:90.5 b:58</p> <p>HONDA OM906920 MERCEDES-BENZ D15Z8 Civic D13B7 Logo HO 31100P2EA01 Axor 6.4l Diesel MI A5TA0991 HC JA1514IR</p>	<p>ALM1515</p>  <p>ALM1515WA</p> <p>ARM3476 PAL0200</p>  <p>12v 80amp a:42 b:13 c:65.5</p> <p>MAZDA RF, WLT 323 2.0L Diesel RF3F 626 2.0L Diesel RF4F MPV 2.5L Diesel MZ WL0118300 MI A2TB1298 HC JA1515IR</p>	<p>ALM1519</p>  <p>ALM1519WA</p> <p>ARM3341 PAL0240</p>  <p>12v 100amp a:33 b:13 c:54.5</p> <p>MITSUBISHI 6A13 Galant 2.5L</p> <p>MI MD336781 MI A3A4791 HC JA1519IR</p>	<p>ALM1520</p>  <p>ALM1520WA</p> <p>ARM3318 PAL0218</p>  <p>12v 70amp a:90 b:58</p> <p>HONDA D14A3, D14A4 Civic 1.4L D16Y6, D14A5 Civic 1.6L D14Z2, D13B7 Logo 1.3L HO 31100P2EG01 MI A5TA4791 HC JA1520IR</p>
























Alternators

Mitsubishi

<p>ALM1522</p>  <p>ALA1522RB ALM1522RB ALM1522WA</p> <p>ARM3341 PAL0240</p>  <p>GS L F</p> <p>12v 100amp a:38 b:13 c:64.5</p> <p>HYUNDAI, KIA MITSUBISHI Sonata, Carisma Magentis, Optima Galant, Pajero</p> <p>4G93, 4G94 4G63, 4G64 G4JPG, G4JP KI 3730038310 MI A3TA7791 HC JA1522IR</p>	<p>ALM1523</p>  <p>ALM1523WA ALM523WA</p> <p>ARM3341 PAL0240</p>  <p>GS L F</p> <p>12v 85amp a:38 b:13 c:65</p> <p>MITSUBISHI Carisma, Colt Galant, Lancer Pajero Space Star</p> <p>4G92 4G63 4G93 MI MD343562 MI A2TA5391 HC JA1523IR</p>	<p>ALM1524</p>  <p>ALM1524WA</p> <p>ARM3379 PAL0502</p>  <p>L S</p> <p>24v 40amp a:46 b:13 c:81</p> <p>MITSUBISHI Fuso</p> <p>MI ME017591 MI A3T76682 HC JA1524IR</p>	<p>ALM1530</p>  <p>ALM1530WA ALM530WA</p> <p>ARM3830 PAL0200</p>  <p>L S</p> <p>12v 70amp a:41.5 b:13 c:65</p> <p>FORD RANGER 2.5 MAZDA B 2500 MAZDA B 2500</p> <p>TDDi MD25NA WLE7 MZ WL9118300 MI A2TA6099 HC JA1530IR</p>
<p>ALM1531</p>  <p>ALM1531WA</p> <p>ARM3341 PAL0240</p>  <p>GS L F</p> <p>12v 80amp a:37.5 b:13 c:66</p> <p>MITSUBISHI Colt Lancer Mirage</p> <p>4G13 4G15 4G62 MI MD325696 MI A2TA5191 HC JA1531IR</p>	<p>ALM1532</p>  <p>ALM1532WA</p> <p>ARM3285 PAL0200</p>  <p>L S</p> <p>12v 75amp a:24 b:17 c:55</p> <p>MITSUBISHI Galant 2.5L</p> <p>MI MD197468 MI A4T02991 HC JA1532IR</p>	<p>ALM1533</p>  <p>ALM1533WA ALM533WA</p> <p>ARM3847 PAL0200</p>  <p>L S</p> <p>12v 80amp a:42 b:13 c:55</p> <p>MITSUBISHI PAJERO 2.5L Diesel L200 2.5L Diesel L400 2.5L Diesel</p> <p>4D56 4D56T 4D56TD MI MD340419 MI A2TN1798 HC JA1533IR</p>	<p>ALM1594</p>  <p>ALM1594WA</p> <p>ARM3476 PAL0200</p>  <p>L S</p> <p>12v 100amp a:42.5 b:13 c:81.5</p> <p>NISSAN Patrol 2.8l Diesel</p> <p>RD28TI NI 23100VB310 MI A3TA4399 HC JA1594IR</p>
<p>ALM1601</p>  <p>ALM1601WA</p> <p>ARM3832 PAL0200</p>  <p>L S</p> <p>12v 100amp a:23.5 b:17 c:54</p> <p>MITSUBISHI Pajero 3.0l Pajero 3.5l Montero 3.5l</p> <p>6G74 6G72 MI MD350609 MI A3T14491 HC JA1601IR</p>	<p>ALM1612</p>  <p>ALM1612WA ALN1612RB</p> <p>ARM3381 PAL0221</p>  <p>L IG C</p> <p>12v 60amp a:90 b:58</p> <p>MERCEDES-BENZ, SUZUKI M13A, M16A 9t 5.7l Diesel Grand Vitara 1.5 Jimny 1.3l, Wagon 1.0l Liana 1.3l, 1.6l</p> <p>G13BB, J20A, G16B OM352911 SU 3140075F00 MI A5TA3891 HC JA1612IR</p>	<p>ALM1615</p>  <p>ALM1615WA</p> <p>ARM3362 PAL0200</p>  <p>L S</p> <p>12v 90amp a:43 b:13 c:81</p> <p>NISSAN Almera X-Trail Pick Up</p> <p>YD25DDTi TD25Ti YD22ETi NI 231005M310 MI A3TB0771 HC JA1615IR</p>	<p>ALM1617</p>  <p>ALM1617WA</p> <p>ARM3854 PAL0200</p>  <p>L S</p> <p>12v 125amp a:42 b:13 c:60.5</p> <p>MITSUBISHI Pajero 3.2L</p> <p>4M41 MI ME203546 MI A3TA4298A HC JA1617IR</p>






















Alternators

Mitsubishi

<p>ALM1619</p>  <p>ALM1619WA PAL0205</p>  <p>12v 90amp a:34 b:12 c:53.5</p> <p>CHRYSLER, DODGE Cyrus 2.5L Stratus 2.5L</p> <p>V6 625H H00,EEB CH 4609125 MI A2TA7491ZC HC UA1619</p>	<p>ALM1646</p>  <p>ALM1646WA ARM3188</p> <p>12v 120amp a:43 b:22 c:45</p> <p>FIAT, CITROEN, PEUGEOT RHV, 6FZ, RHY Ducato C5, Berlingo 206, 307, 406 607</p> <p>WJZ, HFX, RFN RHS, 3FZ FI 71719944 MI A3TA6491 HC CA1646IR</p>	<p>ALM1652</p>  <p>ALM1652WA ALM652WA ALV1652 ARM3554 PAL0214</p>  <p>12v 110amp a:42 b:15 c:57</p> <p>RENAULT Clio RENAULT Kangoo NISSAN Kubistar</p> <p>K9K700 K9K718 K9K710 NI 2310000QA1 MI A2TB6481 HC CA1652IR</p>	<p>ALM1687</p>  <p>ALM1687WA ALV1687 ARM3498 PAL0213</p>  <p>12v 70amp a:42 b:22.5 c:45.5</p> <p>CITROEN, PEUGEOT C3 207</p> <p>KFV, NFU TU3JP TU5JP4 PE 9638543580 MI A5TA6292 HC CA1687IR</p>
<p>ALM1704</p>  <p>ALM1704WA ARM3848 PAL0220</p>  <p>12v 80amp a:46 b:13 c:80</p> <p>SAAB, SUBARU 9-2 2.5l Forester 2.0l Impreza 2.0l Legacy 2.0l, 2.5l</p> <p>EJ20, EJ25, EJ205 EJ207, EJ16, EJ16E EJ253, EJ255, 251 SU 23700AA390 MI A2TB2891 HC JA1704IR</p>	<p>ALM1705</p>  <p>ALM1705WA ARM3465 PAL0203</p>  <p>12v 90amp a:39.5 b:60 c:74</p> <p>MAZDA 6 1.8/2.0/2.3L 2002-></p> <p>GY L3C1</p> <p>MAZD L81318300 MI A3TG0091 HC JA1705</p>	<p>ALM1713</p>  <p>ALM1713WA ARM3342 PAL0200</p>  <p>12v 85amp a:46 b:13 c:80</p> <p>SUBARU Legacy Impreza</p> <p>EJ18, EJ20, EJ22 EJ20EMPI EJ25D SU 23700AA36A MI A002T37391AC HC JA1713IR</p>	<p>ALM1727</p>  <p>ALM1727WA ARM3851 PAL0111</p>  <p>12v 70amp a:94.5 b:58</p> <p>HONDA Civic 1.4l Civic 1.6l Civic 1.7l Civic 1.8l</p> <p>D14Z6, D14Z5 D16V1, D17A6 D17A8, D17A9 HO 31100PLMA02 MI A5TA7091 HC JA1727IR</p>
<p>ALM1728</p>  <p>ALM1728WA ARM3851 PAL0110</p>  <p>12v 70amp a:39 b:31 c:46</p> <p>HONDA CR-V 2.0L FR-V 2.0L Stream 2.0L</p> <p>K20A4, K24A1 K20A1 K20A9 HO 31100RJJ004 MI A2TB8691 HC JA1728IR</p>	<p>ALM1741</p>  <p>ALM1741WA ALM741WA ARM3606 PAL0213</p>  <p>12v 120amp a:41.5 b:22 c:45</p> <p>CITROEN, PEUGEOT C4 206</p> <p>TU5JP4 KFU (ET3J4) PE 5705HA MI A3TB2691 HC CA1741IR</p>	<p>ALM1791</p>  <p>ALM1791WA PAL0450</p>  <p>12v 120amp a:33 b:12 c:53.5</p> <p>CHRYSLER CHEVROLET PT Cruiser 2.0</p> <p>ECC</p> <p>CH 5033054AC MI A3TB2491ZC HC JA1791</p>	<p>ALM1805</p>  <p>ALM1805WA ARM3845 PAL0240</p>  <p>12v 90amp a:38 b:13 c:64.5</p> <p>MITSUBISHI Colt Lancer Mirage Eclipse</p> <p>4G13 4G15</p> <p>MI MD357737 MI A2TA5393 HC JA1805IR</p>













Alternators

Mitsubishi

<p>ALM1806</p>  <p>ALM1806WA</p> <p>ARM3362 PAL0200</p>  <p>12v 110amp a:41.5 b:13 c:80</p> <p>NISSAN Primera 2.2L T DSL</p> <p>P12, WP12</p> <p>NI 23100AD210 MI A3TA6581KD HC JA1806IR</p>	<p>ALM1832</p>  <p>ALM1832WA</p> <p>ARM5498 PAL0213</p>  <p>12v 60amp a:42 b:22 c:45</p> <p>CITROEN, PEUGEOT C2, C3 Xsara 1.4</p> <p>HFX, KVF, NFU KFU, 8HX</p> <p>PE 9644904680 MI A1TA3392C HC CA1832IR</p>	<p>ALM1842</p>  <p>ALM1842WA</p> <p>ARM3113</p> <p>24v 100amp a:46 b:23 c:72.5</p> <p>SCANIA 114, 124, 260 144, 230, 300 94, T114</p> <p>DC902, DC903 DC1102, DC1101 DSC1201, DSC1202 SC 571474 MI A4TR5191 HC CA1842IR</p>	<p>ALM1852</p>  <p>ALM1852WA</p> <p>24v 60amp a:45 b:27 c:67</p> <p>RENAULT VI S135, S150, S180, S210 M, M180, M210 135, 180, 150 210, 220, 250, 270</p> <p>MIDR040226A4 DCi4B MIDR0402266B4 RE 5001847422 MI A3TA8291 HC CA1852IR</p>
<p>ALM1895</p>  <p>ALM1895WA</p> <p>ARM3341 PAL0240</p>  <p>12v 85amp a:46 b:13 c:46</p> <p>MITSUBISHI Colt Lancer Smart</p> <p>4A90, 4G15T 4A91, CX2, CY2</p> <p>MI MN155953 MI A5TG0091 HC JA1895IR</p>	<p>ALM1896</p>  <p>ALM1896WA</p> <p>ARM3476 PAL0200</p>  <p>12v 90amp a:39 b:13 c:67</p> <p>MAZDA 6 Mpv</p> <p>RF5C</p> <p>MZ RF5C18300 MI A3TB4981 HC JA1896IR</p>	<p>ALM1897</p>  <p>ALM1897RB ALM1897WA</p> <p>ARM3582 PAL0111</p>  <p>12v 80amp a:42 b:16 c:37</p> <p>HONDA Civic AirWave Jazz Fit</p> <p>L12A1, L13A1 L13A5, L13A7 L15A2 HO 31100PWA004 MI A5TB0091 HC JA1897IR</p>	<p>ALM1898</p>  <p>ALM1898WA</p> <p>ARM3345 PAL0203</p>  <p>12v 80amp a:13 b:13 c:65</p> <p>MAZDA 3</p> <p>B6ZE, Z6 BK</p> <p>MZ ZJ0118300 MI A2TC0091 HC JA1898</p>
<p>ALM1902</p>  <p>ALM1902WA</p> <p>ARM3345 PAL0203</p>  <p>12v 90amp a:75 b:75 c:69</p> <p>MAZDA 3 5</p> <p>LF17, L823, LFF7 CR19</p> <p>MZ LF5018300 MI A3TG1391A HC JA1902</p>	<p>ALM1943</p>  <p>ALM1943WA</p> <p>ARM3381 PAL0221</p>  <p>12v 75amp a:90 b:58</p> <p>SUZUKI Swift 1.3L/1.5L Wagon 1.3L 2003-></p> <p>M13A M15A</p> <p>SU 3140084E01 MI A5TB0891ZE HC CA1943IR</p>	<p>ALM1946</p>  <p>ALM1946WA</p> <p>ARM3547 PAL0220</p>  <p>12v 150amp a:38 b:13 c:81</p> <p>NISSAN Pathfinder 2.5L Dci Navara 2.5L</p> <p>R51 D40</p> <p>NI 23100EB315 MI A3TJ0781AE HC CA1946IR</p>	<p>ALM1947</p>  <p>ALM1947WA</p> <p>24v 80amp a:45 b:27 c:64.5</p> <p>RENAULT V.I. 270.18 6.2 250.15 6.2 220.16 6.2 150.08 4.1</p> <p>DCi6A, DCi6W MIDR060226Y/41 DCi4B RE 5010480572 MI A3TA8491 HC CA1947IR</p>













Alternators

Mitsubishi

<p>ALM1948</p>  <p>ALM1948WA PAL0214</p> <p>12v 110amp b:16 c:61</p> <p>NISSAN, RENAULT Kubistar Clio, Kangoo</p> <p>K9K710 K9K700, K9K702, K9K710</p> <p>NI 2310000QA9 MI A2TC0982 HC CA1948IR</p>	<p>ALM1957</p>  <p>ALM1957WA ARM3564 PAL0220</p> <p>12v 120amp a:32 b:14 c:58.5</p> <p>NISSAN Micra Note</p> <p>HR16DE HR16DE</p> <p>NI 23100BC400 MI A2TJ0291ZE HC CA1957IR</p>	<p>ALM1971</p>  <p>ALM1971WA PAL0453</p> <p>12v 210amp a:32.5 b:14.5 c:60</p> <p>RENAULT Scénic 2.0 Megane 2.0 Laguna Grand Scénic 2.0</p> <p>M9R615, M9R809 V9X791, M9R802 M9R816, M9R615 RE 8200654785 MI A4TJ0282 HC CA1971IR</p>	<p>ALM1972</p>  <p>ALM1972WA PAL0225</p> <p>12v 90amp a:39 b:13 c:66.5</p> <p>MAZDA 3 5 6</p> <p>RF7J BK12, BK14 GG, GY MA RF7J18300A MI A3TB6581 HC CA1972</p>
<p>ALM1979</p>  <p>ALM1979RB ALM1979WA PAL0220</p> <p>12v 150amp a:32 b:14 c:60.5</p> <p>NISSAN, RENAULT Koleos 2.0 X-Trail</p> <p>M9R832, M9R M9R834 M9R760 NI 23100JD71A MI A3TJ2481ZE HC CA1979IR</p>	<p>ALM1981</p>  <p>ALM1981WA ARM3558 PAL0110</p> <p>12v 90amp a:44 b:20 c:41</p> <p>HONDA Civic</p> <p>R18A2 R18A1</p> <p>HO 31100RNAA01 MI A2TC1391ZC HC CA1981IR</p>	<p>ALM1983</p>  <p>ALM1983WA ARM3362 PAL0200</p> <p>12v 90amp a:37.5 b:13 c:81</p> <p>NISSAN Pick Up 2.5 Di</p> <p>D22</p> <p>NI 23100VK010 MI A3TB5099 HC CA1983IR</p>	<p>ALM2013 <i>New</i></p>  <p>ALM2013WA ARM3571 PAL0240</p> <p>12v 120amp a:34 b:13 c:54</p> <p>CITROEN, PEUGEOT MITSUBISHI 4007, C-Crosser Outlander Lancer</p> <p>MMC 4B12 4B11 PE 5705KA MI A3TG3181 HC CA2013IR</p>
<p>ALM2014</p>  <p>ALM2014WA ARM3505 PAL0225</p> <p>12v 100amp a:39.5 b:60 c:83.5</p> <p>MAZDA MX-5 6</p> <p>NC, GG, GY, GG GH</p> <p>MZ L3P918300A MI A2TJ0391A HC CA2014</p>	<p>ALM2015</p>  <p>ALM2015WA ARM3121 PAL0212</p> <p>12v 120amp a:43 b:22 c:45</p> <p>CITROEN, PEUGEOT Expert, C4 407 SW, 407 308 SW, 307 807, C8, C5</p> <p>EW10A EW12J4</p> <p>CI 96498046880 MI A3TG1891ZEB HC CA2015IR</p>	<p>ALM2019</p>  <p>ALM2019WA ARM3154 PAL0473</p> <p>24v 90amp a:81 b:27.5 c:66</p> <p>RENAULT Trucks MAZ MINSK 5440A9 URAL 6367-31 URAL 6563</p> <p>RE 5001866377 MI A4TR5091 HC CA2019IR</p>	<p>ALM2026</p>  <p>ALM2026WA ARM3381 PAL0221</p> <p>12v 75amp a:90 b:58</p> <p>SUZUKI SX4 Swift Splash</p> <p>M16A, GY M13A K12B SU 3140084E10 MI A5TB1292AE HC CA2026IR</p>























Alternators

Mitsubishi

<p>ALM2039</p>  <p>ALM2039WA</p> <p>24v 100amp a:20 b:85 c:35.5</p> <p>SCANIA 4 Series</p> <p>MI A4TR5291 MI A4TR5291ZT HC CA2039IR</p>	<p>ALM2081</p>  <p>ALM2081WA</p> <p>12v 75amp a:43 b:54 c:55</p> <p>MITSUBISHI L 400</p> <p>4D56TD 4D56T</p> <p>MI A003TN0199 MI A3TN0299 LU LRA02006</p>	<p>ALM2083</p>  <p>ALM2083WA</p> <p>ARM3472 PAL0220</p> <p>12v 90amp a:47 b:13 c:80</p> <p>SAAB, SUBARU 9-2X Forester Impreza</p> <p>SU 23700AA380 MI A2TB3091 WA 11058N</p>	<p>ALM2087 <i>New</i></p>  <p>ALM2087WA</p> <p>ARM3121 PAL0212</p> <p>12v 80amp a:26.5 b:80</p> <p>CITROEN, PEUGEOT C3 Picasso 1.4 01.2009-></p> <p>EP3</p> <p>PE V757695680 MI A5TG0881ZEB HC CA2087IR</p>
<p>ALM2091 <i>New</i></p>  <p>ARM3341 PAL0240</p> <p>12v 125amp a:25 b:16 c:60</p> <p>MITSUBISHI Pajero 3 Shogun</p> <p>v6 3.5l</p> <p>MD MD370479 MI A3TB2091A MH ALM2091</p>	<p>ALM2158</p>  <p>ALM2158WA</p> <p>ARM3225 PAL0501</p> <p>12v 60amp a:42 b:13 c:80</p> <p>NISSAN Cherry King Cab King Vanette Silvia</p> <p>E15ET, FJ20E Z24 A15S NI 2310004M00 MI A2T40972 HC JA158IR</p>	<p>ALM2191 <i>New</i></p>  <p>ARM3622 PAL0233</p> <p>12v 150amp a:52 b:21 c:51</p> <p>FORD Focus FORD Escpae MAZDA Tribute MERCURY Mariner</p> <p>2.0l L4 2.3l L4 2.5l L4 MZ ZZC718300 MI A2TX0191 WA 11272N</p>	<p>ALM2214 <i>New</i></p>  <p>ARM3571</p> <p>12v 140amp a:38 b:12 c:61</p> <p>MITSUBIHI Pajero 3.2D SPORT 2007-></p> <p>MI A3TG4579 MI A2TX1279</p>
<p>ALM2286 <i>New</i></p>  <p>ALM2286WA</p> <p>ARM3843 PAL0204</p> <p>24v 35amp: a:45 b:13 c:81</p> <p>MITSUBISHI FUSO</p> <p>6D14 6D15 6D16 MI ME037640 MI A4TU3186 MH ALM2286</p>	<p>ALM2390 <i>New</i></p>  <p>PAL0233</p> <p>12v 110amp a:43 b:20 c:56</p> <p>MAZDA 6 MAZDA CX-9</p> <p>3.5L 3.7L</p> <p>MZ CY0118300A MI A3TJ2391 WA 11267N</p>	<p>ALM2391 <i>New</i></p>  <p>ARM3480 PAL0220</p> <p>12v 110amp a:46 b:13 c:81</p> <p>SUBARU Legacy 2.5L Outback 2.5L</p> <p>SU 23700AA55A MI A3TG2391 WA 11024N</p>	<p>ALM2481 <i>New</i></p>  <p>12v 105amp a:45 b:12 c:55</p> <p>MITSUBISHI Pajero</p> <p>4D56T</p> <p>MI MD371144 MI A3TN2481 MS 210656</p>

Alternators

Mitsubishi

<p>ALM2492</p>  <p>ALM2492WA</p> <p>ARM3293 PAL0502</p>  <p>12v 50amp a:43.5 b:21</p> <p>VETUS M4 Marine</p> <p>CA 1992358 MI A7T02071C CG 112492</p>	<p>ALM2530</p>  <p>ALM2530WA</p> <p>PAL0205</p>  <p>12v 90amp a:33 b:12 c:54</p> <p>CHRYSLER MITSUBISHI Neon Eclipse</p> <p>ECC, 420T 420A CH 4671041 MI A2T81192ZC CG 111530</p>	<p>ALM2578</p>  <p>12v 100amp a:43 b:13 c:74</p> <p>MITSUBISHI Galant VI 2.0L</p> <p>4D68 4D68T MI A3TA2578 MI MD321845</p>	<p>ALM2591 <i>New</i></p>  <p>ALM2591WA</p> <p>12v 110amp a:31 b:13 c:59</p> <p>NISSAN HR15DE</p> <p>NI 23100ED01A MI A2TJ0591 MH ALM2591</p>
<p>ALM2879 <i>New</i></p>  <p>ARM3465 PAL0203</p>  <p>12v 110amp a:50 b:21 c:51</p> <p>MAZDA MPV</p> <p>2.3L MZ L33618300 MI A3TG0291 MH ALM2879</p>	<p>ALM3156 <i>New</i></p>  <p>ALM3156WA</p> <p>ARM3217 PAL0200</p>  <p>12v 75amp a:37 b:12 c:49</p> <p>MITSUBISHI, DODGE EAGLE, PLYMOUTH Galant, Lancer Eclipse, Laser Colt, Talon</p> <p>E32A C6A, C7A C77A MI MD117156 MI A2T09792 MH ALM3156</p>	<p>ALM3181 <i>New</i></p>  <p>ARM3505 PAL0225</p>  <p>12v 110amp a:50 b:26 c:58</p> <p>MAZDA 3 6 Speed</p> <p>2.3L 2.3L Turbo MZ L3M618300A MI A3TJ1181 WA 11169N</p>	<p>ALM3188 <i>New</i></p>  <p>ALM3188WA ALM3506</p> <p>ARM3846 PAL0204</p>  <p>24v 45amp a:28.5 b:13 c:71</p> <p>MITSUBISHI MAZDA Titan</p> <p>4D33 4D34 MI A3TN6188 WA 1346625W</p>
<p>ALM3191</p>  <p>ALM3191WA</p> <p>ARM3476 PAL0200</p>  <p>12v 110amp a:38 b:12 c:81</p> <p>INFINITI FX35 3.5L G35 3.5L NISSAN 350Z 3.5L</p> <p>NI 23100CD010 MI A3TG0191 WA 11052N</p>	<p>ALM3196</p>  <p>ALM3196WA</p> <p>ARM3505 PAL0225</p>  <p>12v 110amp a:38 b:55 c:79</p> <p>MAZDA MPV 3.0i</p> <p>MI A3TJ0191 WA 11006N</p>	<p>ALM3281</p>  <p>ALM3281RB ALM3281WA</p> <p>ARM3564 PAL0220</p>  <p>12v 110amp a:41 b:14 c:59</p> <p>NISSAN Cube Sentra Versa Platina</p> <p>NI 23100EM01B MI A2TJ0281 WA 11343N</p>	<p>ALM3350</p>  <p>ALM3350WA</p> <p>ARM3294 PAL0502</p>  <p>24v 50amp a:45 b:12 c:80</p> <p>MITSUBISHI Fuso Z-Great</p> <p>MP517, MP118, FK516 MP117, MM115, FK515 FM516, FM515, FK416 MI ME037620 MI A004T57786 UP ALT3352</p>


















Alternators

Mitsubishi

<p>ALM3360</p>  <p>ALM3360WA AHM3735 PAL0451</p>  <p>12v 85amp a:34 b:12.5 c:54</p> <p>DODGE Neon 2.0L PLYMOUTH Neon 2.0L CHRYSLER</p> <p>420H ECB, ECH L4 CH 4793692 MI A2TB1491ZC CG 113360</p>	<p>ALM3368</p>  <p>ALM3368WA ARM3832 PAL0200</p>  <p>12v 110amp a:41 b:25 c:81</p> <p>NISSAN Quest 3.0 GXE MERCURY Villager 3.0L</p> <p>VG30E NI 231000B000 MI A4T01192ZC CG 113368</p>	<p>ALM3370</p>  <p>ALM3370WA ARM3369 PAL0200</p>  <p>12v 125amp a:41 b:26 c:81</p> <p>NISSAN, MERCURY Quest 3.3L Vilager 3.3L</p> <p>VG33E NI 231007B000 MI A3TA5691 CG 113370</p>	<p>ALM3381</p>  <p>ALM3381WA PAL0200</p>  <p>12v 80amp a:39 b:12 c:80</p> <p>MAZDA Titan Bongo</p> <p>RF6C MA RF6C18300A MI A2TN3381</p>
<p>ALM3399</p>  <p>ALM3399WA PAL0200</p>  <p>12v 70amp a:29 b:13 c:55</p> <p>mitsubishi Canter 2.8L T DSL</p> <p>FE35 MI ME200699 MI A3T08799 UP ALT3039</p>	<p>ALM3462</p>  <p>ALM3462WA ARM3845 PAL0284</p>  <p>12v 90amp a:34.5 b:13 c:79.5</p> <p>EAGLE, MITSUBISHI Talon Eclipse Galant</p> <p>ECF EBG 4G64 MI MD310997 MI A2T82791 CG 113462</p>	<p>ALM3481</p>  <p>ALM3481WA ARM3304 PAL0296</p>  <p>12v 115amp a:33 b:13 c:55</p> <p>CHRYSLER, DODGE, JEEP Sebring Avenger, Caliber Compass, Patriot</p> <p>CH 4801323AD MI A2TJ0481 WA 11231N</p>	<p>ALM3482</p>  <p>ALM3482WA PAL0400</p>  <p>12v 210amp a:38 b:14 c:61</p> <p>RENAULT Megane II 1.5l Scenic II 1.5l VOLKSWAGEN Golf V 1.5l</p> <p>K9K734 K9K724 BKG, BLN RE 8200404638 MI A4TJ0481 MH ALM3482</p>
<p>ALM3491 <i>New</i></p>  <p>ALM3491WA ARM3545 PAL0243</p>  <p>12v 120amp a:42 b:25 c:24</p> <p>HOLDEN Adventra Commodore Statesman</p> <p>3.6 Lt MI A3TG1491 MH ALM3491</p>	<p>ALM3497</p>  <p>ALM3497WA ARM3846 PAL0201</p>  <p>24v 35amp a:43 b:13 c:82</p> <p>MITSUBISHI Canter NEW HOLLAND</p> <p>MI ME017614 MI A3TN5188 CG 113497</p>	<p>ALM3506</p>  <p>ALM3506WA ARM3846 PAL0204</p>  <p>24v 40amp a:43 b:13 c:81.5</p> <p>MITSUBISHI Canter Fuso</p> <p>4D342AT4 6D311AT2 4D31T MI ME017615 MI A3TN5288 CG 113506</p>	<p>ALM3562</p>  <p>ALM3562WA ARM3295 PAL0502</p>  <p>12v 40amp a:42 b:13 c:81.5</p> <p>FORD 1000 Series 2000 Series CASE, NEW HOLLAND Tractors</p> <p>4139, 391 4135, 381 Shibaura Diesel FO SBA185046320 MI A7T03877 CG 113562</p>

Alternators

Mitsubishi

<p>ALM3581</p>  <p>ALM3581WA</p> <p>ARM3849 PAL0274</p>  <p>12v 100amp a:41 b:13 c:82</p> <p>SUZUKI Jimny 1.5L (FJ) DDiS 4x4 2003-></p> <p>K9K K9K700</p> <p>SU 3140084A00 MI A3TN2581 CG 114207</p>	<p>ALM3582</p>  <p>ALM3582WA</p> <p>PAL0453</p>  <p>12v 210amp a:38 b:14.5 c:64.5</p> <p>RENAULT Laguna</p> <p>RE 8200660057 MI A4TJ0581 HC CA2086IR</p>	<p>ALM3592</p>  <p>ARM3098 PAL0261</p>  <p>24v 80amp a:44 c:103.5</p> <p>VOLVO PENTA</p> <p>VO 3587218 MI A3TR5092ZT NR A3TR5092AN</p>	<p>ALM3677</p>  <p>ALM3677WA</p> <p>ARM3290 PAL0502</p>  <p>12v 60amp a:28.5 b:17</p> <p>KUBOTA</p> <p>M6800 M8200 M9000</p> <p>V3300 68HP V3300 82HP V3300 90HP KU 1C01064011 MI A1TA1777 NR 021777</p>
<p>ALM3691</p>  <p>ALM3691WA</p> <p>ARM3098 PAL0260</p>  <p>24v 100amp a:20 b:86 c:35</p> <p>SCANIA Euro Trucks</p> <p>SC 1884268 MI A4TR5691 NR 025691</p>	<p>ALM3782</p>  <p>ALM3782WA</p> <p>ARM3341 PAL0240</p>  <p>12v 110amp a:51 b:59 c:75</p> <p>MITSUBISHI Lancer 2.4L Outlander 2.4L</p> <p>KENWORTH</p> <p>4G69</p> <p>HB J5115082 MI A3TG3491 CG 113782</p>	<p>ALM3819</p>  <p>ALM3819WA</p> <p>ARM3098 PAL0260</p>  <p>24v 100amp a:28 b:58</p> <p>DEUTZ-Fahr VOLVO B7/B9/B10/B12 MITSUBISHI BUS</p> <p>RENAULT RVI MIDLUM DXI100A</p> <p>DE 1182336 MI A4TA8591 NR 022764</p>	<p>ALM3840</p> <p>24v 80amp a:46 b:14 c:104</p> <p>VOLVO</p> <p>VO 3840183 MI A3TR5093</p>
<p>ALM3891</p>  <p>ALM3891WA</p> <p>ARM3098 PAL0260</p>  <p>24v 130amp a:42 b:14 c:102</p> <p>RENAULT Trucks</p> <p>RE 7421056611 MI A4TR5891ZT CA CAL35621GS</p>	<p>ALM3892</p> <p>ALM3892WA</p> <p>12v 90amp</p> <p>PEUGEOT 207 1.6L 308 1.6L</p> <p>16V 16V Vti</p> <p>PE V753506580 MI A5TG0891ZEB MH ALM3892</p>	<p>ALM3971</p>  <p>ALM3971WA</p> <p>ARM3153</p> <p>12v 115amp a:45 b:14 c:55</p> <p>VOLVO PENTA</p> <p>D255, D120, D6435 D240, D113, D6310 D130, D4250 VO 874502 MI A3TR0091ZT CG 113971</p>	<p>ALM4018</p>  <p>PAL0200</p>  <p>12v 65amp a:46 b:13 c:54.5</p> <p>MITSUBISHI Delica</p> <p>2.5L Diesel</p> <p>MI MD339606 MI A2TN1583 CG 114018</p>

Alternators

Mitsubishi

<p>ALM4116</p>  <p>PAL0111 </p> <p>12v 75amp b:22</p> <p>HONDA Motorcycles GL1800 Gold Wing</p> <p>HO 31100MCA700 MI A5TA7599ZC CG 114116</p>	<p>ALM4181</p>  <p>ARM3529 PAL0233 </p> <p>12v 200amp a:47 b:26</p> <p>FORD MERCURY</p> <p>FO FW7310346AC MI A4TJ0181 WA 11026N</p>	<p>ALM4244</p>  <p>ALM4244WA ARM3473 PAL0224 </p> <p>12v 130amp b:13 c:81</p> <p>NISSAN Pathfinder 2.5 YD25DDTI NISSAN Navara 2.5 RENAULT V.I. Trucks EU</p> <p>NI 23100EB310 MI A3TG2681 CG 114244</p>	<p>ALM4318</p>  <p>12v 105amp a:32 b:12 c:53</p> <p>NITSUBISHI Lanser</p> <p>MI 1800A324 MI A2TG2191</p>
<p>ALM4356</p>  <p>ALM4356WA ARM3465 PAL0203 </p> <p>12v 100amp a:41 b:55 c:74</p> <p>MAZDA MPV 2.5L</p> <p>GYDE</p> <p>MZ GY0118300J MI A3TB1081 CG 114356</p>	<p>ALM4391 <i>New</i></p>  <p>ALM4391WA ARM3554 PAL0214 </p> <p>12v 110amp a:55 b:27 c:67</p> <p>RENAULT, DACIA Logan Sandero Clio, Laguba Megane</p> <p>RE 8200400891 MI A2TC0391 MH ALM4391</p>	<p>ALM4424</p>  <p>ALM4424WA ARM3161</p> <p>12v 80amp a:45 b:13 c:52</p> <p>mitsubishi FE Series</p> <p>4D311AT 4D341AT 6D340AT MI ME015237 MI A4TU0088 CG 114424</p>	<p>ALM4425</p>  <p>ALM4425WA ARM3843 PAL0200 </p> <p>24v 50amp a:42 b:14 c:81</p> <p>MITSUBISHI Aero Midi Fuso Z-GREAT 1993-> SUPER, KV20J FIGHTER, CNG</p> <p>6D17 6M61 MI ME077790 MI A4T40386 CG 114425</p>
<p>ALM4432</p>  <p>ALM4432WA ARM3830 PAL0200 </p> <p>12v 100amp a:23 b:13 c:79.5</p> <p>MITSUBISHI L 300 Space Gear</p> <p>4G63 4G64</p> <p>MI MD318460 MI A3TA2391A CG 114432</p>	<p>ALM4591</p>  <p>24v 50amp a:65 b:12 c:75</p> <p>ISUZU</p> <p>IS 1812005201 MI A4TU4591</p>	<p>ALM4679 <i>New</i></p>  <p>ALM4679WA ARM3571</p> <p>12v: 120amp: a:45 b:12 c:55</p> <p>MITSUBISHI Pajero IV 3.2 DI-D 2006-</p> <p>MI 1800A115 MI A3TG4679 MH ALM4679</p>	<p>ALM4686 <i>New</i></p>  <p>ALM4686WA ALM6686 ARM3212 PAL0502 </p> <p>24v 60amp a:45 b:12 c:81</p> <p>KOMATSU HITACHI KATO VOLVO</p> <p>8DC9 6D40</p> <p>MI A4T66686 MH ALM4686</p>

Alternators

Mitsubishi

<p>ALM4707 <i>New</i></p>  <p>ARM3121 PAL0212</p>  <p>COM</p> <p>12v 80amp a:42.5 b:22 c:45.5</p> <p>CITROEN C3, C4, C5 PEUGEOT 307, 407</p> <p>KFT (TU3AE5) RFJ (EW10A) RFN (EW10J4) PE 9666030280 MI A5TG1392 CG 114707</p>	<p>ALM4789 <i>New</i></p>  <p>12v 210amp a:32 b:13 c:63</p> <p>RENAULT Espace iv</p> <p>JK02 JK03 M9R802 RE 8200654789 MI A4TJ0381</p>	<p>ALM5292</p> <p>24v 150amp</p> <p>MITSUBISHI HITACHI EX1900</p> <p>MI 0434339020 MI A9TU5292</p>	<p>ALM5392 <i>New</i></p>  <p>ALM5392WA</p> <p>PAL0240</p>  <p>G S L F</p> <p>12v 90amp a:37.5 b:13 c:66.5</p> <p>MITSUBISHI Lancer 1.6L</p> <p>4G92</p> <p>MI MD375853 MI A2TA5392 CG 114357</p>
<p>ALM5493</p>  <p>24v 50amp a:33 b:11 c:82</p> <p>MITSUBISHI FUSO CANTER/ROSA 6.9T 4M50T, 4M50T3, 4M50T</p> <p>MI ME22495 MI A3TR5493 UP ALT3106</p>	<p>ALM5590 <i>New</i></p>  <p>ARM3472 PAL0220</p>  <p>L S</p> <p>12v 110amp a:46 b:13 c:80</p> <p>MITSUBISHI SUBARU B9 Tribeca 3.0L 2008-> Legacy 3.0L 2009-> Outback 3.0L</p> <p>EZ350</p> <p>SU 23700AA510 MI A003TG0591 MH ALM5590</p>	<p>ALM5591 <i>New</i></p>  <p>ALM5591WA</p> <p>24v: 150amp: a:45 b:14 c:151</p> <p>SCANIA Heavy Duty Trucks K 400, 440, 480</p> <p>SC 1777301 MI A9TU5591 NR 02U5591</p>	<p>ALM5686</p>  <p>ALW5686WA</p> <p>24v 50amp a:45 b:12 c:87</p> <p>HITACHI EX220 EX2002</p> <p>6HK1 6BD1T</p> <p>IS 1812005160 MI A4TU5686 NR 025686</p>
<p>ALM5791</p>  <p>24v 120amp a:89 b:57</p> <p>IVECO</p> <p>IV 504282826 MI A4TR5791</p>	<p>ALM5981 <i>New</i></p>  <p>ALM5981RB ALM5981WA</p> <p>12v a:34 b:13 c:59</p> <p>NISSAN</p> <p>MI A2TA1981F MH ALM5981</p>	<p>ALM6034</p>  <p>12v 65amp a:44 b:13 c:80</p> <p>MAZDA MITSUBISHI</p> <p>MA F60118300A MI A002T41191 BO 0986034291</p>	<p>ALM6091 <i>New</i></p>  <p>ARM3341 PAL0240</p>  <p>G S L F</p> <p>12v 105amp a:37 b:14 c:70</p> <p>MITSUBISHI Airtrek Lancer</p> <p>4G63 4G69 DOHC16V MI MN163016 MI A3TB6091 WA 23312R</p>

Alternators

Mitsubishi

<p>ALM6285</p>  <p>24v 50amp a:59 b:12 c:75</p> <p>ISUZU</p> <p>IS 1812006032 MI A4TU6285</p>	<p>ALM6511 <i>New</i></p>  <p>24v 80amp a:37 b:12 c:82</p> <p>MITSUBISHI Canter</p> <p>4D34 2AT4 2AT6 MI ME221165 MI A4TU6888</p>	<p>ALM6654</p>  <p>ARM3281 PAL0200 </p> <p>12v 65amp a:53 b:13 c:54</p> <p>MITSUBISHI Colt Galant Lancer</p> <p>4D65 4D65 T 4G13 MI MD102865 MI A2T49476 HC JA654IR</p>	<p>ALM7480</p>  <p>ARM3121</p> <p>12v 80Amp a:42 b:22 c:46</p> <p>CITROEN C2 1.1L 1.4L C3 1.4L PEUGEOT 207 1.4L</p> <p>HFV KFV PE 9651927480 MI A005TG0192A</p>
<p>ALM7899</p>  <p>12v 80amp a:40 b:12 c:68</p> <p>KUBOTA</p> <p>KU 3M76064010 MI A5TA7899</p>	<p>ALM7991 <i>New</i></p>  <p>ALM7991WA ARM3342 PAL0200 </p> <p>12v 140amp a:73 b:50</p> <p>PONTIAC GTO 5.7L 2004-</p> <p>MI A3TA7991 WA 11096N</p>	<p>ALM8334</p>  <p>ALM8334RB</p> <p>12v 130amp a:47 b:13 c:49</p> <p>CITROEN C4 1.8L MITSUBISHI ASX 1.8L LANCER 1.8L PEUGEOT 4008 1.8L</p> <p>4N13 MI A002TX1081A</p>	<p>ALM8383 <i>New</i></p>  <p>PAL0502 </p> <p>24v 30amp a:43 b:12 c:81</p> <p>KOBELCO Refine search Shimbun Industrials</p> <p>IS 8971822892 MI A002TA8383 CG 114456</p>
<p>ALM8391 <i>New</i></p>  <p>24v 120amp a:77 b:55</p> <p>DEUTZ KHD RENAUT VOLVO</p> <p>DE 01183118 MI A4TA8391 VO 21289223</p>	<p>ALM8591</p>  <p>ARM3095</p> <p>24v 100amp a:44.5 b:27 c:66</p> <p>RENAULT VI</p> <p>MI A3TA8591 DR DRA0845</p>	<p>ALM8913</p>  <p>12v 50Amp a:41 b:13 c:80</p> <p>FORD Econovan 1.4L MAZDA 121 I 1.1L 323 II 1.1L 1.3L 1.5L</p> <p>E5,E3 UC,E1 MAZD E30318300 MI A5T30171 HC JA127IR</p>	<p>ALM8991</p>  <p>24v 80amp a:43 b:26 c:67</p> <p>FORD otosan</p> <p>FO 6C4610300AA MI A3TA8991</p>

Alternators

Mitsubishi

ALM9075 New	ALM9110	ALM9112	ALM9118 New
 <p style="text-align: right;">PAL0205 </p>	 <p style="text-align: right;">ARM3505</p>	 <p style="text-align: right;">ARM3547</p>	 <p style="text-align: right;">ARM3830 PAL0200 </p>
<p>12v 110amp a:27 b:12 c:62</p> <p>CHRYSLER DODGE</p> <p style="text-align: center;">GM 4609075 MI MD4609075</p>	<p>12v 100amp a:85 b:65 c:71</p> <p>MAZDA 3 2007-></p> <p style="text-align: center;">MA LFB618300 MI A3TJ1091</p>	<p>12v 110amp a:35 b:14 c:58</p> <p>NISSAN CUBE 1.6 I JUKE 1.6 I</p> <p style="text-align: center;">HR16DE NI 231001KA1A MI A2TJ1291</p>	<p>12v 90amp a:20 b:12 c:79</p> <p>mitsubishi 4G64</p> <p style="text-align: center;">MI A5TA1891</p>
ALM9131 New	ALM9162	ALM9280 New	ALM9935
 <p style="text-align: right;">ALM9131WA ARM3126 PAL0225 </p>		 <p style="text-align: right;">PAL0200 </p>	
<p>12v 90amp a:16 b:14 c:65</p> <p>MAZDA 1.3L 1.5L 1.6L</p> <p style="text-align: center;">ZJ-VE FUJA MA ZJ3818300 MI A2TG1391 LU LRA03482</p>	<p>12v 80amp a:40 b:13 c:66</p> <p>MITSUBISHI Colt</p> <p style="text-align: center;">MI MN149162 MI A005TB0391 LU LRA02822</p>	<p>24v 40amp a:44 b:12 c:81</p> <p>CASE</p> <p style="text-align: center;">MI ME049280 MI A4T40299</p>	<p>24v 50amp a:35 b:12 c:81</p> <p>CATERPILLAR LOG LOADER 320B, 320C 1996-2007</p> <p style="text-align: center;">DIESEL CA 2128561 MI A004TU3599</p>

Alternators

MO

<p>ALT0058</p>  <p>ALT0058WA ART8265</p> <p>12v 55amp a:76.5 b:51</p> <p>VOLVO PENTA MERCURY Marine Inboard Engines</p> <p>ME 92497A3 MO 8EM2003KA HC JA1169IR</p>	<p>ALT0474</p>  <p>ALT0474WA ARV1763</p> <p>12v 80amp</p> <p>MASSEY FERGUSON</p> <p>MO 9AR5052U MH ALT0474</p>	<p>ALT0919</p>  <p>ART8249</p> <p>24v 75amp b:15 c:101</p> <p>TRUCKS</p> <p>MO 8LHA3025PA MO 8LHA3025P HC UA919IR</p>	<p>ALT0920</p>  <p>ART8396</p> <p>24v 100amp b:15 c:102</p> <p>TRUCKS</p> <p>MO 8SC3002Y MO 8SC3019U HC UA920IR</p>
<p>ALT0921</p>  <p>ALT0921WA</p> <p>24v 175amp b:15 c:102</p> <p>VOLVO PENTA TRUCKS MARINE SPECIAL HIGH AMP MARINE APPLICATIONS</p> <p>MO 8SC3005Y MO 8SC3157V HC UA921IR</p>	<p>ALT0922</p>  <p>ART8223</p> <p>12v 51amp b:27</p> <p>THERMO KING</p> <p>MO 8HA2009K MO 110304 HC UA922</p>	<p>ALT1108</p>  <p>ALT1108WA ART8224</p> <p>12v 150amp b:15 c:98.5</p> <p>FORD MACK PETERBILT FREIGHTLINER Medium&Heavy Duty Truck</p> <p>MO 8SA2017R MO 8SA2022R HC UA1108IR</p>	<p>ALT2761</p>  <p>ALT2761WA ART8280</p> <p>12v 105amp b:27.2</p> <p>Various Marine Various Models</p> <p>MO 8MR2401UA MO 8MR2401U CG 111761</p>
<p>ALT4347</p>  <p>ART8396</p> <p>24v 150amp b:14.5 c:102</p> <p>CATERPILLAR, CUMMINS Various Models</p> <p>MO 8SC3068VC MO 8SC3068V CG 114347</p>	<p>ALT4349</p>  <p>ALT4349WA</p> <p>24v 150amp b:14 c:101</p> <p>CUMMINS Various Models</p> <p>MO 8SC3238VC CG 114349</p>	<p>ALT4430</p>  <p>12v 175amp b:25 c:80</p> <p>FORD ALL Models FREIGHTLINER</p> <p>MO 8LHP2276V MO 110775P CG 114430</p>	<p>ALT4529 New</p>  <p>ART8329</p> <p>12v 160amp b:13 c:101</p> <p>FORD FREIGHTLINER MACK VOLVO Medium & Heavy Trucks</p> <p>Cummins Caterpillar DD 60 Series VO 391988 MO 8LHA2057VA CG 114529</p>


Alternators

MO

ALT4530	ALT7021 <i>New</i>	ALT8203 <i>New</i>
 <p style="text-align: right;">ART8329</p>	 <p style="text-align: right;">ART8329</p>	 <p style="text-align: right;">ALT8203WA ART8326</p>
<p>12v 175amp b:14 c:101.5</p>	<p>12v 160amp b:22 c:83</p>	<p>12v 90amp b:50</p>
<p>VOLVO FORD Various Models ALL Models FREIGHTLINER</p> <p style="text-align: right;">MO 8LHA2275V MO 110775 CG 114530</p>	<p>FORD FREIGHTLINER VOLVO MACK STERLING</p> <p style="text-align: right;">FO 4C4010300KA MO 8LHP2170E WA 8410N</p>	<p>JOHN DEERE</p> <p style="text-align: right;">JD AH112211 MO 8MR2030T WA 8045N</p>











Alternators

Nikko

<p>ALK0156</p>  <p>ALK0156WA ARK9228</p> <p>24v 40amp a:38.5 b:16 c:103</p> <p>KOMATSU 6D110 Excavators 6D125 Loaders 6D108 Crawlers KM 6008253120 PC300-6 NK 0350000390 NR 023150</p>	<p>ALK0162</p>  <p>ALK0162WA 03571900 66H4578</p> <p>24v 40amp a:61 b:16 c:72</p> <p>NEW HOLLAND JOHN DEERE Excavators Forester JD 4454118 NK 0350003871X NR 023872</p>	<p>ALK0172</p>  <p>ALK0172WA ARK9228</p> <p>24v 15amp a:42 b:13 c:83</p> <p>KOMATSU 4D95, 6D95L Compressors 6D105, 4D95S Excavators 6D1055, 4D1055, 6D95 Lift Trucks KO 6008213840 Crawlers NK 0330005540 NR 025510</p>	<p>ALK0177</p>  <p>ALK0177WA ARK9321</p> <p>24v 50amp a:61 b:16 c:70</p> <p>ISUZU 6BG1T JCB JS130, JZ140, JS145W JS160, JS180, JS200 JS210, JS220, JS240 IS 1812002493 JS260, JS300, JS330 NK 0350003011 NR 023013</p>
<p>ALK0181</p>  <p>ALK0181WA 03571902 10</p> <p>24v 60amp a:45 b:15 c:102</p> <p>KOMATSU 6D114 DAEWOO DH220-5 KO 6008256110 NK 0350004190 NR 026110</p>	<p>ALK0210</p>  <p>ALK0210WA ARK9228</p> <p>24v 40amp a:60 b:16 c:68.5</p> <p>HITACHI, ISUZU EX220 Excavators 6BD1T Industrial IS 1812003590 NK 0330006552 CG 113386</p>	<p>ALK0418 <i>New</i></p>  <p>ALK0418WA 03371900 AL0471</p> <p>24v 30amp a:44.5 b:12 c:81</p> <p>ISUZU 4BD1T 4BD1 IS 897022210 NK 0330006540 CG 112168</p>	<p>ALK0788</p>  <p>ALK0788WA</p> <p>24v 35amp a:48 b:16.5 c:90</p> <p>KOMATSU 4D155 Crawlers 6D155 KM 6008218160 NK 0330001180 HC JA788</p>
<p>ALK0789</p>  <p>ALK0789WA ARK9226</p> <p>24v 25amp a:47 b:16 c:68</p> <p>KOMATSU 6D105 Excavators Fork Lift PC200 KO 6008215580 PC220 NK 0330005280 HC JA789IR</p>	<p>ALK0790</p>  <p>ALK0790WA ARK9228</p> <p>24v 25amp a:50 b:12 c:68</p> <p>KOMATSU 6D95 Excavators 6D105, 4D105 Crawlers 6D125 Motor Graders KO 6008216130 Compressors NK 0330005850 HC JA790IR</p>	<p>ALK0977</p>  <p>ALK0977WA ARK9226</p> <p>24v 13amp a:47 b:16.5 c:71</p> <p>KOMATSU S40105 Forklift KO 6008213260 NK 0330002200 HC JA977IR</p>	<p>ALK1116</p>  <p>ALK1116WA ARK9228</p> <p>24v 25amp a:45 b:17 c:68</p> <p>ISUZU IS 1812003650 NK 0330006000 HC JA1116IR</p>

Alternators

Nikko

<p>ALK3200</p>  <p>ALK3200WA ARK9226</p> <p>24v 40amp a:60 b:16 c:70</p> <p>LINK BELT Excavators LS3400 LS2800</p> <p>IS 1812003820 NK 330003700 WA 285111N</p>	<p>ALK3221</p>  <p>ALK3221WA ARK9226</p> <p>24v 50amp a:60 b:16 c:71</p> <p>IS 1812002960 HN 0350003210 MH ALW3221</p>	<p>ALK3341</p>  <p>ALK3341 ARK9226</p> <p>24v 25amp a:59 b:16 c:69</p> <p>IS 1812002360 NK 0330004010 NR 024010</p>	<p>ALK3770</p>  <p>ALK3770WA 03371900 90</p> <p>24v 30amp a:64 b:16 c:69</p> <p>ISUZU Industrial</p> <p>6BD1</p> <p>IS 1812004250 NK 0330005771 WA 285120N</p>
<p>ALK4598 <i>New</i></p>  <p>ALK4598 ARK9915</p> <p>24v 50amp a:55 b:15 c:69</p> <p>ISUZU KOMATSU</p> <p>IS 8973750171 NI 0350004598 KO 60086103111</p>	<p>ALK4648</p>  <p>ALK4648WA ARK9915</p> <p>24v 50amp a:46 b:17 c:84</p> <p>IS 8980921122 NK 0350004858</p>	<p>ALK5510 <i>New</i></p>  <p>ALK5510 03371900 8AL0502</p> <p>24v 20amp a:44.5 b:13.5 c:81.5</p> <p>MITSUBISHI Fork Lift</p> <p>IZ 8944047902 NK 0330005510 CG 113212</p>	<p>ALK5620 <i>New</i></p>  <p>ALK5620WA ARK9228</p> <p>24v 35amp a:49 b:15 c:104</p> <p>KOMATSU Industrial Excavators</p> <p>KO 6008217310 NK 0350003050 NR 025620</p>
<p>ALK5650 <i>New</i></p>  <p>ALK5650 ARK9228</p> <p>12v 50amp a:43 b:11 c:81</p> <p>ISUZU</p> <p>4BD1 6BB1 6BD1 IS 8944047910 NK 0330005650 NR 025650</p>	<p>ALK7443</p>  <p>ALK7443 ARK9228</p> <p>24v 50amp a:45 b:13 c:86</p>		





















Alternators

Other

<p>ALZ3285</p>  <p>12v 350amp a:36 b:27</p> <p>MAYBACH 57</p> <p>MB A2851500050 MH ALZ3285</p>	<p>ALZ5011 <i>New</i></p> <p>ALZ5011WA</p>  <p>24v 45amp a:50 b:14 c:98</p> <p>ISUZU BESTA truck</p> <p>HN 270501110T MH ALZ5011</p>	<p>ALZ9009 <i>New</i></p> <p>ALZ9009WA</p>  <p>24v 50amp a:60 b:14 c:75</p> <p>XX HT009 MH ALZ9009</p>	<p>ALZ9012 <i>New</i></p> <p>ALZ9012WA</p>  <p>ARP9236</p> <p>24v 70amp a:75 b:50</p> <p>Sino Truck</p> <p>OE VG1047090012 MH ALZ9012</p>
<p>ALZ9016 <i>New</i></p> <p>ALZ9016WA</p>  <p>24v 45amp a:50 b:14 c:97</p> <p>CH PS0016 MH ALZ9016</p>	<p>ALZ9206 <i>New</i></p> <p>ALZ9206WA</p>  <p>ARP9236</p> <p>24v 70amp a:75 b:55</p> <p>WEICHAI Industrial techniks</p> <p>WD615 WD10220</p> <p>OE 612600090206D MH ALZ9206</p>	<p>ALZ9955 <i>New</i></p> <p>ALZ9955WA</p>  <p>12v 45amp a:42 b:20</p> <p>CH EX55 MH ALZ9955</p>	












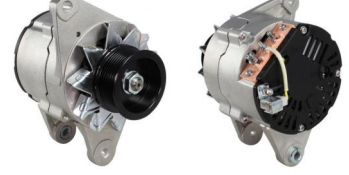
Alternators

Poong Sung

<p>ALY0008</p>  <p>ALY0008WA ARN6454 PAL0226</p>  <p>12v 130amp a:40 b:19.5 c:56.5</p> <p>HYUNDAI, KIA Santa Magnetis Optima Rondo</p> <p>KI 373003E100 PS 021319271 WAI 11190N</p>	<p>ALY0009</p>  <p>ALY0009 ARN6454 PAL0226</p>  <p>12v 130amp a:40 b:20 c:43</p> <p>HYUNDAI Sonata 3.3L Santa Fe 2.7L 3.3L KIA Sorento 3.3L 3.8L</p> <p>KI 373003C120 PS 021319153 WAI 11191N</p>	<p>ALY0024</p>  <p>ALY0024 ARA1544 PAL0226</p>  <p>12v 110amp a:39 b:20 c:56</p> <p>HYUNDAI, KIA Sonata Magnetis Optima Rondo</p> <p>HD 3730025301 PS 021319132 WAI 11202N</p>	<p>ALY0237</p>  <p>ALY0237</p> <p>12v 120amp a:25 b:22 c:43</p> <p>KIA Carnival</p> <p>KI 373004X900 PS 021319221 MS 210679</p>
<p>ALY1708</p>  <p>ALY1708WA ARH5711 PAL0200</p>  <p>12v 120amp a:102 b:63</p> <p>HYUNDAI Elantra Santa Fe KIA Sportage</p> <p>D4EA D4EA-V KI 3730027010 PS 021319311 HC JA1708IR</p>	<p>ALY1795</p>  <p>ALY1795WA ARY9469 PAL0502</p>  <p>12v 60amp a:51 b:13 c:80</p> <p>KIA Retona 2.0L Sportage 2.2L</p> <p>RF Diesel KI OK05418300 PS 021218074 HC JA1795IR</p>	<p>ALY2018</p>  <p>ALY2018WA ARH5711 PAL0200</p>  <p>12v 120amp a:102.5 b:64</p> <p>KIA Ceed 2.0L Magentis 2.0L HYUNDAI Sonata V 2.0L</p> <p>D4EB D4EA D4EAF HD 3730027021 PS 021319262 HC CA2018IR</p>	<p>ALY3303</p>  <p>ALY3303</p> <p>12v 110amp a:43 b:28 c:54</p> <p>KIA Sorento</p> <p>2.5 CRDi KIA 373004A300 PS 021319212</p>
<p>ALY3310</p>  <p>ALY3310 373702A8 50</p> <p>12v 110amp a:15 b:28 c:45</p> <p>HYUNDAI H-1 2.5 CRDi 2007-</p> <p>HD 373004A310 PS 021319340 CA CAL32136GS</p>	<p>ALY5093 <i>New</i></p>  <p>ALY5093WA</p> <p>24v 50amp a:45 b:14</p> <p>HINO Trucks</p> <p>EK100 EP100 HN 270401530 PS 021425093 MH ALY5093</p>	<p>ALY8300</p>  <p>ALY8300WA ARY9102 PAL0200</p>  <p>12v 75amp a:44 b:13 c:80</p> <p>KIA Pregio 2.7L Bongo 2.7L</p> <p>DSL HD 3730012470 PS 021319021 CA CAL41107GS</p>	<p>ALY9021 <i>New</i></p>  <p>ALY9021WA ARY9469 PAL0502</p>  <p>12v 120amp a:45 b:12 c:81</p> <p>KIA K2700 2.7L</p> <p>J2 KI OK65A18300A PS 021219021 MS 210654</p>

Alternators

Prestolite

<p>ALP0027</p>  <p>ALP0027WA</p> <p>24v 150amp a:45 b:15 c:105</p> <p>YUTONG BUS YC6112</p> <p>YU 37010005 PT 8RL3023CA MH ALP0027</p>	<p>ALP0246</p>  <p>ALP0246WA ARP1415</p> <p>24v 110amp a:32 b:13 c:103</p> <p>CUMMINS ISF 3.8 PAZ-3204 PAZ-4234</p> <p>CU 5263830 PT AVE2119E MH ALP0246</p>	<p>ALP0247</p>  <p>ALP0247WA</p> <p>12v 150amp a:28 b:18 c:84</p> <p>CUMMINS Foton</p> <p>CU 5272634 PT AVIC2002 MH ALP0247</p>	<p>ALP0248</p>  <p>ALP0248WA</p> <p>24v 110amp a:63 b:15 c:100</p> <p>DEUTZ China Bus</p> <p>BF6M1013</p> <p>CH S3701010AD003 PT 8LHA3013UC MH ALP0248</p>
<p>ALP0256</p>  <p>ALP0256WA</p> <p>24v 115amp b:14.5 c:103</p> <p>CHINA BUSES</p> <p>CH W4005030310 PT 8LHA3099UC MH ALP0256</p>	<p>ALP0446 <i>New</i></p>  <p>ALP0446WA</p> <p>24v 55amp a:75 b:54`</p> <p>FOTON-3251</p> <p>SHAANXI EURO-2 WEICHAI PPOWER WD-615 OE 612600090259 PT JFZ2517A MH ALP0446</p>	<p>ALP0447 <i>New</i></p>  <p>ALP0447WA</p> <p>24v 55amp a:78 b:55</p> <p>TRUCKS</p> <p>WD615</p> <p>OE D1110211 PT JFZ2517A1 MH ALP0447</p>	<p>ALP0449 <i>New</i></p>  <p>ALP0449WA</p> <p>24v 70amp a:50 b:13 c:71</p> <p>Yuchai</p> <p>YC4110 YC4110ZQ</p> <p>OE J41J13701100002 PT JFZ2710A2C MH ALP0449</p>
<p>ALP0450 <i>New</i></p>  <p>ALP0450WA</p> <p>24v 70amp a:75 b:55</p> <p>SHAANXI</p> <p>WP 10 EURO 2</p> <p>OE 612600090248 PT JFZ2716D MH ALP0450</p>	<p>ALP0451 <i>New</i></p>  <p>ALP0451WA</p> <p>24v 70amp a:55 b:14 c:75</p> <p>OE 37010104K011 PT JFZ273DC MH ALP0451</p>	<p>ALP0452 <i>New</i></p>  <p>ALP0452WA</p> <p>24v 70amp a:39 b:15 c:81</p> <p>OE A44BA3701100002 PT JFZ273W1 MH ALP0452</p>	<p>ALP0453 <i>New</i></p>  <p>ALP0453WA</p> <p>24v 70amp a:39 b:15 c:76</p> <p>Yuchai YC6J-2200-30</p> <p>OE 15313701010002 PT JFZ273Y2 MH ALP0453</p>

Alternators

Prestolite

<p>ALP0454 <i>New</i></p>  <p>ALP0454WA</p> <p>24v 70amp a:45 b:13 c:102</p> <p>HO 4105Q44D1P2130 PT JFZ276C8 MH ALP0454</p>	<p>ALP0456 <i>New</i></p>  <p>ALP0456WA</p> <p>24v 70amp a:40 b:13 c:103</p> <p>OE B30073701010002 PT JFZ276L MH ALP0476</p>	<p>ALP0457 <i>New</i></p>  <p>ALP0457WA</p> <p>24v 70amp a:45 b:19</p> <p>SDEC SHANGCHAI 114</p> <p>OE D1110209C PT JFZ277D MH ALP0457</p>	<p>ALP0589</p>  <p>ALP0589WA</p> <p>24v 90amp a:44 b:14 c:80</p> <p>IVECO Sofim KLQ6728</p> <p>YU 370100589 PT AVI1441F11 MH ALP0589</p>
<p>ALP0787</p>  <p>ALP0787WA</p> <p>12v 55amp a:76 b:50.5</p> <p>BOBCAT D950 Skid Steer Loaders Compact Excavators Articulated Loaders Trenchers</p> <p>BT 6632192 PT 20130178 HC JA7871R</p>	<p>ALP0918</p>  <p>ALP0918 CR</p> <p>12v 72amp a:24 b:51</p> <p>FORD, NEW HOLLAND Backhoes Tractors Farm Tractors Industrial Tractors Utility</p> <p>FO D7NN10300B PT 8MA2014P HC UA918</p>	<p>ALP0932</p>  <p>ALP0932WA ARP8687</p> <p>24v 22amp a:83 b:15.5 c:102</p> <p>CASE, CATERPILLAR Graders, Scrapers Excavators Forestry Loaders Pipelayers</p> <p>CT 9S4870 PT ANB6004 HC UA932</p>	<p>ALP0934</p>  <p>ALP0934WA</p> <p>12v 37amp b:27.5</p> <p>THERMO KING TK244 30 DI TC TK366 HK 100 TK388 KD30 MT 8MR2175F PT 8EK2011FA HC UA9341R</p>
<p>ALP0935</p>  <p>ALP0935WA ART8050</p> <p>12v 65amp b:27.5</p> <p>THERMO KING TK244 30 DI TC, TD II 30 TK366 HK 100 TK388 HK 60 CS 3675147RX KD 50 PT 8MR2326L HC UA9351R</p>	<p>ALP1114 <i>New</i></p>  <p>ALP1114WA</p> <p>24v 80amp b:14 c:103</p> <p>CATERPILLAR TIGERCAT HD LOGGING EQUIPMENT</p> <p>CT 0R3669 PT MDA3922 HC UA1141R</p>	<p>ALP1193</p>  <p>ALP1193</p> <p>24v 55amp b:76</p> <p>CUMMINS Engines Marine PERKINS RTI ENGINES</p> <p>PK 2871A003 PT 66021507 HC CA11931R</p>	<p>ALP1466</p>  <p>ALP1466 PAL0294</p> <p>12v 60amp a:27 b:56</p> <p>Universal</p> <p>OP 1204009 PT 66021149 HC CA14661R</p>



Alternators

Prestolite

<p>ALP1668</p>  <p>24v 115amp</p> <p>VOLVO</p> <p>VO 8112272 PT 1285515 HC CA1668IR</p>	<p>ALP1669</p>  <p>24v 115amp b:22 c:110</p> <p>VOLVO</p> <p>VO 8112932 PT 1286000 HC CA1669IR</p>	<p>ALP1670</p>  <p>ALP1670WA</p> <p>24v 180amp b:22 c:110</p> <p>VOLVO B Series</p> <p>DH10A THD130K D12 VO 8112933 PT 1286500 HC CA1670IR</p>	<p>ALP2201</p>  <p>12v 65amp b:51(16)</p> <p>HYSTER, CLARK Fork Truck, Lift Truck Timber Jack Skidder Tractor 60, 80</p> <p>GM 4.3L V6 Gas 380GP, 380DP 450DP, 450HP VO 110702078 PT 8AR2200L NR 022201</p>
<p>ALP2294</p>  <p>ALP2294WA</p> <p>ART8047</p> <p>24v 110amp a:42.5 b:13 c:101.5</p> <p>CATERPILLAR</p> <p>MT 110459 PT 8LHA3096U CG 112294</p>	<p>ALP2582</p>  <p>ALP2582WA</p> <p>12v 72amp b:51(12)</p> <p>THERMO KING</p> <p>CU 1911600 PT 8MR2058PA NR 022058</p>	<p>ALP2716 <i>New</i></p>  <p>ALP2716WA</p> <p>ARP9236</p> <p>24v 70amp a:75 b:56</p> <p>DUETZ FAW TRUCK</p> <p>BF4M1013-26E3</p> <p>DU 3701010D147 PR AVE2716H1 MH ALP2716</p>	<p>ALP2764 <i>New</i></p>  <p>ALP2764WA</p> <p>ARP9236</p> <p>24v 70amp a:75 b:53</p> <p>FAW JIEFANG TRUCK</p> <p>FAWDE 6DM 6DL1E3 6DL2E3 OE 3701010473JH40 PT AVE2716F4 MH ALP2764</p>
<p>ALP3019</p>  <p>24v 180amp b:22 c:110</p> <p>VOLVO CUMMINS B Series 12.0</p> <p>TD122FH</p> <p>VO 3112741 PT 880718Z CG 112019</p>	<p>ALP3040 <i>New</i></p>  <p>ALP3040WA</p> <p>24v 120amp b14.5 c:97</p> <p>HIGER YUTONG ZHONGTONG</p> <p>HI 37E0101004 PT 8LHA3040UC MH ALP3040</p>	<p>ALP3095</p>  <p>24v 110amp a:40 b:13 c:102</p> <p>KING LONG BUS HIGER BUS YUTONG BUS</p> <p>KL 3702110029AF PR 8LHA3095UC23 YU 370101065</p>	<p>ALP3176</p>  <p>12v 185amp b:14.5 c:102</p> <p>NEW HOLLAND CX 800</p> <p>MT 8SC2023Z PT 8SC2282VG CG 113898</p>

Alternators

Prestolite

<p>ALP3197</p>  <p>12v 90amp b:26.5</p> <p>THERMO KING Trailer Units Truck Units</p> <p>Yanmar 353, Yanmar 395 TK 353, TK395 Diesel Units MT 8MR2197T PT 110639RM NR 020380</p>	<p>ALP3227</p>  <p>12v 185amp b:14.5 c:102</p> <p>NEW HOLLAND CATERPILLAR AGCO CORP</p> <p>CT 1847174 PT SCJ2227 MH ALP3227</p>	<p>ALP3239 <i>New</i></p>  <p>ALP3239WA</p> <p>24v a:43 b:14 c:102</p> <p>Chinese Buses KING LONG SHANGHAI SONGZ AIRCON</p> <p>CH JFWZ2302 PT 8SC3239VC MH ALP3239</p>	<p>ALP3252</p>  <p>ALP3252WA</p> <p>24v 55amp a:28 b:51(20)</p> <p>FOTON 1041, 1049, 1069 Euro3</p> <p>PT JFZ252D2 PT T74501035 MH ALP3252</p>
<p>ALP3271</p>  <p>24v 70amp a:52 b:18 c:73</p> <p>DEUTZ-FAHR China Buses</p> <p>YU 3701010Y01W PT JFB271J MH ALP3271</p>	<p>ALP3275</p>  <p>ALP3275WA</p> <p>24v 70amp a:44 b:15.5 c:101</p> <p>DongFeng Cummins DCEC 6B</p> <p>YU 370100689 PT JFZ275 MH ALP3275</p>	<p>ALP3276</p>  <p>ALP3276WA</p> <p>ARP9402</p> <p>24v 70amp a:38 b:15 c:102</p> <p>KAMAZ 4308</p> <p>Cummins EQB 21020</p> <p>DG 37T6701001A PT JFZ276W MH ALP3276</p>	<p>ALP3295</p>  <p>ALP3295WA</p> <p>ARP1415</p> <p>24v 90amp a:42 b:15 c:101</p> <p>YUTONG</p> <p>Cummins 6CT, 6BT, ISB</p> <p>YU 370100304 PT JFZ291 MH ALP3295</p>
<p>ALP3302</p>  <p>ARP8888</p> <p>24v 140amp a:66.5 b:22.5 c:111</p> <p>YUTONG 6129 6119 6118</p> <p>CU 3415564 PT AC172RA301A MH ALP3302</p>	<p>ALP3314</p>  <p>24v 140amp b:15 c:102</p> <p>CUMMINS</p> <p>CU 3975140 PT BLD3314GH NR 023314</p>	<p>ALP3320</p>  <p>ALP3320WA</p> <p>12v 200amp b:14 c:102</p> <p>INTERNATIONAL JOHN DEERE Medium Trucks Heavy-Duty Trucks Bus</p> <p>IHC DT466 IHC VT365 Caterpillar C10, C12 JD RE500713 PT A0014860JB WA 8320N</p>	<p>ALP3363</p>  <p>ALP3363WA</p> <p>ARP8888</p> <p>24v 155amp b:22 c:111</p> <p>SCANIA YOUTONG GOLDEN DRAGON IRISBUS KING LONG</p> <p>Cummins IS AAT1355 (140 amp) PT AC172RA363B MH ALP3363</p>

Alternators

Prestolite

<p>ALP3411</p>  <p>12v 160amp b:14.5 c:102</p> <p>CATERPILLAR CLAAS PERKINS</p> <p>CT 2684110 PT SCJ2231 MH ALP3411</p>	<p>ALP3549</p>  <p>ALP3549WA ART8247</p> <p>24v 35amp b:27.5</p> <p>CATERPILLAR Various Models</p> <p>MO 8HC3022F PT 8HC3022FS CG 113549</p>	<p>ALP3568</p>  <p>24v 150amp b:14.5 c:101</p> <p>LIA 36212</p> <p>CT 2155568 PT SCJ3292 MH ALP3568</p>	<p>ALP3601</p>  <p>ALP3601WA</p> <p>24v 110amp a:41.5 b:16.5 c:101.5</p> <p>Yang-Chai, Yu-Chai Higer King, Yang-Zhou</p> <p>PT JFZ2101A2 UP ALT0172</p>
<p>ALP3602</p>  <p>24v 100amp a:31 b:14 c:100</p> <p>HIGER S7 S8</p> <p>KLQ6728</p> <p>PT JFZ2101SC MH ALP3602</p>	<p>ALP3603</p>  <p>24v 110amp a:39 b:16 c:101.5</p> <p>YULIN, GOLDEN DRAGON YC6L28030 Diesel Bus</p> <p>PT JFZ2110D3 PT AVE2110D3 MH ALP3603</p>	<p>ALP3620</p>  <p>24v 180amp b:22 c:110</p> <p>Renault Trucks</p> <p>RE 5010257066 PT 1285620 MH ALP3620</p>	<p>ALP3730</p>  <p>24v 155amp b:22 c:101</p> <p>CUMMINS, HIGER, IKARUS XMQ6121G, AC172RA301A Various engine SD41102K, AC172RA302A S7-S8 Cummins Engines DENNIS, ANKIA CU 3282431 Chinese Buses PT 1277A730 MH ALP3730</p>
<p>ALP3739</p>  <p>ALP3739WA</p> <p>12v 130amp b:13 c:102</p> <p>FORD Various Models</p> <p>MO 110800 PT 8HA2070VA CG 113739</p>	<p>ALP3766</p>  <p>ALP3766WA ART8329</p> <p>12v 140amp b:79 c:109</p> <p>Medium&Heavy-Duty Trucks MACK, FREIGHTLINER PETERBILT, KENWORTH INTERNATIONAL, VOLVO MO 11055P STERLING, WS PT 8LHP2170VH CG 113766</p>	<p>ALP3816</p>  <p>24v 140amp b:26 c:82</p> <p>PETERBILT DAIMLER TRUCKS</p> <p>CA 200619 PT LN110816 NR 020819</p>	<p>ALP3821</p>  <p>ALP3821WA ARQ9505</p> <p>24v 70amp a:36 b:14 c:82</p> <p>DONGFENG BUS Cummins China YUTONG BUS ZHONGTONG BUS</p> <p>YU 370100684 PT C4935821 MH ALP3821</p>





Alternators

Prestolite

ALP4191 New	ALP4348	ALP4374	ALP6533 New
 <p>24v 55amp a:102 b:75</p> <p>Special Techniks</p> <p style="text-align: right;">BU 859444 PT 66021491 MH ALP4191</p>	 <p>ALP4348WA ART8251</p> <p>24v 150amp b:13 c:102</p> <p>THERMO KING Various Models</p> <p>YUCHAI YC6A 26021 YUCHAI YC6G 30020 Cummins C MO 8SC3110V PT 8SC3110VC CG 114348</p>	 <p>24v 110amp a:50 b:16.2 c:101.2</p> <p>CUMMINS SHANGHAI DIESEL XICHAI-FAWD HIGER KING LONG</p> <p style="text-align: right;">PT JFZ2110A2 CG 114374</p>	 <p>24v 140amp b:14 c:102</p>
<p>ALP8141 New</p>  <p>ALP8141WA</p> <p>24v 140amp b:22 c:111</p> <p>Chinese Buses GOLDEN DRAGON KING LONG</p> <p>DCEC ISC Cummins Eng YUCHAI</p> <p>YU 37T3501001 PT 8SC3141VC MH ALP8141</p>	<p>ALP8694</p>  <p>12v 270amp b:24 c:103</p> <p>BLUEBIRD FORD FREIGHTLINER</p> <p>PR A0014942PA FO 4C4O10300BA</p>		

Alternators

Russian (USSR)

<p>ALR0130</p>  <p>ALR0130WA</p> <p>12v 42amp a:26.5 b:19 c:61</p> <p>LADA (VAZ) Niva, Nova, Samara Toscana 1200, 1500 1600</p> <p>VAZ2101, VAZ2105 VAZ2103, VAZ2106 VAZ21011, VAZ2121 LA 21013710000 LA 21013701005 HC CA131</p>	<p>ALR0131</p>  <p>ARR9672</p> <p>12v 42amp a:26.5 b:19 c:61</p> <p>LADA (VAZ) Niva Riva 1400, 1500, 1600</p> <p>Niva 1600 (VAZ2121) RIVA 1200 (VAZ2107) VAZ2104, VAZ2105, VAZ2106 LA 21053701010 LA 21053701005 HC CA131IR</p>	<p>ALR0295</p>  <p>ARR9673</p> <p>12v 55amp a:44.5 b:18.5 c:60.5</p> <p>LADA (VAZ) 1300, 1500, 1600 Samara Toscana</p> <p>VAZ2103, VAZ2106 VAZ2101, VAZ2102 VAZ2108, ECE LA 21083701010 BO 0120488280 HC CA295IR</p>	<p>ALR0652 <i>New</i></p>  <p>ARB0701 PAL0400 </p> <p>12v 110amp a:36 b:56</p> <p>LADA (VAZ) Granta VAZ2170 VAZ1118 VAZ2190</p> <p>LA 2170370101013 BO F000BL0652 MH ALR0652</p>
<p>ALR0956 <i>New</i></p>  <p>PAL0433 </p> <p>12v 140amp a:93 b:55</p> <p>SSANGYONG Actyon Kyron Rexton TAGAZ Tiger</p> <p>SS 1611543902 MB A0002655043 MH ALR0956</p>	<p>ALR1347</p>  <p>AER1615</p> <p>12v 80amp a:92.5 b:56</p> <p>LADA (VAZ) Samara 110 111 112</p> <p>VAZ2111 VAZ2112 VAZ2111 LA 21103701010 IS AAK5102 HC CA1347IR</p>	<p>ALR1472</p> <p>ALR1472WA</p> <p>12v 80amp a:81 b:56</p> <p>LADA (VAZ) 110 111 112 Niva</p> <p>VAZ 2111 VAZ 21214 VAZ 2112 VA 437819 LA 212143701010 HC CA1472IR</p>	<p>ALR3052</p>  <p>ARB0298 PAL0260 </p> <p>24v 80amp a:46 b:55</p> <p>KAMAZ 4 KAMAZ 5 KAMAZ 6 43118, 5460, 53605 6520, 6522, 65117, 65225</p> <p>74013, 74030 74050 74051 BO 0124555052 MH ALR3052</p>
<p>ALR3117</p> <p>ALB3117 ALR3117WA</p> <p>ARB0230 PAL0211 </p> <p>12v 90amp b:56</p> <p>UAZ, GAZ Patriot Volga Kombi Hunter MB Sprinter</p> <p>MZ 6461540002 BO 0124325117 MH ALR3117</p>	<p>ALR3610</p>  <p>ALP3610WA ARP9402</p> <p>24v 72amp a:41 b:15 c:69</p> <p>KAMAZ 4308 5308 43225 6515</p> <p>Cummins PT JFZ2710F PT C3972529 MH ALR3610</p>	<p>ALR3631</p>  <p>ALB0862 ALB0862WA ALR3631WA 91910373 02</p> <p>12v 105amp a:38 b:14 c:62</p> <p>GAZEL Steyr engine</p> <p>VM 38522321F BO F002G10862 NR 020862</p>	<p>ALR3666 <i>New</i></p>  <p>ARR3666</p> <p>12v 120amp a:28 b:14.5 c:84</p> <p>GAZEL ISF 2.8</p> <p>CUMMINS GA 5272666 PT AVIC3003 MH ALR3666</p>












Alternators

Russian (USSR)

ALR3781 New		ALR3850		ALR8167 New	
 <p>ALR3781WA</p> <p>ARB0408 PAL0418</p> 		 <p>ALR3850WA</p> <p>PAL0450</p> 		 <p>ARI9509</p>	
12v	120amp	a:27	b:14	c:84	
GAZEL		CUMMINS			
ISF 2.8L					
		GA 5266781			
		GA 5262499			
		MH ALR3781			
12v	136amp	a:30	b:12	c:68	
JEEP		L4			
Liberty 2.4l		Chrysler Engine			
Wrangler 2.4l					
GAZ, GAZEL		CH 56044530AC			
Syber 2.4l		ND 1210004520			
		WA 13961N			
24v	100amp		b:55		
MAZ			Deutz		
"Zubrenok"			Perkins		
			ST 22056600		
			IS AAN8167		
			MH ALR8167		




Alternators

SA

<p>ALW0217</p>  <p>24v 55amp a:45 b:14 c:86</p> <p>HINO 600 HINO 700</p> <p>LFR</p> <p>HN 270402171B SW 02011520912 UP ALT0134</p>	<p>ALW2062</p>  <p>24v 55amp a:55 b:13 c:86</p> <p>HINO</p> <p>J05C J08C</p> <p>HN 270402062D SW 02011520716 UP ALT0139</p>	<p>ALW2383</p>  <p>24v 55amp a:40 b:14 c:86.5</p> <p>HINO 500 700</p> <p>17T 26T</p> <p>HN 270402380A SW 02011720510 UP ALT0135</p>	<p>ALW3749</p>  <p>ALW3749WA</p> <p>24v 55amp a:44 b:14 c:85</p> <p>HINO Trucks Industrial Engine Commercial Engine HITACHI Excavators SUMIOMO Yale Cranes</p> <p>HN 270201050 SW 02111020222 VA 600765</p>
<p>ALW4250</p> 	<p>ALW4423</p>  <p>24v 55amp a:51 b:14 c:85.5</p> <p>HINO Trucks</p> <p>H07D J08C W06E HN 270401461 SW 02011023015 CG 114423</p>	<p>ALW5086</p>  <p>ALW5086WA</p> <p>PAL0110</p>  <p>24v 60amp a:55 b:14 c:86</p> <p>HINO Ranger</p> <p>J08C</p> <p>HN 270401952 SW 02011520110 MH ALW5086</p>	<p>ALW5112</p>  <p>ARW0517</p> <p>24v 35amp a:47 b:14 c:97</p> <p>HINO</p> <p>HN 270501112A</p>
<p>ALW7763</p>  <p>24v 60amp a:49 b:14 c:87</p> <p>HINO Ranger</p> <p>J07C</p>	<p>ALW7764</p>  <p>ARW9493</p> <p>24v 60amp a:52 b:14 c:87</p> <p>HINO City bus</p>	<p>ALW7765</p>  <p>ARW9493</p> <p>24v 60amp a:49 b:14 c:87</p> <p>HINO Heavy Truck</p> <p>J08C J05C</p> <p>HI 270402191</p>	<p>ALW7766</p>  <p>ARW9493</p> <p>24v 60amp a:52 b:14 c:87</p> <p>HINO Heavy Truck KOBELCO SK200-8, 250-8, 350-8</p> <p>J07C J08C</p> <p>HI 270402191</p>























Alternators

SA

ALW7767		ALW8031 <i>New</i>	
			
ARW9493		ARW9493	
24v	60amp	a:52	b:14
		c:87	
HINO		ALN8031 ALW8031WA	
		24v	85amp
		a:46	b:12
		c:86	
		DAIHATSU	S05C
		TOYOTA	J05C
			S05D
			TO 2706078031
			MH ALN8031

Alternators

Valeo

<p>ALV0025</p>  <p>ALV0025WA ARV1571 PAL0454</p>  <p>12v 110amp a:19 b:27 c:66</p> <p>RENAULT Kangoo 1.6</p> <p>K7M</p> <p>RE 8200622004 VA TG10B025 WA 439659</p>	<p>ALV0030</p>  <p>ALV0030 ARA1550 PAL0226</p>  <p>12v 65amp a:25 b:13 c:55</p> <p>HYUNDAI, KIA Pony Lantra Optima Magentis</p> <p>X2 G4DG</p> <p>HD 3730025201 VA TG11C076 WA 11189N</p>	<p>ALV0053</p>  <p>ALV0053 ARV1763</p> <p>12v 80amp a:83.5 b:56</p> <p>BMW 524</p> <p>M21D24 M21D24W</p> <p>BM 12312242248 VA 2541300 HC CA894IR</p>	<p>ALV0059</p>  <p>ALV0059WA ARV1571 PAL0454</p>  <p>12v 120amp a:33 b:13.5 c:61</p> <p>RENAULT Scenic 1.9L Grand Scenic 1.9L</p> <p>RE 8200410674 VA SG12B092 HC CA2058IR</p>
<p>ALV0062</p>  <p>ALV0062WA ARV1516 PAL0214</p>  <p>12v 110amp a:67 b:27 c:65</p> <p>RENAULT Clio Kangoo</p> <p>E7J780, K7M744 K7M745, E7J780 E7J634, K7J701, E7J635</p> <p>RE 7700869600 VA A13V1188 HC CA1345IR</p>	<p>ALV0083</p>  <p>ALV0083 ARV1540 PAL0243</p>  <p>12v 125amp a:60 b:41</p> <p>CHEVROLET, BUICK, PONTIAC Uplander Terraza Montana</p> <p>GM 15201678 VA TG13S012 WA 11023N</p>	<p>ALV0092</p>  <p>ALV0092WA ARV1571 PAL0454</p>  <p>12v 110amp a:33.5 b:13 c:61</p> <p>RENAULT Clio 3 Modus Twingo 3</p> <p>RE 8200718724 VA TG11C068 HC CA2054IR</p>	<p>ALV0095</p>  <p>ALV0095 591894 PAL0409</p>  <p>12v 230amp a:55 b:28 c:76</p> <p>BMW X5</p> <p>E70</p> <p>BM 12317533469 VA TG23C011 WA 11397R</p>
<p>ALV0114</p>  <p>ALV0114WA ARV1520 PAL0431</p>  <p>12v 145amp a:73 b:51</p> <p>CHEVROLET Corvette 5.7 Corvette 6.0 Corvette 6.2 Corvette 7.0</p> <p>GM 10327514 VA TG15C089 WA 13969N</p>	<p>ALV0117</p>  <p>ALV0117WA ARV1155</p> <p>12v 130amp a:36 b:12 c:85</p> <p>NISSAN, SUZUKI Armada Frontier Pathfinder Equator</p> <p>4.0L 5.6L</p> <p>NI 23100ZH00A VA TG15C113 WA 11256N</p>	<p>ALV0118</p>  <p>ALV0118 ARV1576 PAL0403</p>  <p>12v 150amp a:52 b:20 c:46</p> <p>FORD C-MAX, FIESTA 1.6 TDCi 2008-</p> <p>FO AV6N10300GB VA TG15C183 MH ALV0118</p>	<p>ALV0147</p>  <p>ALV0147WA ARV1524 PAL0456</p>  <p>12v 130amp</p> <p>HUMMER H3 3.5L</p> <p>211 L5</p> <p>GM 15104219 VA TG13S024 WA 11147N</p>

Alternators

Valeo

<p>ALV0153 New</p>  <p>12v 110amp a:28 b:15 c:57</p> <p>AUDI VOLKSWAGEN Lavida 1.6L</p> <p>VW 03C903023L VA TG11C070 MH ALV0153</p>	<p>ALV0165</p> <p>ALV0165WA</p>  <p>ARV1652 PAL0292</p> <p>12v 50amp a:49 b:27 c:65</p> <p>RENAULT, VOLVO</p> <p>Master R18 66 340</p> <p>J5R718 829730 B11, B130, B143E RE 7700662371 VA A13N14 HC CA165IR</p>	<p>ALV0197</p> <p>ALV0197WA</p>  <p>ARV1103 PAL0400</p> <p>12v 180amp a:38 b:14 c:81.5</p> <p>FIAT Ducato 3.0 JTD Multijet Power</p> <p>F1CE0481D 01.2006-></p> <p>FI 51787165 VA FG18S022 HC CA2089IR</p>	<p>ALV0201</p>  <p>595478</p> <p>12v 150amp a:19 b:22 c:45</p> <p>CITROEN C5</p> <p>RC RD</p> <p>PE 5702H6 VA TG15C120 MH ALV0201</p>
<p>ALV0203</p> <p>ALV0203WA</p>  <p>ARV1464 PAL0407</p> <p>12v 230amp a:27 b:63 c:63</p> <p>BMW N6 550i, 550iX, 550i GT, 550iX GT 6 Series 65</p> <p>BM 12317575344 VA FG23S043 VA 440203</p>	<p>ALV0205</p>  <p>ARV1001</p> <p>12v 180amp a:25 b:13 c:62</p> <p>AUDI Q7 2006-></p> <p>3.6 FSI [BHK] 280hp</p> <p>VW 021903016L VA FG18S036 VA 439639</p>	<p>ALV0208</p>  <p>ARV1332</p> <p>12v 140amp a:40 b:14 c:61</p> <p>AUDI A4 A5 Q5</p> <p>8K2 8T</p> <p>VW 03G903016GX VA TG14C020 VA 440208</p>	<p>ALV0215</p>  <p>ARV1571 PAL0454</p> <p>12v 150amp a:33 b:14 c:61</p> <p>RENAULT Laguna Turbo</p> <p>BT01 F4R</p> <p>RE 8200854117 VA TG15C143 VA 440215</p>
<p>ALV0218</p> <p>ALV0218RB</p>  <p>ARV1571 PAL0454</p> <p>12v 125amp a:33 b:14 c:61</p> <p>RENAULT Grand Scenic III Megane CC III</p> <p>JZ0/1 EZ0/1</p> <p>RE 8200757870 VA TG15C143 VA 440218</p>	<p>ALV0222</p>  <p>ARV1332</p> <p>12v 140amp a:96 b:76</p> <p>AUDI Q3 2012-> A4 (B8)</p> <p>VW 06J903023N VA TG14C019 VA 439792</p>	<p>ALV0223</p>  <p>599162</p> <p>12v 90amp a:12 b:19.5 c:26.5</p> <p>TOYOTA Yaris</p> <p>VVTi</p> <p>TO 270600Q140 VA FG9T011 MS 210690</p>	<p>ALV0224</p>  <p>ARV1652 PAL0292</p> <p>12v 50amp a:49.5 b:27 c:66</p> <p>VW RENAULT Passat R20 Master</p> <p>WE, 829700, 829701 829703, 829702, J8S330 851700, 852, J8S702 RE 7700751401 VA A13N65 HC CA224IR</p>

Alternators

Valeo

<p>ALV0226</p>  <p>ALB9030 599211 PAL0407</p>  <p>12v 140amp a:38 b:14 c:61</p> <p>VW 8VD000001 Audi A3, S3 Sportback 2013 -></p> <p>VW 03L903023L VA TG14C043 VA 439791</p>	<p>ALV0229</p>  <p>ALV0229WA ARV1652 PAL0292</p>  <p>12v 70amp a:49 b:27 c:65</p> <p>CITROEN 170A, 170B, J7R726 RENAULT 170C, J6TA500, J7T714 R25 M23639, J6TA500, J7T70850 CX, C25 RE 7700754832 VA A14N22 HC CA229IR</p>	<p>ALV0230</p>  <p>ARV1125</p> <p>12v 180amp a:96 b:70 c:60</p> <p>MERCEDES-BENZ W204 C-Class II 306</p> <p>MB A0009063622 VA FG18S098 MH ALV0230</p>	<p>ALV0231</p>  <p>599107</p> <p>12v 180amp a:34 b:69 c:75</p> <p>MERCEDES-BENZ M276</p> <p>VA FG18S099 MH ALV0231</p>
<p>ALV0232</p>  <p>ARV1305 PAL0407</p>  <p>12v 140amp a:28 b:14 c:61</p> <p>AUDI 3L TDI V6</p> <p>VA TG14C047 MH ALV0232</p>	<p>ALV0249</p>  <p>ARV1103 PAL0400</p>  <p>12v 140amp a:35 b:14 c:56</p> <p>VW Golf VI</p> <p>VW 03L903023F VA TG14C026 VA 440249</p>	<p>ALV0250</p>  <p>ARV1103 PAL0400</p>  <p>12v 140amp a:30 b:14 c:57</p> <p>VW 5K1 Golf POLO CAXA 6R, CAVE VW 03C903025DX VA TG14C027 VA 440250</p>	<p>ALV0253</p>  <p>ARV1103 PAL0400</p>  <p>12v 180amp a:48 b:14 c:60</p> <p>VW, SKODA Passat 2.0 TDi 2005-> Yeti 2009-></p> <p>VW 03L903023E VA FG18T033 VA 440253</p>
<p>ALV0257</p>  <p>ARV1276</p> <p>12v 150amp a:29 b:69 c:59</p> <p>MERCEDES C-class E-class C220, C250 E220, E250</p> <p>W204 MB A0141541102 VA TG15C130 VA 440257</p>	<p>ALV0268</p>  <p>ARV1661 PAL0292</p>  <p>12v 50amp a:39 b:27</p> <p>RENAULT</p> <p>RE 6001000269 VA A13R243 HC CA169IR</p>	<p>ALV0269</p>  <p>ARV1652 PAL0292</p>  <p>12v 55amp a:46 b:56</p> <p>RENAULT</p> <p>RE 7701348548 VA A13N113 HC CA170IR</p>	<p>ALV0281</p>  <p>ALV0281RB</p> <p>ARV1652 PAL0292</p>  <p>12v 50amp a:21 b:27 c:65</p> <p>RENAULT Fuego R18 R30</p> <p>J8S712 112 140, 144 RE 7701381525 VA A13R270 HC CA268IR</p>













Alternators

Valeo

<p>ALV0282</p>  <p>ARV1652 PAL0292</p>  <p>12v 50amp a:105 b:56</p> <p>NEOPLAN, RENAULT R11 Centroliner</p> <p>C1E715, D2066LUH22 C1E720, D2066LUH46 C1J715, D2066LUH21 RE 7701349263 VA A13N12 HC CA288IR</p>	<p>ALV0283</p>  <p>ARV1652 PAL0292</p>  <p>12v 55amp a:46 b:27 c:66</p> <p>VOLVO 340 343</p> <p>B14.3E B14.4S VO 3283184 VA A13N64 HC CA289IR</p>	<p>ALV0285</p>  <p>ARV1661 PAL0291</p>  <p>12v 50amp a:38 b:36 c:56.5</p> <p>CITROEN, PEUGEOT AX C15 309 205</p> <p>CDZ, E1A HDZ, 109N, 150D 150G, 150H, 150B PE 570583 VA A13N123 HC CA369IR</p>	<p>ALV0286</p>  <p>ARV1652 PAL0292</p>  <p>12v 60amp a:102 b:56</p> <p>RENAULT R11 R9</p> <p>C1E715, C1E720 C1G700, C1G710 C1J715, C1J792 RE 7701499227 VA A13N85 HC CA512IR</p>
<p>ALV0288</p>  <p>ALV0288RB</p> <p>ARV1652 PAL0292</p>  <p>12v 105amp a:23 b:27 c:65</p> <p>RENAULT R25</p> <p>RE 7700796914 VA A14N140 HC CA536IR</p>	<p>ALV0289</p>  <p>ARV1639 PAL0292</p>  <p>12v 105amp a:22.5 b:27 c:66</p> <p>RENAULT Alpine Espace R25</p> <p>Z6W, Z7U734 Z7W712, Z7W713 Z7U702, Z7V708, Z7V711 RE 7700780774 VA A14N95 HC CA579IR</p>	<p>ALV0290</p>  <p>ARV1652 PAL0292</p>  <p>12v 50amp a:19 b:27 c:65</p> <p>RENAULT R5 Gtx Super R5</p> <p>F2N720, F2N722 F3N702, F3N716 RE 7700730273 VA A13N127 HC CA580IR</p>	<p>ALV0291</p>  <p>ALV0291WA</p> <p>ARV1661 PAL0291</p>  <p>12v 55amp a:59.5 b:40</p> <p>CITROEN, PEUGEOT C15 Visa 104 205</p> <p>109K, 150D 150B, 1095, 150G 108C, 109F, 150B PE 95495512 VA A13N94 HC CA291IR</p>
<p>ALV0294</p>  <p>ALB0294 ALB0294WA ALV0294RB</p> <p>ARV1661 PAL0291</p>  <p>12v 50amp a:46 b:27 c:69</p> <p>CITROEN, PEUGEOT, OPEL BX, CX, C15 Omega 205, 305, 405, 309</p> <p>30NE 180A, D6B, 180Z MI A2T26391 VA A13N218 HC CA294IR</p>	<p>ALV0297</p>  <p>ARV1639 PAL0292</p>  <p>12v 50amp a:19.5 b:27 c:68.5</p> <p>RENAULT R5 GX Super</p> <p>RE 7700731040 VA A13N128 HC CA581IR</p>	<p>ALV0304</p>  <p>ARV1652 PAL0292</p>  <p>12v 70amp a:20 b:27 c:67</p> <p>RENAULT</p> <p>RE 7700803449 VA A13N200 HC CA606IR</p>	<p>ALV0310</p>  <p>ALB0310RB</p> <p>ARV1652 PAL0292</p>  <p>12v 75amp a:47.5 b:27 c:65.5</p> <p>RENAULT Espace R18</p> <p>J8S240 J8S774 RE 7701361053 VA A14N54 HC CA643IR</p>








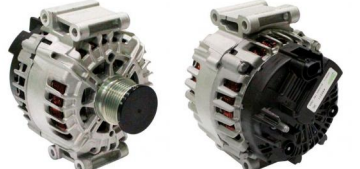



Alternators

Valeo

<p>ALV0313</p>  <p>ALV0313WA</p> <p>ARV1506 D+ PAL0294 B+ B+</p> <p>12v 55amp a:66 b:41 c:41</p> <p>SEAT Ibiza 1.2L Malaga 1.2L</p> <p>021A1000, 021C1000 021A2000, 021B2000</p> <p>FI 63320029 VA A13E19 HC CA313IR</p>	<p>ALV0314</p>  <p>ALV0314WA</p> <p>ARV1652 PAL0292</p> <p>12v 75amp a:58 b:27 c:65.5</p> <p>RENAULT Master Trafic B Series Messenger</p> <p>81402725 S8U731, S9U702 8140612300 RE 7700731740 VA A14N4 HC CA314IR</p>	<p>ALV0315</p>  <p>ARV1652 PAL0292</p> <p>12v 70amp a:45 b:56</p> <p>RENAULT Clio Fuego R11</p> <p>C1E700, C1E715, C1J715 C3G720, C1E720 A2M723, C1G710 RE 7700499251 VA A13N156 HC CA375IR</p>	<p>ALV0329</p>  <p>ALV0329WA</p> <p>ARV1103 PAL0400</p> <p>12v 180amp a:41 b:14 c:81</p> <p>FIAT, IVECO Ducato II 2.3 05/2011-> Ducato II 2.3 MJTD</p> <p>F1AE3481D F1AE3481E</p> <p>FI 504280010 VA FG18S023 HC CA2090IR</p>
<p>ALV0338</p>  <p>ARV1652 PAL0292</p> <p>12v 80amp a:27 b:36</p> <p>PEUGEOT</p> <p>PE 570566 VA A14N59 HC CA338IR</p>	<p>ALV0356</p>  <p>ARV1661 PAL0291</p> <p>12v 50amp a:88.5 b:36</p> <p>TALBOT 1510 1.4 Solara 1.3</p> <p>6G1, 6J2 6Y2D 6J1, 6G1DVP MT 9AR2757 VA A13R220 HC CA356IR</p>	<p>ALV0359</p>  <p>ALV0359WA</p> <p>ARV1661 PAL0291</p> <p>12v 50amp a:94.5 b:56</p> <p>CITROEN, PEUGEOT AX, BX C15 205, 309 405</p> <p>KDZ, K2B, K1D TU3, H1B, 150D C3A, CDY, KAY PE 95624061 VA A13N215 HC CA359IR</p>	<p>ALV0370</p>  <p>ALV0370WA</p> <p>ARV1652 PAL0292</p> <p>12v 50amp a:59 b:27 c:65</p> <p>CITROEN</p> <p>PE 9559873580 VA A13N109 HC CA370IR</p>
<p>ALV0372</p>  <p>ALV0372WA</p> <p>ARV1652 PAL0292</p> <p>12v 60amp a:46 b:27 c:68.5</p> <p>MERCEDES, RENAULT SCANIA, VOLVO Actros, O303, O305 Trafic, R9, R11 P/G/R/T Series, 340</p> <p>B172K, DH12D420 OM353976, F2N730 OM541940, DC1305 RE 7700721797 VA A13N120 HC CA372IR</p>	<p>ALV0373</p>  <p>ALV0373RB</p> <p>ARV1652 PAL0292</p> <p>12v 60amp a:46.5 b:27 c:70</p> <p>VOLVO RENAULT 340 1.6L Diesel R11, R9</p> <p>D16 F8M700, F8M720, F8M730 RE 7700753082 VA A13N86 HC CA373IR</p>	<p>ALV0378</p>  <p>ALV0378RB ALV0378WA</p> <p>ARV1652 PAL0292</p> <p>12v 60amp a:49 b:27 c:65</p> <p>ASTRA, RENAULT MD 8 Espace Master, Trafic R20, R21, R25</p> <p>852720, J5R726 J7T780, J7R720 J6R706, J6R707 RE 7700709420 VA A13N88 HC CA378IR</p>	<p>ALV0380</p>  <p>ALV0380WA</p> <p>ARV1661 PAL0291</p> <p>12v 70amp a:46 b:27 c:73.5</p> <p>CITROEN, PEUGEOT BX C15 205, 305 309, 405</p> <p>AJZ, DKZ, D2C DFZ, DDZ, XU5J B1E, BDY, 159 PE 95653968 VA A13N220 HC CA380IR</p>

Alternators

Valeo

<p>ALV0395 <i>New</i></p>  <p>ALV0395WA ARV1511</p> <p>12v 120amp a:29 b:14.5 c:83</p> <p>MASSEY FERGUSON Tractors Perkins 1004.4, 1006.6 Perkins 6365 Valment 6403, 6451 MF 3780634M1 VA A13VI243 CG 113961</p>	<p>ALV0396 <i>New</i></p>  <p>12v 90amp a:32.5 b:15 c:50</p> <p>HYUNDAI, KIA SOLARIS 2010-> Yuedong (Elantra) Verna (Accent III) Soul SB KI 373002B400 VA TG9S075 VA 442123</p>	<p>ALV0397 <i>New</i></p>  <p>ARV1095</p> <p>12v 180amp a:56 b:28 c:76</p> <p>BMW 530d (F10, E70, E71) BM 12317803724 VA FG18S011 VA 439668</p>	<p>ALV0398 <i>New</i></p>  <p>12v 100amp a:34.5 b:14.5 c:82</p> <p>VW Passat B5 1.8 Santana 3000 Santana Vista VW 33D903018 VA SA13VI76T VA 442028</p>
<p>ALV0399 <i>New</i></p>  <p>595389</p> <p>12v 105amp a:38 b:63 c:59</p> <p>FIAT GRANDE PUNTO 2005-> IDEA 2003-> NUOVA 500 2007-> FI 51792276 VA TG9S060 VA 439706</p>	<p>ALV0400 <i>New</i></p>  <p>12v 100amp a:37 b:13 c:66</p> <p>AUDI, VW Santana 100 Foton 4G18 VA 442133</p>	<p>ALV0402 <i>New</i></p>  <p>12v 180amp a:21 b:70 c:57</p> <p>MERCEDES-BENZ C300 E280 E300 212.154 E400 212.165 MB A0009060500 VA FG18S055 VA 442212</p>	<p>ALV0403 <i>New</i></p>  <p>12v 150amp a:20 b:70 c:52.5</p> <p>MERCEDES-BENZ C260 C200 MB A0131543302 VA TG15C167 VA 442211</p>
<p>ALV0404 <i>New</i></p>  <p>12v 150amp a:23 b:70 c:56</p> <p>MERCEDES-BENZ C300 C280 MB A0141543002 VA TG15C164 VA 442210</p>	<p>ALV0405 <i>New</i></p>  <p>12v 150amp a:24 b:70.5 c:56</p> <p>MERCEDES-BENZ C180K MB A2711541502 VA TG15C163 VA 442209</p>	<p>ALV0406 <i>New</i></p>  <p>12v 110amp a:23 b:13 c:78</p> <p>BYD F6 M6 S6 VA TG11C109 VA 442218</p>	<p>ALV0407 <i>New</i></p>  <p>12v 110amp a:25 b:14 c:78</p> <p>BYD F6 VA TG11S058 VA 442188</p>

Alternators

Valeo

<p>ALV0409 <i>New</i></p>  <p>12v 110amp a:24 b:13 c:78.5</p> <p>BYD F6</p> <p>1.8 MT 2.0 MT</p> <p>VA TG11S058A VA 442195</p>	<p>ALV0410 <i>New</i></p>  <p>12v 110amp a:35 b:13 c:65.5</p> <p>JAC Refine 2.4L Rein TAGAZ</p> <p>2.4L</p> <p>VA TG11S072 VA 442215</p>	<p>ALV0411 <i>New</i></p>  <p>12v 110amp a:48 b:20 c:54</p> <p>CHERY A3 1.6L</p> <p>E4G16</p> <p>CHE E4G163701110 VA TG11S108 VA 442217</p>	<p>ALV0412 <i>New</i></p>  <p>12v 120amp a:34.5 b:13 c:58.5</p> <p>NISSAN Qashqai X-Trail</p> <p>VA TG12C103 VA 442213</p>
<p>ALV0414 <i>New</i></p>  <p>ALV0414WA ARV1549</p> <p>12v 150amp a:29 b:14 c:61</p> <p>RENAULT Espace IV 2.0L</p> <p>RE 8200795452 VA TG15C137 VA 440248</p>	<p>ALV0417 <i>New</i></p>  <p>ALV0417WA ARA1820</p> <p>12v 120amp a:36 b:55 c:78</p> <p>FORD Mondeo 3.0L</p> <p>V6</p> <p>FO 2S7T10300BA VA TG12C110 MS 210417</p>	<p>ALV0425 <i>New</i></p>  <p>ALV0425WA 599162</p> <p>12v 90amp a:30 b:18 c:37</p> <p>TOYOTA 1.3L</p> <p>TO 270600Y120 VA FG9T012 VA 439787</p>	<p>ALV0426 <i>New</i></p>  <p>ARV1464 PAL0407 COM</p> <p>12v 220amp a:56 b:28 c:74</p> <p>BMW GRAND TURISMO 530, 535 2008-></p> <p>BM 12317807187 VA FG23S011 VA 439670</p>
<p>ALV0435 <i>New</i></p>  <p>ARV1001 PAL0415 LIN NC</p> <p>12v 180amp a:30 b:13 c:62</p> <p>VOLKSWAGEN TOUAREG 3.6L 2010-</p> <p>CGRA</p> <p>VW 03H903023C VA FG18T070 MH ALV0435</p>	<p>ALV0436 <i>New</i></p>  <p>ARV1327 PAL0415 LIN NC</p> <p>12v 180amp a:39 b:13 b:62</p> <p>VOLKSWAGEN Touareg 3.0L 2010-</p> <p>CGEA CGFA</p> <p>VW 06E903023 VA FG18T072 MH ALV0436</p>	<p>ALV0437 <i>New</i></p>  <p>PAL0415 LIN NC</p> <p>12v 180amp a:30 b:13 b:62</p> <p>VOLKSWAGEN Touareg 3.0L 2010-</p> <p>CASA, CATA CNRB, CRCA CJGD, CASD VW 059903023K VA FG18T094 MH ALV0437</p>	<p>ALV0438 <i>New</i></p>  <p>599191 PAL0415 6700 LIN NC</p> <p>12v 200amp a:30 b:13 c:61</p> <p>AUDI A6 A6 Avant - 3.0 TDI 2010-></p> <p>CLAA, CLAB CDUC, CDUD</p> <p>VW 059903018TX VA FG20S011 MH ALV0438</p>

Alternators

Valeo

<p>ALV0441 <i>New</i></p>  <p>599191 PAL0415 7000</p>  <p>12v 200amp a:40 b:13 c:62</p> <p>AUDI A6 2.0L 2011-</p> <p>CGLC, CGLD CMGB</p> <p>VW 03L903016AX VA FG20S014 MH ALV0441</p>	<p>ALV0458 <i>New</i></p>  <p>ARV1549 PAL0213</p>  <p>12v 90amp a:37 b:13 c:61</p> <p>CITROEN C3 PEUGEOT 307</p> <p>RE 8200810614 VA TG9B052 VA 439676</p>	<p>ALV0467 <i>New</i></p>  <p>ARV3097</p> <p>12v 150amp a:26 b:70 c:58</p> <p>MERCEDES-BENZ</p> <p>MB A0141541502 LU FG15T036 VA 440264</p>	<p>ALV0472 <i>New</i></p>  <p>595446</p> <p>12v 180amp a:57 b:27 c:76</p> <p>BMW 3</p> <p>N47D20A N47D20C 204D4 BM 12318507623 VA FG18D057 VA 440299</p>
<p>ALV0473 <i>New</i></p>  <p>ARV1591</p> <p>12v 230amp a:25 b:69 c:58</p> <p>MERCEDES-BENZ SPRINTER</p> <p>OM651961 OM651956 OM651955 ME A0009063422 VA TG23C034 LU DRA0925</p>	<p>ALV0510</p>  <p>ALV0510WA</p> <p>ARV1652 PAL0292</p>  <p>12v 75amp a:22 b:27 c:69</p> <p>CITROEN RENAULT CX</p> <p>RE 7700687564 VA A14N12 HC CA510IR</p>	<p>ALV0524</p>  <p>ARV1652 PAL0292</p>  <p>12v 70amp a:45 b:27 c:66</p> <p>RENAULT R19 R21</p> <p>F3N740, F2N712 F3N742, F3N746 F3N743 RE 7700796221 VA A13N159 HC CA524IR</p>	<p>ALV0525</p>  <p>ALV0525WA</p> <p>ARV1661 PAL0291</p>  <p>12v 70amp a:46.5 b:27 c:66</p> <p>CITROEN, PEUGEOT C15 BX 205, 305, 309, 405</p> <p>XUD7, XUD7TE 171A, 171B, 171C, DFZ AJZ, B1E, D9A, BDZ PE 95653968 VA A13N183 HC CA525IR</p>
<p>ALV0526</p>  <p>ALV0526WA</p> <p>ARV1652 PAL0292</p>  <p>12v 70amp a:48.5 b:27 c:66</p> <p>RENAULT Espace R21 R25 Trafic</p> <p>J8S620 852720 J7T600 RE 7700754835 VA A13N171 HC CA526IR</p>	<p>ALV0527</p>  <p>ALV0527RB ALV0527WA</p> <p>ARV1652 PAL0292</p>  <p>12v 70amp a:47 b:27 c:67.5</p> <p>RENAULT R 19</p> <p>F8Q706, F8Q742 RE 7700805873 VA A13N162 HC CA527IR</p>	<p>ALV0529</p>  <p>ALV0529WA</p> <p>ARV1652 PAL0292</p>  <p>12v 60amp a:47 b:27 c:68</p> <p>VOLVO RENAULT 340 R11, R9</p> <p>F8M700, F8M720 F8M730 D16 RE 7701499236 VA A13N136 HC CA529IR</p>	<p>ALV0533</p>  <p>ALV0533WA</p> <p>ARV1661 PAL0291</p>  <p>12v 70amp a:95 b:56</p> <p>CITROEN PEUGEOT AX, BX, C15 205, 309, 405</p> <p>TU3, K1D KDY, KDZ, KAY K2B, TU9, H1B PE 95632727 VA A13N216 HC CA533IR</p>

Alternators

Valeo

<p>ALV0534</p>  <p>ARV1652 PAL0292</p>  <p>12v 90amp a:49 b:27 c:64.5</p> <p>RENAULT Espace R21 R25 Alpine</p> <p>Z7W712, Z7W713, J7R750PEL, RENAULT J7R740, J7R752, J7R756Corsa Z7U702, Z7V709, Z7W707Espace, R21, R25 RE 7700780773 VA A14N60 HC CA534IR</p>	<p>ALV0535</p>  <p>ALV0535WA ARV1639 PAL0292</p>  <p>12v 105amp a:48.5 b:27 c:66</p> <p>13SB J8S610 J7T772 RE 7700754850 VA A14N73 HC CA535IR</p>	<p>ALV0549</p>  <p>ALV0549WA ARV1652 PAL0292</p>  <p>12v 60amp a:56 b:27 c:67.5</p> <p>RENAULT Clio R19 Rapid</p> <p>E7J742 E6J700 E7J, E7J726 RE 7701499436 VA A13N157 HC CA549IR</p>	<p>ALV0556</p>  <p>ALV0556WA ARV1926</p> <p>12v 80amp a:41.5 b:27.5 c:68</p> <p>CITROEN, PEUGEOT XM 605</p> <p>P9A, P8A, RGX UFZ, SFZ, RGY XUD11ATE, PJZ PE 90041021 MI A14N172 HC CA556IR</p>
<p>ALV0557</p>  <p>ALV0557WA ARV1652 PAL0292</p>  <p>12v 50amp a:47 b:27 c:69</p> <p>RENAULT R5 Rapid Super5</p> <p>F8M720 F8M730 F8M736, F8M760 RE 7700734240 VA A13N137 HC CA557IR</p>	<p>ALV0558</p>  <p>ALV0558WA ARV1120</p> <p>24v 75amp b:27 c:67.5</p> <p>SCANIA 93 Series 112 Series 113 Series 143 Series</p> <p>DSC1121, DSC1117 DSC1116, DS1115 DS1114 SC 571518 VA A14N104 HC CA558IR</p>	<p>ALV0574</p>  <p>ALV0574WA ARV1661 PAL0291</p>  <p>12v 70amp a:46.5 b:27 c:69.5</p> <p>VOLVO 440 460 480</p> <p>B18F, B16F B20F, B18FT D19T, B18KP VO 9031146 VA A13N133 HC CA574IR</p>	<p>ALV0587</p>  <p>ALV0587WA ARV1926</p> <p>12v 70amp a:42.5 b:27 c:73.5</p> <p>CITROEN, PEUGEOT XM 605</p> <p>RDZ, XU102C, RFZ RFV, RGX R5A, RGY, P9A PE 96009847 VA A13N184 HC CA587IR</p>
<p>ALV0602</p>  <p>ALV0602WA ARV1652 PAL0292</p>  <p>12v 70amp a:46 b:27 c:64</p> <p>RENAULT SCANIA R19, R21 P/G/R/T Series</p> <p>DC1305, DC1306 F8Q706, F8Q710 F8Q742, F8Q744 RE 7700784979 VA A13N164 HC CA602IR</p>	<p>ALV0605</p>  <p>ALV0605WA ARV1652 PAL0292</p>  <p>12v 70amp a:46.5 b:27 c:72</p> <p>RENAULT Clio R19 Rapid</p> <p>F8Q682, F8Q640 F8Q724, F8Q774 F8Q730, F8Q732 RE 7700803325 VA A13N230 HC CA605IR</p>	<p>ALV0607</p>  <p>ALV0607RB ALV0607WA ARV1652 PAL0292</p>  <p>12v 70amp a:46.5 b:27 c:68.5</p> <p>RENAULT Clio R5 Super</p> <p>F2N770, F3P710 F3P716 F3N702 RE 7700798995 VA A13N201 HC CA607IR</p>	<p>ALV0612</p>  <p>ALV0612WA ARV1652 PAL0292</p>  <p>12v 70amp a:46.5 b:27 c:68.5</p> <p>RENAULT R11 R19 R21 R9</p> <p>F2N700, F2N704, F3N726 F3N740, F3N741, F3N742 F2N724, F3N722, F2N708 RE 7700730364 VA A13N172 HC CA612IR</p>


Alternators

Valeo

<p>ALV0617</p>  <p>ALV0617WA ARV1511</p>	<p>ALV0618</p>  <p>ALV0618WA ARV1511</p>	<p>ALV0632</p>  <p>ALV0632WA ARV1652 PAL0292</p> 	<p>ALV0633</p>  <p>ARV1652 PAL0292</p> 
<p>12v 50amp a:95 b:56</p> <p>CITROEN, PEUGEOT CX 106 306 405</p> <p>KDZ, HDZ, KDX KDY, CDY KFX, NFZ PE 95668060 VA A11VI42 HC CA617IR</p>	<p>12v 70amp a:95 b:56</p> <p>CITROEN, PEUGEOT AX, Berlingo, BX Saxo, Xsara, ZX 106, 306, 405 Partner</p> <p>KFX, KFW HFX, HDZ NFT, CDZ PE 95667742 VA A11VI43 HC CA618IR</p>	<p>12v 90amp a:52 b:27 c:65.5</p> <p>RENAULT Clio R19 Rapid</p> <p>C3G720 E7F700 E7J, E7J718 RE 7700805159 VA A14N156 HC CA632IR</p>	<p>12v 70amp a:52.5 b:27 c:72</p> <p>RENAULT Clio 1.4</p> <p>E7J718, E7J754 E7J719, E7J710 E7J711 RE 7700805158 VA A13N204 HC CA633IR</p>
<p>ALV0634</p>  <p>ALV0634RB ALV0634WA ARV1652 PAL0292</p> 	<p>ALV0635</p>  <p>ALV0635RB ALV0635WA ARV1652 PAL0292</p> 	<p>ALV0636</p>  <p>ALV0636RB ARV1511</p>	<p>ALV0637</p>  <p>ALV0637RB ALV0637WA ARV1511</p>
<p>12v 90amp a:46.5 b:27 c:67.5</p> <p>RENAULT Clio Espace R19</p> <p>F2N770 J6R236 J7R760 RE 7700796907 VA A14N171 HC CA634IR</p>	<p>12v 60amp a:46.5 b:27 c:72</p> <p>RENAUL Clio Rapid</p> <p>F8Q722, F8Q724 F8Q730, F8Q732 F8Q774, F8Q776 RE 7700852395 VA A13N206 HC CA635IR</p>	<p>12v 50amp a:42 b:27 c:66</p> <p>CITROEN, PEUGEOT ZX 1.9 306</p> <p>D9B, DJZ, DHY DJY, DJZ CI 9612259680 VA A11VI24 HC CA636IR</p>	<p>12v 70amp a:42.5 b:26.5 c:66</p> <p>CITROEN, FIAT PEUGEOT, SUZUKI Berlingo, Jumpy 306, 405, Partner Scudo, Vitara</p> <p>XUD9, XUD9A DHY, DJZ, DHW A9A, WJZ, DJY PE 95667747 VA A11VI40 HC CA637IR</p>
<p>ALV0638</p>  <p>ALV0638RB ALV0638WA ARV1511</p>	<p>ALV0639</p>  <p>ALV0639RB ALV0639WA ARV1511</p>	<p>ALV0640</p> <p>ALV0640WA ARV1652 PAL0292</p> 	<p>ALV0648</p>  <p>ALV0648WA ARV1511</p>
<p>12v 80amp a:42 b:27 c:66.5</p> <p>CITROEN, FIAT PEUGEOT Berlingo, Jumper Ducato, Partner 306, 405, Boxer</p> <p>A9A, DJY XUD9, D8C XUD9TE, DHY PE 9612259880 VA A13VI49 HC CA638IR</p>	<p>12v 80amp a:42.5 b:27 c:66.5</p> <p>CITROEN, PEUGEOT AX, ZX 205, 405</p> <p>TU9, HDZ KDZ, KDY H1A, D9B PE 95667748 VA A13VI85 HC CA639IR</p>	<p>12v 70amp a:49.5 b:27 c:66.5</p> <p>RENAULT Espace R21 R25</p> <p>J7T770, J8S776 J8S704, J8S600 J7T715, J8S738 RE 7700754835 VA A13N171 HC CA640IR</p>	<p>12v 70amp a:19.5 b:27.5 c:66</p> <p>CITROEN, FIAT LANCIA, PEUGEOT Evasion, XM, Xsara Ulysse, Zeta 306, 405, 806</p> <p>RFX LFW LFZ VA A11VI17 VA A11VI48 HC CA648IR</p>

Alternators

Valeo

<p>ALV0649</p>  <p>ALV0649WA</p> <p>ARV1652 PAL0292</p>  <p>12v 70amp a:56 b:27 c:72</p> <p>RENAULT, SCANIA Clio R19 Rapid P/G/R/T Series</p> <p>DC1305 DC1310 E7F708, E7J718 RE 7700784482 VA A13N158 HC CA649IR</p>	<p>ALV0711</p>  <p>ALV0711WA</p> <p>ARV1661 PAL0291</p>  <p>12v 70amp a:46.5 b:27 c:70</p> <p>VOLVO 460 440 480</p> <p>B18FT, B18U B20F, D19T B18EP, B18E VO 3417316 VA A13N242 HC CA711IR</p>	<p>ALV0713</p>  <p>ALV0713WA</p> <p>ARV1511</p> <p>12v 80amp a:19.5 b:27 c:66</p> <p>CITROEN, FIAT LANCIA, PEUGEOT Jumper, Ducato Xantia, XM 306, 405, 605, 806</p> <p>T9A RFX PE 9612262680 VA A13VI48 HC CA713IR</p>	<p>ALV0715</p>  <p>ALV0715WA</p> <p>ARV1511</p> <p>12v 80amp a:19.5 b:56</p> <p>CITROEN, PEUGEOT Berlingo, Saxo Xsara, ZX 106, 306 Partner</p> <p>KFX HDZ NFT PE 9619429380 VA A13VI46 HC CA715IR</p>
<p>ALV0716</p>  <p>ALV0716WA</p> <p>ARV1528 PAL0292</p>  <p>12v 110amp a:46 b:26.5 c:66</p> <p>RENAULT VOLVO R19 480, 460, 440</p> <p>F8Q742 F8Q706, B18FT B20F, B18U, B16F RE 7700811462 VA A13VI139 HC CA716IR</p>	<p>ALV0728</p>  <p>12v 150Amp a:40 b:14 c:61</p> <p>RENAULT CLIO 1.5L</p> <p>RE 231007281R VA FG15T057</p>	<p>ALV0729</p>  <p>ARV1511</p> <p>12v 50amp a:42.5 b:27 c:66</p> <p>CITROEN PEUGEOT FIAT 405 XM</p> <p>XUD9TE XUD11A XU102C CI 95667749 VA A11VI15 HC CA729IR</p>	<p>ALV0730</p>  <p>ALV0730WA</p> <p>ARV1511</p> <p>12v 80amp a:42 b:27.5 c:66.5</p> <p>CITROEN, FIAT PEUGEOT Evasion, Xantia, ZX Ulysse 306, 405</p> <p>LFZ, BDY BFZ, RFT RFX, LFZ PE 96076412 VA A13VI89 HC CA730IR</p>
<p>ALV0743</p>  <p>IP735B</p> <p>12v 70amp a:74.5 b:51</p> <p>VOLVO PENTA SABB</p> <p>VO 38031464 VA A13N148M HC CA743IR</p>	<p>ALV0748</p>  <p>ALV0748WA</p> <p>ARV1120</p> <p>24v 55amp b:27 c:67</p> <p>SCANIA 112 Series 113 Series</p> <p>DSC1117 DSC1116 DSC1121 SC 1105367 VA A14N135 HC CA748IR</p>	<p>ALV0813</p>  <p>ALV0813WA</p> <p>ARV1904</p> <p>12v 75amp</p> <p>PORSCHE 911 3.3L Turbo 930 3.3L Turbo</p> <p>93060 93066 PO 91160312004 VA A14N11 HC CA813IR</p>	<p>ALV0815</p>  <p>ALV0815RB</p> <p>ARV1513</p> <p>12v 110amp a:23 b:27 c:65</p> <p>RENAULT Safrane 3.0L</p> <p>V6 RE 7701352122 VA A13VI157 HC CA815IR</p>












Alternators

Valeo

<p>ALV0816</p>  <p>ARV1513</p> <p>12v 80amp a:62.5 b:27 c:65</p> <p>RENAULT Safrane</p> <p>J7T763, J7T761 J7T762, J7T760 J7R734, J7R735 RE 7701353119 VA A13VI16 HC CA816IR</p>	<p>ALV0817</p>  <p>ALV0817WA ARV1513</p> <p>12v 80amp a:23 b:27 c:67</p> <p>RENAULT Safrane</p> <p>RE 7700260935 VA A13VI23 HC CA817IR</p>	<p>ALV0819</p>  <p>ALV0819RB ALV0819WA ARV1513</p> <p>12v 110amp a:62 b:27 c:66.5</p> <p>RENAULT Safrane</p> <p>J7R732 J7T760</p> <p>RE 7700856247 VA A13VI17 HC CA819IR</p>	<p>ALV0820</p>  <p>ALV0820WA ARV1511</p> <p>12v 70amp a:42 b:27 c:66</p> <p>CITROEN, FIAT LANCIA, PEUGEOT Evasion, ZX Ulysse, Zeta 306, 405, 806</p> <p>BFZ, RGX, RFU LFZ, LFW P8A, PJZ PE 95667744 VA A11VI48 HC CA820IR</p>
<p>ALV0821 <i>New</i></p>  <p>ARV1513</p> <p>12v 110amp a:62.5 b:27 c:67</p> <p>RENAUT Safrane</p> <p>M027132 N7UA700</p> <p>RE 7700856250 MH ALV0821</p>	<p>ALV0825</p>  <p>ALV0825WA ARV1511</p> <p>12v 95amp a:42 b:27 c:68</p> <p>CITROEN, FIAT PEUGEOT Jumper, Evasion Ducato, Ulysse 306, 405, 806</p> <p>T8A, T9A, LFW RFU, BFZ, RFT RGZ, RFY, RFX FI 9610601580 VA A13VI71 HC CA825IR</p>	<p>ALV0830</p>  <p>ALV0830WA ARV1652 PAL0292</p> <p>12v 90amp a:56 b:27 c:68</p> <p>RENAULT R19</p> <p>E6J700 E7J742 E7J700 RE 7700749023 VA A14N131 HC CA830IR</p> 	<p>ALV0831</p>  <p>ALV0831WA ARV1652 PAL0292</p> <p>12v 90amp a:46.5 b:27 c:69</p> <p>RENAULT R19 R21</p> <p>F3P682 F3N740 F2N720 RE 7700730365 VA A14N102 HC CA831IR</p> 
<p>ALV0836</p>  <p>ALV0836WA ARV1511</p> <p>12v 120amp a:41.5 b:26.5 c:67</p> <p>CITROEN, PEUGEOT FIAT, LANCIA XM, Xsara, C4 Ducato, Zeta 405</p> <p>EP6CDT, RFW, RFL DK5ATE, RGX XU7JP, BDY, BFZ FI 1323249080 VA A14VI30 HC CA836IR</p>	<p>ALV0837</p>  <p>ALV0837WA ARV1511</p> <p>12v 90amp a:31 b:14 c:82</p> <p>AUDI, VW 80, 100, A4, A6 A8, Cabriolet Passat</p> <p>ABC, ACK, ALG AAT, AGA, ALT AHH, AAR VW 078903015B VA A13VI155 HC CA837IR</p>	<p>ALV0838</p>  <p>ALV0838RB ALV0838WA ARV1652 PAL0292</p> <p>12v 90amp a:46 b:27 c:67.5</p> <p>RENAULT Clio R21</p> <p>F8Q730 F8Q710 F8Q732 RE 7700749226 VA A14N164 HC CA838IR</p> 	<p>ALV0845</p>  <p>ALV0845RB ALV0845WA ARV1511</p> <p>12v 95amp a:77 b:56</p> <p>BMW, MERCEDES 3 5 8t</p> <p>M51D25 BM 12312244833 VA A13VI18 HC CA845IR</p>

Alternators

Valeo

<p>ALV0848</p>  <p>ALV0848WA ARV1513</p> <p>12v 110amp a:46.5 b:27 c:66.5</p> <p>RENAULT, VOLVO Laguna, Megane R19, Scenic S40</p> <p>F3P670 D4192T F8Q620 RE 6001023940 VA A13VI45 HC CA848IR</p>	<p>ALV0849</p>  <p>ALV0849WA ARV1661 PAL0292</p> <p>12v 70amp a:47 b:27 c:72.5</p> <p>RENAULT Clio R19 Rapid</p> <p>F8Q730, F8Q732 F7P704, F8Q682 F8Q640, F8Q776 RE 7700803325 VA A13N235 HC CA849IR</p>	<p>ALV0857</p>  <p>ALV0857WA ARV1729</p> <p>24v 55amp b:50.5</p> <p>DAF, VOLVO Marine Agricultural F series FL Series</p> <p>TD101G TD100GA TD120G, TD121G VA A14N119 VA A14N81M HC CA857IR</p>	<p>ALV0858</p>  <p>ALV0858WA ARV1729</p> <p>24v 55amp b:50.5</p> <p>RENAULT VI, VOLVO C Series B/F/FL Series Marine</p> <p>TD70ES D6B, TD122F TD102FBQ VO 872021 VA A14N141M HC CA858IR</p>
<p>ALV0889</p>  <p>ALV0889RB ALV0889WA ARV1661 PAL0292</p> <p>12v 60amp a:50.5 b:27.5 c:45</p> <p>RENAULT Twingo</p> <p>C3G700 C3G702 RE 7700820794 VA A13N269 HC CA889IR</p>	<p>ALV0895</p>  <p>ALV0895WA ARV1513</p> <p>12v 110amp a:54 b:27 c:66.5</p> <p>RENAULT Safrane</p> <p>S8U762, S8U763 RE 7701035684 VA A13VI21 HC CA895IR</p>	<p>ALV0896</p> <p>ALV0896WA ARV1513</p> <p>12v 75amp a:46.5 b:26.5 c:66.5</p> <p>RENAULT Espace Laguna</p> <p>G8T716, G8T714 G8T716, F3P678, G8T794 F3P720, F3P724, F3R722 VO 8111570 VA A11VI26 HC CA896IR</p>	<p>ALV0913</p>  <p>ALV0913WA ARV1513</p> <p>12v 80amp a:56 b:27 c:66.5</p> <p>RENAULT Laguna</p> <p>G8T706 G8T790 RE 7700864606 VA A13VI66 HC CA913IR</p>
<p>ALV0914</p>  <p>ALV0914WA ARV1513</p> <p>12v 110amp a:56 b:27 c:67</p> <p>RENAULT Laguna</p> <p>G8T706 G8T790 RE 7700827344 VA A13VI62 HC CA914IR</p>	<p>ALV0986 <i>New</i></p>  <p>ALV0986 ARV1513</p> <p>12v 110amp a:52 b:27 c:66</p> <p>RENAULT</p> <p>Z7X775 Z7X760 Z7X765 RE 7701352304 VA A13VI55 CG 112682</p>	<p>ALV1018 <i>New</i></p>  <p>ALV1018 ARV1001</p> <p>12v 180amp a:29 b:14 c:61</p> <p>VOLKSWAGEN TOUAREG 7P5 3.0 V6 TSI/TD 2010-></p> <p>CASA CNRB CJMA VW 059903023H VA FG18T071 MH ALV1018</p>	<p>ALV1033</p>  <p>ALV1033 ARV1513</p> <p>12v 110amp a:62.5 b:27 c:66.5</p> <p>Renault Safrane 2.1 TD</p> <p>AC RE 7701352117 VA A13VI14 HC CA1033IR</p>

Alternators

Valeo

<p>ALV1036</p>  <p>ALV1036RB ALV1036WA</p> <p>ARV1513</p> <p>12v 110amp a:46.5 b:28 c:66.5</p> <p>RENAULT F3R728, F3R729, D4192T VOLVO G8T714, G8T716, G8T752 Espace, Laguna D4192T3, F3P724, F3R728 S40 RE z V40 VA A13V1153 HC CA1036IR</p>	<p>ALV1038</p>  <p>ALV1038RB ALV1038WA</p> <p>ARV1511</p> <p>12v 70amp a:52 b:26 c:58</p> <p>CITROEN, PEUGEOT VJY VJZ TUD5 Saxo PE 9620332580 106 VA A11V145 HC CA1038IR</p>	<p>ALV1039</p>  <p>ALV1039WA</p> <p>ARV1514</p> <p>12v 80amp a:52.5 b:26.5 c:67</p> <p>CITROEN, FIAT 814047 Jumper 814063 Croma 2.0L 16V (92-96) 814043 Ducato 2.5D/2.5TDI FI 46231787 2.8D/2.8TD (94-02) VA A13V172 HC CA1039IR</p>	<p>ALV1042</p>  <p>ALV1042WA</p> <p>ARV1506</p> <p>12v 105amp a:72.5 b:16 c:82</p> <p>BMW M42B18 3 M40B16 5 BM 12311734322 VA A14V13 HC CA1042IR</p>
<p>ALV1048</p>  <p>ARV1904</p> <p>12v 50amp</p> <p>HATZ Stationnares Industrial Engine</p> <p>HE 8EL732873001 VA A13N52 HC CA1048IR</p>	<p>ALV1049</p>  <p>ALB1049RB ALV049WA ALV1049WA</p> <p>ARV1169</p> <p>24v 55amp b:14.5 c:99</p> <p>VOLVO Trucks FH, FM, FL Series</p> <p>D12A420 D12D340 D12A420 VO 8113477 VA A14N183M HC CA1049IR</p>	<p>ALV1052</p>  <p>ALV1052WA</p> <p>ARV1511</p> <p>12v 90amp a:91.5 b:56</p> <p>CITROEN, FIAT RGX, RFV LANCIA, PEUGEOT LFX, LFY Berlingo, Xsara R2A, RFS 306, 406 PE 9618961480 605, 806 VA A13V1101 HC CA1052IR</p>	<p>ALV1059</p>  <p>ARV1528</p> <p>12v 75amp a:47 b:27 c:69</p> <p>RENAULT Twingo</p> <p>C3G700 C3G702 RE 7701352300 VA A11V129 HC CA1059IR</p>
<p>ALV1060</p>  <p>ALV1060RB</p> <p>ARV1512 PAL0292</p> <p>12v 110amp a:46.5 b:27 c:66.5</p> <p>RENAULT Clio</p> <p>F3P710, F3P714 F3P754, F3P755 F3P712, F3P758 RE 7700856856 VA A13V152 HC CA1060IR</p>	<p>ALV1064</p>  <p>ALV1064RB ALV1064WA</p> <p>ARV1511</p> <p>12v 80amp a:69 b:28 c:76</p> <p>BMW M50B20 3 M52B20 5 M50B25 323 BM 12311735743 328 VA A13V154 HC CA1064IR</p>	<p>ALV1065</p>  <p>ALV1065WA</p> <p>ARV1511</p> <p>12v 95amp a:91.5 b:56</p> <p>ALFA ROMEO, CITROEN DHY, DJY FIAT, LANCIA, PEUGEOT DHW, DHX 306, 406, 605 P8C Partner, Ulysse PE 9617849180 Delta, Berlingo VA A13V1231 HC CA1065IR</p>	<p>ALV1077</p>  <p>ARV1517</p> <p>12v 80amp a:52.5 b:27 c:66.5</p> <p>RENAULT Megane Clio Scenic</p> <p>F8Q696, K7M702, E7J624 E7J764, K7M703, E7J626 E7J764, K7M720 RE 7700866507 VA A13V1184 HC CA1077IR</p>







Alternators

Valeo

<p>ALV1078</p>  <p>ALV1078RB ALV1078WA</p> <p>ARV1517</p> <p>12v 110amp a:52.5 b:27.5 c:66</p> <p>RENAULT Megane Scenic</p> <p>E7J764 K7M702</p> <p>RE 7700862865 VA A13V1185 HC CA1078IR</p>	<p>ALV1079</p>  <p>ALV1079WA</p> <p>ARV1517</p> <p>12v 75amp a:46.5 b:27 c:67</p> <p>RENAULT Laguna Megane</p> <p>F3R750 F7R710 F8Q784</p> <p>RE 7700861496 VA A11V159 HC CA1079IR</p>	<p>ALV1080</p>  <p>ALV1080RB ALV1080WA</p> <p>ARV1517</p> <p>12v 80amp a:47 b:26.5 c:69</p> <p>RENAULT, VOLVO Clio S40 V40</p> <p>D4192T D4192T4 F8Q730, F8Q678</p> <p>RE 7700862613 VA A13V164 HC CA1080IR</p>	<p>ALV1086</p>  <p>ALV1086WA</p> <p>ARV1511</p> <p>12v 80amp a:42.5 b:27 c:66.5</p> <p>CITROEN, FIAT PEUGEOT Jumper, Xantia Ducato, Ulysse 306, 806, Boxer</p> <p>RFU, RFW, BFZ RFW, DJY, DHX RFX, RFY, LFZ FI 9611366880 VA A13V1189 HC CA1086IR</p>
<p>ALV1095</p>  <p>ALV1095WA</p> <p>ARV1511</p> <p>12v 70amp a:89 b:56</p> <p>CITROEN, PEUGEOT ZX 106</p> <p>K9Y</p> <p>PE 5705J9 VA A11V144 HC CA1095IR</p>	<p>ALV1098</p>  <p>ALV1098WA</p> <p>ARV1511</p> <p>12v 120amp a:91.5 b:56</p> <p>CITROEN, FIAT PEUGEOT Berlingo, Jumpy 406, 605, 806 Partner, Ulysse</p> <p>DHX, P8C A9A, XUD9TE PHZ, DHW</p> <p>PE 9617843180 VA A14V113 HC CA1098IR</p>	<p>ALV1099 <i>New</i></p>  <p>ALV1099RB</p> <p>12v 120amp a:42 b:27 c:65</p> <p>Peugeot</p> <p>THY DK5ATE</p> <p>PE 9620170280 VA A14V111 HC CA1099IR</p>	<p>ALV1101</p>  <p>ALV1101WA</p> <p>ARV1661 PAL0291</p> <p>12v 70amp a:46 b:27 c:66.5</p> <p>ROVER 200 400</p> <p>XUD7TE</p> <p>RO GNU2333 VA A13N207 HC CA1101IR</p>
<p>ALV1104</p>  <p>ARV1513</p> <p>12v 110amp a:52.5 b:27.5 c:68.5</p> <p>RENAULT R19</p> <p>F7P704</p> <p>RE 7700855154 VA A13V147 HC CA1104IR</p>	<p>ALV1105</p>  <p>ALV1105</p> <p>ARV1652 PAL0292</p> <p>12v 90amp a:47 b:27 c:66</p> <p>RENAULT R19</p> <p>F8Q706, F8Q742 F8Q744</p> <p>VA 2541230 VA A14N152 HC CA1105IR</p>	<p>ALV1118</p>  <p>12v 175amp a:56 b:28 c:77</p> <p>BMW</p> <p>N47TU</p> <p>BM 12318519890 VA FG18D111</p>	<p>ALV1125</p>  <p>12v 120amp a:33 b:14 c:61</p> <p>RENAULT Clio 0.9L</p> <p>RE 231007842R VA TG12C125</p>






Alternators

Valeo

<p>ALV1131</p>  <p>12v 110Amp a:40 b:14 c:61</p> <p>VOLKSWAGEN Amarok 2.0L</p> <p>CNEA,CSHA CDBA,CNFB CDBA,CNFB VW 03L903024R VA TG11C131</p>	<p>ALV1139</p>  <p>ALV1139WA ARV1511</p> <p>12v 90amp a:34.5 b:14 c:82</p> <p>AUDI, VW A4 A6 Passat</p> <p>ADP, AHL ANA, ARM AJL, AFY VW 058903016BX VA A13V1138 HC CA1139IR</p>	<p>ALV1150</p>  <p>ALV1150WA ARV1511</p> <p>12v 105amp a:77 b:57</p> <p>BMW, OPEL, VAUXHALL 3 5 Omega</p> <p>X25DT, 25DT M51D25 OP 90511442 VA A13V176 HC CA1150IR</p>	<p>ALV1152</p>  <p>ALB1152WA ARV1511</p> <p>12v 80amp a:92 b:56</p> <p>CITROEN, FIAT, LANCIA Ulysse Zeta</p> <p>M41D18 RFX, RFY, RFT, LFY PE 9617861280 VA A13V1262 HC CA1152IR</p>
<p>ALV1156</p>  <p>ALV1156WA ARV1511</p> <p>12v 120amp a:91.5 b:56</p> <p>CITROEN, FIAT LANCIA, PEUGEOT Berlingo, Zeta 306, 406, 605 Evasion, Xantia</p> <p>LFX, RFV RGX, LFY RGY PE 9621158480 VA A14V114 HC CA1156IR</p>	<p>ALV1157</p>  <p>ALV1157WA ARV1514</p> <p>12v 110amp a:53 b:27 c:68.5</p> <p>CITROEN, FIAT Jumper Relay Ducato</p> <p>814047 814043 814063 FI 98490186 VA A13V173 HC CA1157IR</p>	<p>ALV1192</p>  <p>ALV1192WA ARV1736</p> <p>12v 45amp a:74 b:50.5</p> <p>VOLVO Marine Engine</p> <p>AQ120, KAD32P AQ145, KAD44P, MD17 AQ200, MD11 VO 842765 VA A13N147 HC CA1192IR</p>	<p>ALV1194</p>  <p>ARV1140</p> <p>12v 110amp a:30 b:14 c:61</p> <p>VOLKSWAGEN Tiuran 1.2L</p> <p>CBZB VW 03C903025GX VA TG11C094</p>
<p>ALV1195</p>  <p>ARV1140</p> <p>12v 110Amp a:30 b:14 c:61</p> <p>VOLKSWAGEN Touran 1.4L</p> <p>BLG,CAVB BMY,CAVC CDCA VW 03C903023RX VA TG11C095</p>	<p>ALV1200</p>  <p>ALV1200WA ARV1513</p> <p>12v 110amp a:19.5 b:27 c:65</p> <p>RENAULT VOLVO 19 Chamade II (L53_) Laguna (K56_) S40 I (VS)</p> <p>2.0 [F3R 722] 1.8 16V [F7P 704] 1.9 TD RE 7700869377 VA A13V1107 HC CA1200IR</p>	<p>ALV1201</p>  <p>595389</p> <p>12v 120amp a:43 b:61 c:59</p> <p>FIAT CITROEN PEUGEOT</p> <p>233A9.000 199A2.000 F13DE5 FI 51854103 VA TG12S101 PE 1606439580</p>	<p>ALV1203</p>  <p>ALV1203WA ARV1511</p> <p>12v 80amp a:52 b:27 c:56</p> <p>CITROEN, PEUGEOT AX Saxo Xsara 106</p> <p>VJY TUD5 PE 5705N2 VA A13V184 HC CA1203IR</p>










Alternators

Valeo

<p>ALV1225</p>  <p>ARV1513</p> <p>12v 110amp a:22.5 b:27 c:67</p> <p>RENAULT Safrane 3.0L</p> <p>RE 7700260899 VA A13V132 HC CA1225IR</p>	<p>ALV1238</p>  <p>ALV1238WA ARV1511</p> <p>12v 80amp a:43 b:27 c:65</p> <p>CITROEN, PEUGEOT XM 605</p> <p>P9A, P8A P8C, PHZ PJZ, RGY PE 5705J1 VA A13V109 HC CA1238IR</p>	<p>ALV1243</p>  <p>ALV1243RB ALV1243WA ARV1511</p> <p>12v 90amp a:74.5 b:56</p> <p>CITROEN, PEUGEOT Berlingo Xsara 106 Partner</p> <p>HDZ, HFX KFX, KFW NFX, HDY PE 9621308580 VA A13V141 HC CA1243IR</p>	<p>ALV1247</p>  <p>ALV1247RB ALV1247WA ARV1537 PAL0232</p>  <p>15 61E</p> <p>12v 95amp a:77.5 b:56</p> <p>BMW 3</p> <p>M41D18</p> <p>BM 12312245576 VA A13V197 HC CA1247IR</p>
<p>ALV1250</p>  <p>ALV1250WA ARV1517</p> <p>12v 110amp a:19 b:27 c:65</p> <p>RENAULT Megane (96-03)</p> <p>2.0L 16V</p> <p>RE 7700880466 VA A13V106 HC CA1250IR</p>	<p>ALV1251</p>  <p>ARV1513</p> <p>12v 80amp a:54 b:27 c:66.5</p> <p>RENAULT Safrane</p> <p>S8U763 S8U762</p> <p>RE 7701035685 VA A13V120 HC CA1251IR</p>	<p>ALV1270</p>  <p>ALV1270VA</p> <p>12v 180amp a:51 b:20 c:44</p> <p>PEUGEOT 508 1.6L CITROEN C3 1.6L</p> <p>Hdi</p> <p>CI 9675753680 VA 2612707A VA IST60C017</p>	<p>ALV1298</p>  <p>ALV1298WA ARV1546 PAL0214</p>  <p>12v 75amp a:46.5 b:27 c:65</p> <p>RENAULT Clio Twingo Kangoo</p> <p>D7F710, D7F720 D7F700, D7F701 D7F746, D7F710 RE 7700427880 VA SG7S028 HC CA1298IR</p>
<p>ALV1302</p>  <p>ARV1517</p> <p>12v 75amp a:47.5 b:27 c:65</p> <p>RENAULT Clio 1.2L Kangoo 1.2L Twingo 1.2L</p> <p>D7F730</p> <p>RE 7700870822 VA 2542223 HC CA1302IR</p>	<p>ALV1303</p>  <p>ALV1303WA ARV1517</p> <p>12v 120amp a:46 b:26.5 c:66.5</p> <p>RENAULT Espace Laguna Megane</p> <p>F9Q722 F9Q716 F8Q620, F8Q784 RE 7700106501 VA A13V1254 HC CA1303IR</p>	<p>ALV1304</p>  <p>ALV1304WA ARV1516 PAL0214</p>  <p>12v 75amp a:46.5 b:26.5 c:66.5</p> <p>RENAULT, OPEL Clio Kangoo Laguna Megane</p> <p>F7R714 F9Q731 F5R740 RE 7700105333 VA A11V188 HC CA1304IR</p>	<p>ALV1306</p>  <p>ALV1306WA ARV1517</p> <p>12v 75amp a:46.5 b:27 c:66.5</p> <p>RENAULT Espace Laguna Megane</p> <p>F3R791 F9Q734 F8Q620 RE 7700107124 VA A11V192 HC CA1306IR</p>

Alternators

Valeo

<p>ALV1307</p>  <p>ALV1307WA ARV1517</p> <p>12v 110amp a:46.5 b:27 c:66.5</p> <p>RENAULT, VOLVO Espace, Laguna Megane Sport Spider S40, V40</p> <p>F9Q722, F3P674 F3P724, F3P670 F9R722, F8Q620 RE 7700104210 VA A13VI216 HC CA1307IR</p>	<p>ALV1308</p>  <p>ALV1308WA ARV1517</p> <p>12v 80amp a:46.5 b:27 c:65</p> <p>RENAULT Espace Laguna</p> <p>G8T716 G8T714 G8T760, G8T794 RE 7700424594 VA A13VI211 HC CA1308IR</p>	<p>ALV1309</p>  <p>ALV1309WA ARV1517</p> <p>12v 110amp a:46 b:26.5 c:66.5</p> <p>RENAULT, VOLVO Espace, Laguna Megane, Scenic S40, V40 Safrane</p> <p>G8T716 F3P678 F8Q624 RE 7700104209 VA A13VI209 HC CA1309IR</p>	<p>ALV1310</p>  <p>ALV1310WA ARV1489</p> <p>24v 90amp b:23 c:68</p> <p>SCANIA 94 Series 114 Series 124 Series 144 Series</p> <p>DC1101, DC1103 DSC1201, DSC1205 DSC1415, DSC915 SC 1433688 VA A14VI20 HC CA1310IR</p>
<p>ALV1312</p>  <p>ALV1312WA ARV1519</p> <p>12v 150amp a:91.5 b:56</p> <p>CITROEN, PEUGEOT FIAT</p> <p>XUD11ATE, XUD11BTE DHY P8C</p> <p>605, Ulysse 406, Xantia</p> <p>PE 9624177680 VA A14VI16 HC CA1312IR</p>	<p>ALV1320</p>  <p>ALV1320WA ARV1513</p> <p>12v 75amp a:19.5 b:27.5 c:65</p> <p>RENAULT Laguna I 3.0L</p> <p>V6</p> <p>RE 7700860977 VA A11VI30 HC CA1320IR</p>	<p>ALV1322</p>  <p>ALV1322WA ARV1517</p> <p>12v 120amp a:46.5 b:27 c:67</p> <p>VOLVO S40 V40</p> <p>D4192T2 D4192T</p> <p>RE 7700422142 VA A13VI255 HC CA1322IR</p>	<p>ALV1323</p>  <p>ALV1323WA ARV1511</p> <p>12v 80amp a:69 b:28 c:76</p> <p>BMW 328 320</p> <p>M52B28 M20B20</p> <p>BM 12311744561 VA A13VI132 HC CA1323IR</p>
<p>ALV1325</p>  <p>ALV1325WA ARV1560 PAL0232 15 61E</p> <p>12v 140amp a:69 b:28 c:76</p> <p>BMW 5, 7 528, 523, 520 Z3</p> <p>M52B20 M52B25</p> <p>BM 12317551252 VA SG14B020 HC CA1325IR</p>	<p>ALV1331</p>  <p>ALV1331RB ALV1331WA ARV1517</p> <p>12v 80amp a:47 b:27 c:65.5</p> <p>RENAULT, VOLVO Clio Rapid S40 V40</p> <p>D4192T D4192T3 F8Q678, F8Q640 RE 7700424575 VA A13VI217 HC CA1331IR</p>	<p>ALV1332</p>  <p>ALV1332WA ARV1511</p> <p>12v 105amp a:68.5 b:28 c:75</p> <p>BMW M3 Z3</p> <p>S50B30, S50B32</p> <p>BM 12311318079 VA A13VI180 HC CA1332IR</p>	<p>ALV1333</p>  <p>ALV1333WA ARV1517</p> <p>12v 80amp a:52.5 b:27 c:66.5</p> <p>RENAULT Clio Megane</p> <p>E7J756, E7J757 E7J764, K7M703</p> <p>RE 7700424583 VA A13VI266 HC CA1333IR</p>

Alternators

Valeo

<p>ALV1334</p>  <p>ALV1334WA ARV1517</p> <p>12v 150amp a:92 b:56</p> <p>CITROEN, PEUGEOT Xantia 306 406</p> <p>XU5JP XU10J2 XU10J2C PE 9624137480 VA A14V115 HC CA1334IR</p>	<p>ALV1339</p>  <p>ALV1339WA ARV1652 PAL0292</p>  <p>12v 90amp a:59 b:27 c:70.5</p> <p>RENAULT Master Trafic</p> <p>S9U702, S9U740 8140272580 8140272500 RE 5010270136 VA A14N176 HC CA1339IR</p>	<p>ALV1342</p>  <p>ALV1342RB ALV1342WA ARV1557</p> <p>12v 90amp a:29.5 b:140 c:41.5</p> <p>MERCEDES 140 160 26t Vaneo</p> <p>M166940 M166960 OM446946 MB 0101543802 VA A13V1237 HC CA1342IR</p>	<p>ALV1343</p>  <p>ALV1343WA ARV1517</p> <p>12v 75amp a:52 b:27 c:69.5</p> <p>OPEL Arena Movano</p> <p>S8U780 S8U770, S9W702 OP 9160344 VA A11V181 HC CA1343IR</p>
<p>ALV1344</p>  <p>ALV1344RB ALV1344WA ARV1516</p> <p>12v 75amp a:67 b:27 c:68.5</p> <p>RENAULT Clio 1.4L Kangoo 1.4L</p> <p>E7J780, K7M745 K7M744 RE 7700429042 VA A13V1235 HC CA1344IR</p>	<p>ALV1383</p>  <p>ALV1383 ARV1661 PAL0291</p>  <p>12v 70amp a:51 b:27 c:71.5</p> <p>MASSEY FERGUSON 6365</p> <p>MF 3618908M1 VA A13N274 HC CA1383IR</p>	<p>ALV1387</p>  <p>ALV1387</p> <p>12v 65amp a:32 b:27</p> <p>MASSEY FERGUSON</p> <p>MF 3405390M1 VA 9AR2566 MO 9AR2862K</p>	<p>ALV1388</p>  <p>ALV1388 ARV1517</p> <p>12v 150amp a:42.5 b:22 c:45</p> <p>CITROEN, PEUGEOT FIAT, LANCIA RENAULT, V6 C5, C6, C8 406, 407, 607, 807</p> <p>XFU, XFX, XFX ES9J4S, L7X762 XFZ, L7X720 CI 9627963480 VA A14V117 HC CA1388IR</p>
<p>ALV1389</p>  <p>ALV1389WA ARV1515</p> <p>12v 105amp a:50.5 b:30 c:57</p> <p>OPEL Sintra</p> <p>X22XE OP 10295857 VA A13V1193 HC CA1389IR</p>	<p>ALV1390</p>  <p>ALV1390RB ALV1390WA ARV1557</p> <p>12v 90amp a:30 b:140 c:41</p> <p>MERCEDES 160 170 190 Vaneo</p> <p>OM668941 OM668940 M166990 MB 0121544402 VA SG9B038 HC CA1390IR</p>	<p>ALV1392</p>  <p>ALV1392RB ARV1517</p> <p>12v 120amp a:42 b:22 c:45</p> <p>CITROEN FIAT LANCIA PEUGEOT RENAULT</p> <p>L7X731, L7X760, XFX L7X700, ES9J4S L7X727, SFZ PE 9634475880 VA A13V1201 HC CA1392IR</p>	<p>ALV1397</p>  <p>ALV1397WA ARV1511</p> <p>12v 90amp a:35 b:14 c:82</p> <p>VW Passat 2.3L VR5 (97-00)</p> <p>AGZ VW 046903015E VA A13V1173 HC CA1397IR</p>

Alternators

Valeo

<p>ALV1398</p>  <p>ALV1398RB ALV1398WA</p> <p>ARV1511</p> <p>12v 80amp a:47 b:20 c:73.5</p> <p>BMW 3 5</p> <p>M42B18, M43B16 M43164E3, M44B19</p> <p>BM 12311247288 VA A13VI78 HC CA1398IR</p>	<p>ALV1400</p>  <p>ALV1400RB ALV1400WA</p> <p>ARV1527 PAL0232</p>  <p>15 61E</p> <p>12v 95amp a:78 b:56</p> <p>BMW 5 7</p> <p>M51D25</p> <p>BM 12312246070 VA A13VI150 HC CA1400IR</p>	<p>ALV1434</p>  <p>ALV1434WA</p> <p>ARV1517</p> <p>12v 110amp a:52.5 b:27 c:66.5</p> <p>OPEL, RENAULT VAUXHALL Movano Master Arena</p> <p>S8U758 S8U770 S9W702 GM R1030105 VA A13VI179 HC CA1434IR</p>	<p>ALV1437</p>  <p>12v 140Amp a:30 b:70 c:60</p> <p>AUDI TT 1.8L 2.0L VOLKSWAGEN PASSAT 1.8L 2.0L</p> <p>CDAА,CETA CESA,CCZB BZB,CAWB VW 06H903017E VA TG14C037</p>
<p>ALV1442</p>  <p>ALV1442WA</p> <p>ARV1511</p> <p>12v 70amp a:42.5 b:22 c:45.5</p> <p>CITROEN, FIAT PEUGEOT Berlingo, Jumpy Scudo 206, 306, Partner</p> <p>WJY, WJZ DW8, NFU RFN, RFR PE 9621791680 VA A11VI91 HC CA1442IR</p>	<p>ALV1444</p>  <p>ALV1444RB ALV1444WA</p> <p>ARV1516 PAL0214</p>  <p>12v 110amp a:46 b:27 c:66.5</p> <p>RENAULT Clio Kangoo</p> <p>F4R730 F8Q630 F9Q780 VA A13VI195 RE 7700105539 HC CA1444IR</p>	<p>ALV1449</p>  <p>ALV1449RB ALV1449WA</p> <p>ARV1511</p> <p>12v 100amp a:38 b:28.5</p> <p>BMW 530 540 730 740</p> <p>3.0L</p> <p>BM 12311704081 VA A13VI59 HC CA1449IR</p>	<p>ALV1454</p>  <p>ARV1652 PAL0292</p>  <p>12v 90amp a:49 b:27 c:66</p> <p>RENAULT Espace 2.1 TD</p> <p>J8S610, J8S612 J8S772, J8S776 J8S778 RE 6025105563 VA A14N178 HC CA1454IR</p>
<p>ALV1467</p>  <p>12v 140Amp a:40 b:14 c:61</p> <p>VOLKSWAGEN AMAROK 2.0L</p> <p>CNEA,CSHA CNFB,CDBA CNFA VW 03L903024T VA TG14C067</p>	<p>ALV1484</p>  <p>ALV1484WA</p> <p>ARV1516 PAL0214</p>  <p>12v 75amp a:20 b:80 c:40</p> <p>DACIA, NISSAN RENAULT Logan, Sandero Kubistar Megane, Scenic</p> <p>K4J714 k4M700 E7J626 RE 7700101279 VA A11VI94 HC CA1484IR</p>	<p>ALV1495</p>  <p>ALV1495RB ALV1495WA</p> <p>ARV1526 PAL0280</p>  <p>PL F S</p> <p>12v 150amp a:51.5 b:30 c:57.5</p> <p>OPEL, VAUXHALL Sintra</p> <p>X22DTH</p> <p>OP 6204085 VA A14VI23 HC CA1495IR</p>	<p>ALV1496</p>  <p>ARV1511</p> <p>12v 80amp a:42.5 b:22 c:45.5</p> <p>CITROEN, FIAT PEUGEOT Berlingo, C5, Xsara Scudo 206, 306, Partner</p> <p>RHY, WJY WJZ, NFU HFХ, KFX VA A13VI203 PE 9623727280 HC CA1496IR</p>























Alternators

Valeo

<p>ALV1497</p>  <p>ALV1497WA ARV1042 PAL0214</p> <p>12v 70amp a:94 b:56</p> <p>CITROEN, PEUGEOT Saxo 106 206</p> <p>TU9M TU1M TU3JP PE 9633782480 VA A11V1101 HC CA1497IR</p>	<p>ALV1498</p>  <p>ALM1498RB ALM1498WA ALV1498WA ARV1564 PAL0213</p> <p>12v 70amp a:42.5 b:22 c:45.5</p> <p>CITROEN, PEUGEOT Berlingo C2, C4, Xsara 206, 307 1007</p> <p>NFU, KFV HFX, HFZ KFU, NFS PE 9633782580 VA A11V1106 HC CA1498IR</p>	<p>ALV1499</p>  <p>ALE1499RB ALM1499RB ALN1499RB ARV1564 PAL0213 ARV1562</p> <p>12v 80amp a:42.5 b:22 c:45</p> <p>CITROEN, FIAT PEUGEOT Berlingo, C4, C5, C8 Fiorino, Ulysse 206, 307, 406, 607</p> <p>6FZ, RFN, RFJ NFU, KFU, KFW 3FZ, NFZ PE 9630204580 VA A13V1236 HC CA1499IR</p>	<p>ALV1506</p>  <p>ARV1516 PAL0214</p> <p>12v 120amp a:47 b:26.5 c:64</p> <p>RENAULT Laguna 1.9 Megane</p> <p>F9Q716 F9Q732, F9Q731 F9Q736 RE 7700430182 VA SG10B010 HC CA1506IR</p>
<p>ALV1509</p>  <p>ALB1509RB ALV1509RB ALV1509WA ARV1561 PAL0292</p> <p>12v 150amp a:42.5 b:22 c:45.5</p> <p>CITROEN, FIAT PEUGEOT Berlingo, C4, Jumpy Ducato, Ulysse Boxer, Partner, 206</p> <p>4HY, RHV RHW, WJY RHY, RHZ PE 9467560280 VA A14V127 HC CA1509IR</p>	<p>ALV1513</p>  <p>12v 160Amp a:30 b:14 c:61</p> <p>RENAUT Grand scenic III 2.0L Laguna 2.0L Megane III 2.0L</p> <p>M4R711 M4R704 M4R726 NI 231000543R VA TG15C153</p>	<p>ALV1529</p>  <p>12v 150amp a:51 b:19 c:39</p> <p>HYUNDAI KIA IX35 diesel 2010</p> <p>HY 373002F000 VA FG15S029</p>	<p>ALV1553</p>  <p>ALV1553RB ALV1553WA ARV1561 PAL0292</p> <p>12v 150amp a:42.5 b:22 c:45.5</p> <p>ALFA ROMEO, CITROEN FIAT, LANCIA PEUGEOT, SUZUKI GT, C5, C8, Jumper Ducato, 307, 406</p> <p>RHW, RHS, 4HX RFR, RHY, 9HY 4HW, RHK, DW10UTD PE 9467560380 VA A14V135 HC CA1553IR</p>
<p>ALV1559</p>  <p>ALV1559WA ARV1663 PAL0232</p> <p>12v 120amp a:60.5 b:28 c:75.5</p> <p>BMW, LAND ROVER MG, ROVER 3, 5, 7, X, Z Freelander, ZT 75</p> <p>M57D30 S54B32 204D2, M47R BM 12312247389 VA SG12B080 HC CA1559IR</p>	<p>ALV1564</p>  <p>ALV1564WA ARV1511</p> <p>12v 90amp a:42 b:22 c:45.5</p> <p>CITROEN, FIAT LANCIA, PEUGEOT SCANIA Trucks EU Berlingo, Jumper Boxer, Partner, 206</p> <p>WJZ, RHY, WJY 6FZ, RHZ 4HX, RHS, 4HY FI 71716609 VA A13V1204 HC CA1564IR</p>	<p>ALV1572</p>  <p>ALV1572RB ALV1572WA ARV1516 PAL0214</p> <p>12v 120amp a:46.5 b:27 c:68</p> <p>RENAULT Espace Laguna Megane Scenic</p> <p>F9Q744 F9Q731 F9Q710 RE 7700431943 VA SG10B019 HC CA1572IR</p>	<p>ALV1573</p>  <p>ALV1573RB ALV1573WA ARV1528 PAL0291</p> <p>12v 75amp a:46 b:27 c:66.5</p> <p>VOLVO 440, 460, 480</p> <p>F3N VO 9031311 VA A11V176 HC CA1573IR</p>
























Alternators

Valeo

<p>ALV1574</p>  <p>ALV1574WA ARV0035</p> <p>24v 80amp b:27 c:68.5</p> <p>RENAULT VI 385 400 AE390 AE470</p> <p>MIDR062356A41 MIDR062356B41 MIDR062465A42 RE 5010306710 VA SG12B045 HC CA1574IR</p>	<p>ALV1578</p>  <p>ALV1578WA ARV1527 PAL0232</p>  <p>12v 100amp a:46.5 b:20 c:73.5</p> <p>BMW 3</p> <p>M43B19, M43164E3 M43B16 BM 12311435938 VA A13VI287 HC CA1578IR</p>	<p>ALV1579</p>  <p>ALV1579WA ARV1475 PAL0232</p>  <p>12v 100amp a:38 b:28</p> <p>BMW 730 740 7</p> <p>BM 12311702926 VA A13VI82R HC CA1579IR</p>	<p>ALV1583</p>  <p>ALV1583WA ARV1511</p> <p>12v 90amp a:55 b:26.5 c:56.5</p> <p>CITROEN, PEUGEOT Saxo 106</p> <p>VJY TUD5 PE 9636545580 VA A13VI273 HC CA1583IR</p>
<p>ALV1584</p>  <p>ALV1584WA ARV1560 PAL0232</p>  <p>12v 150amp a:60.5 b:28 c:75</p> <p>BMW, MAN OPEL, VAUXHALL 3, 5, 7, X Omega 18t</p> <p>Y25DT, M57306D1 M57D30, M47D20 M47204D1 VA SG15S030 OP 24451624 HC CA1584IR</p>	<p>ALV1589</p>  <p>ALV1589WA ARV1564 PAL0213</p>  <p>12v 90amp a:42.5 b:22 c:45.5</p> <p>CITROEN, FIAT PEUGEOT Berlingo, C5, C8, Xsara Ulysse, Partner 206, 307, 407, 607, 807</p> <p>HFZ, KFX NFU, HFX 6FZ, 3FZ, RFN PE 9642880180 VA A13VI277 HC CA1589IR</p>	<p>ALV1621</p>  <p>ALV1621RB ALV1621WA ARV1516 PAL0214</p>  <p>12v 110amp a:45 b:27 c:67</p> <p>RENAULT Clio Kangoo Laguna Megane</p> <p>F8Q630, F9Q780 F4P760, K4M710 F4P760, F4R780 RE 7700431944 VA A13VI253 HC CA1621IR</p>	<p>ALV1622</p>  <p>ALV1622WA ARV1516 PAL0214</p>  <p>12v 120amp a:46.5 b:27 c:65.5</p> <p>OPEL, RENAULT, VOLVO Movano 1.9 Dti Clio, Espace Kangoo 1.9, Megane S40, V40</p> <p>F9Q770 F9Q780, D4192T2 F9Q722, F4R700, F9Q733 OP 4404174 VA A13VI238 HC CA1622IR</p>
<p>ALV1627</p>  <p>ALV1627RB ALV1627WA ARV1546 PAL0214</p>  <p>12v 125amp a:32.5 b:14 c:60.5</p> <p>NISSAN, OPEL RENAULT, VAUXHALL VOLVO Interstar, Primastar Movano, Vivaro</p> <p>F4R720, F9Q760 G9U730 D4192T3, D4192T4 RE 7700426849 VA SG12B096 HC CA1627IR</p>	<p>ALV1631</p>  <p>ALV1631WA ARV1527 PAL0232</p>  <p>12v 100amp a:61 b:28 c:75.5</p> <p>BMW M</p> <p>S54B32 RO YLE000260 VA A13VI234 HC CA1631IR</p>	<p>ALV1640</p>  <p>ALV1640WA ARV1042 PAL0213</p>  <p>12v 70amp a:75 b:56</p> <p>CITROEN, PEUGEOT Saxo Berlingo 106 306</p> <p>KFX, HDZ NFZ, HFX NFU, HDY, NFT PE 9638276180 VA A11VI102 HC CA1640IR</p>	<p>ALV1641</p>  <p>ALV1641WA ARV1564 PAL0213</p>  <p>12v 80amp a:75 b:56</p> <p>CITROEN, PEUGEOT Saxo 106</p> <p>TU5JP TU5J2 NFZ, NFW PE 9634561480 VA A13VI288 HC CA1641IR</p>
























Alternators

Valeo

<p>ALV1642</p>  <p>ALV1642WA ARV1564 PAL0213</p>  <p>12v 97amp a:75 b:56</p> <p>CITROEN, PEUGEOT TU5JP Saxo TU5J2 106 NFZ, NFW PE 9634561480 VA A13V1279 HC CA1642IR</p>	<p>ALV1643</p>  <p>ALV1643WA ARV1079</p> <p>12v 120amp a:52 b:27 c:68.5</p> <p>CITROEN, FIAT 814043S PEUGEOT 814043N Jumper Ducato PE 5702C0 Boxer VA SG12B040 HC CA1643IR</p>	<p>ALV1645</p>  <p>ALV1645RB ALV1645WA ARV1546 PAL0214</p>  <p>12v 125amp a:36 b:14 c:61</p> <p>NISSAN, OPEL, VOLVO D4192T RENAULT, VAUXHALL K9K700 Kubistar, Primastar F9Q772, K9K702 Movano, Master OP 93160829 Clio, S40, V40 VA SG12B108 HC CA1645IR</p>	<p>ALV1653</p>  <p>ALV1653RB ALV1653WA ARV1516 PAL0214</p>  <p>12v 80amp a:46 b:27 c:67</p> <p>RENAULT F9Q732 Megane F9Q744 RE 8200064685 VA A13V1285 HC CA1653IR</p>
<p>ALV1661</p>  <p>ALV1661WA ARV1546 PAL0214</p>  <p>12v 125amp a:33 b:14 c:61</p> <p>NISSAN, OPEL F4R760 RENAULT, VAUXHALL G9T710 Interstar, Primastar F5R700 Movano, Vivaro RE 7700427476 Laguna, Master VA SG12B030 HC CA1661IR</p>	<p>ALV1662</p>  <p>ALV1662RB ALV1662WA ARV1549 PAL0214</p>  <p>12v 125amp a:32 b:14 c:61</p> <p>RENAULT F4P770 Laguna F4P773 RE 7711134758 VA SG12B055 HC CA1662IR</p>	<p>ALV1664</p>  <p>ALV1664RB ALV1664WA ARV1103 PAL0400</p>  <p>12v 120amp a:34.5 b:14 c:82</p> <p>AUDI, SKODA, VW AHL, ARM A4, A6 AEB, ANB, APU Superb AZM, ALZ, AZX Passat VW 06B903016F VA SG12B018 HC CA1664IR</p>	<p>ALV1665</p>  <p>ALV1665WA ARV1421 PAL0213</p>  <p>12v 80amp a:42 b:22 c:45.5</p> <p>CITROEN, PEUGEOT NFU, KFU, KFW C2, C3, C4 HFX, KVF, NFS Xsara 307 CI 9638544280 1007 VA SG8B022 HC CA1665IR</p>
<p>ALV1674</p>  <p>ALV1674RB ALV1674WA ARV1773 PAL0213</p>  <p>12v 150amp a:42.5 b:21 c:45</p> <p>CITROEN, FIAT, LANCIA DV4TED, 8HZ PEUGEOT, SUZUKI 8HX, RFK C1, C2, C3, C4, C5 DV4D, 4HX Ulysse, Liana CI 9640623580 107, 206, 307, 407, 607 VA TG15C119 HC CA1674IR</p>	<p>ALV1675</p>  <p>ALV1675WA ARV1103 PAL0400</p>  <p>12v 90amp a:29.5 b:14 c:61</p> <p>VW, SKODA AWY, CGPB, BMD Fabia CGPC Rapid AZQ, BME Polo VW 03D903025J VA SG9B057 HC CA1675IR</p>	<p>ALV1680</p>  <p>ALV1680WA ARV1103 PAL0400</p>  <p>12v 150amp a:37 b:20 c:22</p> <p>MERCEDES-BENZ OM668940 160 OM668942 170 OM668914 Vaneo MB A6681540302 VA SG9B057 HC CA1680IR</p>	<p>ALV1681</p>  <p>ALV1681WA ARV1564 PAL0213</p>  <p>12v 90amp a:42 b:22 c:45.5</p> <p>CITROEN, PEUGEOT HFX, KVF C2, C3, Xsara NFU, KFU 307 8HX, TUJ5JP4 PE 9642879780 VA A13V1283 HC CA1681IR</p>















Alternators

Valeo

<p>ALV1685</p>  <p>ALL1685WA PAL0281 </p> <p>12v 75amp a:92 b:56</p> <p>DAEWOO Korando 2.0 Korando 2.9 Diesel Korando 3.2 Musso 2.3</p> <p>M161E20, OM60129TD M161E23, M104995 OM662, M111970 DW 6621543202 VA 437798 HC CA1685IR</p>	<p>ALV1725</p>  <p>ALV1725RB ALV1725WA ARA1525 PAL0206 </p> <p>12v 80amp a:45.5 b:13 c:70</p> <p>NISSAN Micra</p> <p>CG10DE, CR12DE NI 23100AX600 VA TG8C011 HC JA1725IR</p>	<p>ALV1738</p>  <p>ALV1738RB</p> <p>24v 60amp b:27.5 c:70</p> <p>RENAULT V.I. 300, 400 340, 420 385</p> <p>MIDR062045D41 RE 5010306506 VA SG10B013 HC CA1738IR</p>	<p>ALV1746</p>  <p>ALB1746WA ALV1746WA ARV1103 PAL0400 </p> <p>12v 140amp a:30 b:14 c:82</p> <p>AUDI, SKODA, VW A4, A6, Allroad Superb Passat</p> <p>BDH, BAU, BDG AVK, ASN, AKE AYM, BBJ, AMM VW 078903016AC VA SG14B012 HC CA1746IR</p>
<p>ALV1750</p>  <p>ALV1750WA ARV1939 PAL0400 </p> <p>12v 90amp a:40 b:14 c:61</p> <p>VW Transporter</p> <p>AAC ABL VW 028903029M VA A13V1241 HC CA1750IR</p>	<p>ALV1752</p>  <p>ALV1752RB ALV1752WA ALV1752VA ARV1545 PAL0409 </p> <p>12v 120amp a:30 b:70 c:56</p> <p>MERCEDES-BENZ 160 180 200 230</p> <p>M271940 M271921 M271942 MB 2711540802 VA SG12B062 HC CA1752IR</p>	<p>ALV1755</p>  <p>ALV1755WA ARV1103 PAL0400 </p> <p>12v 90amp a:29.5 b:14 c:61</p> <p>VW, SKODA Fox Polo Fabia</p> <p>BMD, BME CHFA, AWY AZQ VW 03D903025H VA SG8B026 HC CA1755IR</p>	<p>ALV1756</p>  <p>ALV1756RB ALV1756WA ARV1369 PAL0413 </p> <p>12v 150amp a:61 b:28 c:75</p> <p>BMW 3</p> <p>M47D20, M47204D1 M57D30 M47N204D4 BM 12312249966 VA A14V134 HC CA1756IR</p>
<p>ALV1757</p>  <p>ALV1757WA ARV1369 PAL0413 </p> <p>12v 150amp a:60 b:28 c:75.5</p> <p>BMW, LAND ROVER 3 X Freelander</p> <p>M47 M47N204D4 M57N306D2 BM 12317789980 VA TG15C012 HC CA1757IR</p>	<p>ALV1761</p>  <p>ALB1761WA ALV1761RB ARV1828 PAL0214 </p> <p>12v 150amp a:42 b:21 c:45</p> <p>CITROEN, FIAT LANCIA, PEUGEOT Berlingo, C2, C3, C4, C5 206, 207, 307, 407, 607 Ducat, Scudo, Ulysse</p> <p>DV6B, DV6ATED4 9HY, 9HZ, RHR 4HY, RHV, 4HX PE 5702E1 VA TG15C020 HC CA1761IR</p>	<p>ALV1762</p>  <p>ALV1762WA ARV1546 PAL0213 </p> <p>12v 110amp a:42.5 b:14.5 c:60</p> <p>DACIA, NISSAN RENAULT Duster, Logan Sandero, Almera Micra, Megane</p> <p>K9K710 K4J730 K4M761 RE 7701474416 VA TG11C064 HC CA1762IR</p>	<p>ALV1767</p>  <p>ALV1767WA ARV1574 PAL0213 </p> <p>12v 155amp a:33 b:14 c:60</p> <p>RENAULT Espace Grand Scénic 1.9L Megane</p> <p>F9Q680, F9Q820, F9Q812 G9T742, F9Q800, F4R797 J7R768, F4R794, F4R795 RE 7711134926 VA SG15L027 HC CA1767IR</p>













Alternators

Valeo

<p>ALV1768</p>  <p>ALV1768RB ALV1768WA</p> <p>ARV1546 PAL0213</p>  <p>12v 110amp a:32.5 b:14 c:60.5</p> <p>RENAULT Grandscenic Megane Scenic</p> <p>F9Q812 F4K770 F9Q800 RE 8200495294 VA TG11C022 HC CA1768IR</p>	<p>ALV1771</p>  <p>ALV1771WA</p> <p>ARV1549 PAL0214</p>  <p>12v 120amp a:20 b:80 c:40</p> <p>RENAULT Clio Laguna Megane Scénic 1.4</p> <p>K4M708, K4M748, K4J758 K4M716, M9R700, K9K722, 3, 5, X, Z M9R740, K4J714, F4R740 RE 8200054590 VA SG10B020 HC CA1771IR</p>	<p>ALV1774</p>  <p>ALB1774RB ALV1774WA</p> <p>ARV1334 PAL0409</p>  <p>12v 145amp a:29 b:62.5</p> <p>BMW, PORSCHE</p> <p>N46B20 N45B16A N46B20C BM 12317521384 VA SG14B017 HC CA1774IR</p>	<p>ALV1778</p>  <p>ALV1778WA</p> <p>ARA1820 PAL0233</p>  <p>12v 150amp a:41.5 b:21 c:45</p> <p>FORD, MAZDA Fiesta Fusion 2</p> <p>F6JA F6HB PE 9643001680 VA SG15S019 HC CA1778IR</p>
<p>ALV1781</p>  <p>ALV1781WA</p> <p>ARV1079</p> <p>12v 90amp a:52 b:27 c:68.5</p> <p>CITROEN, FIAT PEUGEOT Jumper Ducato Bpxer</p> <p>814043S F28TDCR FI 504033459 VA SG9B054 HC CA1781IR</p>	<p>ALV1810</p>  <p>ALV1810WA ALV810WA</p> <p>ARV1547 PAL0400</p>  <p>12v 110amp a:39 b:14 c:61</p> <p>AUDI, SEAT, SKODA, VW Audi A3 1.9 Tdi SKODA Octavia Tdi</p> <p>BLS BMM VW 06F903023D VA TG11C017 HC CA1810IR</p>	<p>ALV1814</p>  <p>ALV1814RB ALV1814WA</p> <p>ARV1546 PAL0213</p>  <p>12v 125amp a:32.5 b:14 c:60.5</p> <p>NISSAN, RENAULT Primera Megane Scenic</p> <p>F9Q F4R770 F9Q800 RE 7711135333 VA SG12B052 HC CA1814IR</p>	<p>ALV1829</p>  <p>ALV1829WA</p> <p>ARV1546 PAL0213</p>  <p>12v 100amp a:33 b:14 c:61</p> <p>OPEL, VAUXHALL NISSAN, RENAULT Primastar 2.0 Vivaro 2.0</p> <p>F4R720, F4R722 F4R720, F4R820, F4R RE 8200495278 VA SG9B053 HC CA1829IR</p>
<p>ALV1835</p>  <p>ALV1835WA</p> <p>ARV1514</p> <p>12v 120amp a:51.5 b:27 c:65</p> <p>CITROEN, PEUGEOT FIAT Jumper 2.8 Ducato 2.5 Boxer 2.8</p> <p>814063 814067, 814043, 814063 FI 500362607 VA A14V137 HC CA1835IR</p>	<p>ALV1836</p>  <p>ALV1836WA</p> <p>ARV1521 PAL0400</p>  <p>12v 120amp a:28.5 b:14 c:61</p> <p>FORD Galaxy 2.0L/2.3L 16V (95-06)</p> <p>E5SB E5SA ZVSA FO YM2110300AA VA SG12B042 HC CA1836IR</p>	<p>ALV1850</p>  <p>ALV1850RB ALV1850WA</p> <p>ARV1278 PAL0214</p>  <p>12v 150amp a:42 b:21 c:45</p> <p>CITROEN, PEUGEOT Berlingo C1, C2 206 Partner</p> <p>8HZ 8HX RHY PE 9644529680 VA TG15C023 HC CA1850IR</p>	<p>ALV1855</p>  <p>ALV1855WA</p> <p>ARV1115</p> <p>12v 75amp a:40.5 b:64 c:55</p> <p>FIAT, LANCIA, SUZUKI OPEL, VAUXHALL Punto, Ypsilon Astra, Corsa, Tigra Agila, Combo, Wagon</p> <p>Z13DT, Z13DTJ 188A9000 199A2000, 199A3000 FI 51718499 VA TG8S014 HC CA1855IR</p>




















Alternators

Valeo

<p>ALV1856</p>  <p>ALV1856WA ARV1561</p> <p>12v 75amp a:40 b:64 c:55</p> <p>FIAT, LANCIA Punto 1.3 Musa 1.3</p> <p>JTD, Multijet, Diesel Multijet, Diesel FI 46823546 VA TG8S010 HC CA1856IR</p>	<p>ALV1862</p>  <p>ALV1862WA ARV1115</p> <p>12v 90amp a:41 b:64 c:55</p> <p>ALFA ROMEO, FIAT LANCIA, SUZUKI OPEL, VAUXHALL Astra, Combo, Corsa Doblo, Panda, Punto</p> <p>188A9000 Z13DT 199A300 OP 13117279 VA TG9S037 HC CA1862IR</p>	<p>ALV1866</p>  <p>ALV1866RB ALV1866WA ARV1416 PAL0453</p> <p>12v 90amp a:32 b:14.5 c:61</p> <p>RENAULT Modus Twingo Wind Clio</p> <p>D4F740, D4F764, D4F784 D4F780, D4F772, D7F800180 D4F782 RE 8200654541 VA TG9B042 HC CA1866IR</p>	<p>ALV1873</p>  <p>ALV1873RB ALV1873WA ARV1576 PAL0410</p> <p>12v 150amp a:32 b:151.5 c:43</p> <p>MERCEDES OM640940 OM640941 OM640942 MB 6401540102 VA TG15C121 HC CA1873IR</p>
<p>ALV1874</p>  <p>ALV1874RB ALV1874WA ARV1568 PAL0410</p> <p>12v 115amp a:29 b:142 c:43</p> <p>MERCEDES-BENZ A 150, A 160, A 170 A 200, B 150, B 170 B 200</p> <p>M266960 M266980, M266920 W245 MB A2661540902 VA TG11C021 HC CA1874IR</p>	<p>ALV1875</p>  <p>ALV1875RB ARV1948 PAL0410</p> <p>12v 90amp a:29 b:142 c:43</p> <p>MERCEDES-BENZ A 150, A 170 B 150, B 170</p> <p>M266920, M266940 MB A2661540802 VA SG9B068 HC CA1875IR</p>	<p>ALV1879</p>  <p>ALV1879WA ARV1562 PAL0213</p> <p>12v 90amp a:41.5 b:22 c:45.5</p> <p>CITROEN, FIAT PEUGEOT Jumper Ducato Boxer</p> <p>RHV 4HY PE 9655296080 VA SG10B048 HC CA1879IR</p>	<p>ALV1881</p>  <p>ALV1881RB ALV1881WA ARV1549 PAL0214</p> <p>12v 120amp a:42 b:14 c:61</p> <p>NISSAN RENAULT Micra Logan Clio</p> <p>K9K790, K12, K9K K9K792, K9K700 K9K704 NI 2310000QBE VA SG12B103 HC CA1881IR</p>
<p>ALV1904</p>  <p>ALV1904 ARV1543 PAL0410</p> <p>12v 150amp a:55.5 b:28 c:75.5</p> <p>BMW 118, 120 318, 320, 325, 330</p> <p>M47N204D4, N47D20A, E90, E91, M47N20 M47D20TU, M47N204D5, BM 12317799180 VA TG15C027 HC CA1904IR</p>	<p>ALV1905</p>  <p>ALV1905WA ARV1854 PAL0409</p> <p>12v 170amp a:60 b:28.5 c:76.5</p> <p>BMW 5 7 M</p> <p>M57N2 S85B50A M57306D4 BM 12317789981 VA TG17C010 HC CA1905IR</p>	<p>ALV1906</p>  <p>ALV1906 ARV1115 PAL0206</p> <p>12v 120amp a:33 b:13 c:51</p> <p>HYUNDAI, KIA Accent 1.5, Elantra 1.6 Getz 1.5, Matrix 1.5 Cerato 1.5, Rio 1.5</p> <p>D4FA D4FB D3EA KI 373002A110 VA TG12C033 HC CA1906IR</p>	<p>ALV1910</p>  <p>ALV1910WA ARV1987 PAL0407</p> <p>12v 180amp a:39 b:14 c:61</p> <p>AUDI A6 A6 (4F) 2.0TDI</p> <p>BNA, BRF BLB, BRE BVG VW 03G903016A VA TG17C054 HC CA1910IR</p>

























Alternators

Valeo

<p>ALV1911</p>  <p>ALV1911WA ARV1103 PAL0400</p>  <p>12v 150amp a:30 b:14 c:61</p> <p>AUDI A4</p> <p>BPP ASB, BKN BSG VW 059903016D VA TG16C013 HC CA1911IR</p>	<p>ALV1920</p>  <p>ALV1920WA ARV1278 PAL0214</p>  <p>12v 180amp a:42.5 b:21 c:45</p> <p>CITROEN, PEUGEOT FIAT, LANCIA C4, C5, C6, C8 Ulysse 2.0, Phedra 2.0 307, 407, 607, 807</p> <p>9HY, 9HZ, RHJ, RHR DV6TED4, 4HT, RHK 4HW, DW10UTED4 CI 9661544880 VA FG18S017 HC CA1920IR</p>	<p>ALV1921</p>  <p>ALV1921WA ARV1521 PAL0400</p>  <p>12v 110amp a:29.2 b:14.5 c:60.5</p> <p>VW, SKODA Golf, Passat Jetta Polo Rapid</p> <p>CAVD, CMXA, BLG CAXA, CBEA, BMY CAVE VW 03C903023GX VA TG11C048 HC CA1921IR</p>	<p>ALV1932</p>  <p>ALV1932WA ARV1042 PAL0213</p>  <p>12v 70amp a:42.5 b:22 c:45.5</p> <p>CITROEN, PEUGEOT C2, C4 Berlingo Xsara 206</p> <p>NFS NFU, NfV HFZ, RFN, HFX PE 9644927080 VA A11V199 HC CA1932IR</p>
<p>ALV1933</p>  <p>ALV1933WA ARV1546 PAL0214</p>  <p>12v 125amp a:38.5 b:14 c:61</p> <p>DACIA, NISSAN RENAULT Logan, Sandero Kubistar Kangoo</p> <p>K9K704, K9K714 K9K700, K9K702 K9K722 RE 6001548553 VA SG12B105 HC CA1933IR</p>	<p>ALV1934</p>  <p>ALV1934WA ARV5990</p> <p>12v 105amp a:40.5 b:63.5 c:55</p> <p>OPEL, VAUXHALL FIAT, LANCIA 500, Doblo, Linea Astra, Corsa Meriva</p> <p>169A1000, 199A2000 199A3000, Y13DT Z13DTH, Z13DT OP 1204429 VA TG9S011 HC CA1934IR</p>	<p>ALV1936</p>  <p>ALV1936WA ARV1571 PAL0454</p>  <p>12v 150amp a:32.5 b:14 c:60.5</p> <p>RENAULT Grand Scénic 2.0 Megane Scénic 2.0</p> <p>M9R700, M9R724 RE 8200404461 VA TG15C091 HC CA1936IR</p>	<p>ALV1937</p>  <p>ALV1937RB ALV1937WA ALV937WA ARV1545 PAL0414</p>  <p>12v 180amp a:29.5 b:14 c:61</p> <p>AUDI, VW A6, A8 Touareg 3.0 Tdi</p> <p>BPP CASB VW 059903017K VA TG17C020 HC CA1937IR</p>
<p>ALV1953</p>  <p>ALV1953RB ALV1953WA ARV1543 PAL0407</p>  <p>12v 180amp a:28 b:62.5 c:42.5</p> <p>BMW 330 X3, X5 730 630</p> <p>N52B30, N52B30A E92, E93, N53B30A N52B25 BM 12317555926 VA TG17C015 HC CA1953IR</p>	<p>ALV1954</p>  <p>ALV1954WA ARV1149 PAL0212</p>  <p>12v 120amp a:25 b:80 c:48</p> <p>CITROEN, PEUGEOT, MINI C3, C4, C5 DS3 Cooper 1.6 207, 308</p> <p>EP3, 8FR, EP6, 5FS, 5FT EP6DT, EP6, 5FV, 8FR R57, R56, R55, EP3 PE 5702J0 VA TG12C059 HC CA1954IR</p>	<p>ALV1959</p>  <p>ALV1959RB ALV1959WA ALV959WA ARV1319 PAL0213</p>  <p>12v 150amp a:32 b:14 c:61</p> <p>Nissan, Opel, Renault Primastar 2.0 Dci Laguna 2.0 Dci</p> <p>X83 M9R740 RE 8200404459 VA TG15C058 HC CA1959IR</p>	<p>ALV1963</p>  <p>ALV1963WA ARV1546 PAL0214</p>  <p>12v 80amp a:44 b:13 c:67.5</p> <p>NISSAN Micra March Note</p> <p>K12 E11 NI 23100AX610 VA TG8C018 HC CA1963IR</p>





















Alternators

Valeo

<p>ALV1974</p>  <p>ALV1974WA ARV1571 PAL0453 </p> <p>12v 150amp a:38.5 b:14 c:61.5</p> <p>RENAULT Clio Megane Cangoo</p> <p>KR0G, KZ0C BZ0C, DZ0C, DZ1A KW0A, KW0F NI 231000026R VA TG15C146 HC CA1974IR</p>	<p>ALV1975</p>  <p>ALV1975WA ALV975WA ARV1571 PAL0454 </p> <p>12v 110amp a:38.5 b:14 c:61</p> <p>RENAULT KANGOO 1.6</p> <p>K4M K4M830 RE 8200772726 VA TG11C069 HC CA1975IR</p>	<p>ALV1976</p>  <p>ALV1976RB ALV1976WA ARV1549 PAL0214 </p> <p>12v 95amp a:53.5 b:27 c:67.5</p> <p>NISSAN, RENAULT Kubistar Clio, Kangoo Thalia, Sandero</p> <p>D4F712, D4F722 D4F706, D7F710 D7F726, D7F746 RE 7700437090 VA SG9B035 HC CA1976IR</p>	<p>ALV1977</p>  <p>ALV1977WA ARV1915 PAL0214 </p> <p>12v 80amp a:45.5 b:13 c:67</p> <p>NISSAN Micra Note</p> <p>CR12DE CR14DE NI 23100AX62B VA TG8S024 HC CA1977IR</p>
<p>ALV1982</p>  <p>ALV1982WA ARV1560 PAL0232 </p> <p>12v 120amp a:69 b:28 c:75.5</p> <p>BMW M3 Z3</p> <p>S54B32, S54N32 S54326S4 BM 12317831436 VA SG12B039 HC CA1982IR</p>	<p>ALV1986</p>  <p>ALV1986WA ARV1305 PAL0407 </p> <p>12v 140amp a:39 b:14.5 c:61</p> <p>AUDI A4, A5 Q5</p> <p>CAGA, CAGB, CAGC CAHB, CAHA VW 03G903016E VA TG15C149 HC CA1986IR</p>	<p>ALV1992</p>  <p>ALV1992WA ARV1332 PAL0407 </p> <p>12v 140amp a:29.5 b:14 c:60.5</p> <p>AUDI A4, A5 Q5</p> <p>CAMA, CAMB, CGKA, CGKB CGKB, CCWA, CAPA CGKB VW 059903016E VA TG14C022 HC CA1992IR</p>	<p>ALV1993</p>  <p>ALV1993RB ALV1993WA ARA1820 PAL0233 </p> <p>12v 80amp a:38.5 c:73.5</p> <p>BMW Ka</p> <p>A9B FO 4S5T10300AA VA TG7S012 HC CA1993IR</p>
<p>ALV1996</p>  <p>ALV1996WA ARV1545 PAL0409 </p> <p>12v 150amp a:28 b:70 c:58</p> <p>AUDI A6, A6Q 2005-> 2.0 TFSI</p> <p>A6Q BPJ BYK VW 06E903016D VA TG16C014 HC CA1996IR</p>	<p>ALV2002</p>  <p>ALV2002WA ARV1103 PAL0400 </p> <p>12v 140amp a:29.5 b:14 c:61</p> <p>AUDI A4 Avant A4 Saloon A4 Convertible</p> <p>BPP, BSG, ASB BKN VW 059903023A VA TG14C014 HC CA2002IR</p>	<p>ALV2003</p>  <p>ALV2003WA ARV1571 PAL0454 </p> <p>12v 110amp a:38.5 b:14 c:61</p> <p>RENAULT Kangoo Megane Twingo</p> <p>K4M, K4M830 K4M812, K4M856 K4M754, K4M854 RE 8200410669 VA TG11C060 HC CA2003IR</p>	<p>ALV2008</p>  <p>ALB2008RB ALV2008WA ARV1885 PAL0213 </p> <p>12v 150amp a:41.5 b:21 c:45</p> <p>CITROEN, PEUGEOT MITSUBISHI C-Crosser 2.2 4007 Outlander</p> <p>DW12MTED4 CW7W PE 9662731680 VA TG15C112 HC CA2008IR</p>

Alternators

Valeo

<p>ALV2025</p>  <p>ALV2025WA ARV1574 PAL0213</p>  <p>12v 155amp a:32.5 b:14.5 c:61</p> <p>RENAULT Espace Grand Scénic 1.9 Megane</p> <p>F9Q680, F9Q820, F9Q804 F4R790, F4R791, F4R797C4, C5 J7R768, F9Q812, F9Q800 RE 8200225806 VA SG15L033 HC CA2025IR</p>	<p>ALV2030</p>  <p>ARV5987 PAL0212</p>  <p>12v 180amp a:47 b:21 c:45</p> <p>CITROEN, PEUGEOT RHE, RHH, 9HL, 9HR DW10CTED4</p> <p>0407, 308 3008 2.0 5008 2.0</p> <p>PE 9663010980 VA FG18S027 HC CA2030IR</p>	<p>ALV2031</p>  <p>ALV2031WA ARV5953 PAL0214</p>  <p>12v 90amp a:42 b:21.5 c:45.5</p> <p>CITROEN PEUGEOT Nemo 1.4L Diesel Beeper 1.4L Diesel</p> <p>8HS, DV4TED PE 9663647980 VA TG9B049 HC CA2031IR</p>	<p>ALV2033</p>  <p>ALV2033WA 599240 PAL0212</p>  <p>12v 150amp a:41.5 b:21.5 c:45.5</p> <p>CITROEN, PEUGEOT DW10CTED4 DV6DTEd DV6C PE 9664779680 VA TG15C135 HC CA2033IR</p>
<p>ALV2037</p>  <p>ALV2037WA ARV1079</p> <p>12v 150amp a:52 b:27 c:66.5</p> <p>CITROEN FIAT, PEUGEOT Jumper Ducato Boxer</p> <p>IV 500345767 VA SG15S032 HC CA2037IR</p>	<p>ALV2038</p>  <p>ALV2038WA ARV1573 PAL0407</p>  <p>12v 180amp a:30.5 b:70 c:56.5</p> <p>MERCEDES Sprinter Viano Vito</p> <p>OM646984 OM646985 OM646986 MB 6461540102 VA TG17C061 HC CA2038IR</p>	<p>ALV2041</p>  <p>ALV2041RB ARV1095 PAL0410</p>  <p>12v 180amp a:57 b:28 c:75.5</p> <p>BMW 1 3 X1 X3</p> <p>E81, E87 E90, E84 E83 MB A6461541102 VA FG18S019 HC CA2041IR</p>	<p>ALV2043</p>  <p>ALV2043RB ALV2043WA ARV1546 PAL0213</p>  <p>12v 110amp a:38.5 b:14 c:61</p> <p>RENAULT, DACIA Duster Megane Logan Tondar</p> <p>F9Q800 F9Q803 RE 8200667607 VA TG11C027 HC CA2043IR</p>
<p>ALV2055</p>  <p>ALV2055WA ARV1573 PAL0407</p>  <p>12v 180amp a:29.5 b:70 c:55.5</p> <p>MERCEDES A-class, 160, 180, 200 G-class, G320 GL-class, GL320, GL420 ML-class, 280, 320, 420</p> <p>W169, W463, OM642970 X164, W164, OM642940 OM629912, W251 MB A6421540302 VA TG17C032 HC CA2055IR</p>	<p>ALV2058</p>  <p>12v 220Amp a:61 b:28 c:76</p> <p>BMW 5 Series F10 F18 6 Series F11 F12 F13 x5 E71 E72 x6 E71 E72</p> <p>N57D30A N57D30B N57D30C BM 12317823341 VA FG23S058</p>	<p>ALV2078 <i>New</i></p>  <p>12v 120amp a:39 b:14 c:61</p> <p>RENAULT Megane</p> <p>RE 231000027R VA TG12C078 MH ALV2078</p>	<p>ALV2092 <i>New</i></p>  <p>ALV2092WA ARV1549</p> <p>12v 120amp a:31.5 b:15 c:61</p> <p>DACIA, RENAULT Duster</p> <p>F4R RE 231007562R VA TG12C092 VA 439790</p>

Alternators

Valeo

<p>ALV2101 <i>New</i></p>  <p>ALV2101RB 595411 PAL0454</p>  <p>12v 120amp a:31 b:14 c:61</p> <p>RENAULT GRAND 1.9 dCi (02.09-) MEGANE III 1.9 dCi (11.08-) SCHNIC III 1.9 dCi (02.09-) RE 8201049749 VA TG12C077 HC CA2101IR</p>	<p>ALV2183 <i>New</i></p>  <p>ALV2183WA ARV1661</p> <p>12v 60amp</p> <p>KHD Engine 2.7 Engine 2.0</p> <p>F4L1011 F3L1011 KH 01179755 VA A13N165 CG 112183</p>	<p>ALV2245 <i>New</i></p>  <p>12v 120amp a:52 b:33 c:61</p> <p>OPEL Astra 1.4L 2009- Meriva 1.4L 2010- Zafira 1.4L 2011-</p> <p>A14NEL, A14NET A14XER B14NEL, B14XER OP 1202245 VA FG12S048 WA 11654N</p>	<p>ALV2247</p>  <p>ARV1204</p> <p>12v 90Amp a:41 b:64 c:56</p> <p>FIAT ALFA ROMEO MITO 500L, PUNTO EVO 1.3L 2009-></p> <p>199B1000 199B4000 233A9000 FI 51880174 VA 439786</p>
<p>ALV2303 <i>New</i></p>  <p>ARV1103</p> <p>12v 110amp a:28 b:13 c:62</p> <p>AUDI A3 8PA 1.2 TSI 04.10- CBZB SKODA YETI 5L 1.2 TSI 09.09- VOLKSWAGEN CADDY III VW 03F903023E VA 440323</p>	<p>ALV2308 <i>New</i></p>  <p>ARV1159</p> <p>12v 220amp a:29 b:14 c:61</p> <p>VOLKSWAGEN TOUAREG 7P5 3.6 V6 FSI 2010-></p> <p>CGRA VW 03H903023D VA 439711 MH ALV2308</p>	<p>ALV2312</p>  <p>12v 50amp a:28 b:69 c:58</p> <p>MERCEDES-BENZ C-CLASS MZ A0009060501 VA TG15C181 DR DRA0818</p>	<p>ALV2327</p>  <p>ARV5912</p> <p>12v 220Amp a:32 b:70 c:58</p> <p>MERCEDES-BENZ S-Class VI (W221) S350 4Matic 2011-></p> <p>M276950 ME A0141544302 VA FG23S027</p>
<p>ALV2330</p>  <p>ARV1103</p> <p>12v 140Amp a:27 b:70 c:58</p> <p>VOLKSWAGEN Multivan V 2.0L Transporter V 2.0L CJKA CJKB VW 06A903023E VA TG14C040</p>	<p>ALV2335 <i>New</i></p>  <p>ARV1183</p> <p>12v 220amp a:26 b:14 c:62</p> <p>AUDI A6 Allroad II (4GH) A6 Avant IV (4G5,C7) A7 Sportback (4GA) WV 059903018J VA FG23S035 MH ALV2335</p>	<p>ALV2339 <i>New</i></p>  <p>ARV1127</p> <p>12v 220amp a:27 b:15 c:60</p> <p>MERCEDES BENZ S-Class VI (W221) 2011-> M278920 ME A0009062200 VA FG23S039 MH ALV2339</p>	<p>ALV2341</p>  <p>12v 220Amp a:60 b:28 c:76</p> <p>BMW 3 Series F30 F35 F80 3.0L 4 Series F33 F36 F83 3.0L X5 F15 3.0L N57D30A N57D30B N57D30C BM 12318509227 VA FG23S041</p>

Alternators

Valeo

<p>ALV2349 <i>New</i></p>  <p>12v 230amp a:25 b:70 c:59</p> <p>MERCEDES-BENZ S-Class</p> <p>MB A0009064500 VA FG23S049 MH ALV2349</p>	<p>ALV2357 <i>New</i></p>  <p>12v 220amp a:31 b:14 c:62</p> <p>VOLKSWAGEN TOUAREG</p> <p>CJGD CRCA CNRB WV 059903023L VA 440407 MH ALV2357</p>	<p>ALV2369 <i>New</i></p>  <p>12v 140amp a:60 b:22 c:57</p> <p>OPEL Astra 1.6L</p> <p>ARV1069 PAL0243</p> <p>OP 13500329 VA TG12C069 MH ALV2369</p> 	<p>ALV2548</p>  <p>ALV2548WA</p> <p>12v 60amp</p> <p>KHD Engine</p> <p>F4L1011</p> <p>KH 1180660 VA A13N271 CG 112548</p> 
<p>ALV2593</p>  <p>12v 120amp a:62 b:22 c:61</p> <p>OPEL VAUXHALL</p> <p>OP 1202188 VA TG12C054</p>	<p>ALV2611</p>  <p>12v 130Amp a:33 b:13 c:51</p> <p>KIA CEED 1.6L Sportage 1.6L IHYUNDAI I30 1.6L I40 1.6L</p> <p>D4FB D4FB-L D4FD-L HY 373002A850 VA 2611067</p>	<p>ALV2650</p>  <p>12v 120Amp a:35 b:14 b:54</p> <p>HYUNDAI ix20 1.4L ix20 1.6L KIA Venga 1.6L Ceed 1.6L</p> <p>D4FC D4FC-M D4FB HY 373002A650 VA TG12C141</p>	<p>ALV2976 <i>New</i></p>  <p>12v 120amp a:50 c:19 c:36</p> <p>OPEL Astra J 2010-></p> <p>A13DTE</p> <p>OP 13502987 VA TG12C076 WD ALT14485</p>
<p>ALV2978 <i>New</i></p>  <p>12v 120amp a:37 b:20 c:48</p> <p>PEUGEOT 208 PEUGEOT 301 1.0 VtI 12V [EB0] 68 6/2005-></p> <p>EB</p> <p>ARV5915</p> <p>PE 967089978A VA TG12C106 VA 439758</p>	<p>ALV3012</p>  <p>ALV3012WA</p> <p>12v 230amp a:54 c:75.5</p> <p>BMW X5 (E70) xDrive35d X6</p> <p>E70 E71 N57N306D5 BM 12317801124 VA TG23C012 HC CA2100IR</p> <p>ARV1232 PAL0410</p> 	<p>ALV3013</p>  <p>12v 110amp a:49 b:54 c:74</p> <p>FORD Mondeo</p> <p>B5Y B4Y BWY FO 2S7T10300AA VA TG12C013 MS 210415</p> <p>ARA1820 PAL0233</p> 	<p>ALV3017 <i>New</i></p>  <p>12v 180amp a:35 b:12 c:62</p> <p>AUDI A4 A5 Q5</p> <p>CAGA, CJCB CJCA, CAHB CGLD, CMGB VW 03L903017B VA FG20S016 MH ALV3017</p>













Alternators

Valeo

<p>ALV3018</p>  <p>ALV3018WA ARV1232</p> <p>12v 230amp a:27 b:62 c:45</p> <p>BMW 7 (F01, F02) 740i 2008-> X6 xDrive35i 2008-></p> <p>F01 F02 E71, N54B30A BM 12317573754 VA TG23C018 VA 440206</p>	<p>ALV3022</p>  <p>ALV3022WA ARV1545</p> <p>12v 180amp a:39 b:14 c:60</p> <p>AUDI A6 (4F2) 3.0 quattro [BBJ] BBJ</p> <p>4F2 BBJ VW 06C903016J VA TG17C022 MS 210551</p>	<p>ALV3023</p>  <p>ALV3023 ARV1103</p> <p>12v 140amp a:39.5 a:13 c:61</p> <p>AUDI, VW SEAT, SKODA Passat, Golf Yeti, Octavia A3, A4, TT</p> <p>VW 06F903023P VA TG14C023 VA 440240</p>	<p>ALV3026</p>  <p>ALV3026WA ARV1952</p> <p>12v 200amp a:94 b:70</p> <p>CHRYSLER 300 C Saloon 3.0L 300 C Touring 3.0L</p> <p>CH 04896808AA VA TG17C026 VA 440037</p>
<p>ALV3028</p>  <p>ALV3028WA ARA1531 PAL0200</p> <p>12v 110amp a:43.5 b:23 c:44</p> <p>KIA Magentis 2.7L HYUNDAI Santa Fe 2.7L Sonata 2.7L</p> <p>HD 3730037400 VA TG11C024 VA 439295</p>	<p>ALV3031 <i>New</i></p>  <p>12v 180amp a:30 b:12 c:62</p> <p>AUDI A4 AUDI A5 AUDI A6 AUDI A7 AUDI Q5</p> <p>CLAB, CDUC CKVB, CKVC CCQB, CDUD VW 059903018Q VA FG20S018 MH ALV3031</p>	<p>ALV3032</p>  <p>ALV3032WA ARV1464</p> <p>12v 220amp a:60 b:28 c:74</p> <p>BMW 5 Serie</p> <p>520D BM 12318507625 VA FG23S032 VA 439730</p>	<p>ALV3034</p>  <p>ALV3034WA ARV1853 PAL0410</p> <p>12v 170amp a:69 b:28 c:76</p> <p>BMW X5 X6</p> <p>E70 E71, N57N306D5 M57N306D5 BM 12317796125 VA TG17C034 HC CA2095IR</p>
<p>ALV3036</p>  <p>ALV3036WA ARV1853 PAL0409</p> <p>12v 180amp a:60 b:28 c:76</p> <p>BMW X5 4.8L (E70) 3.0d xDrive30i</p> <p>BM 12317561004 VA TG17C036 WA 11396R</p>	<p>ALV3037</p>  <p>ALV3037WA ARV1576 PAL0403</p> <p>12v 120amp a:10.5 b:72 c:52.5</p> <p>FORD Fiesta Mondeo</p> <p>STJA, STJB, HXJA SNJA, SNJB, HXJB SPJA, SPJB, RHBA FO 1685794 VA TG12C037 HC CA2044IR</p>	<p>ALV3038</p>  <p>ALV3038WA ARV1576 PAL0403</p> <p>12v 120amp a:41 b:21 c:45.5</p> <p>FORD, MAZDA, RENAULT Fiesta Demio Modus</p> <p>MZRCD MZ Y40518300 VA TG12C038 HC CA2091IR</p>	<p>ALV3044</p>  <p>ALV3044WA ARV1987 PAL0407</p> <p>12v 180amp a:92 b:70</p> <p>AUDI A6 Allroad Quattro</p> <p>4F2, BKH BDW, 4FH AUK VW 06E903016G VA TG17C044 VA 439554</p>

Alternators

Valeo

<p>ALV3048</p>  <p>ARV3097</p> <p>12v 220amp a:91 b:71 c:60</p> <p>MERCEDES-BENZ R Class Sprinter Vito 3.0CDi</p> <p>OM642838 OM642853 OM642858 MB A0009067400 VA FG23S048 MH ALV3048</p>	<p>ALV3057</p>  <p>ALV3057WA ARV1103 PAL0419</p> <p>12v 110amp a:30 b:14 c:61</p> <p>AUDI, SEAT, VW, SKODA A3 Altea Golf, Passat Laura, Octavia</p> <p>8P1, CAXC CMSA, 5P5 CAXC, CAXA VW 03C903023H VA TG11C057 HC CA2056IR</p>	<p>ALV3063 <i>New</i></p>  <p>ARV1238 PAL0410</p> <p>12v 220amp a:33 b:13 c:61</p> <p>AUDI Q7 V6 3.0 TFSi</p> <p>CJWE, CJTB CTWB, CTWA CNAA, CJWB VW 06E903023B VA FG23S065 VA 439816</p>	<p>ALV3073</p>  <p>ALV3073WA ARV1552 PAL0400</p> <p>12v 120amp a:19.5 b:101 c:43</p> <p>MINI MINI Convertible</p> <p>BM 12317515426 VA SG12S073 HC CA2052IR</p>
<p>ALV3077</p>  <p>ALV3077WA PAL0400</p> <p>12v 180amp a:27 b:69 c:59</p> <p>MERCEDES-BENZ C - Class E - Class</p> <p>MB A0141543302 VA FG18S077 VA 440328</p>	<p>ALV3094</p>  <p>ALV3094WA ARV1305 PAL0408</p> <p>12v 150amp a:25 b:70 c:64</p> <p>AUDI A4 A5 Q5</p> <p>VW 06E903016S VA TG15C094 VA 439658</p>	<p>ALV3098</p>  <p>ALV3098WA ARV1545 PAL0407</p> <p>12v 150amp a:70 b:28 c:76</p> <p>BMW Z4 E85, E86</p> <p>E85 E86</p> <p>BM 12317837691 VA TG15C098 MH ALV3098</p>	<p>ALV3103</p>  <p>ARV1576 PAL0403</p> <p>12v 150amp a:51 b:20 c:46</p> <p>FORD Fiesta MAZDA 2 DV6</p> <p>MZ Y40618300 VA TG15C103 MS 210437</p>
<p>ALV3116</p>  <p>ALV3116WA ARA1534 PAL0200</p> <p>12v 120amp a:35 b:13 c:81</p> <p>NISSAN Maxima 3.5L</p> <p>NI 231007Y020 VA TG12C014 WA 11017N</p>	<p>ALV3123</p>  <p>ALV123WA ALV3123WA ARV1571 PAL0454</p> <p>12v 150amp a:31 b:14 c:61.5</p> <p>RENAULT Laguna III Laguna III Sportour</p> <p>BT0F KT0F OTTO NI 23100011R VA TG15C123 VA 440187</p>	<p>ALV3124</p>  <p>ALV3124WA ARV1571 PAL0454</p> <p>12v 150amp a:18 b:14 c:61</p> <p>RENAULT Laguna 2007-> 2.0 16V Turbo 2.0 GT</p> <p>F4R811 F4R800 RE 8200724133 VA TG15C124 MH ALV3124</p>	<p>ALV3128</p>  <p>ALV3128WA ARV1571 PAL0454</p> <p>12v 160amp a:32 b:14 c:61</p> <p>RENAULT Laguna Megane Scenic Grand Scenic</p> <p>BZ0G NI 23100018R VA TG15C128 VA 440217</p>













Alternators

Valeo

<p>ALV3142</p>  <p>ARV1065 PAL0407 </p> <p>12v 180amp a:30 b:13 c:61</p> <p>VW Touareg I 7LA, 7L6, 7L7</p> <p>3.0 TDI</p> <p>VW 0059903023G VA FG18T042 MH ALV3142</p>	<p>ALV3144</p>  <p>ALV3144WA ARV1305 PAL0407 </p> <p>12v 150amp a:25 b:70 c:58</p> <p>AUDI A6 2.0 TFSI 2005-></p> <p>4F2</p> <p>VW 06D903016D VA TG15C144 VA 440242</p>	<p>ALV3203 <i>New</i></p>  <p>ARV1127</p> <p>12v 220amp a:40 b:70 c:60</p> <p>MERCEDES-BENZ S-Class 3.5L 2011-</p> <p>M276950</p> <p>MB A0141543402 VA FG23S013 MH ALV3203</p>	<p>ALV3213</p>  <p>ALV3213WA ARV1001</p> <p>12v 180amp a:33 b:14 c:61</p> <p>AUDI S5 4.2L</p> <p>VW 079903015F VA FG18S013 VA 440175</p>
<p>ALV3214</p>  <p>ALV3214WA ARV1221 PAL0407 </p> <p>12v 180amp a:60 b:27 c:76</p> <p>BMW M3 2007-></p> <p>E90 E92 E93</p> <p>BM 12317837981 VA FG18S014 VA 440252</p>	<p>ALV3216</p>  <p>ARV5988</p> <p>12v 220amp a:31 b:61 c:44</p> <p>ROLLS ROYCE BMW</p> <p>N74</p> <p>BM 12317603780 VA FG23S016 VA 439699</p>	<p>ALV3217</p>  <p>ARV1515 PAL0283 </p> <p>12v 105amp a:38 b:14 c:54</p> <p>CHEVROLET, PONTIAC Venture Transport 3.4</p> <p>GM 10295859 VA A13V1194 WA 13720N</p>	<p>ALV3223</p>  <p>ALV3095 ALV3223WA ARV1305 PAL0407 </p> <p>12v 150amp a:23 b:14 c:61</p> <p>AUDI A4 A5 Q5 Quattro</p> <p>VW 059903016JX VA TG15C095 VA 439775</p>
<p>ALV3226</p>  <p>ALB3226WA ARV1001</p> <p>12v 180amp a:32 b:14 c:74</p> <p>AUDI A4 Q7 3.0 TDI quattro 2007-></p> <p>B8</p> <p>VW 059903016QX VA FG18S100 VA 439681</p>	<p>ALV3232</p>  <p>12v 120amp a:30 b:78 c:53</p> <p>SAAB</p> <p>GM 13502591 VA TG12C056</p>	<p>ALV3316</p>  <p>ALV3316WA ARV1853 PAL0407 </p> <p>12v 170amp a:55 b:28 c:76</p> <p>BMW 730D 740D</p> <p>E38 E65, E66 M57N2306D2 BM 12317792878 VA TG17C016 VA 439565</p>	<p>ALV3322</p>  <p>ALV3322WA ARV1324</p> <p>12v 220amp a:94 b:71</p> <p>MERCEDES-BENZ Sprinter 906.* 209CDI, 211CDI 215CDI, 218CDI</p> <p>OM646</p> <p>MB A6461540902 VA TG23C022 VA 440182</p>
























Alternators

Valeo

<p>ALV3327</p>  <p>ALE3327WA 593890</p> <p>12v 115amp a:44 b:63 c:58</p> <p>FIAT Grande Punto, Linea Panda, Idea, Doublo LANCIA Epsilon</p> <p>FI 51787210 VA TG9S027 VA 440151</p>	<p>ALV3345 <i>New</i></p>  <p>ARV1215 PAL0407</p> <p>12v 180amp a:62 b:29 c:76</p> <p>BMW 1 2.0L 2010-> 3 2.0L 2011-></p> <p>N47D16A N47D20A, N47D20C N47D20D BM 12317823345 VA FG23S033 MH ALV3345</p>	<p>ALV3351</p>  <p>ALV3351WA ARV1336</p> <p>12v 90amp a:68 b:27 c:76</p> <p>CITROEN XSARA BMW Z4 Roadster</p> <p>N1 M54 BM 12317519621 VA SG9B052 VA 437463</p>	<p>ALV3353</p>  <p>ALV3353WA ARV1549 PAL0213</p> <p>12v 95amp a:38.5 b:14.5 c:51</p> <p>DACIA, RENAULT Logan Sandero</p> <p>RE 8200810621 VA TG9B053 HC CA2098IR</p>
<p>ALV3402</p>  <p>ARV1661 PAL0291</p> <p>12v 50amp a:59.5 b:40</p> <p>CITROEN, PEUGEOT BX 205</p> <p>150A, 150F, 150C 108C, 109N, 150G 150B, 150H CI 95493931 VA A13N237 CG 111402</p>	<p>ALV3416</p>  <p>593845</p> <p>12v 110amp a:125 b:55 c:75</p> <p>FORD Mondeo</p> <p>B5Y B4Y BWY FO 3S7T10300AA VA TG12C016 VA 439569</p>	<p>ALV3428</p>  <p>ARV1294 PAL0409</p> <p>12v 120amp a:93 b:71</p> <p>MERCEDES-BENZ C180 C200 C Class</p> <p>W204 S204 MA A2711541402 VA TG12C026 VA 439611</p>	<p>ALV3438</p>  <p>ARV1241</p> <p>12v 180amp a:30.5 b:70 c:57</p> <p>MERCEDES-BENZ GLK 320CDi 4-matic</p> <p>MB 131546802 VA FG18S012 HC CA2072IR</p>
<p>ALV3441</p>  <p>ARV1519</p> <p>12v 150amp a:38 b:21 c:46</p> <p>CITROEN, RENAULT Berlingo</p> <p>CI 9635642080 VA TG15C060 VA 440241</p>	<p>ALV3445</p>  <p>ALV3445WA ARV1571 PAL0454</p> <p>12v 110amp a:32.5 b:14 c:61</p> <p>RENAULT Megane 2.0L Grand Scenic 1.9L Scenic 1.9L</p> <p>RE 8200410671 VA TG11C040 HC CA2057IR</p>	<p>ALV3463</p>  <p>ARV1304</p> <p>12v 120amp a:91 b:69</p> <p>MERCEDES-BENZ E Class</p> <p>MB A0141541402 VA TG12C063 VA 439678</p>	<p>ALV3466</p>  <p>ARV1571</p> <p>12v 110amp b:14 c:61</p> <p>RENAULT Megane Grand Scenic Kangoo Scenic</p> <p>JM01, CM01 K4M, LM01 BM01 RE 8200561961 VA TG11C054 VA 439592</p>


















Alternators

Valeo

<p>ALV3478</p>  <p>ARV1591 PAL0407</p>  <p>12v 220amp a:32 b:70 c:56</p> <p>MERCEDES-BENZ Sprinter 209, 211, 213, 215 309, 311, 313, 315 509, 511, 515</p> <p>MB A6461540802 VA TG23C017 HC CA2053IR</p>	<p>ALV3484</p>  <p>ARV1987 PAL0407</p>  <p>12v 180amp a:30 b:14 c:60</p> <p>AUDI, VW Q7 Touareg</p> <p>BHK 7LA, 7L6, 7L7 BHL VW 021903016 VA TG17C039 VA 439624</p>	<p>ALV3486</p>  <p>ARV1542 PAL0213</p>  <p>12v 150amp a:45 b:20 c:46</p> <p>SUZUKI SX4</p> <p>GY SU 3140069K00 VA TG15C127 VA 439626</p>	<p>ALV3496</p>  <p>ARV1232 PAL0410</p>  <p>12v 230amp a:80 b:60</p> <p>BMW X5 xDrive30i, Bj. 09.2008-></p> <p>E70 BM 12317560988 VA TG23C013 VA 439603</p>
<p>ALV3526</p>  <p>ALV3526WA ARV1987 PAL0407</p>  <p>12v 150amp a:92 b:70</p> <p>AUDI A6 Allroad Quattro</p> <p>4F2 4FH AUK VW 06E903016F VA TG16C010 VA 439535</p>	<p>ALV3537</p>  <p>ARV1543 PAL0407</p>  <p>12v 180amp a:55 b:28 c:76</p> <p>BMW X5 I (E53)</p> <p>4.4L 4.8L BM 12317537959 VA TG17C027B WA 11355R</p>	<p>ALV3538</p>  <p>ALV3538WA ARV1304 PAL0407</p>  <p>12v 115amp a:82 b:45</p> <p>SMART Forfour MITSUBISHI Colt</p> <p>MB A6391500250 VA TG11C036 MS 210549</p>	<p>ALV3565</p>  <p>ALV3565WA ARV1339 PAL0400</p>  <p>12v 150amp a:90 b:71</p> <p>AUDI A4 A4 Avant A4 Cabrio</p> <p>8EC 8ED 8H7, 8HE VW 06E903016EV VA TG16C011 VA 439564</p>
<p>ALV3572</p>  <p>ALV3572RB ALV3572WA PAL0407</p>  <p>12v 150amp a:61 b:28 c:76</p> <p>BMW X3 (E83) 3.0 D 2004-></p> <p>E83 BM 12317800308 VA TG15C072 HC CA2051R</p>	<p>ALV3599</p>  <p>ARV1159</p> <p>12v 220amp a:33 b:14 c:62</p> <p>VW Touareg 3.0 V6 TDI</p> <p>CNRB CASA VW 059903023J VA FG23S031 VA 439716</p>	<p>ALV3600</p>  <p>ALV3600WA ARA1028 PAL0200</p>  <p>12v 90amp a:37.5 b:13 c:58</p> <p>BOBCAT, KUBOTA Various Models Deutz</p> <p>S185, T200, S250 BC 6675292 VA TA000A48402 CG 113600</p>	<p>ALV3612</p>  <p>PAL0214</p>  <p>12v 80amp a:50 b:26 c:46</p> <p>CITROEN Berlingo 1.1L 1.4L 1.6L 1.9L3FZ,HFU,KFU C4 2.0L C5 1.8L 2.0L C8 2.2IRFN,NFR PEUGEOT 206 1.1L 1.4L 1.6L 2.0L</p> <p>HDZ,6FZ,HFX CI 9633782680 VA A13V1236</p>

Alternators

Valeo

<p>ALV3619</p>  <p>ALV3619WA ARV1591 PAL0419</p>  <p>12v 220amp a:32 b:70 c:58</p> <p>MERCEDES-BENZ Sprinter 906 Vito 109</p> <p>OM646980 MB 6421540802 VA TG23C019 VA 439609</p>	<p>ALV3624</p>  <p>ARV1804 PAL0400</p>  <p>12v 220amp a:35 b:14 c:58</p> <p>PORSCHE, VW Cayenne TOUAREG 3.0TDI 2010-></p> <p>VW 059903016S VA FG23S026 VA 440270</p>	<p>ALV3625</p>  <p>ARV1804</p> <p>12v 220amp a:30 b:14 c:61</p> <p>PORSCHE, VW Cayenne Touareg 3.6L V6 2010-></p> <p>BHK VW 021903016EX VA FG23S025 VA 440269</p>	<p>ALV3709</p>  <p>ARV1095</p> <p>12v 180amp a:57 b:28 c:75</p> <p>BMW X1 X3 1, 3, 5 316d, 318d, 320d</p> <p>N47N BM 12318507624 VA FG18S052 VA 439709</p>
<p>ALV3733</p>  <p>12v 70Amp a:35 b:15 c:47</p> <p>HYUNDAI i10 1.2L i20 1.2L</p> <p>G4LA HY 3730003300 VA 2606900</p>	<p>ALV3735</p>  <p>ARA3530</p> <p>12v 70amp a:35 b:14 c:47</p> <p>HYUNDAI I 10 1.2L KIA Picanto</p> <p>G4LA HY 3730003500 VA 2609013</p>	<p>ALV3748</p>  <p>ALV3748WA ARV1524 PAL0472</p>  <p>12v 105amp a:96 b:71</p> <p>CHEVROLET PONTIAC, SATURN Cavalier Sunfire VUE</p> <p>2.2L GM 22611790 VA SG10S036 CG 113748</p>	<p>ALV3789</p>  <p>12v 180Amp a:40 b:14 c:84</p> <p>FIAT Ducato IVECO Daily IV</p> <p>F1AE0481N F1AE3481D F1AE0481GA FI 5801378902 DR DRA1323 VA FG18S093</p>
<p>ALV3798 <i>New</i></p>  <p>ARV1237 PAL0410</p>  <p>12v 180amp a:27 b:69 c:60</p> <p>AUDI A4 AUDI A5 AUDI A6 AUDI Q5</p> <p>CJEB, CABA CDHA, CAEA CDNB, CDZA VW 06H903017K VA FG20S015 VA 439798</p>	<p>ALV3801 <i>New</i></p>  <p>12v 250amp a:27 b:69 c:57</p> <p>MERCEDES-BENZ C-Class E-Class R-Class</p> <p>MB A0009068301 VA CG25S026 VA 439861</p>	<p>ALV3817 <i>New</i></p>  <p>ARV1238 PAL0410</p>  <p>12v 220amp a:30 b:13 c:61</p> <p>AUDI Q7 (4LB) 3.0 TDI 2007-></p> <p>CASA CCMA CJGA, CNRB VW 059903019F VA FG23S066 VA 440471</p>	<p>ALV3822</p>  <p>12v 180Amp a:40 b:14 c:62</p> <p>VOLKSWAREN Touareg 3.0L</p> <p>CGEA CGFA VW 06E903023C VA FG18T122</p>

Alternators

Valeo

<p>ALV3823 New</p>  <p>ARV1233 PAL0410</p>  <p>12v 140amp a:27 b:13 c:61</p> <p>AUDI A1 CPTA, CJZA AUDI A3 CMBA, CXSA SEAT Leon VOLKSWAGEN Golf 7 VW 04E903023K VA 439821</p>	<p>ALV3824</p>  <p>ALV3824WA 595446</p> <p>12v 180amp a:59 b:28 c:76</p> <p>BMW E90 3 E91 BM 12317805432 VA FG18D024 VA 439652</p>	<p>ALV3841</p>  <p>ARV1065</p> <p>12v 180amp a:25 b:14 c:61</p> <p>AUDI Q7 VW Touareg MB 3094020171 VA FG18T041 VA 439686</p>	<p>ALV4011</p>  <p>12v 40amp a:42 a:23 c:67</p> <p>DEADONG VA TA000A23501</p>
<p>ALV4035 New</p>  <p>ARV1332 PAL0415</p>  <p>12v 140amp a:48 c:60</p> <p>SKODA Fabia Roomster VW Polo VW 03P903023B VA TG14C035 MS 210732</p>	<p>ALV4042</p>  <p>ALV4042WA ARV1573 PAL0407</p>  <p>12v 180amp a:26 b:70 c:65</p> <p>JEEP OM640940 MERCEDES-BENZ OM642910 Commander OM642960 Sprinter MB 6421540202 Actros, Vito VA TG17C030B CG 114042</p>	<p>ALV4044</p>  <p>ALV4044RB ALV4044WA PAL0401</p>  <p>12v 150amp a:42.5 b:22 c:46</p> <p>CITROEN KFU C2 C3 PE 9657363780 VA ST35C010 CG 114044</p>	<p>ALV4045</p>  <p>12v 120amp a:42.5 b:29.5 c:47</p> <p>SMART M132910 Fortwo MB A0061516401 VA ST35C013 CG 114045</p>
<p>ALV4046</p>  <p>ALV4046WA</p> <p>12v 130amp a:30.5 b:150 c:43</p> <p>MERCEDES-BENZ M266920 150, 160, 170 M266940 A-Class II (W169) B-Class I (W245) MB A2661500101 VA ST35C015 CG 114046</p>	<p>ALV4077</p>  <p>ARV1132</p> <p>24v 40amp</p> <p>KHD FL1011F Engine KH 01179756 VA A13N272 CG 114077</p>	<p>ALV4084</p>  <p>ALV4084WA ARV1661 PAL0291</p>  <p>12v 70amp a:60 b:40</p> <p>CARRIER TRANSICOLD SG7S062 Genesis TM800 ARV1201 Supra CR 306005004 VA A13N260 CG 114084</p>	<p>ALV4121 New</p>  <p>ARV1515 PAL0431</p>  <p>12v 110amp a:73 b:50</p> <p>OPEL X22DTH Sintra 2.2L 2007-2009 GM 10246634 VA A14VI21 MH ALV4121</p>

Alternators

Valeo

<p>ALV4154 <i>New</i></p>  <p style="text-align: right;">ARV1127</p> <p>12v 220amp a:32 b:14 c:60</p> <p>MERCEDES-BENZ M278920 S-Class 4.7L 2011- M278932</p> <p>MB A0141541002 VA FG23S021 MH ALV4154</p>	<p>ALV4189</p>  <p style="text-align: right;">ALV4189WA ARV1853 PAL0410 </p> <p>12v 180amp a:57 b:46 c:75</p> <p>BMW N62B36, N67N44 5 N62B44 6 N62B44A 7 BM 12317519721 X VA TG17C021 CG 114189</p>	<p>ALV4202</p>  <p>12v 220Amp a:59 b:29 c:76</p> <p>BMW N57TU F25 - F10 BM 1231782334202 VA FG23S040</p>	<p>ALV4219</p>  <p>12v 50amp a:43 b:15 c:66</p> <p>DAEDONG KIOTI DK35, DK40 Agricultural DK65 DK65S KU E723064012 VA TA000A58101 CG 114219</p>
<p>ALV4289</p>  <p style="text-align: right;">ARV1591</p> <p>12v 220amp a:32 b:70 c:60</p> <p>MERCEDES-BENZ OM642.896 Sprinter OM642.898 OM642.992 ME 0009063502 VA TG23C035</p>	<p>ALV4339</p>  <p style="text-align: right;">ALV4339WA ARV1233 PAL0400 </p> <p>12v 140amp a:30 b:70 c:55</p> <p>AUDI 3.2L A4 A5 Q5 VW 06E903016Q VA TG14C018 VA 439657</p>	<p>ALV4352</p>  <p style="text-align: right;">ALV4352WA ARV1961</p> <p>12v 130amp a:83 b:56</p> <p>LAND ROVER V8 OHV Discovery 4.0 RO YLE000090 VA SG12B063 CG 114352</p>	<p>ALV4393 <i>New</i></p>  <p style="text-align: right;">ARV1526 PAL0280 </p> <p>12v 110amp a:75 b:50</p> <p>CHEVROLET GM 10316182 Corvette 5.7L 2001-> VA A14V139 VA 439387</p>
<p>ALV4405</p>  <p style="text-align: right;">ARV9294</p> <p>12v 220amp a:28 b:14 c:64</p> <p>PORSCHE Cayenne 3.6 VOLKSWAGEN Touareg 3.6 VW 03H903023KX VA 440596</p>	<p>ALV4456 <i>New</i></p>  <p style="text-align: right;">ARV1332 PAL0415 </p> <p>12v 140amp</p> <p>VOLKSWAGEN Passat BWS VW 03H903023E VA TG14C044 VA 440356</p>	<p>ALV4950 <i>New</i></p>  <p style="text-align: right;">PAL0442 </p> <p>12v 75amp a:70 b:51</p> <p>VOLVO PENTA VO 3884950 VA A0002655301 CG 114664</p>	<p>ALV5177 <i>New</i></p>  <p style="text-align: right;">ARV1199 PAL0410 </p> <p>12v 150amp a:25 b:69 c:60</p> <p>AUDI CDNB A6 2.0L 2011- VW 06H903016S VA TG15C177 MH ALV5177</p>

Alternators

Valeo

<p>ALV5182</p>  <p>ARV5387</p> <p>12v 150amp a:30 b:70 c:59</p> <p>MERCEDES-BENZ OM651.913 OM651.911</p> <p>MZ 0009060401 VA TG15C182</p>	<p>ALV5212 <i>New</i></p>  <p>12v 140amp a:50 b:18</p> <p>OPEL DELTA GME 3400, 3410, 3403</p> <p>OP` 13502581 VA 2650799 MH ALV5212</p>	<p>ALV5299 <i>New</i></p>  <p>12v 65amp a:76 b:50</p> <p>HYUNDAI VOLVO</p> <p>6CYI 8CYI</p> <p>VO 3862612 VA A0002655299 HY 2655299</p>	<p>ALV5301 <i>New</i></p>  <p>PAL0240  G S L F</p> <p>12v 95amp a:33 b:12 c:67</p> <p>TAGAZ JAC Refine</p> <p>TG 1015301GA VA SSG10S047 VA 442054</p>
<p>ALV5322 <i>New</i></p>  <p>12v 140amp a:53 b:33 c:59</p> <p>OPEL Astra Corsa Meriva Zafira</p> <p>OP 1202119 VA TG12C074</p>	<p>ALV5412 <i>New</i></p>  <p>ARV1194</p> <p>12v 150amp a:29 b:70 c:58</p> <p>MERCEDES-BENZ C-Class 2.2L 2010-</p> <p>OM651911 OM651912 OM651913 MB A0141541202 VA TG15C131 MH ALV5412</p>	<p>ALV5424 <i>New</i></p>  <p>ARV1095</p> <p>12v 180amp a:51 b:28 c:75</p> <p>BMW</p> <p>BM 12318509739 VA 440322 MH ALV5424</p>	<p>ALV5512 <i>New</i></p>  <p>12v 120amp a:60 b:23 c:57</p> <p>OPEL VAUXHALL Astra 1.8L Zafira 1.8L</p> <p>A18XEL A18XER</p> <p>OP 1202189 VA 13502594 MH ALV1255</p>
<p>ALV5581</p>  <p>ARV1069 PAL0243 </p> <p>12v 140amp a:65 b:22 c:61</p> <p>OPEL</p> <p>OP 13500329 VA 2605581</p>	<p>ALV5810</p>  <p>12v 105amp a:37 b:13 c:68</p> <p>MITSUBISHI</p> <p>4G94</p>	<p>ALV5966</p>  <p>12v a:54 b:38 c:32</p> <p>OPEL</p> <p>OP 095515966 VA TG12C053</p>	<p>ALV6107 <i>New</i></p>  <p>12v 120amp a:65 b:40 c:73</p> <p>FORD C-max 1.6L Focus III 1.6L</p> <p>JQDA JQDB JTDA, JTDB FO BV6N10300AA VA TG12C107</p>

Alternators

Valeo

<p>ALV6420 <i>New</i></p>  <p style="text-align: right;">PAL0227 </p> <p>12v 85amp a:50 b:27 c:43</p> <p>DAEWOO GREAT WALL Jingling 1.3L</p> <p style="text-align: right;">GW 3701100E10 VA SSG9S085 VA 442062</p>	<p>ALV6612 <i>New</i></p>  <p>12v 120amp a:56 b:18</p> <p>VAUXHALL OPEL</p> <p style="text-align: right;">A20DTJ A20DTC A20DTR OP 13502582 VA 440621 MH ALV6612</p>	<p>ALV6618</p>  <p>12v 180Amp a:59 b:28 c:78</p> <p>BMW 3 Series F30 F31 F35 F80</p> <p style="text-align: right;">N57D30A BM 12318509225 VA FG18S066</p>	<p>ALV6814 <i>New</i></p>  <p>12v 140amp a:38 b:13 c:62</p> <p>VOLKSWAGEN Amarok</p> <p style="text-align: right;">CNFB CNFA CDBA VW 03L903024S VA TG14C068</p>
<p>ALV7010 <i>New</i></p>  <p>12v 180amp a:10 b:70 c:54</p> <p>VOLVO S60 1.6L 2010- V60 1.6L 2010-</p> <p style="text-align: right;">B4164T3 VO 36002013 VA FG17T010 MH ALV7010</p>	<p>ALV7069</p>  <p>12v 70amp a:50 b:27 c:40</p> <p>GREAT WALL Xenia 1.5 CN</p> <p style="text-align: right;">VA SG7S069</p>	<p>ALV7072</p>  <p>12v 70amp a:50 b:27 c:40</p> <p>GREAT WALL Xenia 1.3 CN</p> <p style="text-align: right;">VA SG7S072</p>	<p>ALV7315</p>  <p>12v 150amp a:44 b:21 c:49</p> <p>FORD S-max 2.0L Galaxy2.0L Mondeo2.0L</p> <p style="text-align: right;">QXWA,QXWB UFWA,TXBA QXBA,TXWA FO AG9T10300AA VA TG15C176</p>
<p>ALV7415</p>  <p style="text-align: right;">PAL0410 </p> <p>12v 150amp a:45 b:21 c:45</p> <p>FORD Kuga 2.0L Focus 1.6L</p> <p style="text-align: right;">FO AV6N10300MD VA FG15T074</p>	<p>ALV7423</p>  <p style="text-align: right;">ARV9294</p> <p>12v 220Amp a:38 b:14 c:61</p> <p>VOLKSWAGEN Toureg 3.0 Hybrid</p> <p style="text-align: right;">CGEA CGFA VW 06E903023D VA FG23S074</p>	<p>ALV7510</p>  <p>12v 90amp a:35 b:16 c:51</p> <p>HYUNDAI Solaris KIA Rio Venga</p> <p style="text-align: right;">G4FC HY 373002B510 VA 2616741 VA 2616741</p>	<p>ALV7663</p>  <p>12v 150Amp a:45 b:21 c:46</p> <p>FORD C-max II 1.6L Fiesta 1.6L Grand C-max 1.6L</p> <p style="text-align: right;">T1DA,T1DB,T3DA T3DB,HHJC,HHJD HMJE FO AV6N10300GB VA TG15C186</p>













Alternators

Valeo

<p>ALV8017 <i>New</i></p>  <p>ALV8017WA ARV1197</p> <p>12v 120amp a:50 b:64 c:55</p> <p>FIAT Grande Punto 1.3 JTD 10-> ALFA ROMEO MiTo 1.3 08-></p> <p>FI 51880175 VA TG12S111 MH ALV4412</p>	<p>ALV8029 <i>New</i></p>  <p>ARV1125</p> <p>12v 180amp a:32 b:13 c:61</p> <p>MERCEDES-BENZ</p> <p>ME A0141540902 VA 440331 MH ALV8029</p>	<p>ALV8032 <i>New</i></p>  <p>ARV1125</p> <p>12v 180amp a:22 b:69 c:58</p> <p>MERCEDES-BENZ C-CLASS (W204) E-CLASS (W212)</p> <p>OM651,911 M276,957</p> <p>ME 0141543302 VA FG18S032 MH ALV8032</p>	<p>ALV8037 <i>New</i></p>  <p>12v 160amp a:30 b:15 c:52</p> <p>JEEP Compass 2.2L 2010- Patriot 2.2L 2011-</p> <p>ENE OM651925</p> <p>CH 04801227AA VA FG18D037 MH ALV8037</p>
<p>ALV8040 <i>New</i></p>  <p>599213</p> <p>12v 180amp a:27 b:68 c:59</p> <p>MERCEDES-BENZ</p> <p>ME A0141542802 VA FG18S040 MH ALV8040</p>	<p>ALV8046 <i>New</i></p>  <p>599107</p> <p>12v 180amp a:25 b:69 c:52</p> <p>MERCEDES-BENZ</p> <p>m276957 m276952</p> <p>ME A0141544202 VA FG18S046 MH ALV8046</p>	<p>ALV8047 <i>New</i></p>  <p>ARV1303</p> <p>12v 180amp a:27 b:70 c:60</p> <p>MERCEDES-BENZ E-Class V (W212) E-Class IV (S212) GLK-Class (X204)</p> <p>OM 651.924 OM 651.912</p> <p>ME A01415439020 VA FG18S047 MH ALV8047</p>	<p>ALV8058 <i>New</i></p>  <p>12v 180amp a:40 b:20 c:46</p> <p>VOLVO S60, S80 1.6L V40, V60, V70 1.6L</p> <p>D4162T</p> <p>VO 36002929 VA FG18T058 MH ALV8058</p>
<p>ALV8061 <i>New</i></p>  <p>ARV1125</p> <p>12v 180amp a:33 b:13 c:60</p> <p>MERCEDES-BENZ CLASSE E (W212) GL-CLASS (X166)</p> <p>M270920</p> <p>ME A0009062100 VA FG18S061 MH ALV8061</p>	<p>ALV8062 <i>New</i></p>  <p>ALV8062WA ARV1103 PAL0400</p>  <p>12v 180amp a:48 b:15 c:60</p> <p>VOLKSWAGEN Transporter 5</p> <p>VW 03L903024C VA FG18T062 MH ALV8062</p>	<p>ALV8063 <i>New</i></p>  <p>ARV1236</p> <p>12v 180amp a:27 b:69 c:60</p> <p>AUDI A4 A6</p> <p>CADA, CFKA CAEB, CAEA CDNC, CDN B VW 06H903017D VA FG18T063 MH ALV8063</p>	<p>ALV8073 <i>New</i></p>  <p>ARV1303 PAL0407</p>  <p>12v 180amp a:30 b:14 c:60</p> <p>MERCEDENS-BENS E-Class V (W212) SLS AMG (C197) SLS AMG (A197)</p> <p>M159980</p> <p>ME A0009065300 VA 440303 MH ALV8073</p>

Alternators

Valeo

<p>ALV8074 <i>New</i></p>  <p>ARV1103 PAL0407 </p> <p>12v 180amp a:30 b:70 c:75</p> <p>VW T5 2.0L VW T5 2.0TSi Transporter, Multivan</p> <p>VW 06A903023F VA FG18T074 MH ALV8074</p>	<p>ALV8079 <i>New</i></p>  <p>599213</p> <p>12v 180amp a:28 b:70 c:58</p> <p>MERCEDES-BENZ</p> <p>OM642960</p> <p>ME A0009067500 VA FG18S078 MH ALV8079</p>	<p>ALV8083 <i>New</i></p>  <p>ARV1303 PAL0407 </p> <p>12v 180amp a:29 b:72 c:58</p> <p>MERCEDES-BENZ</p> <p>OM651912 OM651924</p> <p>C-Class 2.2L 2011- E-Class 2.2L 2009- GLK-Class 2.2L 2008-</p> <p>MB A0009060601 VA FG18S083 MH ALV8083</p>	<p>ALV8110 <i>New</i></p>  <p>ARV5959</p> <p>12v 180amp a:35 b:13 c:60</p> <p>MERCEDES-BENZ</p> <p>M278922 M278932 M278920 MB A0141540902 VA FG18S110 MH ALV8110</p>
<p>ALV8891 <i>New</i></p>  <p>12v 120amp a:36 b:14 c:62</p> <p>DACIA RENAUT</p> <p>RE 231007788R VA TG12C091</p>	<p>ALV9023</p>  <p>ARV1233</p> <p>12v 140Amp a:29 b:70 c:58</p> <p>VOLKSWAGEN</p> <p>Passat CC 1.8L 2.0L</p> <p>CDA CDAB CCZB VW 06J903023Q VA TG14C055</p>	<p>ALV9024</p>  <p>ARV1233</p> <p>12v 140Amp a:40 b:14 c:61</p> <p>AUDI</p> <p>A1 2.0L</p> <p>VOLKSWAGEN</p> <p>Caddy III 1.6L 2.0L Touran 1.6L 2.0L</p> <p>CFHD,CAYD,CFJA CDLH,CAYE,CLCA CLCB,CFHC,CFHF VW 03L903024M VA TG14C057</p>	<p>ALV9041</p>  <p>ARV1233</p> <p>12v 140amp a:32 b:70 c:59</p> <p>AUDI A3 1.8L</p> <p>SEAT Leon 1.8L 2.0L</p> <p>SKODA OCTAVIA 1.8L 2.0L</p> <p>VOLKSWAGEN GOLF VII 2.0L</p> <p>CJSA,CJSB CJXC,CJXB,CJXE CHHB,CHHA MW 06J903023H VA TG14C041</p>
<p>ALV9057 <i>New</i></p>  <p>12v 90amp a:40 b:63 c:60</p> <p>FIAT</p> <p>FIAT 505565090 VA TG9S057</p>	<p>ALV9233 <i>New</i></p> <p>12v 70amp</p> <p>MERCEDES-BENZ</p> <p>M111957</p> <p>VA 439233</p>	<p>ALV9641</p> <p>12v 230amp a:45 b:21 c:47</p> <p>CITROEN</p> <p>C5 C6 3.0L</p> <p>PEUGEOT</p> <p>407 3.0L</p> <p>DT20C</p> <p>PE 9664984080 VA FG23S022</p>	<p>ALV9692</p>  <p>12v 90amp a:42 b:22 c:46</p> <p>CITROEN</p> <p>Berlingo</p> <p>Peugeot</p> <p>Partner</p> <p>206, 307, 407</p> <p>TU3A TU3JP</p> <p>CI 5702F2 VA 439692 MH ALV9692</p>





Alternators

Valeo

<p>ALV9720 <i>New</i></p>  <p>ARV1332 PAL0407 </p> <p>12v 150amp a:28 b:13 c:61</p> <p>VOLKSWAGEN Golf VI 1.4 TSI 10/08</p> <p>VW 03C903023T VA TG14C028 VA 439720</p>	<p>ALV9766</p>  <p>12v 150Amp a:32 b:14 c:62</p> <p>NISSAN M1D,M9R QASHQAI 2.0L M9R610 RENAUT M9R615 MEGDNE III 2.0L NI 231007033R VA FG15T030</p>	<p>ALV9793 <i>New</i></p>  <p>ARV1212</p> <p>12v 180amp a:58 b:28 c:76</p> <p>BMW N47D16A 1 2.0L N47D20C 3 2.0L N47D20D 4 2.0L BM 12317823344 VA FG18S045 MH ALV9793</p>	<p>ALV9795 <i>New</i></p>  <p>ARV1237</p> <p>12v 180amp a:22 b:70 c:60</p> <p>AUDI CAKA, CCBA, CGWC A4 3.0L 2008- CGXC, CTUB, CMUA A5 3.0L 2010- CTUC, CTVA Q5 3.0L 2012- VW 06E903018L VA FG20S017 VA 439795</p>
<p>ALV9796 <i>New</i></p>  <p>ARV5989</p> <p>12v 120amp a:40 b:63 c:58</p> <p>FORD FD4 Ka 1.3i JTD</p> <p>FO BS5110346CA VA TG12S128</p>	<p>ALV9803</p>  <p>12v 150Amp a:40 b:14 c:61</p> <p>RENAUT</p> <p>RE 231005770R VA FG15T050</p>	<p>ALV9818 <i>New</i></p>  <p>599249</p> <p>12v 180amp a:27 b:70 c:65</p> <p>MERCEDES C-Class II (C204), III (W204) Sprinter 3,5 (906) Vito II (W639)</p> <p>VA FG18S128 MH ALV1828</p>	<p>ALV9826 <i>New</i></p>  <p>12v 120amp a:31 b:13 c:85</p> <p>FORD E5FA E5FC</p> <p>IV 504271461 VA SG10B071 SA 3788017M91</p>
<p>ALV9878</p>  <p>12v: 250amp a:35 b:14 c:60</p> <p>MERCRDES BENZ CL AMG 63</p> <p>ME A0009062004 VA 439878</p>			

Alternators

China

ALQ0387	ALQ0388	ALQ0389	ALQ2371 New
			
24v 110amp b:14 c:102 CUMMINS B Series Higer King Long Foton-AUV Bus Yang-Zhou Diesel PT JFZ2105D UP ALT0176	24v 80amp a:30.5 b:16 c:56 YUTONG BUS YU 37010106DF226018 PT JFZ2715 MH ALQ0388	24v 110amp a:15 b:59 c:102 CUMMINS Xichai-Fawd Yu-Chai Foton-AUV Bus Yu-Tong PT JFZ291B UP ALT0175	12v 75amp a:50 b:28 c:49 CHERY QQ OE S113701110FA OE S123701110BB MH ALQ2371
ALQ3211	ALQ3212	ALQ3220	ALQ3253
			
24v 25amp a:27 b:61(17) HEAVY TRUCKS Laidong Yangdong 380Q, 480Q 495Q Jiangchai375, Changzhou 395 Zhenjiang295, Linghe Auto Huafeng, Bangbu 495 diesel engine CH JFZ11A MH ALQ3211	24v 25amp a:27 b:61(17) Hubei 495Q, Nanchang 4105485Q Wuxi 4102 495 Diesel Engine CH 2JF12A MH ALQ3212	12v 25amp a:84.5 b:18 Jinma Tractor 200Series, 300Series 400Series, 500Series 600Series CH 2JF200 MH ALQ3220	24v 55amp a:40 b:16 c:84 FOTON Leiwo 135 Series Fukuda Ouman Qibing Tianjin Perkins CH JFZ253C CH T64501023B MH ALQ3253
ALQ3513 New	ALQ3517	ALQ3527	ALQ3528
			
12v 50amp a:45 b:17.5 c:68 CH JFZ1513 MH ALQ3513	12v 60amp a:85 b:59 Fukuda490 Yangchai495 Yangchai4102 HYUNDAI Heavy Forklift CH JFWB17D MH ALQ3517	24v 27amp a:50 b:19.5 c:81.5 Luotuo 3100 Luotuo 4105 Tianjin 60 CH JFW27Z MH ALQ3527	24v 27amp a:91 b:60 WAW Commercial vehicles YZ4102 CH JFWB27D MH ALQ3528






















Alternators

China

ALQ3529		ALQ3617		ALQ3623		ALQ3629	
							
24v 40amp	a:50 b:16 c:79	12v 55amp	a:47.5 b:17.5 c:74	24v 35amp	a:44.5 b:18 c:81	24v 35amp	a:46 b:17.5 c:81.5
Place on Forklifts XCMG ZL30G, LW321F LW300F, ZL30F, Foton FL935E LG933L	CH JFWZ29 CH YC6B125T11 MH ALQ3529	FOTON CA498	CH JFW17 MH ALQ3617	FOTON Trucks 495 with no pump	SD490 YN4100	FOTON 3.4 Tdi Yuejin1043	CY4100 CH JFWZB29 MH ALQ3629
ALQ3750		ALQ4710 <i>New</i>					
							
24v 30amp	a:94.5 b:17.5	12v 85amp	a:39 b:13 c:66.5				
Jichai 6130Q, Zhaoyang 6102 Xichai 141, LN142 Yulin, Liufa Turbine type 6105Q Dongfeng EQ-140 Auto	CH 3JF750 MH ALQ3750	BYD Lioncel 1.6L HAFEI	4G18 HAF 471Q3701950 VA SA13VI308G MH ALQ4710				

Starters

Bosch

<p>STB0006</p>  <p>STB0006WA 11 CR </p> <p>12v 1.1kW a:66 b:3 o:42</p> <p>RENAULT Megane 3 2008- 2, 0 Tce</p> <p>RE 8200792969 BO 0001107477 MH STB0006</p>	<p>STB0008</p>  <p>STB0008WA 10 CR </p> <p>12v 1.4kW a:66 b:27</p> <p>AUDI A4, A5</p> <p>VW 079911021DX BO 0001108445 VA 458405</p>	<p>STB0009</p>  <p>STB0009WA 11 CR </p> <p>12v 4kW a:88 b:50 o:20</p> <p>JOHN DEERE Tractors</p> <p>6414 JD PT 4.5L 94HP JD PT 4.5L 105HP JD RE526375 BO 0001260004 WA 19825R</p>	<p>STB0010</p>  <p>STB0010WA 9 CR </p> <p>24v 4kW a:89 b:24 o:30</p> <p>VOLVO Trucks F6 Series F7 Series FL6 Series</p> <p>KH 12153838 BO 0001368047 MH STB0010</p>
<p>STB0062</p>  <p>STB0062WA 214 9 ACR </p> <p>12v 0.7kW a:76.5 b:32.5 o:20</p> <p>BMW, PORSCHE VW Marine 914 Kaefer, Transporter 1500, 1600</p> <p>W, GB, AN AT, AD, AJ AS, AB, AR VW 111911023BT BO 0001211012 HC CS62</p>	<p>STB0066</p>  <p>STB0066WA 229.5 9 CR </p> <p>12v 0.65kW a:68 b:14 o:20</p> <p>OPEL, VAUXHALL Ascona Corsa Astra Nova</p> <p>12S, 12N, 12NC E12GV, 10S OP 1202007 BO 0001157004 HC CS66</p>	<p>STB0069</p>  <p>STB0069WA 9 CR </p> <p>12v 0.8kW a:76 b:5.5 o:20</p> <p>FORD Capri Consul Granada Transit</p> <p>NWN, TV17H, YYE, NYL TV17L, MY, NY, YYH YYF, NYR, EY, 4RB, PR5 FO 77BB11000AA BO 0001208020 HC CS69</p>	<p>STB0072</p>  <p>STB0072WA 255.25 9 CR </p> <p>12v 1.1kW a:76 b:4.5 o:20</p> <p>FORD Capri Taunus</p> <p>NEN, PRN, TV13L TV15H, PRT, PR5, PR5 NYR, YYF, JAC, NWR FO 74EB11000BA BO 0001311109 HC CS72</p>
<p>STB0077</p>  <p>STB0077WA 9 CR </p> <p>12v 0.8kW a:82.5 b:14 o:30</p> <p>AUDI, VW 80, 100 Santana Iltis 1.7 Passat</p> <p>EP, ZA, ZF, YX YJ, ZB, ZC, EU DT, SA, YV, WV VW 026911023A BO 0001211209 HC CS77</p>	<p>STB0079</p>  <p>STB0079RB STB0079WA 9 CR </p> <p>12v 0.8kW a:82.5 b:14 o:30</p> <p>AUDI, VW 50, 80 Derby, Scirocco, Rabbit Golf, Santana Jetta, Polo</p> <p>HB, HC, HH, GF FY, FZ, FA, GG HA, GL, GK, HK VW 036911023FX BO 0001211214 HC CS79</p>	<p>STB0083</p>  <p>STB0083WA 11 CR </p> <p>12v 1.4kW a:66 b:0 o:43</p> <p>RENAULT Grand Megane Scenic</p> <p>RE 8200741476 BO 0001108428 HC CS1509</p>	<p>STB0084</p>  <p>STB0084WA 9 CR </p> <p>12v 2kW a:76 b:24 o:22</p> <p>BMW, ROLS-ROYCE 760i Phantom</p> <p>BM 12417515784 BO 0001109202 NR 01109202</p>







Starters

Bosch

<p>STB0085</p>  <p>STB0085RB 9 CR </p> <p>12v 2.2kW a:82 b:58 o:20</p> <p>VW R5 Touareg 2.5 R5 TDI (03-10)</p> <p>VAG 070911023C BO 0001125607 MH STB0085</p>	<p>STB0087</p>  <p>STB0087WA 9 CR </p> <p>12v 3.6kW a:87 b:47 o:30</p> <p>VOLVO MD47A,B Penta TMD47B</p> <p>VOLV 6643669 BO 0001418005 MH STB0087</p>	<p>STB0088</p>  <p>STB0088WA 11 CR </p> <p>12v 3.6kW a:56 b:40</p> <p>KHD Trucks</p> <p>KH 2918433 BO 0001418006 MH STB0088</p>	<p>STB0089</p>  <p>9 CR </p> <p>12v 1.1kW a:88.5 b:7.5 o:20</p> <p>SAAB BT20, BI20, B20C, BS120 99 B20, B201XC, B20T, BT20 900 B202XL, B201S SA 8319618 BO 0001311108 HC CS89</p>
<p>STB0091</p>  <p>STB0091WA 11 CR </p> <p>12v 3.6kW a:89 b:51</p> <p>VOLVO Various models</p> <p>VO 6210722 BO 0001401063 MH STB0091</p>	<p>STB0097</p>  <p>STB0097WA 342 9 CR </p> <p>24v 4kW a:89 b:47 o:30</p> <p>SCANIA, STEYR DSC1181 10s - 17s DS1173, DS1134 113 Series DSC1108 124 Series SC 571420 114 Series BO 0001368301 HC CS97</p>	<p>STB0098</p>  <p>STB0098WA 407 11 CR </p> <p>24v 5.5kW a:92 b:36 o:30</p> <p>SCANIA DS1115 112 Series DS1114 DSC11, DS SC 571454 BO 0001410037 HC CS98</p>	<p>STB0099</p>  <p>STB0099WA 407 11 CR </p> <p>24v 6kW a:89 b:46 o:30</p> <p>VOLVO TD121F F Series TD121G TD120G, TD100B VO 6686461 BO 0001417041 HC CS99</p>
<p>STB0101</p>  <p>9 CR </p> <p>24v 4kW a:89 b:48 o:30</p> <p>VOLVO</p> <p>VO 243043 BO 0001368018 HC CS101</p>	<p>STB0103</p>  <p>STB0103WA 287.5 9 CR </p> <p>12v 2.7kW a:89 b:27 o:30</p> <p>CLAAS, DEUTZ-FAHR F3L912 IVECO, KHD F4L912 BOBCAT</p> <p>IV 1178026 BO 0001367004 HC CS103</p>	<p>STB0108</p>  <p>STB0108WA 384 9 CR </p> <p>12v 3.6kW a:89 b:46.5 o:30</p> <p>VOLVO AQD70 Penta TAMD60 TMD70 BU 860542 BO 0001401060 CG 110538</p>	<p>STB0110</p> <p>9 CR </p> <p>12v 2.2kW a:82.5 b:20 o:21</p> <p>VOLVO 850 S70 S80 V70</p> <p>VO 9162928 BO 0001218173 HC CS1051</p>

Starters

Bosch

<p>STB0113</p>  <p>288 9 CR</p> <p>12v 1.8kW a:83 b:21 o:20</p> <p>MERCEDES-BENZ LANCIA 206, 4t</p> <p>OM615917, OM615937 OM615910, OM616910 138C2048, OM615 MB A0021516401 BO 0001362004 HC CS113</p>	<p>STB0114</p>  <p>STB0114WA</p> <p>287.5 9 CR</p> <p>12v 2.4kW a:89 b:27 o:30</p> <p>CLAAS, CASE IVECO, KHD MERCEDES</p> <p>F3L912 F4L912</p> <p>IT V941501 BO 0001362305 HC CS114</p>	<p>STB0115</p>  <p>STB0115WA</p> <p>230 9 ACR</p> <p>12v 0.7kW a:76 b:44 o:20</p> <p>VW Transporter</p> <p>CA, CB, CT AS, AF, CJ JU, AD, AH VW 091911023 BO 0001211221 HC CS115</p>	<p>STB0116</p>  <p>STB0116RB</p> <p>9 ACR</p> <p>12v 0.8kW a:76 b:32.5 o:20</p> <p>VW, ROVER GROUP Caddy Golf Jetta, Rabbit LT, Scirocco</p> <p>JB, EM, EW, ANJ, BBF FH, FN, FP, AHD, BBE FT, RE, FR, AVR, EN VW 055911023BX BO 0001211224 HC CS116</p>
<p>STB0117</p>  <p>STB0117WA</p> <p>9 ACR</p> <p>12v 0.7kW a:76 b:33 o:20</p> <p>PORSCHE, VW 911 911 Targa Transporter</p> <p>91101, 91102 91104 W, GB VW 003911023 BO 0001212002 HC CS117</p>	<p>STB0118</p>  <p>STB0118WA</p> <p>10 CR</p> <p>12v 1.1kW a:66 b:24 o:21</p> <p>AUDI, VW A4 1.8TFSI/2.0TFSI 2007-> A5 1.8TFSI/2.0TFSI 2007-> A6 2.0TFSI 2011-> Q5 2.0TFSI 2008-></p> <p>VW 06D911021B BO 0001107450 BL 012118</p>	<p>STB0119</p>  <p>STB0119WA</p> <p>261 9 CR</p> <p>12v 1.5kW a:76 b:28 o:20</p> <p>BMW, FORD 2500, 2800, 3 2.8, 2.5 Consul</p> <p>M30B25, M30B28, M10B11 EV30H</p> <p>BM 12411715230 BO 0001314043 HC CS119</p>	<p>STB0120</p>  <p>STB0120RB STB0120WA</p> <p>341 9 CR</p> <p>24v 4kW a:89 b:48 o:30</p> <p>MERCEDES-BENZ Unimog various trucks</p> <p>OM353954 OM353950 OM366933 MB A0031510401 BO 0001368307 HC CS120</p>
<p>STB0121</p>  <p>STB0121WA</p> <p>407 11 CR</p> <p>24v 6kW a:92 b:48 o:30</p> <p>IVECO SCANIA</p> <p>821022X069 DTC1101, DC1102 DSC1201, DC1201 SC 349578 BO 0001417045 HC CS121</p>	<p>STB0132</p>  <p>STB0132WA</p> <p>255.5 9, 10 CR</p> <p>12v 1.1kW a:82 b:20.5 o:21</p> <p>VW, AUDI Passat, Santana 100, 200, 80 Coupe</p> <p>KX, WN, JS, HP, WE ZJ, ZZ, ZU, WC, WJ GV, WR, WA, WB, WC VW 035911023A BO 0001311118 HC CS132</p>	<p>STB0135</p>  <p>STB0135WA</p> <p>9 CR</p> <p>12v 1.1kW a:82 b:3 o:32</p> <p>PEUGEOT VOLVO 505 760, 780 960</p> <p>B27E B28F B280E VO 5001600 BO 0001108061 HC CS135</p>	<p>STB0136</p>  <p>9 CR</p> <p>12v 1.1kW a:62 b:11 o:30</p> <p>ALFA ROMEO</p> <p>AR 119000503003 BO 0001311126 LU LRS911</p>

Starters

Bosch

<p>STB0140</p>  <p>STB0140RB 263 9 CR 9</p> <p>12v 1.1kW a:82.5 b:35 o:20</p> <p>VOLVO 121, 122, 140, 145 164, 240, 340, 360 740, 760, 1800</p> <p>B18, B18A, B18D, B18E B19A, B19E, B200K, B20X B20D, B20B, B20F, B230 EM VO 834339 BO 0001311001 HC CS140</p>	<p>STB0151</p>  <p>STB0151WA 383 9 CR 9</p> <p>12v 3kW a:89 b:48 o:30</p> <p>VOLVO Various Models D50A TD50A</p> <p>Agricultural VO 6643669 BO 0001401028 HC CS956</p>	<p>STB0180</p>  <p>STB0180 229 9 CR 9</p> <p>12v 0.9kW a:62 b:10 o:30</p> <p>ALFA ROMEO Spider, Giulietta Alfa Romeo Alfa 90, Alfa 75 2000, 1750</p> <p>AR01588, AR00515, AR00112AS, MERCEDES OM312AS AR00530, AR00536, AR00548 Class AR01600, AR01678, AR01609 Unimog FI 116000503002 BO 0001211025 HC CS180</p>	<p>STB0186</p>  <p>STB0186WA 341 9 CR 9</p> <p>12v 3kW a:89 b:48 o:30</p> <p>OM352 OM651940 OM353942 MB A0021519401 BO 0001367034 HC CS186</p>
<p>STB0187 <i>New</i></p>  <p>STB0187WA 10 CR 10</p> <p>24v 3.2kW a:82.5 b:21 o:22</p> <p>MERCEDES-BENZ</p> <p>MB 0031512201 BO 0001363120 CG 112174</p>	<p>STB0188</p>  <p>STB0188RB STB0188WA 289 9 CR 9</p> <p>12v 2.3kW a:82.5 b:21 o:22</p> <p>MERCEDES-BENZ, SEAT 100, 200, 207, 209, 220, 240, 22t, 26t, 300, 307 309, 4t, 5t, MB 132</p> <p>OM403916, OM422953 OM615940, OM616937 OM615912, OM617952 MB A0021516901 BO 0001362002 HC CS188</p>	<p>STB0189 <i>New</i></p>  <p>STB0189WA 9 ACR 9</p> <p>12v 1.6kW a:82.5 b:22 o:20</p> <p>ARONA CLAAS FERRARI GOLDONI LOMBARDINI</p> <p>BO 0001109012 CG 113268</p>	<p>STB0190 <i>New</i></p>  <p>STB0190WA 11 ACR 11</p> <p>12v 1.1kW a:76 b:15.5 o:20</p> <p>LOMBARDINI Industrial</p> <p>LB 58402180 BO 0001107107 CG 113706</p>
<p>STB0191</p>  <p>STB0191WA 390 9 CR 9</p> <p>24v 5.4kW a:92 b:47 o:30</p> <p>MAN, NEOPLAN MERCEDÉS, SETRA NG Series, NL Series NM Series, NU Series Turismo, Viano</p> <p>OHCTL20H OM651940 D2866LOH34 MN 51262017159 BO 0001416002 HC CS191</p>	<p>STB0194</p>  <p>STB0194WA 384 9 CR 9</p> <p>24v 4.5kW a:89 b:48.5 o:30</p> <p>MERCEDES-BENZ AHLMANN IRMER Unimog O302, O309</p> <p>OM314946 OM314944 OM353909 RE 5000789048 BO 0001416024 HC CS194</p>	<p>STB0195</p>  <p>STB0195WA 9 CR 9</p> <p>24v 5.5kW a:55.5 b:37</p> <p>KHD, MERCEDES O 302 O 317 Viano</p> <p>OM360979 OM360986 OM360984 MB 11513901 BO 0001416016 HC CS195</p>	<p>STB0198</p>  <p>STB0198WA 407 9 CR 9</p> <p>24v 6kW a:92 b:47 o:30</p> <p>MAN, MERCEDES MISUBISHI, NEOPLAN SSANGYONG KASSBOHRER</p> <p>D2865LF02 D2865LF20 D2840LF460 MN 81467001 WAI 0001417001 HC CS198</p>

Starters

Bosch

<p>STB0202 <i>New</i></p>  <p>STB0202WA 342 11 CR</p> <p>12v 3.0kW a:82 b:22 o:20</p> <p>LAMBORGHINI HUERLIMMAN SAME Agricultural Industrial</p> <p>FI 2961928 BO 0001354014 HC CS335</p>	<p>STB0210 <i>New</i></p>  <p>STB0210WA 11 CR</p> <p>24v 5.5kW a:89 b:51 o:30</p> <p>CHINA TRUCKS FOTON HOWO SHAANXI</p> <p>STEYR WD615 CH 612600090293 BO 0001241012</p>	<p>STB0222 <i>New</i></p>  <p>STB0222WA 9 CR</p> <p>12v 2.3kW a:74 b:21</p> <p>AUDI A8, Q7 2003-> VW TOUAREG 4.2L V8 TDI 10-></p> <p>4.0L TDI 4.2L TDI VW 057911023E BO 0001223018 WA 32720R</p>	<p>STB0224 <i>New</i></p>  <p>STB0224WA</p> <p>12v a:73 b:27 o:22</p> <p>TOYOTA Hilux 2.5L</p> <p>TO 281000C040 BO F000AL0110 MH STB0224</p>
<p>STB0230</p>  <p>STB0230RB STI0230RB 296.5 9 CR</p> <p>12v 2.7kW a:110 b:27 o:30</p> <p>FIAT, ALFA ROMEO, LANCIA 131, Regata AR 8 A 112, Delta</p> <p>814061200 112B2000, 149C2000 FI 77028560 BO 0001362062 HC CS230</p>	<p>STB0231</p>  <p>STB0231WA STL0231WA 295 9 CR</p> <p>24v 3.2kW a:110 b:28 o:30</p> <p>IVECO, BENFRA EuroCargo Zeta</p> <p>8041 FI 77080560 BO 0001363111 HC CS231</p>	<p>STB0232</p>  <p>STB0232WA 343 9 CR</p> <p>24v 4kW a:110 b:27 o:30</p> <p>IVECO Zeta</p> <p>806004669 806005280 804004200 FI 4172004 BO 0001360043 HC CS232</p>	<p>STB0235 <i>New</i></p>  <p>STB0235 9 CR</p> <p>12v 3kW a:89 b:51 o:30</p> <p>MERCEDES-BENZ TRAC UNIMOG</p> <p>OM353949 OM353907 OM314917v MB 0031511401 BO 0001367039 HC CS605</p>
<p>STB0237 <i>New</i></p>  <p>STB0237 9 CR</p> <p>12v 2.5kW a:81 b:6 o:32</p> <p>FIAT Ducato LANCIA</p> <p>BO 0001109333</p>	<p>STB0238 <i>New</i></p>  <p>STB0238 10 CR</p> <p>12v 1.4kW a:67 b:18 o:22</p> <p>CHEVROLET Aveo CHEVROLET Cruze OPEL Astra OPEL Mokka OPEL Zafira</p> <p>A12XEL, A12XER A14XEL, A14XER A14NEL, A14NET OP 55572440 BO 0001137005 MS 220650</p>	<p>STB0239 <i>New</i></p>  <p>STB0239 10 CR</p> <p>12v 1.4kW a:69 b:29 o:22</p> <p>MERCEDES-BENZ C-Class E-Class SLK</p> <p>M271820 M271860 M271861, M271958 MB A0061517201 BO 0001109333 LU LRS02603</p>	<p>STB0241 <i>New</i></p>  <p>STB0241 12 CR</p> <p>12v 1.4kW a:63 b:24 o:22</p> <p>CHEVROLET Aveo OPEL Astra OPEL Corsa</p> <p>A13DTE, A13DTR Z13DTE, Z13DTJ LSF, LDV OP 1202203 BO 0001138029 LU LRS02553</p>

Starters

Bosch

<p>STB0242 <i>New</i></p>  <p>9 cr </p> <p>12v 1.7kW a:75 b:25 o:21</p> <p>BMW 1-6 X1 X3 Z4</p> <p>N20B20A N54B30A N55B30A BM 12417638194 BO 0001138057 DR DRS0797</p>	<p>STB0243 <i>New</i></p>  <p>11 CR </p> <p>12v 2.2kW a:73 b:21 o:33</p> <p>BMW 3</p> <p>S65B40A BM 12417838020 BO 0001148015 LU LRS02460</p>	<p>STB0245 <i>New</i></p>  <p>10 CR </p> <p>12v 2.5kW a:68 b:39 o:20</p> <p>PORSCHE Panamera 3.0L, 3.6L, 4.8S, 4.8 Turbo 3.0D 2009-></p> <p>MCWDA, M4640 MCRCB, MCRCC MCGEA, MCGFA PO 94860421001 BO 0001139037 DR DRS0302</p>	<p>STB0246 <i>New</i></p>  <p>12 cr </p> <p>12v 2kW a:88 b:19 o:20</p> <p>FORD Tourneo Transit</p> <p>DRFA, DRFB CYFA, CYFB PGFA, PGFB FO AC1T11000AA BO 0001115092 DR DRS0706</p>
<p>STB0249 <i>New</i></p>  <p>9 CR </p> <p>12v 0.8kW a:78 b:15 o:20</p> <p>BEDFORD OPEL VAUXHALL</p> <p>N18Z, 20N 16N, 16S 19N, 19S OP 1203114 BO 0001208023 HC CS70</p>	<p>STB0256 <i>New</i></p>  <p>235 9 CR </p> <p>12v 0.8kW a:82.5 b:21 o:21</p> <p>AUDI MERCEDES-BENZ PONTIAC PORSCHE VOLKSWAGEN</p> <p>ZD, ZU, ZJ, ZZ YA, YB, YC, YD M130980, M130983 VW 058911023AC BO 0001208216 CG 110997</p>	<p>STB0263</p>  <p>STB0263WA 243.5 9 CR </p> <p>12v 0.8kW a:82.5 b:17 o:21</p> <p>OPEL, VAUXHALL Ascona Kadett Manta</p> <p>C18NV, C18NT, C18NE 18S, 18N, 18E, 16SH OP 1202027 BO 0001208224 HC CS263</p>	<p>STB0267</p>  <p>STB0267RB 9 ACR </p> <p>12v 0.95kW a:76 b:33 o:20</p> <p>VW Jetta Rabbit Scirocco</p> <p>VW 055911023D BO 0001208412 HC CS267</p>
<p>STB0268</p>  <p>265 9 CR </p> <p>12v 1.5kW a:82.5 b:24.5 o:22</p> <p>MERCEDES-BENZ 16t, 17t, 26t, 4t, 5t, 33t 190, 200, 210, 230, 300 Actros T1</p> <p>M102920, M102924, OM420M4 M102939, M102943, OM519S2 M102965, M102987 MB A0031513801 BO 0001314036 HC CS268</p>	<p>STB0269</p>  <p>STB0269WA 338.5 10 CR </p> <p>24v 4kW a:89 b:27 o:30</p> <p>EM Series L 2000 SM Series</p> <p>D0826LOH1 D0826LF08 D0826GF03 MN 51262017095 BO 0001368016 HC CS269</p>	<p>STB0272</p>  <p>STB0272RB 265 9 ACR </p> <p>12v 1.7kW a:76 b:32 o:30</p> <p>VW Caddy Jetta Golf Transporter</p> <p>AAB, CR CY, JK ME VW 068911023H BO 0001317018 HC CS272</p>	<p>STB0276</p>  <p>STB0276RB STB0276WA 229.7 9 CR </p> <p>12v 1kW a:82.5 b:13 o:30</p> <p>VW Golf Jetta Scirocco Caddy</p> <p>ABN, DX, EW, DX, PN FH, EZ, FR, HM, JH GF, FT, JB, RF VW 055911023A BO 0001212207 HC CS276</p>













Starters

Bosch

<p>STB0282</p>  <p>STB0282RB STB0282WA</p> <p>243.25 9 CR</p>  <p>12v 1.1kW a:82 b:21.5 o:21</p> <p>AUDI, CITROEN, VW 80, 90, 100, A6 Passat, Santana Xantia</p> <p>JS, JT, HP, KX WN, KV, WE, WG WH, SL, RT, KZ VW 0359110230 BO 0001108009 HC CS282</p>	<p>STB0290</p>  <p>9 CR</p>  <p>12v 1.7kW a:82.5 b:17.5 o:21</p> <p>OPEL, VAUXHALL Ascona Astra Kadett Vectra</p> <p>16D, 16DA 17D, 17DR OP 1202016 BO 0001317022 HC CS290</p>	<p>STB0292</p>  <p>STB0292RB</p> <p>242 9 CR</p>  <p>12v 1.4kW a:82.5 b:34 o:22</p> <p>VOLVO 240, 360, 480 740, 760, 940, 960</p> <p>B200F, B234F, B230FD B230F, B230K, B230FB B23A, B230FT, B230ET VO 204284 BO 0001311147 HC CS292</p>	<p>STB0293</p>  <p>STB0293RB STB0293WA STH0293RB</p> <p>216 9 CR</p>  <p>12v 0.8kW a:82.5 b:15 o:32</p> <p>VW, SEAT Golf, Jetta, Polo Ibiza</p> <p>1W, 2G, AAU, AAK, NZ PY, NU, MH, HZ, GT GL, ACM, AAV VW 036911023KX BO 0001211529 HC CS293</p>
<p>STB0294</p>  <p>STB0294RB STB0294WA</p> <p>230 9 ACR</p>  <p>12v 0.9kW a:76 b:33 o:20</p> <p>SEAT, VW Toledo, Caddy Golf, Jetta Passat, Scirocco Transporter</p> <p>AAC, AAB, PL AAM, 2E, PB EW, JH, 1F VW 055911023F BO 0001107007 HC CS294</p>	<p>STB0295</p>  <p>STB0295RB STB0295WA</p> <p>264.35 9 ACR</p>  <p>12v 1.7kW a:76 b:32 o:30</p> <p>VW Golf, Jetta Multivan, Passat Transporter</p> <p>AAA, AAF ACU, AAZ MF, ME, IV VW 068911023GX BO 0001110001 HC CS295</p>	<p>STB0297</p>  <p>STB0297RB STB0297WA</p> <p>228.75 9 CR</p>  <p>12v 0.95kW a:82.5 b:15 o:33</p> <p>AUDI, VW 80, 100, Coupe Passat, Santana</p> <p>DT, EU, DS DZ, PP, AFE WV, SF, NP VW 026911023BX BO 0001208711 HC CS297</p>	<p>STB0298</p>  <p>230 9 ACR</p>  <p>12v 0.8kW a:76 b:44.5 o:20</p> <p>VW Transporter</p> <p>CT, DF, CU, DG DJ, GW, MV, SS VW 091911023AX BO 0001211254 HC CS298</p>
<p>STB0299</p>  <p>STB0299RB STB0299WA</p> <p>9 ACR</p>  <p>12v 1.7kW a:82.5 b:42 o:20</p> <p>VW Transporter</p> <p>CS, JX VW 068911023JX BO 0001317011 HC CS299</p>	<p>STB0322</p>  <p>STB0322RB STB0322WA</p> <p>269.5 9, 10 CR</p>  <p>12v 1.7kW a:82 b:20 o:21</p> <p>OPEL, VAUXHALL Ascona, Astra Kadett Vectra</p> <p>17D, 17DR 16D, 16DA X17DT, X17DTL OP 90511841 BO 0001110115 HC CS322</p>	<p>STB0325</p>  <p>10 CR</p>  <p>12v 1.7kW a:76 b:14 o:33</p> <p>FORD, MAZDA Escort Fiesta Mondeo 121</p> <p>FO 91AB11000PA BO 0001317023 HC CS325</p>	<p>STB0327</p>  <p>STB0327RB STB0327WA STV0327RB</p> <p>220 9, 10 CR</p>  <p>12v 1.4kW a:82.5 b:26 o:22</p> <p>DAEWOO, MERCEDES SSANGYONG, VW, TAGAZ Korando, Musso Sprinter, Vito LT, Tager</p> <p>AGL, M104992 M111970, M161E23 OM401973, OM445924 MB A0041518101 BO 0001108149 HC CS327</p>

Starters

Bosch

<p>STB0328</p>  <p>STB0328WA 243.30 9 CR</p> <p>12v 1.4kW a:76 b:6 o:20</p> <p>FORD Granada Capri Scorpio Sierra, Transit</p> <p>ARD, ARC, B4B, B4A B4C, BRD, BRC, BOA BRE, BRF, NYL, YYN FO 91GX11000AB BO 0001108119 HC CS328</p>	<p>STB0329</p>  <p>STB0329WA 245.6 10 CR</p> <p>12v 1.4kW a:89 b:30 o:30</p> <p>AVIA, FORD, LAND ROVER LCR, NAE, REC Scorpio, Sierra Discovery</p> <p>NRC, NEL, NRA N4A, RED, NE5 RO NAD10046 BO 0001108071 HC CS329</p>	<p>STB0330</p>  <p>STB0330RB STB0330WA 246 10 CR</p> <p>12v 1.4kW a:76 b:14.5 o:30</p> <p>FORD Scorpio, Sierra Transit</p> <p>NSF, NAT, LAT E5FA, NRB, RED R2A, N8C, N4B FO 91BB11000HA BO 0001108037 HC CS330</p>	<p>STB0331</p>  <p>STB0331RB STB0331WA STV0331RB 276 10, 11 CR</p> <p>12v 2.2kW a:82.5 b:27 o:22</p> <p>DAEWOO, MERCEDES SSANGYONG Korando, Musso Atego 2, Axor Sprinter, Vito</p> <p>OM601942 OM602980 OM662 MB A0031519801 BO 0001218021 HC CS331</p>
<p>STB0338</p>  <p>STB0338WA 273 10, 12 CR</p> <p>12v 2.5kW a:80 b:-6.5 o:31</p> <p>ASTRA, FIAT JEEP, RENAULT HD8, Croma R18</p> <p>852710 J8S711 F3BE0681K RE 7701351026 BO 0001218002 HC CS338</p>	<p>STB0339</p>  <p>STB0339WA 371 10 CR</p> <p>12v 3.6kW a:92 b:20 o:30</p> <p>FORD Trucks EU 0609, 0913 0709, 1013 0711, 1113 0809, 0811</p> <p>905AA FO 82DB11000EA BO 0001367055 HC CS339</p>	<p>STB0340</p>  <p>STB0340WA 10 CR</p> <p>12v 2.3kW a:89 b:21 o:30</p> <p>FORD Sierra</p> <p>FO 83BB11000KB BO 0001362606 HC CS340</p>	<p>STB0341</p>  <p>STB0341RB STB0341WA 265 10 CR</p> <p>12v 1.7kW a:76 b:15 o:33</p> <p>FORD, MAZDA Escort, Fiesta Mondeo, Orion 121</p> <p>RTJ, LTC, RTA RTB, RFK, RFD LTA, RVA, RTH FO 92AX11000HB BO 0001110013 HC CS341</p>
<p>STB0343</p>  <p>STB0343WA 10 CR</p> <p>12v 2.2kW a:89 b:21 o:30</p> <p>FORD Sierra Scopio</p> <p>FO 86GB11000KA BO 0001218106 HC CS343</p>	<p>STB0346</p>  <p>STB0346RB STB0346WA 246.35 9 CR</p> <p>12v 1.4kW a:89 b:18 o:20</p> <p>SAAB 900 9000 90</p> <p>B201, B201XC, B201S B201XL, B202I, B202S B202L, B202XL, B204E SB 8545691 BO 0001108038 HC CS346</p>	<p>STB0347</p>  <p>STB0347RB 287.75 9 CR</p> <p>12v 2kW a:82.5 b:20 o:22</p> <p>AUDI, VW, VOLVO 100 LT 740, 240 FM Series</p> <p>CN, DE CP, DW D24, D24T, D9B300 VW 069911023AX BO 0001362070 HC CS347</p>	<p>STB0350</p>  <p>STB0350RB STB0350WA 274 9 CR</p> <p>12v 2.2kW a:82.5 b:20.5 o:22</p> <p>AUDI, FIAT, VW 100, A6 Croma LT</p> <p>1S, ACT, DW MC, CN, DE AAT, ABP VW 069911023CX BO 0001218115 HC CS350</p>

Starters

Bosch

<p>STB0351</p>  <p>STB0351WA 9 CR </p> <p>12v 2.2kW a:81.5 b:23 o:30</p> <p>FIAT, LANCIA Croma Thema</p> <p>154C6000 814467 8144912000 FI 63222001 BO 0001218014 HC CS351</p>	<p>STB0356</p>  <p>STB0356WA 278.45 9 CR </p> <p>12v 2.2kW a:82 b:17 o:20</p> <p>VW, OPEL LT Frontera, Senator Omega Rekord</p> <p>ATA 23DTR, 23YD, 23D 23TD OP 1202048 BO 0001218122 HC CS356</p>	<p>STB0357</p>  <p>10 CR </p> <p>12v 1.4kW a:76 b:14 o:33</p> <p>FORD Escort Fiesta Orion Sierra</p> <p>F6B, F6D, FUA, N5C LP1, LGA, LPA, LUG, LRT F6C, FUB, FUJ, LUC FO 81BB11000AA BO 0001108004 HC CS357</p>	<p>STB0358</p>  <p>STB0358RB STB0358WA 290 9 ACR </p> <p>12v 1.7kW a:82.5 b:42 o:20</p> <p>VW Transporter Vanagon</p> <p>CS JX KY VW 068911023M BO 0001110009 HC CS358</p>
<p>STB0359</p>  <p>STB0359WA 9 CR </p> <p>12v 1.4kW a:76 b:6 o:33</p> <p>FORD Mercur Scorpio Sierra</p> <p>FO 85BB11000AA BO 0001108075 HC CS359</p>	<p>STB0360</p>  <p>STB0360WA 240 10, 11 CR </p> <p>12v 1.7kW a:82.5 b:27 o:22</p> <p>MERCEDES-BENZ Sprinter Vario Vito</p> <p>OM602984 OM611981 OM611987 MB 0041514501 BO 0001110016 HC CS360</p>	<p>STB0370</p>  <p>STB0370WA 272 9 CR </p> <p>12v 2.2kW a:110 b:27 o:30</p> <p>RENAULT, VAUXHALL Master Trafic Messenger Arena</p> <p>8140472585 S8U742 S8U780 RE 7700730756 BO 0001218019 HC CS370</p>	<p>STB0372</p>  <p>STB0372RB STB0372WA STB372WA 242.5 9 CR </p> <p>12v 1.4kW a:82.5 b:20 o:21</p> <p>OPEL, SAAB Astra 9-3, 9-5, 900</p> <p>4EFE B204E, B204R C20NEF SB 4966842 BO 0001108151 HC CS372</p>
<p>STB0373</p>  <p>STB0373WA 280 10, 11, 12, 13 CR </p> <p>12v 1.7kW a:70 b:-6 o:33</p> <p>CITROEN, FIAT LANCIA, PEUGEOT SCANIA, SUZUKI C4, C6, C5 407, 607, 307</p> <p>EW12J4, RFJ 3FY, JTD RHH, ES9J4S PE 95607234 BO 0001110017 HC CS373</p>	<p>STB0374</p>  <p>STB0374RB STB0374WA 263 10 CR </p> <p>12v 1.7kW a:82.5 b:23 o:33</p> <p>FIAT, SEAT Strada, Fiorino Punto Ibiza</p> <p>021A3000 176A3000 146D7000 VO 8111509 BO 0001110025 HC CS374</p>	<p>STB0375</p>  <p>9 CR </p> <p>12v 1.4kW a:62 b:10.5 o:30</p> <p>ALFA ROMEO Alfa 75 Alfa 90 Spider 2.0</p> <p>AR06166, AR06224 AR01713, AR06212 AR01588, AR01590 FI 60522387 BO 0001108081 HC CS375</p>	<p>STB0376</p>  <p>9, 10 CR </p> <p>12v 2.2kW a:82.5 b:22.5 o:33</p> <p>FIAT Marengo Regata Tempra Tipo</p> <p>160A7000 149A1000 FI 7508589 BO 0001218008 HC CS376</p>

Starters

Bosch

<p>STB0377</p>  <p>STB0377RB STB0377WA</p> <p>246 9, 10 CR</p> <p>12v 1.4kW a:76 b:21.5 o:20</p> <p>BMW 3 5 Z</p> <p>M20B25, S14204EA M20B20 M20B27 BM 12411726504 BO 0001108064 HC CS377</p>	<p>STB0378</p>  <p>STB0378RB STB0378WA STE0378RB</p> <p>271.75 9, 11 CR</p> <p>12v 2.2kW a:76 b:20 o:20</p> <p>BMW, OPEL LAND ROVER 3, 5 Omega Range Rover</p> <p>M51D25, M21D24 25DT, X25DT 256T BM 12412242702 BO 0001218026 HC CS378</p>	<p>STB0383</p>  <p>STB0383WA</p> <p>11 CR </p> <p>24v 5.5kW a:89 b:47 o:30</p> <p>ATLAS COPCO, IVECO Various Trucks</p> <p>F8L413F F8L513 F10L413F FO 82DB11000BA BO 0001416030 HC CS383</p>	<p>STB0384</p>  <p>STB0384WA</p> <p>384 11 CR </p> <p>24v 5.5kW a:89 b:48 o:30</p> <p>IVECO MAGIRUS DEUTZ Various Trucks</p> <p>F8L513 BF8L513 F8L413F KH 01174645 BO 0001416036 HC CS384</p>
<p>STB0386</p>  <p>STB0386WA</p> <p>272.65 9 CR </p> <p>12v 2.2kW a:82.5 b:21 o:22</p> <p>VOLVO, VW LT 240 740, 760 940</p> <p>D24, D24T D24TIC, D13A400 1G, DV, ACL VW 069911023BX BO 0001218004 HC CS386</p>	<p>STB0387</p>  <p>371 11 CR </p> <p>24v 5kW a:88.75 b:39.7 o:30</p> <p>DAF F</p> <p>DH825, DHTD825 DHR825, DHU825 DHS825, DU825, HS825 CV 2998003 BO 0001364104 HC CS387</p>	<p>STB0388</p>  <p>STB0388WA</p> <p>341 10 CR </p> <p>24v 4kW a:89 b:48 o:30</p> <p>DAF 65 F</p> <p>DD575, DNTD620 DT615, NT133 NS133L, NS156M DF 1340895 BO 0001231012 HC CS388</p>	<p>STB0389</p>  <p>STB0389RB STB0389WA</p> <p>242 9 CR </p> <p>12v 1.4kW a:82.5 b:36 o:22</p> <p>VOLVO 240 360, 480 740, 760 940, 960</p> <p>B18E, B200E B230F, B23A B19ET, B204E VO 3523301 BO 0001108030 HC CS389</p>
<p>STB0391</p>  <p>STB0391RB STB0391WA</p> <p>9, 11 CR</p> <p>24v 4kW a:89 b:47 o:30</p> <p>VOLVO F Series FL Series</p> <p>D6B, TD61G D6A250, TD60A TD70G, D6A180 VO 5003009 BO 0001231014 HC CS391</p>	<p>STB0392</p>  <p>240 9 CR </p> <p>12v 0.95kW a:82.5 b:19 o:30</p> <p>VW Golf Jetta Scirocco Caddy</p> <p>EX, GX, PF GU, HV, RP JH, RD, RH VW 027911023 BO 0001212401 HC CS392</p>	<p>STB0394</p>  <p>STB0394WA</p> <p>342 9 CR </p> <p>24v 4kW a:110 b:26 o:30</p> <p>BENFIRA, FIAT IVECO EuroCargo M Series Zeta</p> <p>834005200 806025R4200LTC 806025R4200 MK 81388020 BO 0001368020 HC CS394</p>	<p>STB0395</p>  <p>STB0395RB STB0395WA</p> <p>342 10 CR </p> <p>12v 3kW a:82 b:34 o:20</p> <p>JOHN DEERE JD Series, Various Models 1000 Series 2000 Series 3000 Series</p> <p>RE 6005012976 BO 0001367078 HC CS395</p>

Starters

Bosch

<p>STB0399</p>  <p>9 CR </p> <p>12v 0.85kW a:66 b:25 o:30</p> <p>OPEL VAUXHALL</p> <p>OP 09163851 BO 0001208225 HC CS399</p>	<p>STB0461 <i>New</i></p>  <p>11 ACR </p> <p>12v a:79 b:46 o:20</p> <p>AUDI CJXB,CCZB SEAT CESA,CJKA SKODA CPLA,CBFA VOLKSWAGEN VW 02E911023S BO 0001121435 DR DRS0461</p>	<p>STB0500</p>  <p>STB0500WA 9 CR </p> <p>12v 1.4kW a:82.5 b:15 o:32</p> <p>SEAT MN VW 1W Terra Polo VW 031911023 BO 0001109001 HC CS500</p>	<p>STB0501</p>  <p>STB0501WA 346.5 9 CR </p> <p>24v 4.8kW a:89 b:27.5 o:30</p> <p>ABG, IRMER BF6L913 IVECO, KHD F6L912 P Series F6L913 PA Series IV 42498130 BO 0001364301 HC CS501</p>
<p>STB0502</p>  <p>STB0502WA 384 11 CR </p> <p>24v 5.4kW a:92 b:46 o:30</p> <p>CITROEN, IVECO 846041K AX HDZ, TU1M EuroStar, EuroTech 546041970 M Series, EuroTrakker IV 42498148 TurboTech BO 0001416011 HC CS502</p>	<p>STB0504</p>  <p>STB0504WA 9 CR </p> <p>12v 2.2kW a:81.5 b:23.5 o:30</p> <p>FIAT LANCIA</p> <p>FI 7658554 BO 0001218155 HC CS504</p>	<p>STB0506</p>  <p>STB0506WA 387 11 CR </p> <p>24v 5.4kW a:89 b:47 o:30</p> <p>MERCEDES, VOLVO Cummins STEYR, FIAT-ALLIS WD815, WDB81560 Unimog OM353973 B Series MN 51262017100 BO 0001416038 HC CS506</p>	<p>STB0507</p>  <p>STB0507WA 11 CR </p> <p>12v 2.2kW a:82.5 b:20.5 o:20</p> <p>ALFA ROMEO VM80A Alfa VM81A Alfetta Givlietta AR 116610503000 BO 0001218126 HC CS507</p>
<p>STB0509</p>  <p>STB0509RB STB0509WA 9 CR </p> <p>12v 1kW a:82.5 b:13 o:22</p> <p>AUDI DZ, RU, SD 80, 90, 100 SF, JN, NE Coupe PM, AAD VW 026911023F BO 0001114003 HC CS509</p>	<p>STB0510</p>  <p>STB0510RB STB0510WA 272 9 CR </p> <p>12v 2.2kW a:110 b:27 o:30</p> <p>ALFA ROMEO, FIAT 814421 AR 6 814027 Ducato CRD93L FI 7666135 BO 0001218024 HC CS510</p>	<p>STB0511</p>  <p>STB0511WA 315.5 11 CR </p> <p>12v 3.1kW a:88.8 b:22 o:30</p> <p>CASE 400 Series 500 Series 800 Series E, V IN 3228192R91 BO 0001359075 HC CS511</p>	<p>STB0514</p>  <p>STB0514WA 241 11 CR </p> <p>12v 1.4kW a:68 b:22.5 o:30</p> <p>VW, ALFA ROMEO CH, 834B1000, 834F1000 FIAT, LANCIA AR06476, 831E5046 Alfa 164, LT 154A048, 178B3000 Croma, Palio FI 7727484 Delta, Thema BO 0001108146 HC CS514</p>

Starters

Bosch

<p>STB0515</p>  <p>STB0515WA 267.5 9 CR</p> <p>12v 1.7kW a:76 b:28 o:20</p> <p>ARONA, BMW, MOSA M30B30, S38B36 FERRARI, LOMBARDINI 8LD7402 5 9LD5612 7 BM 12411720663 M BO 0001110041 HC CS515</p>	<p>STB0516</p>  <p>STB0516RB STB0516WA 244 9 CR</p> <p>12v 1.4kW a:76 b:21 o:30</p> <p>BMW M40B18 3 M50B25 5 M43B16 BM 12411738604 BO 0001108065 HC CS516</p>	<p>STB0518</p>  <p>STB0518WA 245 9 CR</p> <p>12v 1kW a:82.5 b:18 o:21</p> <p>OPEL, VAUXHALL 18SV, C20LET Ascona 20XEJ, C18NZ Astra, Omega 20SEH, C20NEF Calibra OP 1202950 Kadett, Vectra BO 0001108079 HC CS518</p>	<p>STB0526</p>  <p>STB0526WA 407 11 CR</p> <p>24v 6.5kW a:115 b:21 o:30</p> <p>CITROEN, FIAT 821042237 IVECO 821022535 BX, CX, DS D9A, M52667 P Series MO 81467005 PA Series BO 0001417005 HC CS526</p>
<p>STB0530</p>  <p>STB0530WA 9 CR</p> <p>24v 4kW a:89 b:28 o:30</p> <p>ABG, AHLMANN F6L913 CASE, COMPARE BF6L913 IVECO, KHD BF6L913T PAYLOADER KH 1173241 WAI 0001368001 HC CS530</p>	<p>STB0531</p>  <p>9 ACR</p> <p>12v 0.8kW a:76 b:31.5 o:20</p> <p>VW DG, DH, CU, DJ Transporter MV, SR, SS VW 003911023D BO 0001212212 HC CS531</p>	<p>STB0535</p>  <p>STB0535WA 183 9 CR</p> <p>12v 1.4kW a:68 b:18 o:20</p> <p>OPEL, VAUXHALL 12NV, 14NV, 16LZ2, 16SV Astra, Ascona, Combo C14SE, C16LZ, X14XE Corsa, Kadett, Vectra, Tigra 16SV, E16NZ, X16SZR PONTIAC OP 1202011 Lemans BO 0001108093 HC CS535</p>	<p>STB0541</p>  <p>STB0541WA 10 CR</p> <p>12v 1.8kW a:76 b:14.5 o:33</p> <p>FORD RFA, RFL P100 Sierra FO 89BB11000AB BO 0001110065 HC CS541</p>
<p>STB0542</p>  <p>STB0542WA 207 9, 10 CR</p> <p>12v 1.4kW a:62 b:-5 o:31</p> <p>CITROEN, NISSAN TUD3, TUD5 PEUGEOT, ROVER K9A, K9Y AX, Saxo, Xsara VJZ, VJY Micra PE 95656490 106, 100 BO 0001108074 HC CS542</p>	<p>STB0543</p>  <p>STB0543WA STV0543RB 273 9 CR</p> <p>12v 3.1kW a:92 b:22 o:30</p> <p>LAND ROVER 23L Defender 12L Discovery 14L Range Rover RO NAD10039 BO 0001218168 HC CS543</p>	<p>STB0544</p>  <p>STB0544WA 387 11 CR</p> <p>24v 5.5kW a:89 b:48 o:30</p> <p>VOLVO D10B360 B Series TD121G F Series D10A320 FL Series VO 11031126 FM Series BO 0001416005 HC CS544</p>	<p>STB0546</p>  <p>STB0546WA 387 11 CR</p> <p>24v 5.4kW a:89 b:45 o:30</p> <p>DAF DKB1160 F DKTS1160E N DKV1160 DF 241787 BO 0001410067 HC CS546</p>

Starters

Bosch

<p>STB0547</p>  <p>12v 1.5kW a:76 b:32 o:20</p> <p>PORSCHE</p> <p>BO 0001312102 BO 0001312111 HC CS547</p>	<p>STB0548</p> <p>STB0548WA</p>  <p>12v 1.7kW a:82.5 b:15.5 o:22</p> <p>AUDI 80, 90 A3, A4, A6 VW PASSAT 1.90 TDI</p> <p>JK RA SB, 1Y VW 068911023S BO 0001110066 HC CS548</p>	<p>STB0551</p> <p>STB0551WA</p>  <p>12v 1.4kW a:62 b:3 o:32</p> <p>CITROEN, PEUGEOT Xantia XM 306 605</p> <p>DJZ, DHY UFZ, UKZ XFZ, SFZ PE 95656488 BO 0001111164 HC CS551</p>	<p>STB0554</p> <p>STB0554WA</p>  <p>12v 2.2kW a:81.5 b:29.5 o:33</p> <p>CITROEN, FIAT C25 Ducato Talento</p> <p>M705 280A1000 230A2000 FI 46231644 BO 0001218141 HC CS554</p>
<p>STB0555</p> <p>STB0555WA</p>  <p>12v 2.2kW a:82.5 b:21 o:22</p> <p>MERCEDES, SEAT 100 2.4L MB 100 2.4L 132 2.2L</p> <p>OM616, OM616963 OM615912 MB 0041510901 BO 9000331419 HC CS555</p>	<p>STB0559</p> <p>STB0559WA</p>  <p>12v 1kW a:76 b:53.5 o:20</p> <p>VW, SEAT Golf, Passat, Corrado Ibiza, Toledo</p> <p>1F, AAM, 1Z, 9A 2E, KR, EZ, PF PG, RP, RF, AAZ VW 02A911023AX BO 0001112011 HC CS559</p>	<p>STB0562</p> <p>STB0562WA</p>  <p>12v 1kW a:76 b:14.5 o:30</p> <p>FORD Scorpio Sierra Transit</p> <p>N9D, NRI, N3A N9F, NSD, L6B R2A, R2C, R6A FO 91BB11000FA FO 0001108110 HC CS562</p>	<p>STB0564</p> <p>STB0564WA</p>  <p>24v 6.5kW a:115 b:20 o:30</p> <p>CITROEN, IVECO BX EuroStar EuroTrakker TurboStar</p> <p>828042001 821042MTCA KDY MN 81467007 BO 0001417006 HC CS564</p>
<p>STB0565</p> <p>STB0565WA</p>  <p>24v 5.5kW a:89 b:45 o:30</p> <p>STEYR 1491 Series 19S 22S 26S</p> <p>WD615 WD61565 WD61577 RE 7701003914 BO 0001416003 HC CS565</p>	<p>STB0568</p> <p>STB0568WA</p>  <p>12v 2.2kW a:82.5 b:9 o:22</p> <p>NISSAN Serena 2.0L Serena 2.3L Vanette 2.0L Vanette 2.3L</p> <p>LD20 LD23 LD20II NI 233009C600 BO 0001218818 HC JS568</p>	<p>STB0569</p> <p>STB0569RB STB0569WA</p>  <p>12v 1.1kW a:82.5 b:13.5 o:22</p> <p>AUDI, VW, SKODA 100, 80, A4 Passat Superb</p> <p>6A, ABK, ADR, AFY ADP, AHL, ALZ, ARG AWT, AZM VW 026911023GX BO 0001107013 HC CS569</p>	<p>STB0572</p> <p>STB0572WA STI0572RB</p>  <p>12v 2.5kW a:110 b:27.5 o:30</p> <p>AGRIFULL, ALLIS CHALMERS, BLX BENFRA, FIAT GOLDONI, IVECO SKODA, VW</p> <p>AXX, BWA 804025900 IV 500333269 BO 0001223504 HC CS572</p>

Starters

Bosch

<p>STB0574</p>  <p>STB0574WA</p> <p>10 ACR </p> <p>12v 1.7kW a:76 b:54 o:20</p> <p>VW Passat</p> <p>RA, SB, 1Y, AAZ</p> <p>VW 02A911023B BO 0001110031 HC CS574</p>	<p>STB0576</p>  <p>STB0576WA</p> <p>272.5 10 CR </p> <p>12v 2.2kW a:82.5 b:26 o:22</p> <p>MERCEDES</p> <p>208, 210 308, 310 4t O100</p> <p>OM601940 OM602940</p> <p>MB 0041513601 BO 0001218110 HC CS576</p>	<p>STB0577</p>  <p>9 CR </p> <p>12v 1.4kW a:76 b:27.5 o:20</p> <p>BMW</p> <p>318, 320 M3</p> <p>M20B20, S14B23, M10B17</p> <p>BM 12411308543 BO 0001108063 HC CS577</p>	<p>STB0583</p>  <p>STB0583RB STB0583WA</p> <p>10 CR </p> <p>12v 1.7kW a:78 b:12.5 o:22</p> <p>MERCEDES</p> <p>400 420 500 560</p> <p>M119975 M117965 M116965 FI 43251450 BO 0001110039 HC CS583</p>
<p>STB0585</p>  <p>STB0585WA</p> <p>9 CR </p> <p>12v 1.4kW a:76 b:11 o:30</p> <p>ALFA ROMEO, FIAT, LANCIA</p> <p>Croma, Thesis Kappa, Thema Alfa 155, Alfa 164 Spider, GTV</p> <p>16105 936A6000 A64308 FI 60585343 BO 0001108159 HC CS585</p>	<p>STB0588</p>  <p>STB0588WA</p> <p>267 9 CR </p> <p>12v 1.4kW a:89 b:26.5 o:21</p> <p>JAGUAR</p> <p>XJ</p> <p>9BPMNA AJ6 AJ64 JG DBC1939N BO 0001110011 HC CS588</p>	<p>STB0589</p>  <p>STB0589WA</p> <p>268 9 CR </p> <p>12v 1.4kW a:73 b:40 o:20</p> <p>LANCIA, LAND ROVER</p> <p>Ardea Defender Discovery</p> <p>22D, OHV 35D, 36D 11D, 31D RO NAD101490 BO 0001108137 HC CS589</p>	<p>STB0595</p>  <p>STB0595RB STB0595WA STI0595RB</p> <p>340 11 CR </p> <p>24v 4kW a:89 b:28 o:30</p> <p>MAN</p> <p>NL Series NM Series SL Series L 2000</p> <p>D0826LUH01 D0226MF D0826LFL03 MN 51262017143 BO 0001368056 HC CS595</p>
<p>STB0597</p>  <p>STB0597RB STB0597WA</p> <p>254 10 ACR </p> <p>12v 1.1kW a:76 b:53 o:30</p> <p>VW</p> <p>Caravelle Multivan Transporter</p> <p>PD AXA AAC VW 02B911023BX BO 0001107005 HC CS597</p>	<p>STB0598</p>  <p>STB0598WA</p> <p>236 10 ACR </p> <p>12v 1.8kW a:76 b:52 o:30</p> <p>VW</p> <p>Transporter Multivan</p> <p>1X, AAB, ABL, AFF ACU, AEN, AET</p> <p>VW 02A911023CX BO 0001110062 HC CS598</p>	<p>STB0599</p>  <p>STB0599RB STB0599WA</p> <p>294 10 ACR </p> <p>12v 2.2kW a:76 b:52.5 o:30</p> <p>VW</p> <p>Transporter Eurovan IV 2.4D (90-98)</p> <p>AAB</p> <p>VW 02B911023AX BO 0001218116 HC CS599</p>	<p>STB0600</p>  <p>STB0600RB STB0600WA</p> <p>9 CR </p> <p>12v 1.7kW a:76 b: o:32</p> <p>VOLVO</p> <p>960</p> <p>B6254S B6304S B6304F VO 13639125 BO 0001110063 HC CS600</p>

Starters

Bosch

<p>STB0601</p>  <p>STB0601WA 244 10 ACR</p> <p>12v 1.1kW a:76 b:53 o:20</p> <p>VW Corrado Golf Passat</p> <p>2E, RP, PG AAM, 9A, KR 1H VW 02A911023E BO 0001107003 HC CS601</p>	<p>STB0606</p>  <p>STB0606RB STB0606WA 9 CR</p> <p>12v 1.7kW a:82.5 b:16 o:31</p> <p>AUDI, VW 80 90 Passat Santana</p> <p>CR JK CY VW 068911023L BO 0001110007 HC CS606</p>	<p>STB0607</p>  <p>STB0607RB 10 CR</p> <p>12v 2.9kW a:89 b:21 o:30</p> <p>RENAULT</p> <p>MN 81262019010 BO 0001359095 HC CS607</p>	<p>STB0608</p>  <p>STB0608WA 316 10 CR</p> <p>24v 4kW a:88.5 b:22 o:30</p> <p>RENAULT G Series Manager Midliner Premium</p> <p>DCI6A, DCI6W DCI4C, DCI4B MIDR060212D MN 81262019013 BO 0001368070 HC CS608</p>
<p>STB0610</p>  <p>STB0610WA 210.5 9 ACR</p> <p>12v 0.8kW a:67 b:41 o:30</p> <p>MG, ROVER ZR 100, 110 200, 214, 400 25, 45</p> <p>16K4F, 14K4F D16Y2, 11K2D 14K2A, 14K2D RO NAD101070 BO 0001106016 HC CS610</p>	<p>STB0611</p>  <p>STB0611WA 274 11 CR</p> <p>12v 2.2kW a:82.5 b:21 o:30</p> <p>ALFA ROMEO, CHRYSLER VM07B, VM31B DODGE, JEEP, ROVER VM82A, VM96A Alfa33, Alfa155, Alfa164 MPV, M51, M52 Voyager, Caravan FI 60512969 Cherokee, 800 BO 0001218023 HC CS611</p>	<p>STB0612</p>  <p>STB0612RB STB0612WA 227.55 9 CR</p> <p>12v 1.1kW a:82.5 b:16 o:22</p> <p>AUDI, BMC MAN, SKODA, VW Passat, 80, 100 A4, A6, Cabriolet Superb</p> <p>ISC260, AHL, ADP D2865LF23 AWT, AZM VW 06B911023 BO 0001107068 HC CS612</p>	<p>STB0614</p>  <p>STB0614WA 10 ACR</p> <p>12v 1.4kW a:76 b:54 o:20</p> <p>VW, SEAT Jetta Golf Passat</p> <p>VW 02A911023D BO 0001108077 HC CS614</p>
<p>STB0615</p>  <p>STB0615WA 9 ACR</p> <p>12v 1.4kW a:76 b:33 o:20</p> <p>FIAT, LANCIA, VW Tempra Tipo Dedra Passat</p> <p>VW 055911023G BO 0001108094 HC CS615</p>	<p>STB0616</p>  <p>STB0616WA 282.5 10 ACR</p> <p>12v 1.7kW a:76 b:55 o:20</p> <p>VW, SEAT Passat, Golf, Vento Toledo</p> <p>1Y, 1Z, AAZ, SB AHU VW 02A911023GX BO 0001110085 HC CS616</p>	<p>STB0617</p>  <p>STB0617WA 387 11 CR</p> <p>24v 5.4kW a:110 b:47 o:30</p> <p>DAF 95 Series Trucks</p> <p>WS225 WS242 WS268 DF 365211 BO 0001416062 HC CS617</p>	<p>STB0618</p>  <p>STB0618RB STB0618WA 223 9 ACR</p> <p>12v 1.1kW a:76 b:33 o:20</p> <p>AUDI, FORD SEAT, SKODA, VW A3, Galaxy Cordoba, Ibiza Octavia, Golf</p> <p>AEH AKL AGN, AGU VW 020911023N BO 0001107020 HC CS618</p>

Starters

Bosch

<p>STB0619</p>  <p>STB0619RB STB0619WA</p> <p>245 10 ACR</p>  <p>10</p> <p>12v 1.1kW a:76 b:53 o:20</p> <p>AUDI, FORD, SEAT SKODA, VW A3, Galaxy Octavia, Golf Passat, Vento</p> <p>AEG, FG 9A, 2E, ADY AGN, AGU VW 02A911023FX BO 0001107022 HC CS619</p>	<p>STB0620</p>  <p>STB0620RB STB0620WA</p> <p>288.5 10 ACR</p>  <p>10</p> <p>12v 1.7kW a:76 b:52.5 o:20</p> <p>FORD, VW Galaxy Beetle, Bora Corrado, Golf Passat, Sharan</p> <p>AAA AQN ABV VW 02A911023HX BO 0001110087 HC CS620</p>	<p>STB0622</p>  <p>9 CR</p>  <p>9</p> <p>12v 1.1kW a:76 b:9 o:20</p> <p>ALFA ROMEO Alfa 75 1.8L, 2.5L, 3.0L Alfa 90 2.5L GTV 2.5L Milano 2.5L, 3.0L</p> <p>V6 FI 60521994 BO 0001311139 HC CS622</p>	<p>STB0624</p>  <p>STB0624RB STB0624WA STV0624RB</p> <p>270 9, 10 CR</p>  <p>9</p> <p>12v 1.8kW a:82.5 b:15 o:22</p> <p>AUDI, FERRARI MULTICAR, SEAT SKODA, VW 80, A4, A6 Passat, Superb</p> <p>AWX, AVF AVB, AHU AVG, AFN BO 0001110066 BO 0001110066 HC CS624</p>
<p>STB0680</p>  <p>STB0680RB STB0680WA</p> <p>241.5 9 CR</p>  <p>9</p> <p>12v 1.4kW a:76 b:-1 o:32</p> <p>RENAULT, VOLVO Safrane 850 C70, V40, V70 S40, S60, S70, S80</p> <p>B5244T, B5204F N7Q710, N7Q711 B5252, B52028 RE 7700103386 BO 0001108167 HC CS680</p>	<p>STB0682</p>  <p>STB0682RB STB0682WA</p> <p>341 9 CR</p>  <p>9</p> <p>12v 3kW a:110 b:27.5 o:30</p> <p>FIAT, IVECO NEW HOLLAND Agricultural machine Industrial Engine Marine</p> <p>100GF000 836125 8361S11000 FI 4719666 BO 0001230009 HC CS682</p>	<p>STB0683</p>  <p>STB0683WA</p> <p>241 9 ACR</p>  <p>9</p> <p>12v 0.95kW a:76 b:44.5 o:20</p> <p>VW Transporter Vanagon Eurovan Type II</p> <p>DF, DG MV, DJ SS, SR VW 025911023A WAI 0001208425 HC CS683</p>	<p>STB0684</p>  <p>STB0684RB STB0684WA STV0684RB</p> <p>265 10, 11 CR</p>  <p>10</p> <p>12v 1.7kW a:66 b:-1 o:33</p> <p>MINI, MITSUBISHI, NEOPLAN PORSCHE, RENAULT SCANIA, VOLVO Clio, Laguna Megane, 340, 460</p> <p>D16, D19T, D13A440 D2066LUH47 F8Q730, K7M744 RE 7700761416 BO 0001110095 HC CS684</p>
<p>STB0685</p>  <p>STB0685WA</p> <p>208.5 10 CR</p>  <p>10</p> <p>12v 1.4kW a:75 b:13.5 o:33</p> <p>FORD Fiesta Escort Sierra Orion</p> <p>F4A, F4B, L1E, L1H N5C, N7A, RDA, RQC L1G, L4B, LUH, RQB FO 92AB11000FB BO 0001107028 HC CS685</p>	<p>STB0687</p>  <p>STB0687RB STB0687WA</p> <p>9 CR</p>  <p>9</p> <p>12v 1.1kW a:76 b:28 o:20</p> <p>ALFA ROMEO Alfa 145 Alfa 146 Alfa 33</p> <p>AR33401, AR30737 AR33201, AR30558 AR30734, AR30746 FI 60562974 BO 0001107009 HC CS687</p>	<p>STB0688</p>  <p>STB0688WA</p> <p>405 12 CR</p>  <p>12</p> <p>24v 6.6kW a:89 b:40 o:30</p> <p>RENAULT VI Agora, Ares C Series, Kerax Major, Maxter Manager, Premium</p> <p>MIDR062045E MIDS062045B MI7R062045C41 RE 5010050904 BO 0001417053 HC CS688</p>	<p>STB0690</p>  <p>STB0690WA</p> <p>9 CR</p>  <p>9</p> <p>12v 1.1kW a:82 b:2 o:32</p> <p>VOLVO 760 Series 780 Series</p> <p>VO 1398764 BO 0001108090 HC CS690</p>

Starters

Bosch

<p>STB0699</p>  <p>387 12 CR</p> <p>24v 5.4kW a:92 b:47 o:30</p> <p>VOLVO FL Series FM Series</p> <p>D7C290, D7A285 TD71F, TD71FQ D7B230, D7A285 VO 5003312 BO 0001416065 HC CS699</p>	<p>STB0704 <i>New</i></p>  <p>310 9 CR</p> <p>12v 3kW: a:110 b:26 o:30</p> <p>ALLIS CHALMERS FIAT LONG</p> <p>IS 11130127 BO 0001359091 MH STB0704</p>	<p>STB0706</p>  <p>342 10 CR</p> <p>12v 2.7kW a:82.5 b:35 o:20</p> <p>JOHN DEERE 1000 Series 2000 Series Industrial Engine Agricultural Machine</p> <p>JD AL41247 BO 0001358041 HC CS706</p>	<p>STB0709</p>  <p>272 9 CR</p> <p>12v 2.2kW a:81.5 b:23 o:33</p> <p>ALFA ROMEO, FIAT FORD, LANCIA Alfa145, Alfa146 Tempra, Tipo Dedra, Delta</p> <p>160D1000 831D1000 AR67501, AR33601 FI 60808773 BO 0001218133 HC CS709</p>
<p>STB0710</p>  <p>387 11 CR</p> <p>24v 5.4kW a:89 b:48 o:30</p> <p>FIAT-ALLIS, MERCEDES STEYR, VOLVO Unimog 19s, 22s, 26s, 32s B Series</p> <p>THD100DA OM353973 WD815, WD81560 MB 11512901 BO 0001410044 HC CS710</p>	<p>STB0713</p>  <p>236 9 ACR</p> <p>12v 1.8kW a:76 b:33 o:20</p> <p>AUDI, FORD, SKODA SEAT, VOLKSWAGEN A3, Galaxy Octavia, Polo Alhambra, Cordoba</p> <p>ALH, AGZ AGR, AHF AEY, ASV VW 068911023T BO 0001110076 HC CS713</p>	<p>STB0714</p>  <p>10 CR</p> <p>12v 1.4kW a:76 b:14.5 o:30</p> <p>FORD Scorpio</p> <p>GAE GGE FO 85GB11000CA BO 0001108110 HC CS714</p>	<p>STB0715</p>  <p>207 9, 11 CR</p> <p>12v 1.4kW a:62 b:-5 o:33</p> <p>CITROEN, FIAT PEUGEOT Berlingo, Xsara Ducato, Ulysse 306, 406, 605, 806</p> <p>LFZ, RFX LFY, RGX RFU, RFW CI 96102058 BO 0001108176 HC CS715</p>
<p>STB0718</p>  <p>340 9, 11 CR</p> <p>12v 3kW a:82.5 b:23 o:20</p> <p>LAMBORGHINI SAME, STEYR Agricultural machine Industrial Engines</p> <p>10003 WD411, WD611 DA1056 SK 9144820 BO 0001230012 HC CS718</p>	<p>STB0719</p>  <p>10 CR</p> <p>12v 1.4kW a:76 b:14 o:32</p> <p>FORD Escort Mondeo</p> <p>L1E, L1H, L1K RDA, RKC, L1J CJBB, NGA FO 93BB11000HB BO 0001108121 HC CS719</p>	<p>STB0723</p>  <p>9 CR</p> <p>12v 0.9kW a:82.5 b:15 o:32</p> <p>VW Golf 1.4L Vento 1.4L</p> <p>ABD VW 036911023PX BO 000112021 HC CS723</p>	<p>STB0724</p>  <p>208.5 10 CR</p> <p>12v 1.4kW a:75 b:13.5 o:33</p> <p>FORD Escort Fiesta Orion Sierra</p> <p>FUG, F6E, LJD, FUJ RDA, N7A, L4B, RQB L1K, N5C, N5D FO 92AB11000GA BO 0001108140 HC CS724</p>

Starters

Bosch

<p>STB0725</p>  <p>STB0725RB STB0725WA</p> <p>245 9 CR</p> <p>9</p> <p>12v 1.4kW a:76 b:28 o:21</p> <p>AUDI, VW 100, 80, A4 A6, A8, Cabriolet Passat</p> <p>ALG, ACK, AQD ABC, AAH, ACZ AFF, AEJ, APR VW 078911023X BO 0001108113 HC CS725</p>	<p>STB0727</p>  <p>STB0727RB STB0727WA STM0727RB</p> <p>9 CR</p> <p>9</p> <p>12v 1.1kW a:82 b:20 o:21</p> <p>DAEWOO, OPEL SAAB, VAUXHALL Espero, Astra Kadett, Omega, Vectra 9-3, 9-5, Frontera</p> <p>C20NE, C18LE C18NZ, C20XE C20LZ, C20LE OP 90458462 BO 0001107015 HC CS727</p>	<p>STB0737</p>  <p>STB0737WA</p> <p>194 9 CR</p> <p>9</p> <p>12v 1.2kW a:74 b:20 o:20</p> <p>FORD, JCB JOHN DEERE, VOLVO Agricultural machine Industrial Engine Marine</p> <p>PE 185086610 BO 0001107078 HC JS737</p>	<p>STB0762</p>  <p>STB0762RB STB0762WA</p> <p>258 9, 11 CR</p> <p>9</p> <p>12v 1.4kW a:82 b:8 o:33</p> <p>CHRYSLER, DODGE PLYMOUTH Lebaon, Saratoga Voyager, Caravan Grand Voyager</p> <p>6G72 300 EFA CH 5227248 BO 0001108070 HC JS762</p>
<p>STB0782</p>  <p>STB0782WA</p> <p>9 CR</p> <p>9</p> <p>12v 2.2kW a:81.5 b:22.5 o:30</p> <p>RENAULT Safrane</p> <p>RE 7701352256 BO 0001218764 HC CS782</p>	<p>STB0788</p>  <p>STB0788RB STE0788WA</p> <p>229 9 CR</p> <p>9</p> <p>12v 0.9kW a:82.5 b:1.5 o:42</p> <p>SEAT, VW Arosa Lupo Polo</p> <p>ANW, ALL APE, AUA APQ, AKV MM 63223039 BO 0001112044 HC CS788</p>	<p>STB0789</p>  <p>STB0789RB STB0789WA STV0789WA</p> <p>236 9 ACR</p> <p>9</p> <p>12v 1.8kW a:76 b:32 o:30</p> <p>AUDI, FORD MERCEDES, SEAT SKODA, VW Golf, Passat Transporter, Octavia</p> <p>AGR, AQM ASV, AHF ALH, AAZ, 1Z VW 020911024AX BO 0001125005 HC CS789</p>	<p>STB0790</p>  <p>STB0790RB STB0790WA STF0790RB</p> <p>210 10 CR</p> <p>10</p> <p>12v 1kW a:76 b:13.5 o:32</p> <p>FORD Mondeo Escort</p> <p>L1H, RDA, RKC NGA, RKA, RKB RKF, RKJ, L1F FO 93BB11000DB BO 0001107016 HC CS790</p>
<p>STB0792</p>  <p>STB0792RB STB0792WA</p> <p>269 9 CR</p> <p>9</p> <p>12v 1.7kW a:76 b:21.5 o:22</p> <p>ALPINA-BMW BMW Roadster 5, 7, 8, M, X, Z</p> <p>M62B44 S38B49 M60B30 BM 12411729981 BO 0001110072 HC CS792</p>	<p>STB0793</p>  <p>STB0793WA</p> <p>9 CR</p> <p>9</p> <p>12v 1.7kW a:76 b:21 o:22</p> <p>BMW 530, 535, 540 730, 740</p> <p>M62B35 M60B40, M62B44 M60B30 BM 12411729982 BO 0001110071 HC CS793</p>	<p>STB0794</p>  <p>STB0794WA</p> <p>10 CR</p> <p>10</p> <p>12v 2.2kW a:82.5 b:26 o:22</p> <p>MERCEDES 230, 250 290, 300 350 Axor2</p> <p>OM603972, OM902913 OM603931, M103987 OM603930, M102979 MB 0041512101 BO 0001218109 HC CS794</p>	<p>STB0797</p>  <p>STB0797WA</p> <p>12 CR</p> <p>12</p> <p>24v 6.6kW a:92 b:47 o:30</p> <p>VOLVO Medium&Heavy Duty Trucks</p> <p>F16 FH16</p> <p>VO 872364 BO 0001417063 HC CS797</p>

Starters

Bosch

<p>STB0799</p>  <p>STB0799WA 326.5 11 CR</p> <p>12v 3kW a:89 b:49 o:30</p> <p>URSUS LAMBORGHINI STEYR Agricultural Tractors</p> <p>985 Engine 1056 Engine SK 443115144640 BO 0001359053 HC CS799</p>	<p>STB0801</p>  <p>STB0801RB STB0801WA STB801WA 238 10 ACR</p> <p>12v 1.8kW a:76 b:52.5 o:30</p> <p>SEAT, VW Ibiza Multivan Transporter Eurovan</p> <p>AAB, AET AVT, APL ACU, AEN VW 028911023M BO 0001125001 HC CS801</p>	<p>STB0802</p>  <p>STB0802WA 9 CR</p> <p>12v 1.4kW a:76 b:19.5 o:20</p> <p>OPEL, SAAB Calibra, Sintra Vectra 9000</p> <p>B308I C25XE X30XE OP 1202139 BO 0001108148 HC CS802</p>	<p>STB0804</p>  <p>294.5 9 CR</p> <p>12v 2.4kW a:82.5 b:19.5 o:20</p> <p>ATLAS KHD Industrial Engine</p> <p>F1L410 F2L411 F2L410 KH 01161890 BO 0001362046 HC CS804</p>
<p>STB0805</p>  <p>STB0805WA 387.5 13 CR</p> <p>24v 5.5kW a:89 b:46 o:30</p> <p>HANOMAG MERCEDES</p> <p>D943 D962 D963 DZ 1170389 BO 0001416004 HC CS805</p>	<p>STB0865</p>  <p>STB0865WA 497.5 11 CR</p> <p>24v 6.7kW a:92 b:47 o:30</p> <p>CATERPILLAR, CLARK CUMMINS, FIAT-ALLIS D3</p> <p>3204 MN 81262016022 BO 0001371018 HC US864</p>	<p>STB0878</p>  <p>STB0878WA 9 CR</p> <p>12v 1.4kW a:89 b:18.5 o:20</p> <p>SAAB 900 9000</p> <p>B212I B234I B234R, B234L SA 8826851 BO 0001108092 HC CS878</p>	<p>STB0879</p>  <p>STB0879RB STB0879WA 215.5 9 CR</p> <p>12v 1.1kW a:82.5 b:19 o:21</p> <p>CHEVROLET, CITROEN DAEWOO, HOLDEN ISUZU, OPEL PEUGEOT</p> <p>9HZ, 8HZ X20SED, T18SED Z24XE, C18XE OP 1202145 BO 0001107034 HC CS879</p>
<p>STB0880</p>  <p>STB0880RB STB0880WA 234 9 CR</p> <p>12v 1.1kW a:82 b:2 o:42</p> <p>SEAT, VW Arosa, Cordoba Ibiza, Inca Caddy, Golf Lupo, Polo</p> <p>AEE, AKP, ABU AUA, AHW, AJV ABD, AYQ, ANM VW 036911025B BO 0001107025 HC CS880</p>	<p>STB0881</p>  <p>STB0881WA 406 11 CR</p> <p>24v 6.6kW a:92 b:36.5 o:30</p> <p>SCANIA 112 Series 113 Series 143 Series</p> <p>DSC1408, DSC1122 DSC1116, DSC1121 DN11, DS1115 SC 349575 BO 0001417042 HC CS881</p>	<p>STB0884</p>  <p>STB0884WA 10 CR</p> <p>12v 1.4kW a:62 b:4.5 o:33</p> <p>CITROEN, PEUGEOT Xantia ZX 306 405</p> <p>1.6L 1.8L 2.0L PE 5802E6 BO 0001108128 HC CS884</p>	<p>STB0885</p>  <p>STB0885WA STB9885WA 272.5 9, 10, 11 CR</p> <p>12v 2.2kW a:74 b:-5.5 o:33</p> <p>CITROEN, PEUGEOT Jumper Boxer 605</p> <p>THY, T9A T8A, THX PE 9625382480 BO 0001218157 HC CS885</p>

Starters

Bosch

<p>STB0887</p>  <p>STB0887WA 303 9 CR</p> <p>12v 3.1kW a:89 b:28 o:30</p> <p>BOSCH, DEUTZ-FAHR KHD, LINDE</p> <p>F3L912 F4L912 BF6L913 KH 1180805 BO 0001369014 HC CS887</p>	<p>STB0888</p>  <p>STB0888WA 10 ACR</p> <p>12v 1.7kW a:76 b:77 o:20</p> <p>VW, PORSCHE, SEAT 911, 997 Cordoba 1.4 Polo 1.0</p> <p>M3069, M3069S M9670, M9770 ANW, AEV PO 96460410400 BO 0001115011 HC CS888</p>	<p>STB0936</p>  <p>9 CR</p> <p>12v 2.2kW a:82.5 b:8 o:20</p> <p>NISSAN Patrol Trade Vanette</p> <p>RD28T NI 23300G9900 BO 9000331428 HC JS936</p>	<p>STB0951</p>  <p>STB0951WA 9 CR</p> <p>12v 3kW a:89 b:47 o:30</p> <p>VOLVO BM, STEYR KHD, LIEBHERR CLAAS Bulldozers Combines</p> <p>MB 0011513601 BO 0001413006 HC CS951</p>
<p>STB0954</p>  <p>STB0954WA 11 CR</p> <p>24v 6.6kW a:89 b:47 o:30</p> <p>VOLVO PENTA Marine</p> <p>KH 1164269 BO 0001417023 HC CS954</p>	<p>STB0955</p>  <p>STB0955WA 388 9 CR</p> <p>24v 5.4kW a:89 b:47 o:30</p> <p>VOLVO PENTA Marine</p> <p>AQD70 TD60 TMD70 VO 881683 BO 0001416028 CG 111218</p>	<p>STB0960</p>  <p>STB0960WA 214.35 10 CR</p> <p>12v 0.9kW a:76 b:26.5 o:33</p> <p>FORD, MAZDA VOLVO Fiesta, Focus B-Max, C-Max S40, V50</p> <p>D16E660 D13B500 DHA, DHB FO 98AB11000CB BO 0001107407 HC CS960</p>	<p>STB0962</p>  <p>STB0962WA 407 12 CR</p> <p>24v 6.6kW a:92 b:47 o:30</p> <p>VOLVO FH Series FL Series NH Series</p> <p>D12A420 D12C340 D12D340 VO 1547049 BO 0001417065 HC CS962</p>
<p>STB0972</p>  <p>STB0972WA 139.75 9 CR</p> <p>12v 1.1kW a:89 b:29.5 o:30</p> <p>FORD Transit</p> <p>4RB, LAT, NAV 4RC, NAT, NCA N6T, NBA FO 89VX11000AA BO 0001108141 HC CS972</p>	<p>STB0973</p>  <p>STB0973RB STB0973WA 272.5 9 CR</p> <p>12v 2.2kW a:81.5 b:21.5 o:30</p> <p>CITROEN, FIAT, PEUGEOT Jumper Ducato Boxer</p> <p>814063 814043 814043N FI 43251487 BO 0001218159 HC CS973</p>	<p>STB0974</p>  <p>STB0974RB STB0974WA STV0974RB 235 10, 11 ACR</p> <p>12v 1.8kW a:76 b:52.5 o:20</p> <p>AUDI, FORD, SEAT SKODA, VW A2, A3, Galaxy Fabia, Octavia Golf, Passat, Polo</p> <p>AFN, 1Z AHU, AMF AXR, ATD VW 02A911023JX BO 0001125012 HC CS974</p>	<p>STB0976</p>  <p>STB0976RB STB0976WA 246 10 CR</p> <p>12v 2kW a:82.5 b:18.5 o:21</p> <p>OPEL, SAAB VAUXHALL Astra, Omega, Vectra Zafira 9-3, 9-5</p> <p>D223L X20DTL X20DH Y20DTL Y20DTH OP 90519331 BO 0001109015 HC CS976</p>

Starters

Bosch

<p>STB0979</p>  <p>STB0979WA 267 9 CR</p> <p>12v 1.4kW a:82 b:8 o:32</p> <p>CHRYSLER, DODGE EDT EDR PLYMOUTH EDG EDM Daytona, GTS, Lebaron K00 Caravan, Dakota CH 4557130 Lancer, Voyager BO 0001108103 HC CS979</p>	<p>STB0982</p>  <p>STB0982RB STB0982WA 230 9 CR</p> <p>12v 1.4kW a:76.5 b:19 o:20</p> <p>CADILLAC X25XE OPEL, VAUXHALL X30XE Catera Omega OP 90542532 BO 0001108150 HC CS982</p>	<p>STB0984</p>  <p>STB0984RB STB0984WA 239 9 CR</p> <p>12v 2kW a:76 b:21 o:22</p> <p>BMW, LAND ROVER 25DT X25DT Y25DT OPEL, VAUXHALL M51D25 M57D30 3, 5, 7, X M57N306D2 Range Rover BM 12417788680 Omega BO 0001109025 HC CS984</p>	<p>STB0985</p>  <p>STB0985WA 9 CR</p> <p>12v 1.8kW a:76 b:29 o:21</p> <p>AUDI ABH, AEC 100 AHK, AEC S6 PT V8 VW 077911023C BO 0001110030 HC CS985</p>
<p>STB0986</p>  <p>STB0986RB STB0986WA 211.75 21 CR</p> <p>12v 1.1kW a:72 b:15 o:32</p> <p>FORD JJA JJC JJE Fiesta JJJ JJK JJM Ka J4C J4J J4Q FO 97KB11000AB BO 0001107059 HC CS986</p>	<p>STB0988</p>  <p>STB0988RB STB0988WA 247 9 ACR</p> <p>12v 1.8kW a:66 b:46 o:20</p> <p>SEAT, VW AGD 1Y AHG Arosa ASX AEF AKU Lupo Polo VW 085911023AX BO 0001125003 HC CS988</p>	<p>STB0989</p>  <p>STB0989WA 352.5 9 CR</p> <p>24v 4kW a:89 b:38 o:30</p> <p>DAF CS133M CS158M 45 CT108 CS119 CB108 CD85 DF 1201327 BO 0001368083 HC CS989</p>	<p>STB0990</p>  <p>STB0990RB STB0990WA 207.5 8 CR</p> <p>12v 1.1kW a:74 b:9 o:21</p> <p>CHRYSLER, DODGE ECC PLYMOUTH C00 Neon 420X, ECB Stratus CH 4793110 BO 0001107031 HC CS990</p>
<p>STB0996</p>  <p>STB0996WA 11 CR</p> <p>12v 2.5kW a:82.5 b:22 o:20</p> <p>LAMBORGHINI, SAAB 2J Agricultural 2G Marine FI 63217163 BO 0001223506 HC CS996</p>	<p>STB1031</p>  <p>STB1031WA 384.5 9 CR</p> <p>12v 3.6kW a:92 b:47 o:30</p> <p>MERCEDES-BENZ 401 421 MB 0031516301 BO 0001413017 CG 110539</p>	<p>STB1034</p>  <p>STB1034WA 384.5 11 CR</p> <p>24v 5.4kW a:89 b:48 o:30</p> <p>DAF DKTD1160 F DKDL1160 SB Various Models DAF 293889 BO 0001416044 CG 110932</p>	<p>STB1036</p>  <p>STB1036RB STB1036WA 245.5 9 CR</p> <p>12v 1.4kW a:66 b:10 o:20</p> <p>EAGLE, JEEP EPE Premier HX Cherokee 4L Wrangler JP 8953002125 Comanche, Wagoneer BO 0001108031 HC CS1036</p>






Starters

Bosch

<p>STB1037</p>  <p>STB1037WA 240 9 CR</p> <p>12v 1.7kW a:82 b:23.5 o:33</p> <p>FIAT Fiorino Palio, Punto Strada, Uno</p> <p>146B2000 176A3000 176B7000 FI 46554407 BO 0001109018 HC CS1037</p>	<p>STB1040</p>  <p>STB1040WA 407 11 CR</p> <p>24v 6.6kW a:92 b:36.5 o:30</p> <p>SCANIA 112 Series</p> <p>DS1115, DS1114 DSC11 DS SC 571454 BO 0001417043 HC CS1040</p>	<p>STB1041</p>  <p>STB1041WA 268 9 CR</p> <p>12v 1.8kW a:76 b:27.5 o:21</p> <p>AUDI A6, A8 S6, S8</p> <p>AWN, ARS, ASG BAT, ABZ, AEW AUX, AUW, AQF VW 077911023E BO 0001110100 HC CS1041</p>	<p>STB1042</p>  <p>STB1042WA STE1042RB 211.8 9 CR</p> <p>12v 1.4kW a:66 b:10 o:30</p> <p>ALFA-ROMEEO FIAT, LANCIA GT, GTV, Spider Brava, Coupe Punto, Lybra</p> <p>185A8000 937A1000 841E000 FI 46454211 BO 0001107066 HC CS1042</p>
<p>STB1044</p>  <p>STB1044RB STB1044WA STV1044RB 240 10, 11 CR</p> <p>12v 2kW a:82.5 b:26 o:22</p> <p>MERCEDES-BENZ Sprinter Vario Vito</p> <p>OM602985 OM601942 OM611981 MB 0011548901 BO 0001109014 HC CS1044</p>	<p>STB1045</p>  <p>STB1045WA 226 9, 11 CR</p> <p>12v 2kW a:82 b:9 o:30</p> <p>ALFA-ROMEEO FIAT, LANCIA Brava, Doblo Punto, Stilo Lybra, Thesis</p> <p>841E000 937A2000 182B9000 FI 46473784 BO 0001109030 HC CS1045</p>	<p>STB1046</p>  <p>STB1046RB STB1046WA 9 CR</p> <p>12v 2.2kW a:76 b:21 o:20</p> <p>BMW 750 850</p> <p>M73B54 M70B50 BM 12411711403 BO 0001218027 HC CS1046</p>	<p>STB1047</p>  <p>STB1047RB STB1047WA 245 9 ACR</p> <p>12v 1.8kW a:76 b:27 o:20</p> <p>SEAT, SKODA, VW Felicia Cordoba Caddy Golf</p> <p>AEK, AKS, AEX AEA, AEE, AAM 1F, ABD, ACC VW 6U0911023A BO 0001124013 HC CS1047</p>
<p>STB1048</p>  <p>STB1048WA 265.5 13 CR</p> <p>12v 1.8kW a:76 b:20.5 o:30</p> <p>BMW 3</p> <p>M41D18 BM 12411245328 BO 0001110110 HC CS1048</p>	<p>STB1049</p>  <p>STB1049WA 268 9 CR</p> <p>12v 1.7kW a:74 b:40 o:20</p> <p>LAND ROVER Defender Discovery Range Rover</p> <p>22D, OHV, 38D 35D, 36D, 11D 40D, 42D, 46D RO NAD101190 BO 0001110120 HC CS1049</p>	<p>STB1050</p>  <p>STB1050RB STB1050WA STV1050RB 214.35 10 CR</p> <p>12v 1.1kW a:76 b:27 o:33</p> <p>FORD, MAZDA, VOLVO C-Mac, Focus, Fusion S40, V50 FH Series FM Series</p> <p>D16E660 XTDA, DHB FXDA, FYDA FO 98AB11000CD BO 0001107417 HC CS1050</p>	<p>STB1053</p>  <p>STB1053RB STB1053WA 211.8 9 CR</p> <p>12v 1.1kW a:66 b:10 o:30</p> <p>ALFA ROMEO, FIAT LANCIA Alfa 145, Alfa 156 Coupe, Punto Kappa, Lybra</p> <p>AR67204, AR32201 182A2000, 175A3000 838A2000, 838A1000 FI 46406973 BO 0001107066 HC CS1053</p>

Starters

Bosch

<p>STB1059</p>  <p>263 10 CR</p> <p>10</p> <p>12v 1.7kW a:82.5 b:24 o:33</p> <p>FIAT, SEAT Regata, Strada, Ritmo Tipo, Fiorino, Duna Ibiza</p> <p>138C000, 146B200 176A3000, 146D7000 021A3000, 149B3000 FI 46231602 BO 0001110125 HC CS1059</p>	<p>STB1061</p>  <p>STB1061WA</p> <p>429 11 CR</p> <p>11</p> <p>24v 6.7kW a:92 b:48 o:30</p> <p>SCANIA 114 Series 124 Series 164 Series</p> <p>DT1201, DC1201 DSC1201, DC1101 DSC1202, DSC1205 SC 571168 BO 0001371006 HC CS1061</p>	<p>STB1062</p>  <p>STB1062RB STB1062WA STV1062RB</p> <p>212 9 ACR</p> <p>9</p> <p>12v 1.1kW a:76.5 b:32 o:30</p> <p>AUDI, FORD, SEAT SKODA, VW A3, TT, Focus Octavia, Bora Golf, Passat, Polo</p> <p>1F, BLF, BLR AEP, AUR, ADD 1Z, AGG, AJH VW 020911024B BO 0001121006 HC CS1062</p>	<p>STB1063</p>  <p>STB1063WA</p> <p>211 9 CR</p> <p>9</p> <p>12v 1.1kW a:82.5 b:3.5 o:31</p> <p>SEAT, SKODA VW Arosa, Ibiza Cordoba, Fabia Lupo, Polo</p> <p>AEX, AKV, APQ ANW, AKK, AUD BBY, AEE, BKY VW 001911023C BO 0001121001 HC CS1063</p>
<p>STB1064</p>  <p>STB1064WA</p> <p>9 CR</p> <p>9</p> <p>12v 1.1kW a:76 b:30 o:21</p> <p>VW Passat 2.3L</p> <p>B5 VR5</p> <p>VW 012911023 BO 0001107071 HC CS1064</p>	<p>STB1066</p>  <p>STB1066RB STB1066WA</p> <p>9 CR</p> <p>9</p> <p>12v 1.4kW a:76 b:5 o:22</p> <p>FORD Mercur Scorpio</p> <p>2.9L</p> <p>FO 95GB11000DA BO 0001108156 HC CS1066</p>	<p>STB1067</p>  <p>STB1067RB STB1067WA STE1067RB</p> <p>231.5 9 CR</p> <p>9</p> <p>12v 1.4kW a:76 b:22 o:32</p> <p>BMW, FORD BERTOLINI 3, 5, 7, X, Z Cargo, Sierra</p> <p>M40B16, M40B18 M42B18, M50B20 RFL, 905AA Dover BM 12417501738 BO 0001108157 HC CS1067</p>	<p>STB1071</p>  <p>STB1071WA</p> <p>242 9 CR</p> <p>9</p> <p>12v 2kW a:82.5 b:21 o:20</p> <p>OPEL, VAUXHALL Frontera</p> <p>25TDS</p> <p>OP 6202048 BO 0001109033 HC CS1071</p>
<p>STB1072</p>  <p>STB1072RB STB1072WA STV1072RB</p> <p>10 CR</p> <p>10</p> <p>12v 1.7kW a:60 b:27 o:22</p> <p>MAYBACH, MERCEDES Maybach 5.5 Maybach 6.0 CL, CLK, CLS C-Class, E-Class</p> <p>M282950 M112910, M112912 M113968 MB A0061510601 BO 0001115005 HC CS1072</p>	<p>STB1073</p>  <p>STB1073RB STB1073WA STN1073WA</p> <p>11 CR</p> <p>11</p> <p>12v 2.4kW a:82.5 b:22 o:20</p> <p>GOLDONI, LAND ROVER HATZ, BMW Marine, Industrial Agricultural Range Rover</p> <p>VMRA394 11A 14L IS AZJ3258 BO 0001367008 HC CS1073</p>	<p>STB1074</p>  <p>STB1074RB STB1074WA</p> <p>230 9 CR</p> <p>9</p> <p>12v 1.4kW a:82.5 b:27.5 o:21</p> <p>AUDI, SKODA, VW A4, A6, A8, Allroad Superb Passat</p> <p>ATX, ATQ, AGE AMX, ACK, ABC AAH, ACK, ALG VW 078911023D BO 0001108174 HC CS1074</p>	<p>STB1075</p>  <p>STB1075RB STB1075WA</p> <p>219.8 9, 10 CR</p> <p>9</p> <p>12v 1.2kW a:82.5 b:26 o:22</p> <p>MERCEDES-BENZ, VW SSANGYONG, DAEWOO Korando, Musso Sprinter LT, Vito</p> <p>M111948, M102942 AGL, M161E23 M111970, M104992 MB 11516901 BO 0001107048 HC CS1075</p>

Starters

Bosch

STB1077	STB1078	STB1079	STB1081
 <p>STB1077WA 405 9 CR</p>	 <p>STB1078WA 9 CR</p>	 <p>STB1079WA 8 CR</p>	 <p>STB1081RB 8 ACR</p>
<p>24v 6.2kW a:92 b:48 o:30</p> <p>MERCEDES-BENZ Actros Travego</p> <p>OM541970 OM541990 OM542920 MB 0041519501 BO 0001372001 HC CS1077</p>	<p>12v 1.4kW a:76 b:21 o:32</p> <p>BMW 3, 5, 7 Z3, Z4 X3, X5</p> <p>BM 12411317584 BO 0001108145 HC CS1078</p>	<p>12v 1.1kW a:70 b:11 o:21</p> <p>NISSAN Micra</p> <p>CG10DE CGA3DE NI 233001F710 BO 0001107010 HC JS1079</p>	<p>12v 1.1kW a:70 b:43 o:20</p> <p>NISSAN CHERRY II,III 1.3L 1.5L MICRA I, II 1.0L 1.2L 1.3L SUNNY I,II 1.3L 1.4L 1.5L 1.6L PRAIRIE 1.5</p> <p>CG10DE,CG13DE CG14DE,E15S,E13 MA10S NI 2330099B05 BO 0001107039 HC JS1081</p>
STB1105	STB1110	STB1112	STB1113
 <p>STB1105WA 211 9 CR</p>	 <p>STB1110 9 CR</p>	 <p>STB1112RB STB1112WA 313 9 CR</p>	 <p>STB1113 9 CR</p>
<p>12v 1.1kW a:74 b:9 o:21</p> <p>TOYOTA Avensis Carina Corolla</p> <p>4AFE 7AFE 7AF TO 2810002080 BO 0001107030 HC JS1105</p>	<p>12v 1.4kW a:76 b:6 o:20</p> <p>FORD Capri II 2.8L Scorpio 2.8L</p> <p>FO 85GX11000DA BO 0001108019 HC CS1110</p>	<p>24v 4kW a:89 b:48 o:30</p> <p>MERCEDES-BENZ Atego Atego 2 Vario Citaro</p> <p>OM906962 OM906920 OM924920 MB A0061512201 BO 0001231002 HC CS1112</p>	<p>12v 1.7kW a:76 b:1 o:32</p> <p>VOLVO S80 S90 V90 960</p> <p>B6304S3 B6284T B6254S VO 8111007 BO 0001115002 HC CS1113</p>
STB1114	STB1115	STB1118	STB1119
 <p>STB1114WA 285 10 CR</p>	 <p>STB1115WA 237 9 CR</p>	 <p>STB1118RB STB1118WA STB9118WA 274 9 CR</p>	 <p>STB1119WA 211.5 10 ACR</p>
<p>12v 2kW a:76 b:29 o:22</p> <p>AUDI, SKODA, VW A4, A6, A8 Superb Passat</p> <p>AFB, AKN BDH, BAU BDG, AFF VW 059911023H BO 0001109021 HC CS1114</p>	<p>12v 2kW a:82.5 b:20.5 o:22</p> <p>VW LT</p> <p>AGX VW 069911023H BO 0001125503 HC CS1115</p>	<p>12v 2.2kW a:110 b:27 o:31</p> <p>IVECO Daily I</p> <p>8140072700 8140072712 814061200 IV 42498678 BO 0001218174 HC CS1118</p>	<p>12v 1.1kW a:76 b:53 o:20</p> <p>AUDI, SEAT, SKODA, VW A3, TT Fabia, Octavia Bora, Golf, Passat</p> <p>APK, AQY ADZ, ADY 412TCE, BFS VW 02T911024E BO 0001121008 HC CS1119</p>

Starters

Bosch

<p>STB1121</p>  <p>STB1121WA 315.6 11 CR</p> <p>12v 2.4kW a:89 b:49 o:30</p> <p>CLAAS Agricultural</p> <p>4236 4248 6354, 6372 BO 0001358021 BO 0001359107 HC CS1121</p>	<p>STB1123</p>  <p>STB1123WA 342 10 CR</p> <p>12v 3kW a:89 b:30 o:30</p> <p>CATERPILLAR MERCEDES VOLVO F Series Hanomag</p> <p>D39B CL 4303062 BO 0001367076 HC CS1123</p>	<p>STB1126</p>  <p>STB1126WA 10 CR</p> <p>12v 3.1kW a:92 b:21 o:30</p> <p>FORD Landbrug NEW HOLLAND M, NH 7000 Series 8000 Series</p> <p>M8Y NH 84036631 BO 0001369023 HC CS1126</p>	<p>STB1127</p>  <p>9 CR</p> <p>12v 1.7kW a:82 b:25 o:30</p> <p>LANCIA Thema</p> <p>F10L F105L046 FI 7540278 BO 0001110027 MA 944280139500</p>
<p>STB1130</p>  <p>STB1130RB STB1130WA 315.8 9 CR</p> <p>12v 3kW a:89 b:28 o:30</p> <p>DEUTZ-FAHR Agricultural BF3L914, F4L914 F5L914, F6L914 Fendt Favorit, Terrion</p> <p>KH 01180928KZ BO 0001230006 HC CS1130</p>	<p>STB1132</p>  <p>230 9 CR</p> <p>12v 1.4kW a:66 b:-1 o:33</p> <p>VOLVO S40 V40</p> <p>B4164S, B4184S2, B4204S B4164S2, B4194T, B4204S B4184S, B4204S, B4204T VO 8602103 BO 0001108173 HC CS1132</p>	<p>STB1135</p>  <p>STB1135WA STB9135WA 250.5 9, 10 CR</p> <p>12v 2kW a:74 b:4 o:22</p> <p>YOTA Avensis Corolla</p> <p>1CDFTV 2CTE TO 281000B010 BO 0001109034 HC JS1135</p>	<p>STB1161</p>  <p>407 12 CR</p> <p>24v 6.6kW a:92 b:47 o:30</p> <p>VOLVO FH Series FL Series NH Series</p> <p>D12A380 D12A420 D12C340 VO 20451445 BO 0001417075 HC CS1161</p>
<p>STB1162</p>  <p>STB1162WA STV112 STV1162WA 10, 11 CR</p> <p>12v 2.2kW a:82.5 b:25 o:22</p> <p>MERCEDES SSANGYONG Sprinter, Viano, Vito Actyon, Kyron Musso, Rexton</p> <p>OM655925 OM601913 OM606964 MB 41516301 BO 0001218156 HC CS1162</p>	<p>STB1163</p>  <p>11 CR</p> <p>24v 6.6kW a:115 b:21 o:30</p> <p>IVECO Euro Trucks</p> <p>821042L40 821042K, 821042L 821042L400 IV 4839041 BO 0001417064 HC CS1163</p>	<p>STB1165</p>  <p>STB1165WA STB9165WA 236.5 9 CR</p> <p>12v 2kW a:82.5 b:21 o:22</p> <p>VW LT</p> <p>AHD, APA BBE, BBF ANJ VW 069911023E BO 0001125501 HC CS1165</p>	<p>STB1166</p>  <p>9 CR</p> <p>12v 1.4kW a:78 b:16.5 o:20</p> <p>OPEL, VAUXHALL SAAB Frontera A, Omega Senator 900</p> <p>C24NE, C30SE, C26NE 30NE, C30LE, C30NE 25NE, C30LE, B258I OP 90349353 BO 0001108080 HC CS1166</p>

Starters

Bosch

<p>STB1167</p>  <p>STB1167WA 12 CR </p> <p>24v 6.6kW a:92 b:47 o:30</p> <p>VOLVO Trucks F16 Series FH16 Series</p> <p>VO 1676800 BO 0001417063 HC CS1167</p>	<p>STB1169</p>  <p>STB1169WA STV1169WA 428 11 CR </p> <p>24v 6.7kW a:92 b:48 o:30</p> <p>SCANIA 94 Series 114 Series 144 Series</p> <p>DC1101, DC1102 DSC1413, DSC1415 DSC912, DSC913 SC 1332903 BO 0001371004 HC CS1169</p>	<p>STB1172</p>  <p>STB1172WA 10 CR </p> <p>12v 1.7kW a:70 b:14 o:20</p> <p>MERCEDES A Vaneo</p> <p>OM668940, OM668941 OM640942 OM640940 MB 0051511601 BO 0001115008 HC CS1172</p>	<p>STB1173</p>  <p>STB1173WA 293.55 9 CR </p> <p>12v 2.7kW a:89 b:21 o:30</p> <p>RENAULT Various Models</p> <p>RE 7700046893 BO 0001359072 HC CS1173</p>
<p>STB1176</p>  <p>STB1176WA 213.15 10 ACR </p> <p>12v 1.1kW a:76 b:53 o:30</p> <p>VW Multivan Transporter</p> <p>AXA AAC</p> <p>VW 02B911023F BO 0001121010 HC CS1176</p>	<p>STB1178</p>  <p>STB1178WA 9 CR </p> <p>24v 5.4kW a:92 b:46 o:30</p> <p>MAN</p> <p>MN 51262017151 BO 0001416074 HC CS1178</p>	<p>STB1179</p>  <p>STB1179WA 208 9 CR </p> <p>12v 0.9kW a:66 b:-0.5 o:44</p> <p>DAF Trucks RENAULT Laguna Megane Scenic</p> <p>F4P720 K4J714 F4R770 RE 7700115294 BO 0001106017 HC CS1179</p>	<p>STB1180</p>  <p>STB1180WA 9 CR </p> <p>12v 2.2kW a:82.5 b:20.5 o:30</p> <p>CHRYSLER Cherokee 2.5</p> <p>VMHR425CLIRX CH 35532045 BO 0001218177 HC CS1180</p>
<p>STB1181</p>  <p>STB1181RB STB1181WA 259 10 ACR </p> <p>12v 2kW a:76 b:62 o:20</p> <p>AUDI, FORD SEAT, SKODA, VW A3, S3, TT Galaxy, Octavia Bora, Golf, Sharan</p> <p>AQN, ASZ, AYL BTB, BLT, ATD ARL, AXR VW 02M911023A BO 0001125018 HC CS1181</p>	<p>STB1183</p>  <p>STB1183WA 208 9, 10 CR </p> <p>12v 0.9kW a:68 b:17 o:20</p> <p>CHEVROLET, DAEWOO OPEL Kalos, Lacetti Nubira, Espero Astra, Corsa</p> <p>C13N, C14NZ C14SE, 12ST Z14XEP, OM441705 OP 1202127 BO 0001107401 HC CS1183</p>	<p>STB1184</p>  <p>STB1184 293 11 CR </p> <p>12v 2.2kW a:82.5 b:21 o:30</p> <p>KHD Various DEUTZ Engines Marine</p> <p>F4L1011, F2L1011 BF4L1011 F3L1011 KH 1177441 BO 0001362700 HC CS1184</p>	<p>STB1185</p>  <p>STB1185WA STB9185WA 267 11 CR </p> <p>12v 2.2kW a:82.5 b:24 o:20</p> <p>KHD Various Agricultural DEUTZ</p> <p>F4L1011 BF4L1011 F2L1011, F3L1011 DZ 01178670 BO 0001218172 HC CS1185</p>

Starters

Bosch

<p>STB1187</p>  <p>STB1187WA 229.5 9 CR</p> <p>12v 2kW a:83 b:21 o:21</p> <p>VW LT 28-46 2.5TDI (99-06)</p> <p>APA ANJ AVR VW 069911023J BO 0001125507 HC CS1187</p>	<p>STB1188</p>  <p>STB1188RB STB1188WA 211.5 9 CR</p> <p>12v 1.1kW a:68 b:19 o:20</p> <p>CHEVROLET, DAEWOO X18XE1 OPEL, VAUXHALL Z18XE Rezo, Tacuma A16DMS Astra, Vectra OP 1202179 Zafira BO 0001107077 HC CS1188</p>	<p>STB1189</p>  <p>STB1189RB STB1189WA 207.5 8 CR</p> <p>12v 1.1kW a:74 b:9 o:21</p> <p>CHRYSLER, DODGE ECB PLYMOUTH ECC 300 EER Neon, Stratus CH 4793804 Breeze BO 9007045018 HC CS1189</p>	<p>STB1190</p>  <p>STB1190WA 9 CR</p> <p>12v 1.4kW a:82 b:9 o:32</p> <p>CHRYSLER, DODGE B00 Voyager 2.4L EDZ Caravan 2.4L CH 4686107 BO 0001108160 HC CS1190</p>
<p>STB1194</p>  <p>STB1194WA 9 ACR</p> <p>12v 1.8kW a:66 b:46 o:20</p> <p>AUDI, VW A2 Lupo</p> <p>ANY AYZ VW 085911023F BO 0001124018 HC CS1194</p>	<p>STB1196</p>  <p>STB1196RB STB1196WA 9 CR</p> <p>12v 2kW a:82.5 b:21 o:21</p> <p>VOLVO S60 S80 V70 XC70</p> <p>D5244T D5244T2 D5252T VO 8602360 BO 0001109041 HC CS1196</p>	<p>STB1197</p>  <p>STB1197WA 210.5 10 ACR</p> <p>12v 1.1kW a:76 b:53 o:20</p> <p>AUDI, SEAT SKODA, VW A2, Ibiza Fabia Golf, Polo</p> <p>BAH, AZQ, BBZ BBY, ASY, AUA AUB, BKY VW 02T911023E BO 0001121016 HC CS1197</p>	<p>STB1198</p>  <p>STB1198RB STB1198WA 273 9 CR</p> <p>12v 2.3kW a:81.5 b:23 o:33</p> <p>CITROEN, FIAT PEUGEOT Jumper Ducato Boxer</p> <p>814043S 814043N 814043, 814063 CI 1329201080 BO 0001223013 HC CS1198</p>
<p>STB1199</p>  <p>STB1199WA 430 11 CR</p> <p>24v 6.7kW a:92 b:37 o:30</p> <p>SCANIA 114 Series</p> <p>DSC1179 DC1102 DC1101, DC1103 SC 1382290 BO 0001371008 HC CS1199</p>	<p>STB1200</p>  <p>STB1200WA 234 10 ACR</p> <p>12v 2kW a:76 b:52 o:20</p> <p>SEAT, SKODA, VW Cordoba, Ibiza Fabia Roomster</p> <p>ASY BNM AXR VW 02T911023C BO 0001125051 HC CS1200</p>	<p>STB1201</p>  <p>STB1201WA 274 9 CR</p> <p>12v 2.2kW a:92 b:20 o:30</p> <p>LAND ROVER Defender Discovery Land Rover Range Rover</p> <p>23L, 14L TD5, 256T 12L, 19J RO NAD100390 BO 0001218168 HC CS1201</p>	<p>STB1202</p>  <p>STB1202RB STB1202WA 240 10 CR</p> <p>12v 2.3kW a:82.5 b:26 o:22</p> <p>MERCEDES-BENZ 216, 220, 270 316, 320 C-Class Coupe Sprinter</p> <p>OM612981 OM613960 OM612962 MB 0051512901 BO 0001223005 HC CS1202</p>

Starters

Bosch

<p>STB1203</p>  <p>STB1203RB STB1203WA STB9203WA</p> <p>258 9 CR</p>  <p>12v 2.4kW a:81 b:27 o:33</p> <p>IVECO, MITSUBISHI 814043K RENAULT VI 814043B3586 Daily I-III 814043S2585 Mascott RE 7700377051 BO 0001223003 HC CS1203</p>	<p>STB1205</p>  <p>STB1205WA</p> <p>315 10, 11 CR</p>  <p>12v 3kW a:89 b:48 o:30</p> <p>JOHN DEERE 6000 Series</p> <p>JD AL81154 BO 0001367077 HC CS1205</p>	<p>STB1208</p>  <p>STB1208WA</p> <p>9 CR</p>  <p>12v 1.8kW a:82.5 b:2.5 o:22</p> <p>AUDI, VW A4 A6 Passat</p> <p>AJM, AVF AWX, ATJ BGH, BGW VW 068911024H BO 0001124020 HC CS1208</p>	<p>STB1209</p>  <p>STB1209WA</p> <p>257 10 ACR</p>  <p>12v 2kW a:76 b:62 o:30</p> <p>VW Transporter</p> <p>AXG AHY AMV VW 02B911023E BO 0001125016 HC CS1209</p>
<p>STB1212</p>  <p>STB1212WA STE1212WA</p> <p>221.35 11 CR</p>  <p>12v 1.8kW a:82 b:10 o:30</p> <p>FIAT Doblo 223A6000 Palio 188A3000 Punto FI 46830212 Strada BO 0001109048 HC CS1212</p>	<p>STB1213</p>  <p>STB1213WA</p> <p>210 9 CR</p>  <p>12v 1.1kW a:66 b:12 o:32</p> <p>FIAT, LANCIA 182A4000, 182A6000 Brava, Marea, Bravo 185A3000, 186A4000 Doblo, Multipla Palio, Stilo FI 46748349 Lybra BO 0001107111 HC CS1213</p>	<p>STB1214</p>  <p>STB1214WA</p> <p>9 CR</p>  <p>12v 1.9kW a:95 b:10.5 o:20</p> <p>NISSAN Cabstar 2.3L Diesel Cabstar 2.5L Diesel Kingcab TO 233006T00A Terrano 2.7L TD BO 9000331201 HC JS1214</p>	<p>STB1241</p>  <p>STB1241WA</p> <p>203.4 9 CR</p>  <p>12v 1kW a:70 b:15.5 o:22</p> <p>SMART (MMC) City 0.8L OM660940 Fortwo 0.8L OM660950 Smart 0.8L OM660951 Cabrio 0.8L MB 0001477V006 BO 0001106014 HC CS1241</p>
<p>STB1243</p>  <p>STB1243WA</p> <p>11 CR</p>  <p>24v 4kW a:89 b:27 o:30</p> <p>MAN Euro Trucks Various Models</p> <p>D0824FL0104 D0834LFL02 D0824LF0 MN 51262017157 BO 0001231007 HC CS1243</p>	<p>STB1247</p>  <p>STB1247WA</p> <p>9 CR</p>  <p>12v 1.7kW a:76 b:19 o:20</p> <p>OPEL, VAUXHALL Signum Z32SE Vectra Y26SE C25XE OP 24460703 BO 0001115020 HC CS1247</p>	<p>STB1248</p>  <p>STB1248RB STB1248WA</p> <p>315 9 CR</p>  <p>24v 4kW a:110 b:27.5 o:30</p> <p>IVECO EuroCargo</p> <p>8060455255 806025VTC 806045STCA IV 500325137 BO 0001231011 HC CS1248</p>	<p>STB1249</p>  <p>STB1249RB STB1249WA</p> <p>10 CR</p>  <p>12v 1.4kW a:60 b:26 o:22</p> <p>MERCEDES-BENZ Viano M112951 Vito M113964 M112941 MB A0061510501 BO 0001108197 HC CS1249</p>

Starters

Bosch

STB1250		STB1253		STB1254		STB1255													
<p>STB1250WA</p>  <p>9 CR </p>		<p>STB1253RB STB1253WA</p>  <p>231.4 12 ACR </p>		<p>STB1254WA</p>  <p>202.5 9 CR </p>		<p>STB1255WA</p>  <p>9 CR </p>													
12v	1.7kW	a:76	b:18	o:20	12v	1.1kW	a:75	b:39	o:20	12v	0.9kW	a:74	b:22	o:20	12v	0.9kW	a:66	b:1	o:43
<p>OPEL, VAUXHALL Omega</p> <p>Y26SE, Y32SE</p> <p>OP 93176056 BO 0001115012 HC CS1250</p>		<p>MG, ROVER MGF, TF, ZR, ZS 25 45 200, 400</p> <p>18K4F N47D20D 18K4K RO NAD101340 BO 0001107080 HC CS1253</p>		<p>Mini Cooper Mini One</p> <p>W10B16A W11B16A B14A BM 12411489994 BO 0001106018 HC CS1254</p>		<p>NISSAN OPEL RENAULT</p> <p>F4R F4R720 F4R830 RE 8200069377 BO 0001106023 HC CS1255</p>													
STB1256		STB1257		STB1259		STB1261													
<p>STB1256WA</p>  <p>230.2 9 CR </p>		<p>STB1257WA</p>  <p>214 9 CR </p>		<p>STB1259</p>  <p>9 CR </p>		<p>STB1261WA</p>  <p>10 CR </p>													
12v	1.4kW	a:76	b:25.5	o:21	12v	1.1kW	a:68	b:19	o:20	12v	1.1kW	a:82.5	b:-6	o:32	24v	4kW	a:89	b:23.5	o:30
<p>BMW 3</p> <p>N42B18, N45B16A N42B20, N46B20 N42B20A BM 0001108196 BO 0001108196 HC CS1256</p>		<p>OPEL, SAAB VAUXHALL Astra, Corsa Vectra, Zafira 9-3</p> <p>Z18XE Z16XE, Z14XEP Z10XE, Z12XE VO 24437136 BO 0001107401 HC CS1257</p>		<p>VW Lupo 1.4</p> <p>ARR</p> <p>VW 085911023H BO 0001107094 HC CS1259</p>		<p>IVECO</p> <p>150E 7.7 170E 7.7 180E 7.7 320E 7.7</p> <p>836046417TCA 836046417 836046R416TCA IV 4854185 BO 0001368082 HC CS1261</p>													
STB1264		STB1266		STB1267		STB1268													
<p>STB1264RB STB1264WA STM1264RB</p>  <p>226 9, 10 CR </p>		<p>STB1266WA</p>  <p>9 ACR </p>		<p>STB1267WA STM1267RB</p>  <p>315 10 CR </p>		<p>STB1268WA</p>  <p>315 10 CR </p>													
12v	1.7kW	a:82	b:8.5	o:30	12v	1.8kW	a:76	b:53	o:20	24v	4kW	a:89	b:27	o:30	24v	4kW	a:89	b:48	o:30
<p>ALFA ROMEO, CADILLAC FIAT, LANCIA OPEL, SAAB, VAUXHALL Astra, Insignia Vectra, Zafira</p> <p>Z19DT A20DTL 192B5000 FI 46823543 BO 0001108202 HC CS1264</p>		<p>SEAT, VW Cordoba, Ibiza Toledo Bora, Golf New Beetle</p> <p>AHU AGZ AQN VW 02A911023S BO 0001125009 HC CS1266</p>		<p>MAN EM Series NM Series L2000</p> <p>D0826LOH01 D0826TOH D0826LFL10 MN 51262017119 BO 0001231008 HC CS1267</p>		<p>IVECO EuroCargo 3.9 EuroCargo 5.9</p> <p>F4AE0481C F4AE0681B F4AE0681E IV 4892338 BO 0001231016 HC CS1268</p>													

Starters

Bosch

<p>STB1269</p>  <p>STB1269RB STB1269WA STM1269WA</p> <p>391 11, 12 CR</p> <p>24v 6.2kW a:92 b:49 o:30</p> <p>MERCEDES Actros Axor Integro Travego</p> <p>OM457948 OM541940 M102987 MB 0051515001 BO 0001372006 HC CS1269</p>	<p>STB1271</p>  <p>STB1271WA</p> <p>240 9 CR</p> <p>12v 2.2kW a:76 o:32</p> <p>VOLVO S60 S80 V70 XC</p> <p>D5244T D5244T11 D5244T15 VO 30658567 BO 0001109252 HC CS1271</p>	<p>STB1272</p>  <p>STB1272RB STB1272WA</p> <p>9 CR</p> <p>12v 1.1kW a:76 o:32</p> <p>VOLVO S40 V40</p> <p>B4164S, B4184S B4184S9, B4194T B4204T5, B4194T2 VO 8602104 BO 0001107076 HC CS1272</p>	<p>STB1274</p>  <p>STB1274WA</p> <p>380 11 CR</p> <p>24v 6.2kW a:110 b:48 o:30</p> <p>DAF 95 CF XF</p> <p>XF355M VF390M XE315C DF 1284775 BO 0001372002 HC CS1274</p>
<p>STB1279</p>  <p>STB1279WA</p> <p>310 9 CR</p> <p>24v 4kW a:89 b:48.5 o:30</p> <p>MERCEDES 6t 7t 8t Unimog</p> <p>OM356980 OM364919 OM354902 MB 0041518601 BO 0001231003 HC CS1279</p>	<p>STB1282</p>  <p>STB1282RB STB1282WA</p> <p>197 10 ACR</p> <p>12v 0.9kW a:76 b:53.5 o:20</p> <p>AUDI, SEAT SKODA, VW A2, Cordoba Ibiza, Fabia Bora, Fox, Polo</p> <p>BCA, BAD, BMD CHFA, AVY, AUA BBY, BKY, BBZ VW 02T911023G BO 0001120400 HC CS1282</p>	<p>STB1283</p>  <p>STB1283WA</p> <p>199 9 CR</p> <p>12v 1.1kW a:70 b:27 o:22</p> <p>MERCEDES 180 200 230 250</p> <p>M271942 M271948 M271820 MB 0051514001 BO 0001107406 HC CS1283</p>	<p>STB1284</p>  <p>STB1284WA</p> <p>11 CR</p> <p>24v 6.6kW a:92 b:47 o:30</p> <p>SCANIA Truck Various</p> <p>DTC1101 DSC1408 DSC1403 SC 571461 BO 0001417047 HC CS1284</p>
<p>STB1285</p>  <p>STB1285WA</p> <p>266 12 CR</p> <p>24v 4kW a:92 b:47 o:30</p> <p>VOLVO FM Series</p> <p>D7C290 D7C250 VO 3978710 BO 0001231004 HC CS1285</p>	<p>STB1286</p>  <p>STB1286RB STB1286WA</p> <p>242 10 ACR</p> <p>12v 2kW a:76 b:42.5 o:20</p> <p>AUDI, SEAT SKODA, VW A3, Altea Touran, Passat Octavia, Golf</p> <p>BWS, BUB, BFH BKD, BKC, BLS AZV, BDB, BMJ VW 02E911023H BO 0001123016 HC CS1286</p>	<p>STB1287</p>  <p>STB1287WA</p> <p>236 9 ACR</p> <p>12v 1.7kW a:76 b:32 o:30</p> <p>AUDI, VW, SKODA FORD, MERCEDES A3, Beetle, Bora Octavia, Galaxy 280, 35t, 33t</p> <p>AGR, OM906910, AAA AGZ, OM541948, Y5B AQM, AGP, OM442950 VW 020911024A BO 0001110076 HC CS1287</p>	<p>STB1289</p>  <p>STB1289RB STB1289WA</p> <p>201 10 CR</p> <p>12v 1.1kW a:76 b:15 o:33</p> <p>FORD Fiesta Ka Streetka</p> <p>BAJA, A9JA A9JB, BAA, CDC A9A, A9B, CDB FO 2S6U11000DA BO 0001107418 HC CS1289</p>























Starters

Bosch

<p>STB1293</p>  <p>STB1293RB STB1293WA STV1293RB</p> <p>246 10 ACR</p>  <p>10</p> <p>12v 2kW a:76.5 b:52.5 o:30</p> <p>AUDI, SEAT, SKODA, VW A3, TT, Fabia Octavia, Golf Jetta, Passat, Polo Transporter</p> <p>AXC, AXB, BRS BRR, AVQ, BKC CDGA, CAXA VW 02Z911023B BO 0001123012 HC CS1293</p>	<p>STB1294</p>  <p>STB1294RB STB1294WA STV1294RB</p> <p>195 10 ACR</p>  <p>10</p> <p>12v 1.1kW a:76 b:53 o:30</p> <p>AUDI, SEAT, SKODA, VW A1, A3, TT, Altea Toledo, Leon Octavia, Superb Golf, Jetta, Passat</p> <p>CAXA, CDGA CAVD, AXA BLR, BLY, BVZ VW 02Z911023E BO 0001121408 HC CS1294</p>	<p>STB1322</p>  <p>STB1322RB STB1322WA</p> <p>223 10 ACR</p>  <p>10</p> <p>12v 1.1kW a:76 b:56 o:30</p> <p>AUDI, SEAT, SKODA, VW A3 Altea, Leon Octavia, Yeti Golf, Jetta, Passat</p> <p>CBZB BLF, BSE, BSX BSF, BGU VW 0AH911023D BO 0001120411 HC CS1322</p>	<p>STB1323</p>  <p>STB1323RB STB1323WA STV1323RB</p> <p>242 10, 11, 12 ACR</p>  <p>10</p> <p>12v 2kW a:76 b:62 o:20</p> <p>AUDI, SEAT SKODA, VW Golf, Jetta, Multivan Passat, Transporter</p> <p>BDL, BKK, AXC BMN, BMM, AZV BMP, CFHB, ASZ VW 02M911024 BO 0001123014 HC CS1323</p>
<p>STB1326</p>  <p>STB1326WA</p> <p>10 CR</p>  <p>10</p> <p>12v 2.3kW a:72 b:-5.5 o:33</p> <p>CITROEN, FIAT LANCIA, PEUGEOT Jumper, Ulysse Phedra, 406 607, 807, Boxer</p> <p>RHW, RHS RHZ, RHY 4HX, RHM, RHT FI 71722353 BO 0001223014 HC CS1326</p>	<p>STB1327</p>  <p>STB1327RB STB1327WA</p> <p>9 CR</p>  <p>9</p> <p>12v 1.7kW a:76 b:7.5 o:21</p> <p>PORSCHE VW Cayenne Touareg</p> <p>AZZ, BKJ, BMV M4810, BMX BRJ, BHK, BHL VW 012911023E BO 0001123002 HC CS1327</p>	<p>STB1330</p>  <p>STB1330RB STB1330WA STL1330RB</p> <p>194 9, 10 ACR</p>  <p>10</p> <p>12v 1kW a:76 b:52.5 o:20</p> <p>AUDI, SEAT, SKODA, VW A1 Ibiza Rapid Polo</p> <p>CNKA CMAA CFNB, CBZB VW 02T911024B BO 0001120406 HC CS1330</p>	<p>STB1331</p>  <p>STB1331RB STB1331WA</p> <p>340 11 CR</p>  <p>11</p> <p>24v 4kW a:110 b:48 o:30</p> <p>DAF 75 CF F</p> <p>DHT825, DHS825 DF615, PR265S PE183C, PE228C DF 1346162 BO 0001231013 HC CS1331</p>
<p>STB1333</p>  <p>STB1333WA</p> <p>380.5 11 CR</p>  <p>11</p> <p>24v 6.2kW a:92 b:48.5 o:30</p> <p>EVOBUS, KASSBOHRER MERCEDES-BENZ Setra Tourismo, Travego Citaro, Conecto</p> <p>OM457944 M476933 OM457HLA MB A4571510301 BO 0001372005 HC CS1333</p>	<p>STB1334</p>  <p>STB1334WA STV1334WA</p> <p>199 9 CR</p>  <p>9</p> <p>12v 1.1kW a:64 b:24 o:21</p> <p>FIAT, LANCIA OPEL, SUZUKI Linea, Musa Astra, Combo, Corsa Swift, Wagon</p> <p>Z13DT, Z13DTJ Z13DTH 199A3000 OP 55353257 BO 0001107437 HC CS1334</p>	<p>STB1335</p>  <p>STB1335WA</p> <p>9 CR</p>  <p>9</p> <p>12v 2.2kW a:82 b:8.5 o:30</p> <p>ALFA ROMEO, FIAT LANCIA, SUZUKI Alfa147, Alfa156 GT, Spider Stilo, Lybra, SX4</p> <p>182B9000 192A5000 937A4000 FI 46800159 BO 0001109045 HC CS1335</p>	<p>STB1337</p>  <p>STB1337RB STB1337WA</p> <p>233.9 10 ACR</p>  <p>10</p> <p>12v 1.1kW a:76 b:62 o:20</p> <p>AUDI, SEAT SKODA, VW TT, Alhambra, Leon Toledo, Octavia Beetle, Golf, Sharan</p> <p>AWM AUG ATM VW 02M911023 BO 0001121022 HC CS1337</p>

Starters

Bosch

<p>STB1339</p>  <p>STB1339RB STB1339WA</p> <p>10 CR </p> <p>12v 1.2kW a:66 b:25.5 o:22</p> <p>AUDI A4 A6 A8</p> <p>AUK, BKH BDW, BDX CCDA, CCEA VW 06E911023B BO 0001108405 HC CS1339</p>	<p>STB1340</p>  <p>STB1340WA</p> <p>272.5 10 CR </p> <p>12v 1.5kW a:82.5 b:43.5 o:20</p> <p>HATZ Stationnares 0.5L, 0.7L</p> <p>1D60 1D80</p> <p>HZ 50353420 BO 0001314047 HC CS1340</p>	<p>STB1343</p>  <p>STB1343RB STB1343WA</p> <p>8, 9 ACR</p> <p>12v 0.9kW a:76 b:32.5 o:20</p> <p>SEAT, SKODA, VW Leon 1.4, Toledo 1.4 Octavia Bora Golf</p> <p>AHW, AXP, BCA AEE, AKL, BFQ, ANP AKQ, BCB, AKS, ADZ VW 020911023H BO 0001120403 HC CS1343</p>	<p>STB1347</p>  <p>STB1347RB STB1347WA STV1347RB</p> <p>210 10 ACR </p> <p>12v 1.1kW a:76 b:62 o:20</p> <p>AUDI, SEAT SKODA, VW A1, A3, Q3, S3, TT Octavia, Yeti Golf, Jeta, Passat</p> <p>AXX, BWA BLX, BLY CFNB, CDLC VW 02M911023M BO 0001122402 HC CS1347</p>
<p>STB1376</p>  <p>STB1376WA</p> <p>315 10, 11 CR</p> <p>12v 3kW a:89 b:47 o:30</p> <p>JOHN DEERE Tractors Agricultural</p> <p>JD RE503226 BO 0001230002 HC CS1376</p>	<p>STB1378</p>  <p>STB1378WA</p> <p>9 CR </p> <p>12v 2.2kW a:82.5 b:59 o:22</p> <p>VW Touareg</p> <p>BAC BLK</p> <p>VW 070911023B BO 0001125600 HC CS1378</p>	<p>STB1380</p>  <p>STB1380RB STB1380WA</p> <p>321 12 CR </p> <p>24v 5.5kW a:110 b:48 o:30</p> <p>BOVA, DAF, Solaris CF XF Syberg, Futura Vacanza</p> <p>XE250C XE355C XE315C, XE390C DF 1604246 BO 0001241007 HC CS1380</p>	<p>STB1382</p>  <p>STB1382WA</p> <p>315 10 CR </p> <p>24v 4kW a:89 b:26.5 o:30</p> <p>DAF CF LF</p> <p>FR136S1 GR165S1 CE136C, CE184C DF 1387383 BO 0001231017 HC CS1382</p>
<p>STB1389</p>  <p>STB1389RB STB1389WA STB9389WA</p> <p>243.8 9 CR </p> <p>12v 2.5kW a:82 b:1 o:33</p> <p>CITROEN, FIAT, PEUGEOT Jumper Ducato Boxer</p> <p>814043S F1AE0481C</p> <p>FI 71789529 BO 0001109300 HC CS1389</p>	<p>STB1392</p>  <p>STB1392RB STB1392WA</p> <p>9 CR </p> <p>12v 2kW a:82 b:2 o:22</p> <p>AUDI, SEAT, SKODA A4, A6 Exeo Superb</p> <p>BNA, BPW, BLB, BRE CAGA, CAHA, CAGC BPZ, BWW, BSS VW 03G911023 BO 0001125053 HC CS1392</p>	<p>STB1393</p>  <p>STB1393WA</p> <p>10 ACR </p> <p>12v 1.7kW a:76 b:52 o:20</p> <p>SEAT, SKODA, VW Cordoba, Ibiza Fabia, Roomster Golf, Polo</p> <p>BNM, BWB ASY BDK VW 02T911024 BO 0001123018 HC CS1393</p>	<p>STB1394</p>  <p>STB1394RB STB1394WA</p> <p>200 9 CR </p> <p>12v 1.2kW a:82.5 b:14.5 o:22</p> <p>AUDI, SEAT, SKODA, VW A4 Exeo Superb Passat</p> <p>ALT, ALZ, AWA BFB, BEX, AMB BPG, BGB, BWT VW 06B911023A BO 0001107427 HC CS1394</p>

Starters

Bosch

<p>STB1397</p>  <p>STB1397WA 244 10 CR</p> <p>12v 1.7kW a:76 b:57.5 o:20</p> <p>VW Caddy</p> <p>BDJ BST</p> <p>VW 0AH911023B BO 0001123020 HC CS1397</p>	<p>STB1398</p>  <p>STB1398WA 9 CR</p> <p>12v 1.4kW a:76 o:32</p> <p>FORD, VOLVO</p> <p>Focus C70 S40 V50</p> <p>HYDA B5244S4 B5254T3 VO 8622742 BO 0001108402 HC CS1398</p>	<p>STB1399</p>  <p>STB1399WA STB9399WA 317 12 CR</p> <p>24v 5.5kW a:92 b:48 o:30</p> <p>SCANIA P Series G Series R Series T Series</p> <p>DC1310 DC1213 DT1212 SC 1447911 BO 0001241001 HC CS1399</p>	<p>STB1400</p>  <p>STB1400WA 12 CR</p> <p>24v 6kW a:92 b:48 o:30</p> <p>SCANIA</p> <p>500 560</p> <p>DC1604, DC1605 DC1606, DC1608 DC1609, DC1617 SC 1447912 BO 0001330008 HC CS1400</p>
<p>STB1404</p>  <p>STB1404WA 10 CR</p> <p>12v 1.4kW a:76 b:26 o:33</p> <p>FORD Focus II 1.4/1.6L 2004-> C-MAX 1.6L 2003-></p> <p>ASDA, ASDB HXDA, HWDB HWDA, SHDA FO 4M5T11000CA BO 0001108408 HC CS1404</p>	<p>STB1405</p>  <p>STB1405RB STB1405WA 258 10 ACR</p> <p>12v 2.2kW a:76 b:61.5 o:20</p> <p>VW Multivan Transporter</p> <p>AXE AXD AAF VW 02M911023Q BO 0001125605 HC CS1405</p>	<p>STB1406</p>  <p>STB1406RB STB1406WA 9 CR</p> <p>12v 1.8kW a:74 b:21 o:22</p> <p>BMW 520, 525, 530, 535 X3 X5</p> <p>M57N2 M57N306D5 N47N20A BM 12417796892 BO 0001115045 HC CS1406</p>	<p>STB1407</p>  <p>STB1407WA STV1407WA 168.4 8 CR</p> <p>12v 1.1kW a:74 b:25 o:21</p> <p>CITROEN, Peugeot TOYOTA C1 107 Aygo</p> <p>1KRFE CFA TO 281000Q021 BO 0001107439 HC CS1407</p>
<p>STB1409</p>  <p>STB1409WA 10 ACR</p> <p>12v 1kW a:76 b:42.5 o:20</p> <p>AUDI, SEAT, VW A3, TT 2.0 Altea, Leon, Toledo 2.0 Golf, Jetta, Scirocco Touran 1.4</p> <p>BZB, AXX, CCZA, BWA CDLB, CAWB BLG, BMY, BLG, AXX VW 02E911023J BO 0001121412 HC CS1409</p>	<p>STB1410</p>  <p>STB1410RB STB1410WA STD1410RB 237 12 CR</p> <p>12v 1.7kW a:82.5 b:26 o:22</p> <p>MERCEDES-BENZ C200, CLC220 CLK220, E200 Sprinter</p> <p>OM646811 OM646962 OM646820 MB 0061512501 BO 0001115047 HC CS1410</p>	<p>STB1411</p>  <p>STB1411WA 252 10 CR</p> <p>12v 2.2kW a:76 b:24.5 o:21</p> <p>AUDI, VW A4, A6, A8 Phaeton</p> <p>CARA, BMK BKN, ASB BPP, BSG VW 059911023Q BO 0001109258 HC CS1411</p>	<p>STB1412</p>  <p>STB1412RB STB1412WA STD1412RB 9 CR</p> <p>12v 1.2kW a:76 b:25 o:21</p> <p>BMW X3 X6 Z4</p> <p>N45B16TU2 N52B30A M52B30A BM 12417521116 BO 0001107423 HC CS1412</p>



















Starters

Bosch

<p>STB1413</p>  <p>STB1413WA STN1413RB</p> <p>199 9 CR</p>  <p>12v 1.2kW a:76 b:25 o:21</p> <p>BMW 1 3 X Z</p> <p>N46B20A N46B20B N46B20TU2 BM 12417523450 BO 0001107425 HC CS1413</p>	<p>STB1414</p>  <p>STB1414WA</p> <p>246.3 10 CR</p>  <p>12v 1.4kW a:60 b:27 o:22</p> <p>MERCEDES 230, 240 280, 350 450, 500, 600 65, Sprinter</p> <p>M272920 M272940 M272960 MB 0061511001 BO 0001108222 HC CS1414</p>	<p>STB1417</p>  <p>STB1417RB STB1417WA STM1417RB</p> <p>10, 11 CR</p> <p>12v 0.9kW a:64 b:13 o:42</p> <p>CITROEN, MINI, PEUGEOT EP3, EP3C C3, C4 Cooper, Mini 207, 308, 3008</p> <p>EP6, EP6C N12B16, N14B16C BM 12417552697 BO 0001106405 HC CS1417</p>	<p>STB1419</p>  <p>STB1419WA</p> <p>9 CR</p>  <p>12v 1.7kW a:76 b:25.5 o:21</p> <p>BMW N45B16TU2, N43B20A, N43B20 N43B16A, E91, E93, E88</p> <p>BM 12417550975 BO 0001138001 HC CS1419</p>
<p>STB1420</p>  <p>STB1420RB STB1420WA</p> <p>319 12 CR</p>  <p>24v 5.5kW a:110 b:47 o:30</p> <p>BOVA, DAF, SOLARIS CF, XF Vacanza Magnum, Synergy Magiq</p> <p>MX340, MX375 MX265, MX300 DF 1667425 BO 0001241020 HC CS1420</p>	<p>STB1421</p>  <p>STB1421RB STB1421WA</p> <p>261.5 12, 13 CR</p> <p>12v 2kW a:88 b:36 o:20</p> <p>CITROEN, FIAT, FORD LAND ROVER, PEUGEOT Jumper Ducato Transit</p> <p>22DT, 4HV 22DTPUMA QVFA FI 9658144780 BO 0001109205 HC CS1421</p>	<p>STB1423</p>  <p>STB1423WA STB423WA</p> <p>241.5 9 CR</p>  <p>12v 2kW a:82.5 b:15 o:22</p> <p>AUDI A4 A6</p> <p>BNA, BLB CAGB, CAHB BRE, BLB VW 03G911023A BO 0001109064 HC CS1423</p>	<p>STB1435</p>  <p>STB1435WA</p> <p>234 9 CR</p>  <p>12v 2kW a:82.5 b:19 o:22</p> <p>VW Crafter</p> <p>BJJ, BJK BJL, BJM</p> <p>MB 6461510101 BO 0001125055 HC CS1435</p>
<p>STB1440</p>  <p>STB1440RB STB1440WA</p> <p>232 9 CR</p>  <p>12v 1.7kW a:76 b:52.5 o:20</p> <p>PORSCHE 911 Boxster Cayman</p> <p>M9720, M9721 M9620, M9621 M9601, M9602 PR 99660410300 BO 0001123001 HC CS1440</p>	<p>STB1445</p>  <p>STB1445WA</p> <p>9 CR</p>  <p>12v 0.9kW a:74 b:25.5 o:20</p> <p>MINI Cooper</p> <p>W10B16A W11B16A</p> <p>BM 12411517328 BO 0001106018 HC CS1445</p>	<p>STB1449</p>  <p>STB1449RB STB1449WA</p> <p>246 9 CR</p>  <p>12v 2.5kW a:82 b:22 o:30</p> <p>CITROEN, FIAT, PEUGEOT F30DTE5 Jumper, Jumpy Ducato Boxer</p> <p>F1CE3481N F1AE0481D FI 51779086 BO 0001109302 HC CS1449</p>	<p>STB1450</p>  <p>STB1450WA STN4830</p> <p>9 CR</p>  <p>12v 1.2kW a:74 b:14 o:21</p> <p>TOYOTA Auris Aygo</p> <p>1ZRFAE 1ZRFE 2ZRFAE TO 281000T030 BO 0001107449 HC CS1450</p>

Starters

Bosch

<p>STB1453</p>  <p>STB1453WA 9 CR </p> <p>12v 1.1kW a:74 b:15 o:21</p> <p>TOYOTA Auris Yaris</p> <p>NDE150 NLP10</p> <p>TO 281000N010 BO 0001107440 HC CS1453</p>	<p>STB1464</p>  <p>STB1464WA 10 CR </p> <p>24v 4kW a:89 b:22 o:30</p> <p>RENAULT G Series, Manager Maxter, Midliner Premium, Midlum</p> <p>MIDR040226A4 MIDR060226D MIDR060226V RE 5001859572 BO 0001231009 HC CS1464</p>	<p>STB1465</p>  <p>STB1465WA 8 CR </p> <p>12v 1.4kW a:77 b:21 o:22</p> <p>HYUNDAI KIA</p> <p>HY 361002B300 BO 0001138017 HC CS1465</p>	<p>STB1466</p>  <p>STB1466RB STB1466WA 10, 11 CR</p> <p>12v 2kW a:69 b:6 o:30</p> <p>BMW 1, 3 BMW 5, 7 X1, X3 2008->></p> <p>N47D20A, N47D20C N57D30A, N57D30C M57N2306D3 BM 12417801203 BO 0001109070 HC CS1466</p>
<p>STB1467</p>  <p>STB1467WA STB9467WA 11 CR </p> <p>12v 2.2kW a:69 b:6 o:30</p> <p>BMW 116, 120, 123 318, 320, 330 520 X1</p> <p>N47D20A N57D30A N47D20 BM 12417823701 BO 0001139001 HC CS1467</p>	<p>STB1471</p>  <p>STB1471WA 239 9 CR </p> <p>12v 2kW a:74 b:18 o:20</p> <p>JCB KHD PERKINS</p> <p>JC 71435600 BO 0001109035 HC CS1471</p>	<p>STB1485</p>  <p>13 CR </p> <p>12v 2.0kW a:81 b:30 o:22</p> <p>MERCEDES-BENZ Sprinter (906) 2.2TDI 09-> start-stop system</p> <p>OM 646.984 OM 646.985 OM 646.986 ME A6469060000 BO 0001139025 NR 01139025</p>	<p>STB1504 <i>New</i></p>  <p>13 ACR </p> <p>12v: 2kW a:79 b:65 o:20</p> <p>AUDI SEAT SKODA VOLKSWAGEN</p> <p>CFHD,CAWB CFFB, CCTA CBBB,CCZA VAG 02M911024C BO 0001153009 CG 115402</p>
<p>STB1704 <i>New</i></p>  <p>9 CR </p> <p>12v 1.8kW a:76 b:26 o:21</p> <p>AUDI A6</p> <p>BCY BRV</p> <p>VW 077911023F BO 0001110130 LU LRS01704</p>	<p>STB1814 <i>New</i></p>  <p>10 ACR </p> <p>12v 1.1kW a:75 b:35 o:30</p> <p>VW Bora 1.6 1.8 1.8T (AT) Jetta 1.6</p> <p>VW 020911024D BO 0001121418 VA 442009</p>	<p>STB2024 <i>New</i></p>  <p>13 ACR </p> <p>12v 2.2kW a:79 b:55 o:20</p> <p>VAG GROUP Fabia 1.2L 2007- Polo 1.2L 2009- Ibiza 1.2L 2010-</p> <p>CAXA, CBZA, CNVA CBZB, CEVA, CGPA BZG, CHTA, CGPB VW 02T911024J BO 0001142001 MH STB2024</p>	<p>STB2034</p>  <p>233.3 9, 10 ACR</p> <p>12v 1.7kW a:76 b:27 o:20</p> <p>VW, FERRARI, BCS ACME, ARONA, GOLDONI HATZ, LOMBARDINI MOSA, RUGGERINI</p> <p>BAD, 3LD350 12LD4352 6LD400, 6L360 LB 58402230 BO 0001109029 CG 112034</p>

Starters

Bosch

<p>STB2037</p>  <p>STB2037WA 340.7 10 CR</p> <p>24v 4kW a:89 b:22 o:30</p> <p>FOTON PERKINS VOLVO</p> <p>Komatsu TD40GFE D40GDE IV 154011053 BO 0001368085 CG 112037</p>	<p>STB2039 <i>New</i></p>  <p>STB2039WA 295 9 CR</p> <p>12v 2.7kW a:82.5 b:21 o:20</p> <p>FENDT JENBACHER KHD LOMBARDINI</p> <p>RE 0855787900 BO 0001362076 CG 112039</p>	<p>STB2046</p>  <p>STB2046WA 404 11 CR</p> <p>24v 6.6kW a:89 b:48 o:30</p> <p>MAN, VOLVO Euro Trucks Industrial Engines</p> <p>TD103KAE VO 4778060 BO 0001417002 CG 111046</p>	<p>STB2091</p>  <p>196 CR</p> <p>24v 2.5kW OD:117</p> <p>HL 8EA732863001 BO 0136355081 CG 111091</p>
<p>STB2103 <i>New</i></p>  <p>9 CR</p> <p>12v 1.1kW a:82 b:6 o:32</p> <p>SEAT SKODA VOLKSWAGEN</p> <p>BBY BKY AUA VW 001911023B BO 0001121032</p>	<p>STB2120</p>  <p>STB2120WA 405 9 CR</p> <p>24v 6.6kW a:92 b:47.5 o:30</p> <p>MAN, MERCEDES NG, NS, SG, SL Series Euro Trucks</p> <p>D2865LF02 OM401905 MB 0031516201 BO 0001417037 CG 112120</p>	<p>STB2137</p>  <p>STB2137WA 340.7 10 CR</p> <p>24v 4kW a:89 b:20 o:30</p> <p>PERKINS, VOLVO E Series L Series Foton</p> <p>TD40GDE Komatsu IV 154011053 BO 0001368085 CG 112037</p>	<p>STB2151</p>  <p>9 CR</p> <p>12v 0.8kW a:89 b:28 o:20</p> <p>ROVER Mini 1.3L</p> <p>12A2B 12A2E 12A2L RV ADU9703 BO 0986020151</p>
<p>STB2171</p>  <p>STB2171RB STB2171WA 220 9 ACR</p> <p>12v 1.1kW a:76 b:28 o:20</p> <p>BCS, BERTOLINI FERRARI, GOLDONI LOMBARDINI, PIAGGIO VALPADANA</p> <p>GL400 3LD350 6LD400 LB 58401420 BO 0001107024 CG 112171</p>	<p>STB2201 <i>New</i></p>  <p>STB2201RB 10 CR</p> <p>24v 1.4kW a:60 b:29 o:22</p> <p>MERCEDES-BENZ G-Class (USA, JAPAN)</p> <p>MB A0061516301 BO 0001122201 LU LRS02679</p>	<p>STB2204</p>  <p>9 CR</p> <p>24v a:89 b:51 o:30</p> <p>BO F002G20486</p>	<p>STB2219</p>  <p>STB2219WA 407 11 CR</p> <p>24v 5.4kW a:89 b:47.5 o:30</p> <p>VOLVO PENTA Inboard Engines</p> <p>9.6L Diesel VO 298386 BO 0001415021 CG 111219</p>

Starters

Bosch

<p>STB2249</p>  <p>STB2249WA 381.8 9 CR</p> <p>24v 5.4kW a:89 b:48.5 o:30</p> <p>VOLVO PENTA Inboard Engines KHD STEYR</p> <p>6 cyl, Diesel</p> <p>KH 1178720 BO 0001416013 CG 111249</p>	<p>STB2297</p>  <p>9 CR</p> <p>a:68 b:16 o:20</p> <p>OPEL</p> <p>GM 55580764</p>	<p>STB2410</p>  <p>13 acr</p> <p>12v 1.7kW a:74 b:54 o:20</p> <p>MERCEDES-BENZ</p> <p>M 270.910 M 270.920 M 133.980 ME 2709060700 BO 0001152410</p>	<p>STB2494</p>  <p>STB2494WA 316 9 CR</p> <p>24v 4kW a:89 b:29 o:30</p> <p>VOLVO DEUTZ KHD</p> <p>KH 01183239 BO 0001231005 CG 112494</p>
<p>STB2496</p>  <p>STB2496WA 269 11 CR</p> <p>12v 2kW a:82 b:14.5 o:31</p> <p>FARYMANN Marine Industrial Engines</p> <p>FM 5474041 BO 0001109017 CG 112496</p>	<p>STB2497</p>  <p>STB2497WA 227 9 ACR</p> <p>12v 1.4kW a:76 b:24 o:20</p> <p>MOSA, RUGGERINI LOMBARDINI Various Models MD, MM, MW</p> <p>MD15, MW15 MD19, MW19 MM150 LB 563R0540 BO 0001108050 CG 112497</p>	<p>STB2499</p>  <p>STB2499WA 407 11 CR</p> <p>24v 6.6kW a:89 b:48 o:30</p> <p>LIBHERR Industrial Engines DEUTZ</p> <p>D9306T D9308TB F6L413 DZ 01174647 BO 0001417060 CG 112499</p>	<p>STB2507</p>  <p>STB2507WA 385 9 CR</p> <p>24v 5.4kW a:89 b:47.5 o:30</p> <p>VOLVO F Series Marine</p> <p>TD60 TD60B VO 4881097 BO 0001416026 CG 112507</p>
<p>STB2519</p>  <p>STB2519WA 341 9 CR</p> <p>12v 3kW a:89 b:48 o:30</p> <p>IVECO VOLVO F Series N Series</p> <p>TD60B TD60A D60A SC 9142744 BO 0001359071 CG 110519</p>	<p>STB2542</p>  <p>265 13 CR</p> <p>12v 1.35kW a:82.5 b:22 o:20</p> <p>BOMAG, HATZ 70 Series Stationnares 0.6L</p> <p>E785 ES785 BO 0001307021 BO 0001311054 CG 112542</p>	<p>STB2550</p>  <p>378 11 CR</p> <p>24v 4kW a:89 b:47 o:30</p> <p>IKARUS, VOLVO, NEOPLAN MERCEDÉS</p> <p>B230FT, B4164T, D2866L, D2867L, D2868L, D2869L, D2870L, D2871L, D2872L, D2873L, D2874L, D2875L, D2876L, D2877L, D2878L, D2879L, D2880L, D2881L, D2882L, D2883L, D2884L, D2885L, D2886L, D2887L, D2888L, D2889L, D2890L, D2891L, D2892L, D2893L, D2894L, D2895L, D2896L, D2897L, D2898L, D2899L, D2900L, D2901L, D2902L, D2903L, D2904L, D2905L, D2906L, D2907L, D2908L, D2909L, D2910L, D2911L, D2912L, D2913L, D2914L, D2915L, D2916L, D2917L, D2918L, D2919L, D2920L, D2921L, D2922L, D2923L, D2924L, D2925L, D2926L, D2927L, D2928L, D2929L, D2930L, D2931L, D2932L, D2933L, D2934L, D2935L, D2936L, D2937L, D2938L, D2939L, D2940L, D2941L, D2942L, D2943L, D2944L, D2945L, D2946L, D2947L, D2948L, D2949L, D2950L, D2951L, D2952L, D2953L, D2954L, D2955L, D2956L, D2957L, D2958L, D2959L, D2960L, D2961L, D2962L, D2963L, D2964L, D2965L, D2966L, D2967L, D2968L, D2969L, D2970L, D2971L, D2972L, D2973L, D2974L, D2975L, D2976L, D2977L, D2978L, D2979L, D2980L, D2981L, D2982L, D2983L, D2984L, D2985L, D2986L, D2987L, D2988L, D2989L, D2990L, D2991L, D2992L, D2993L, D2994L, D2995L, D2996L, D2997L, D2998L, D2999L, D3000L</p> <p>16t, 19t, 22t, 26t, 33t 190, 200, 220, 230, 300 200 Series, 740, V60, Space</p> <p>M102920, M102980, M102990, M102994 M180924, OM421905, OM421906, OM421907, OM421908, OM421909, OM421910, OM421911, OM421912, OM421913, OM421914, OM421915, OM421916, OM421917, OM421918, OM421919, OM421920, OM421921, OM421922, OM421923, OM421924, OM421925, OM421926, OM421927, OM421928, OM421929, OM421930, OM421931, OM421932, OM421933, OM421934, OM421935, OM421936, OM421937, OM421938, OM421939, OM421940, OM421941, OM421942, OM421943, OM421944, OM421945, OM421946, OM421947, OM421948, OM421949, OM421950, OM421951, OM421952, OM421953, OM421954, OM421955, OM421956, OM421957, OM421958, OM421959, OM421960, OM421961, OM421962, OM421963, OM421964, OM421965, OM421966, OM421967, OM421968, OM421969, OM421970, OM421971, OM421972, OM421973, OM421974, OM421975, OM421976, OM421977, OM421978, OM421979, OM421980, OM421981, OM421982, OM421983, OM421984, OM421985, OM421986, OM421987, OM421988, OM421989, OM421990, OM421991, OM421992, OM421993, OM421994, OM421995, OM421996, OM421997, OM421998, OM421999, OM422000</p> <p>SK 443115174642 BO 0001402040 CG 110550</p>	<p>STB2573</p>  <p>STB2573WA 311 10 CR</p> <p>12v 2.8kW a:101 b:25.5 o:30</p> <p>LOHMEYER, DENNIS</p> <p>BMC 3844 BMC 465 JC 71403000R BO 0001359116 CG 111573</p>

Starters

Bosch

<p>STB2592</p>  <p>STB2592WA 420 11 CR 11</p> <p>24v 6.6kW a:55 b:37.5</p> <p>MERCEDES-BENZ OM354920 FORTSCHRITT KASSBOHRER 814 KR 7431032000 Agricultural BO 0001417009 CG 110592</p>	<p>STB2651</p>  <p>STB2651WA 351.5 11 CR 11</p> <p>24v 4.8kW a:89 b:48 o:30</p> <p>BOSCH, KHD F5L413FR, F6L413 Engine BF6L513 Various Models DDOD KH 1179595 BO 0001364300 CG 112651</p>	<p>STB2670</p>  <p>STB2670WA 341 10 CR 10</p> <p>24v 4kW a:89 b:28.5 o:30</p> <p>DAF, MERCEDES DF615 F Hanomag CL 3777195R BO 0001368040 CG 112670</p>	<p>STB2816</p>  <p>STB2816WA 8 CR 8</p> <p>12v 1.1kW a:74 b:9 o:20</p> <p>CHRYSLER, DODGE ECB PLYMOUTH, EAGLE ECC Breeze 420X Neon CH 4672108AB Stratus BO 0001107032 CG 112816</p>
<p>STB3014</p>  <p>STB3014WA 9 CR 9</p> <p>12v 1.4kW a:81 b:3 o:20</p> <p>HOLDEN VB, VC, VH, VK ommodore H Series, Sunbird Torana, WB BO F005M00014 Monaro, E Series BO F000AL0123 MH STB3014</p>	<p>STB3015</p>  <p>STB3015WA 9 CR 9</p> <p>12v 1.4kW a:80 b:14.5 o:20</p> <p>HOLDEN HSV BO F005M00012 MH STB3015</p>	<p>STB3023</p>  <p>STB3023WA 9 CR 9</p> <p>12v 1.4kW a:76 b:10 o:20</p> <p>MITSUBISHI Magna BO F005M00010 BO 9000061001 MH STB3023</p>	<p>STB3026 <i>New</i></p>  <p>10 CR 10</p> <p>12v 1.7kW a:76.2 b:55 o:20</p> <p>VOLKSWAGEN AUDI VW 02Z911023L BO 0001123026 MH STB3026</p>
<p>STB3105 <i>New</i></p>  <p>11 CR 11</p> <p>24v 3.2kW a:82.5 b:24 o:20</p> <p>ADIM 1053 1054 1056 LD 296191200 BO 0001363105 NR 01363105</p>	<p>STB3113</p>  <p>9 CR 9</p> <p>12v 1.4kW a:81 b:14 o:33</p> <p>VW 377911023HV BO F010AL0103 MH STB3113</p>	<p>STB3177</p>  <p>213 11 ACR 11</p> <p>12v 1.1kW a:76 b:16 o:20</p> <p>LOMBARDINI L353 Jalpa Espada Jarama LB 58402150 BO 0001107040 CG 113177</p>	<p>STB3178 <i>New</i></p>  <p>226.5 11 ACR 11</p> <p>12v 1.4kW a:76 b:15.5 o:20</p> <p>VOLVO S70 PI 293762 BO 0001108168 CG 113178</p>

Starters

Bosch

STB3181	STB3182	STB3183	STB3230 <i>New</i>
 <p>STB3181RB STB3181WA</p> <p>261 9 CR</p> 	 <p>STB3182WA</p> <p>320 9 CR</p> 	 <p>STB3183WA</p> <p>315 9 CR</p> 	 <p>11 CR</p> 
<p>12v 2.3kW a:82.5 b:23.5 o:20</p>	<p>12v 3kW a:110 b:30 o:30</p>	<p>24v 4kW a:110 b:28 o:30</p>	<p>24v 4kW a:89 b:51 o:30</p>
<p>BOMAG F6L413 JCB KHD DEUTZ KH 1181751 BO 0001223016 CG 113181</p>	<p>NEW HOLLAND L Series TL Series IVECO DAYLI III IV 500325145 BO 0001230007 CG 113182</p>	<p>IVECO 806004660 EuroCargo 806005280 Zeta 804045400TCA FI 75114529 BO 0001231010 CG 113183</p>	<p>AGCO POWER 411 C SISU DIESEL 611 C IS 11130686 BO 0001368041</p>
STB3451 <i>New</i>	STB3478	STB3600	STB3609
 <p>STB3451WA</p> <p>11 CR</p> 	 <p>STB3478WA</p> <p>304 10 CR</p> 	 <p>STB3600WA</p> <p>384.5 9 CR</p> 	 <p>STD3609WA</p> <p>391 11, 12 CR</p>
<p>24v 8.4kW a:91 b:49 o:30</p>	<p>12v 2.8kW a:82 b:35 o:20</p>	<p>24v 5.4kW a:90 b:48 o:30</p>	<p>24v 6.2kW a:92 b:48 o:30</p>
<p>MTU OP 910819 BO 0001340501</p>	<p>ATLAS COPCO 3.9L Diesel JOHN DEERE 5000 Series JD RE501680 BO 0001230005 CG 113478</p>	<p>IKARUS D2356HM6U 200-SERIE D2156HM6U MN 51262019116 BO 0001416020 CG 110600</p>	<p>MERCEDES-BENZ M102987, M115954 Actros OM457937, OM457957 230, 320 OM541920, OM541922 Axor MB A0051515001 Integro BO 0001372006 CG 113609</p>
STB3613	STB3720 <i>New</i>	STB3724 <i>New</i>	STB3749
 <p>STB3613WA</p> <p>211.5 8 CR</p> 	 <p>8 CR</p> 	 <p>STB3724WA</p> <p>11 CR</p> 	 <p>STB1113 STB1113WA STB3749WA</p> <p>238 9 CR</p> 
<p>12v 1.1kW a:74 b:9 o:21</p>	<p>12v 1.2kW a:70 b:30 o:22</p>	<p>24v 6.2kW a:108 b:39 o:30</p>	<p>12v 1.7kW a:76 b:-1 o:32</p>
<p>DODGE, PLYMOUTH Neon 2.0 CH 05033556AC BO 6004AA0003 CG 113613</p>	<p>SUZUKI M13A Ignis M15A Liana M16A SZ 3110080G10 BO 0986023720 HC JS1319</p>	<p>DAF DA 1346163 BO 0001372004</p>	<p>VOLVO B6294S, B6294S2 S80 B6304S3 XC B6284T, B6294T VO 1363912 BO 000115007 CG 113749</p>

Starters

Bosch

<p>STB3806 <i>New</i></p>  <p>STB3806WA 11 CR </p> <p>12v 1.7kW a:60 b:17</p> <p>BMW Mini</p> <p>BM 12417802945 BO 0001138006 MH STB3806</p>	<p>STB3811 <i>New</i></p>  <p>STB3811WA 10 CR </p> <p>12v 1.4kW a:64 b:25 o:21</p> <p>ALFA ROMEO Mita FIAT Punto FORD Ka</p> <p>FI 51810307 BO 0001138011 CG 115400</p>	<p>STB3815</p>  <p>STB3815WA 9 CR </p> <p>12v 1.7kW a:76 b:19 o:20</p> <p>CADILLAC CTS 3.2</p> <p>WL 91157197 BO 000115014 CG 113815</p>	<p>STB3847 <i>New</i></p>  <p>STB3847WA 228 11 CR </p> <p>12v 1.7kW a:60 b:17 o:42</p> <p>MINI Cooper/Cooper S One Clubman Countryman</p> <p>N12B16A, N12B14A N14B16A, N14B16C N16B16A, N18B16a BM 12417616698 BO 0001138047 CG 114692</p>
<p>STB3850</p>  <p>STB3850WA 387 9 CR </p> <p>24v 5.4kW a:89 b:48 o:30</p> <p>VOLVO Agricultural (BM) A20, L90</p> <p>Type description TD71G</p> <p>VO 4772059 BO 0001416059 CG 113850</p>	<p>STB3900</p>  <p>STB3900WA 240 9 CR </p> <p>12v 2.5kW a:82.5 b:26 o:20</p> <p>JOHN DEERE 300 Series 4000 Series 5000 Series</p> <p>4024T</p> <p>JD RE531243 BO 0001109331 CG 113900</p>	<p>STB3921</p>  <p>STB3921RB STB3921WA 9 CR </p> <p>12v 1.1kW a:68 b:19</p> <p>OPEL Astra 1.4L Astra J 1.4L</p> <p>OP 55578921 BO 0001107522 MH STB3921</p>	<p>STB3965 <i>New</i></p>  <p>STB3965WA 11 CR </p> <p>12v 1.1kW a:63 b:11 o:33</p> <p>FIAT Linea 1.9L</p> <p>FI 46803965 BO F000AL0100 MH STB3965</p>
<p>STB3980</p>  <p>STB3980WA 319 11 CR </p> <p>24v 4kW a:82.5 b:23 o:30</p> <p>KHD Industrial Engine</p> <p>F4L1011 BF4L1011 F2L1011 F3L1011 KH 1178671 BO 0001231006 CG 113980</p>	<p>STB4001</p>  <p>STB4001WA 317 11 CR </p> <p>24v 4kW a:89 b:31 o:30</p> <p>MAN 7t, 8t, 10t 12t, 13t, 15t 18t, 26t</p> <p>D0836LF41 D0834LFL40 D0384LFL41 MN 51262017193 BO 0001231034 CG 114001</p>	<p>STB4002</p>  <p>STB4002WA STB9002WA 316 10 CR </p> <p>12v 4.2kW a:89 b:27 o:30</p> <p>CASE Agricultural 400 Series</p> <p>432TM</p> <p>IV 504357109 BO 0001230021 CG 114002</p>	<p>STB4003</p>  <p>STB4003WA 9 CR </p> <p>12v 3kW a:89 b:49 o:30</p> <p>MERCEDES-BENZ Unimog Trucks Various Models</p> <p>MB 006151230180 BO 0001230001 CG 114395</p>

Starters

Bosch

<p>STB4007</p>  <p>STB4007WA 12 CR </p> <p>24v 6kW a:92 b:51 o:30</p> <p>VOLVO Penta</p> <p>VO 3827444 BO 0001330007 NR 01330007</p>	<p>STB4014</p>  <p>STB4014WA 9 CR </p> <p>12v 1.5kW a:75 b:17 o:20</p> <p>SATURN L Series 3.0l Vue 3.0l</p> <p>GM 24451168 BO 6004AA2014 WA 17858N</p>	<p>STB4020</p>  <p>STB4020WA 240 9 CR </p> <p>12v 2.2kW a:82 o:30</p> <p>LDV Maxus 2,5 CRDi 2005-></p> <p>VM39C VM40C</p> <p>FI 1347058080 BO 0001109267 CG 114020</p>	<p>STB4021</p>  <p>STB4021WA 314 10 CR </p> <p>12v 3kW a:89 b:30 o:30</p> <p>NEW HOLLAND Industrials Agricultural machine Backhoes Telehandlers</p> <p>NH 323019050 BO 0001230020 CG 114021</p>
<p>STB4028</p>  <p>STB4028WA 11 CR </p> <p>24v 9kW a:92 b:51 o:30</p> <p>CATERPILLAR</p> <p>MB 0041519901 BO 0001420029 MH STB4028</p>	<p>STB4050</p>  <p>STB4050WA 317 10 CR </p> <p>12v 4.2kW a:89 b:27.5 o:30</p> <p>NEW HOLLAND Agricultural machine</p> <p>NH 82032859 BO 0001230022 CG 114050</p>	<p>STB4052</p>  <p>STB4052WA 219 9 CR </p> <p>12v 1.1kW a:76 b:18 o:20</p> <p>LOMBARDINI Engine</p> <p>LB 58402090 BO 0001107430 CG 114052</p>	<p>STB4053</p>  <p>STB4053WA 240.5 9 CR </p> <p>12v 2kW a:82.5 b:19 o:20</p> <p>LOMBARDINI Industrial Engine</p> <p>LDW2004 LDW1503 LDW1303 LB 58401910 BO 0001109031 CG 114053</p>
<p>STB4055</p>  <p>STB4055WA 273 9 CR </p> <p>12v 2.2kW a:82.5 b:21 o:20</p> <p>JACOBSEN JOHN DEERE 100F 76F 85F</p> <p>VM Motori</p> <p>JD FGV35532054 BO 0001218176 CG 114055</p>	<p>STB4069</p>  <p>STB4069WA STB9069WA 318 11 CR </p> <p>24v 4kW a:110 b:48 o:30</p> <p>DAF Trucks EU CF Series</p> <p>PE228C PR265S PR228S DF 1633811 BO 0001263004 CG 114069</p>	<p>STB4102</p>  <p>STB4102WA 12 CR </p> <p>24v 7.5kW a:89 b:49 o:30</p> <p>IVECO Genlyon</p> <p>IV 994327600 BO 0001231502 WA 150325W</p>	<p>STB4104</p>  <p>STB4104WA 12 CR </p> <p>24v 5.5kW a:91 b:50 o:30</p> <p>MERCEDES Various Models</p> <p>MB 0061512401 BO 0001241004 NR 01241004</p>

Starters

Bosch

<p>STB4105</p>  <p>STB4105WA</p> <p>12 CR </p> <p>24v 5.5kW a:92 b:48 o:30</p> <p>MAN TGA Series TGS Series TGX Series</p> <p>MN 51261017228 BO 0001241005 NR 01241005</p>	<p>STB4106</p>  <p>STB4106WA</p> <p>263 9 CR </p> <p>12v 1.6kW a:82.5 b:40 o:20</p> <p>HATZ</p> <p>1D20 1D40</p> <p>HA 50353510 BO 0001109043 CG 114106</p>	<p>STB4107</p>  <p>STB4107WA</p> <p>9 CR </p> <p>12v 1.2kW a:76 b:56 o:20</p> <p>PORSHE</p> <p>Boxster 2.5L, 2.7L, 3.2L</p> <p>PO 98660410400 BO 0001121003 WA 17758N</p>	<p>STB4114</p>  <p>STB4114WA</p> <p>11 CR </p> <p>24v 5.5kW a:87 b:49 o:30</p> <p>HWO, DELONG, BALONG</p> <p>BO 0001261014 WA 150025W</p>
<p>STB4115</p>  <p>STB4115WA</p> <p>11 CR </p> <p>24v 6.7kW a:110 b:41 o:30</p> <p>DAF XF95</p> <p>DF 1329660 BO 0001371016 NR 01371013</p>	<p>STB4117</p>  <p>STB4117WA</p> <p>11 CR </p> <p>24v 9kW a:89 b:46 o:30</p> <p>LIEBHERR DEUTZ KHD INTERNATIONAL HARVESTER</p> <p>DZ 01163556 BO 0001510017 NR 01510017</p>	<p>STB4122</p>  <p>STB4122WA</p> <p>11 CR </p> <p>24v 5.5kW a:89 b:49 o:30</p> <p>Foton Shaanxi</p> <p>PT M105R3040SE BO 0001241022 MH STB4122</p>	<p>STB4123</p>  <p>STB4123WA</p> <p>12 CR </p> <p>24v 5.5kW a:89 b:28 o:30</p> <p>DEUTZ KHD Engine - Marine Fuchs Excavator</p> <p>F3L912</p> <p>BO 0001241023 WA 19801N</p>
<p>STB4125</p>  <p>STB4125WA</p> <p>9 CR </p> <p>24v 9kW a:91 b:44 o:30</p> <p>CLAAS, KASSBOHRER MAN, MERCEDES NEOPLAN</p> <p>MB A0021519201 BO 0001510025 NR 01510025</p>	<p>STB4127</p>  <p>STB4127WA</p> <p>10 CR </p> <p>12v 1.1kW a:55 b:4 o:30</p> <p>LAND ROVER RANGE ROVER</p> <p>RO LR009338 BO 0001121427 MH STB4127</p>	<p>STB4136</p>  <p>STB4136WA</p> <p>11 CR </p> <p>24v 9kW a:89 b:51</p> <p>LIEBHERR IVECO KHD 750 KIROVETZ K744 12.8L</p> <p>8L BH8L513C D9306TI KH 42522861 BO 0001510035 NR 01510035</p>	<p>STB4138</p>  <p>STB4138WA</p> <p>10 CR </p> <p>24v 4kW a:89 b:31 o:30</p> <p>MAN TGL</p> <p>D0836 D0834</p> <p>MN 51262017223 BO 0001231035 NR 01231035</p>

Starters

Bosch

<p>STB4139</p>  <p>STB4139WA 11 CR</p> <p>24v 9kW a:92 b:51 o:30</p> <p>JENBACHER WERKE AG</p> <p>JW 229312 BO 0001510039 NR 01510039</p>	<p>STB4147</p>  <p>STB4147WA 9 ACR</p> <p>12v 1.7kW a:77 b:34.5 o:20</p> <p>PORSCHE Carrera</p> <p>M6405, M6406 M6421, M6422</p> <p>PO 91160410201 BO 0001110047 WA 17158</p>	<p>STB4160</p>  <p>STB4160WA 9 ACR</p> <p>12v 1.7kW a:82 b:24 o:21</p> <p>PORSCHE 944 Series 968 Series</p> <p>PO 94460410300 BO 0001110060 WA 17280N</p>	<p>STB4186</p>  <p>STB4186WA 9 CR</p> <p>12v 1.7kW a:82.5 b:20 o:21</p> <p>MERCEDES-BENZ</p> <p>BO 0001110186 MH STB4186</p>
<p>STB4195</p>  <p>STB4195WA 312 10 CR</p> <p>12v 3kW a:89 b:51 o:30</p> <p>JOHN DEERE Industrials Agricultural machine</p> <p>4045</p> <p>JD RE507943 BO 0001230008 CG 114195</p>	<p>STB4196</p>  <p>STB4196WA STB9196WA 317 10 CR</p> <p>24v 4kW a:89 b:27 o:20</p> <p>CASE, NEW HOLLAND Industrial Engines Agricultural machine</p> <p>IV 504036695 BO 0001263019 CG 114196</p>	<p>STB4201</p>  <p>STB4201WA 10 ACR</p> <p>12v 1.4kW a:76 b:56</p> <p>VW Beetle Jetta Rabbit</p> <p>VW 02Z911023J BO 0001122400 WA 17968N</p>	<p>STB4203 <i>New</i></p>  <p>13 ACR</p> <p>12v 1.1kW a:79 b:55 o:30</p> <p>VAG GROUP A3 1.4L 2007- YETI 1.4L 2010- Passat 1.4L 2007- Passat 2.0L 2008-2010</p> <p>CAXC, CAXA CTHD, CMSA</p> <p>VW 02Z911023R BO 0001142003 MH STB4203</p>
<p>STB4205</p>  <p>STB4205WA 13 ACR</p> <p>12v 1.1kW a:78 b:64 o:20</p> <p>AUDI, VW A1 A3 GOLF PASSAT</p> <p>VW 0AM911023F BO 0001142005 MH STB4205</p>	<p>STB4220</p>  <p>STB4220WA 315 9 CR</p> <p>24v 4kW a:82.5 b:25 o:20</p> <p>DEUTZ-FAHR Agricultural</p> <p>TCD2011</p> <p>KH 1181753 BO 0001231018 CG 114220</p>	<p>STB4228</p>  <p>11 cr</p> <p>24v 7.5kW a:92 b:51 o:30</p> <p>MERSEDES BENZ</p> <p>MZ A0051510201</p>	<p>STB4299 <i>New</i></p>  <p>232 11, 12 ACR</p> <p>12v 2kW a:76 b:57.5 o:30</p> <p>AUDI, SKODA, VW A1 Praktik, Roomster Caddy, Passat</p> <p>CAYB CAYC, CCZB CFWA, CLCA VW 02Z911023M BO 0001123028 CG 114299</p>

Starters

Bosch

<p>STB4306</p>  <p>STB4306WA 10 CR </p> <p>12v 2.3kW a:60 b:27 o:20</p> <p>MERCEDES-BENZ ML 400 E400 S400 G400</p> <p>MB A005151250180 BO 0001223006 NR 01223006</p>	<p>STB4307 <i>New</i></p>  <p>STB4307WA 10 CR </p> <p>24v 4kW a:89 b:47 o:41</p> <p>CASE Industrials</p> <p>IV 504368346 BO 0001231039 MH STB4307</p>	<p>STB4313</p>  <p>STB4313WA 272 9 CR </p> <p>24v 2.5kW a:82.5 b:24 o:20</p> <p>VM MOTORI Industrial Engines</p> <p>BO 0001219014 CG 114313</p>	<p>STB4315</p>  <p>STB4315WA 13 cr </p> <p>12v 3kW a:80 b:88 o:20</p> <p>VW Touareg 2002-></p> <p>5.0 TDi V10 VW 07Z911023B BO 0001230015 NR 01230015</p>
<p>STB4320</p>  <p>STB4320WA 316 9 CR </p> <p>12v 3kW a:82.5 b:23 o:20</p> <p>JCB, KHD Agricultural Industrial</p> <p>KH 01181570KZ BO 0001230013 CG 114320</p>	<p>STB4327</p>  <p>STB4327WA STB9327WA 320 11 CR </p> <p>24v 5.5kW a:89 b:48 o:30</p> <p>HOWO WEICHAI SCANIA</p> <p>XX 612600090293 BO 0001241008 CG 114327</p>	<p>STB4345</p>  <p>STB4345WA 197 11 CR </p> <p>12v 1.7kW a:79 b:43 o:20</p> <p>AUDI, VW A3 Sportback II,Q3, TT II SEAT Altea SKODA Octavia II, Superb IIVW 02E911024AX Passat</p> <p>BO 0001123044 MH STB4345</p>	<p>STB4389 <i>New</i></p>  <p>STB4389WA 9 CR </p> <p>12v 1.4kW a:76 b:6</p> <p>FIAT 1,6 D Multijet 2010-</p> <p>FI 51810308 BO 0001138009 MH STB4389</p>
<p>STB4426 <i>New</i></p>  <p>214 10 CR </p> <p>12v 1.1kW a:76 b:26 o:33</p> <p>FORD, MAZDA Fiesta, Focus, Puma 2</p> <p>DHA, FXDA, KGBA, MHA DHB, FXDC, MHB, L1W FXJA FO 96FB11000KA BO 0001107043 CG 111906</p>	<p>STB4437</p>  <p>STB4437WA 324 11 CR </p> <p>24v 5.4kW a:89 b:47.5 o:30</p> <p>AATLAS COPCO BOSCH, POCLAIN FORD, KHD Cargo</p> <p>F6L413 KH 1174635 BO 0001416031 CG 114437</p>	<p>STB4438</p>  <p>0001416032 STB4438WA 11 CR </p> <p>24v 5.4kW a:89 b:47.5</p> <p>KHD, LIEBHERR Industrial Engine</p> <p>D904TB F8L413 F6L413 KH 01163558 BO 0001416032 CG 114438</p>	<p>STB4519</p>  <p>STB4519WA 9 CR </p> <p>12v 2kW a:76 b:28 o:30</p> <p>AUDI, PORSCHE, VW Touareg 3.0 V6 TDi Cayenne Q7 3.0 TDi</p> <p>VW 059911024H BO 0001125519 MH STB4519</p>

Starters

Bosch

<p>STB4525</p>  <p>STB4522 STB4522WA</p> <p>10 CR </p> <p>12v 1.7kW a:60 b:30 o:20</p> <p>PORSCHE Cayenne 4.5L</p> <p>PO 94860410600 BO 0001125025 MH STB4525</p>	<p>STB4557</p>  <p>STB4557WA</p> <p>10 CR </p> <p>12v 2kW a:60 b:28 o:20</p> <p>PORSCHE, Cayenne S 4.8l</p> <p>PO 94860420600 BO 0001125059 MH STB4557</p>	<p>STB4582 <i>New</i></p>  <p>STB4582WA</p> <p>10 CR </p> <p>12v 1.7kW a:66 b:24.5 o:21</p> <p>AUDI</p> <p>VW 03L911021C BO 0001115082 MH STB4582</p>	<p>STB4615</p>  <p>STB4615WA</p> <p>9 CR </p> <p>24v 6.6kW a:102 b:90</p> <p>MERCEDES-BENZ</p> <p>MB 0031518401 BO 0001416015 WA 16372N</p>
<p>STB4619</p>  <p>STB4619WA</p> <p>9 CR </p> <p>24v 5.4kW a:87 b:48 o:30</p> <p>MAN</p> <p>415, 520, 535 636, 650, 735</p> <p>D0836M2, D0026M1 D0026M2, D0846HM2 D0846HMY-011 MAN 51262019073 BO 0001416019 NR 01416019</p>	<p>STB4661</p>  <p>STB4661WA</p> <p>9 CR </p> <p>24v 5.4kW a:89 b:51</p> <p>MERCEDES</p> <p>KH 1174631 BO 0001416060 NR 01416060</p>	<p>STB4669</p>  <p>STB4669WA</p> <p>11 CR </p> <p>24v 5.4kW a:88 b:45 o:30</p> <p>LIEBHERR Agricultural Industrial</p> <p>D904T D926TI</p> <p>LH 91157071 BO 0001416069 WA 18166N</p>	<p>STB4702</p>  <p>STB4702WA</p> <p>9 CR </p> <p>12v 1.1kW a:64 b:12 o:30</p> <p>ALFA ROMEO FIAT</p> <p>FI 51804744 BO 0001137002 WA STR50518</p>
<p>STB4725</p>  <p>STB4725WA</p> <p>11 CR </p> <p>12v 3kW a:88 b:47 o:20</p> <p>VOLVO BM</p> <p>VO 4785540 BO 0001359085 MH STB4725</p>	<p>STB4726</p>  <p>STB4726WA</p> <p>9 CR </p> <p>24v 6.6kW a:89 b:46 o:30</p> <p>SCANIA P Series G Series R Series T Series</p> <p>KH 01176483 BO 0001417026 NR 01417026</p>	<p>STB4755</p>  <p>STB4755WA</p> <p>11 CR </p> <p>24v 5.4kW a:89 b:51</p> <p>DEUTZ KHD Engines Marine</p> <p>BF10L513 F12L513</p> <p>KH 1176177 BO 0001417055 NR 01417056</p>	<p>STB4756</p>  <p>STB4756WA</p> <p>10 CR </p> <p>12v 1.1kW a:104 b:16</p> <p>FORD</p> <p>FO BAFZ11001A BO 0001107456 MH STB4756</p>

Starters

Bosch

<p>STB4758</p>  <p>STB4758WA 9 CR </p> <p>24v 6.6kW a:89 b:51 o:30</p> <p>VOLVO KHD ENGINE</p> <p>KH 01178721 BO 0001417058 NR 01417058</p>	<p>STB4759</p>  <p>STB4759RB STB4759WA 10 CR </p> <p>12v 1.1kW a:60 b:25 o:22</p> <p>MERCEDES C-Class E-Class S-Class CLK, GLK</p> <p>MB 0061516001 BO 0001107459 MH STB4759</p>	<p>STB4764 <i>New</i></p>  <p>STB4764WA 13 CR </p> <p>12v 1.1kW a:70 b:7 o:32</p> <p>CHRYSLER Voyager 2.0L</p> <p>CH 04685664AC BO 0001107064 CG 114294</p>	<p>STB4771</p>  <p>STB4771WA 11 CR </p> <p>24v 6.6kW a:87 b:47 o:30</p> <p>SCANIA LIEBHERR</p> <p>D926TI</p> <p>SC 1414068 BO 0001417071 NR 01417071</p>
<p>STB4800</p>  <p>STB4800WA 9 CR </p> <p>12v 1.4kW a:76 b:32</p> <p>VW Passat 4.0</p> <p>VW 07D911023AX BO 0001108200 MM AMS0240</p>	<p>STB4804</p>  <p>STB4804WA 11 CR </p> <p>24v 4kW a:89 b:48 o:20</p> <p>VOLVO MWM Diesel</p> <p>VO 4785484 BO 0001368004 WA STR50313</p>	<p>STB4808</p>  <p>STB4808RB STB4808WA 9 CR </p> <p>12v 1.7kW a:76 b:21 o:22</p> <p>BMW 6 645i/650i 2004-> 7 (E65, E66) 740i/750i 2008-> X5 (E53, E70) 4.4i/4.8i 2008-> 5 (E60/E61) 540i/550i 2005-> BM 12417537513 BO 0001108208 WA 17923N</p>	<p>STB4810</p>  <p>STB4810WA 11 CR </p> <p>12v 3.6kW a:92 b:51</p> <p>IVECO Trucks MAGIRUS Trucks KHD</p> <p>KH 61585080 BO 0001418010 MH STB4810</p>
<p>STB4822</p>  <p>STB4822WA 272 9 CR </p> <p>12v 2.3kW a:110 b:27 o:30</p> <p>VW Transporter LT 28-46 2.8 TDi (97-07)</p> <p>AGK ATA AUH VW 062911023 BO 0001218822 CG 114304</p>	<p>STB4831</p>  <p>STB4831WA 9 CR </p> <p>12v 1.4kW a:88 b:23 o:20</p> <p>LANDROVER Defender 2.5L Various Models 2.5L</p> <p>RO NAD100400 BO 0001108131 WA 30157N</p>	<p>STB4836</p>  <p>STB4836WA 9, 11 CR</p> <p>12v 1.7kW a:75 b:32</p> <p>OPEL Vectra Signum Astra</p> <p>OP 55350543 BO 0001108236 WA STR80031</p>	<p>STB4850</p>  <p>STB4850WA 11 CR </p> <p>24v 4kW a:82 b:25</p> <p>HATZ L30, 2M40 3M40, 4L40</p> <p>HZ 50195400 BO 0001368050 NR 01368071</p>

Starters

Bosch

<p>STB4867</p>  <p>STB4867WA 10 CR </p> <p>24v 4kW a:89 b:51 o:30</p> <p>CUMMINS Industrial</p> <p>CU 3283721 BO 0001368067 CG 114397</p>	<p>STB4872</p>  <p>STB4872WA 9 CR </p> <p>12v 1.4kW a:76 b:22 o:20</p> <p>SAAB V6T 9-5 3.0I</p> <p>SB 93184920 BO 0001108172 WA 17789N</p>	<p>STB4900</p>  <p>STB4900RB STB4900WA 11 CR </p> <p>12v 1.8kW a:69 b:16</p> <p>MERCEDES E200 E220 250 CDI</p> <p>MB A6519061200 BO 0001149400 MH STB4900</p>	<p>STB4908</p>  <p>STB4908WA 9 CR </p> <p>24v 2.5kW a:82.5 b:24 o:20</p> <p>MERCEDES Military Utility Vehicle</p> <p>BO 0001219008 NR 01219008</p>
<p>STB4909</p>  <p>STB4909WA 10 CR </p> <p>24v 2.5kW a:82.5 b:30 o:20</p> <p>MERCEDES-BENZ G-Class I (W460) G-Class II (W461) G-Class III (W463)</p> <p>OM602930 OM602983 OM603931 MB 0041513101 BO 0001219009 CG 114319</p>	<p>STB4910</p>  <p>STB4910WA 9 ACR </p> <p>24v 2.5kW a:76 b:30 o:20</p> <p>RUGGERINI HATZ Marine</p> <p>MRD 190</p> <p>LB 58401410 BO 0001219010 WA STR22093</p>	<p>STB4943 <i>New</i></p>  <p>13 CR </p> <p>12v 1.8kW</p> <p>MERCEDES-BENZ</p> <p>MB A6519061100 BO 0001139044 MH STB4943</p>	<p>STB4957</p>  <p>STB4957WA 9 CR </p> <p>12v 1.8kW a:76 b:24</p> <p>BMW 7 Series E65 735LI/745I,LI 01-></p> <p>BMW 12417508634 BO 0001109057 WA 17856N</p>
<p>STB4958</p>  <p>STB4958WA 9 CR </p> <p>12v 2kW a:76 b:21 o:20</p> <p>BMW 3 7</p> <p>318TI</p> <p>BM 12417508637 BO 0001109058 MH STB4958</p>	<p>STB4959</p>  <p>STB4959WA 9 CR </p> <p>12v 2kW a:76 b:29 o:20</p> <p>VW Passat Saloon Passat Variant</p> <p>3B3 3B6</p> <p>VW 07D911023 BO 0001109059 MH STB4959</p>	<p>STB4960</p>  <p>STB4960WA 10 CR </p> <p>12v 2.2kW a:76 b:24.5 o:21</p> <p>AUDI A8 Quattro</p> <p>VAG 059911023A VAG 059911024F BO 0001109260</p>	<p>STB4962</p>  <p>STB4962RB STB4962WA 10 CR </p> <p>12v 2.2kW a:70 b:30 o:22</p> <p>MERCEDES-BENZ E-Class GL-Class ML-Class</p> <p>W211 X164 W164</p> <p>MB A0061515601 BO 0001109262 NR 01109262</p>
















Starters

Bosch

<p>STB4964</p>  <p>STB4964WA STN4964WA</p> <p>11 CR </p> <p>12v 2.7kW a:82.5 b:24 o:20</p> <p>HATZ ???? 800</p> <p>Caterpillar 3741</p> <p>CT 813255 BO 0001359007 NR 01359060</p>	<p>STB5017 <i>New</i></p>  <p>9 CR </p> <p>12v 1.7kW a:74 b:26 o:21</p> <p>AUDI A8 VOLKSWAGEN phaeton</p> <p>AZC,BRK AYT,BAN BKL VW 07C911023 BO 0001115016 DR DRS0383</p>	<p>STB5022</p>  <p>9 cr </p> <p>12v 1.7kW a:76 b:34 o:21</p> <p>VOLKSVAGEN Passat 2.3L Passat Variant 2.3L</p> <p>AGZ AZX VW 012911023C BO 0001115022</p>	<p>STB5030 <i>New</i></p>  <p>10 CR </p> <p>24v 4.5kW a:89 b:51 o:30</p> <p>CUMMINS</p> <p>CU 529579 BO 0001231146</p>
<p>STB5076 <i>New</i></p>  <p>STB5076RB STB5076WA</p> <p>255 10 CR </p> <p>12v 1.8kW a:60 b:26 o:20</p> <p>MERCEDES-BENZ Sprinter Viano Vito</p> <p>OM642993 OM541920 OM642 MB A0061517501 BO 0001115076 CG 114507</p>	<p>STB5084 <i>New</i></p>  <p>10 CR </p> <p>12v 1.7kW a:66 b:26 o:21</p> <p>AUDI A8 6.3l Quattro CEJA</p> <p>VW 03L911021F BO 0001115084</p>	<p>STB5088 <i>New</i></p>  <p>STB5088RB</p> <p>12 CR </p> <p>12v 1.7kW a:88 b:21 o:20</p> <p>FORD Transit 2.2L 2011-</p> <p>DRRA, DRRB, DRRC CVRA, CVRB, CVRC CYRA, CYRB, CYRC FO CC1T11000BA BO 0001115088 MH STB5088</p>	<p>STB5096</p>  <p>10 CR </p> <p>12v 1.7kW a:59 b:26 o:22</p> <p>MAYBACH MERCEDES-BENZ</p> <p>MB A0061519801 BO 0001115096</p>
<p>STB5098</p>  <p>STB5098RB</p> <p>10 CR </p> <p>12v 1.7kW a:62 b:28 o:22</p> <p>MERCEDES-BENZ</p> <p>OM 642960 OM 642853 OM 642862</p> <p>BO 0001115098</p>	<p>STB5307 <i>New</i></p>  <p>STB4501WA STB5307WA</p> <p>13 ACR </p> <p>12v 2kW a:79 b:52</p> <p>AUDI A1, A3 SEAT Ibiza</p> <p>8P1, 8PA 6J5 VW 02Z911024R BO 0001153007 HC CS1505</p>	<p>STB5613 <i>New</i></p>  <p>9 ACR </p> <p>12v a:60 b:32 o:20</p> <p>MERCEDES-BENZ SLS 6208cc 2010-</p> <p>M159980</p> <p>MB A0061500001 BO 0001125613 MH STB5613</p>	<p>STB6003 <i>New</i></p>  <p>9 CR </p> <p>12v 1.5kW a:82 b:24 o:21</p> <p>MERCEDES-BENZ</p> <p>MO117.982 MO117.985 MO115.954 ME 0021510901 BO 0001313006 MH STB6003</p>













Starters

Bosch

<p>STB6049 <i>New</i></p>  <p>9 CR </p> <p>12v 1.4kW a:62 b:13 o:33</p> <p>ALFA RAMEO AR01713 75 2.0L 90 2.0iL AR06212 ALFETTA 2.0L 2.0L Turbo AR01655 Giulietta 2.0L 2.0L Turbo AR 117010503000 GTV,Spider 2.0L 2.0L TorboBO 0986014960 VA 433349</p>	<p>STB6057</p>	<p>STB6063</p> <p>24V</p> <p>DAF</p> <p>DAF 614283</p>	<p>STB6118 <i>New</i></p>  <p>8 CR </p> <p>12v 1.4kW a:71 b:12 o:21</p> <p>MITSUBISHI 6A12 Galant 6G72 Pajero G6AT HYUNDAI MI MD373135 Sonata BO F005M00006 WA 17731N</p>
<p>STB6210 <i>New</i></p>  <p>10 CR </p> <p>12v 2.4kW a:89 b:33 o:30</p> <p>NISSAN LD20 Trade</p> <p>NI 772000082 BO 0001362100 MH STB6210</p>	<p>STB6275</p>  <p>9 CR </p> <p>12v 1.4kW a:82 b:10 o:20</p> <p>HOLDEN L67 Caprice 3.8L D27DT Commodore 3.8L Statesman 3.8L HO 10455700 BO F005M00003</p>	<p>STB6407 <i>New</i></p>  <p>9 ACR </p> <p>12v 0.9kW a:62 b:12 o:20</p> <p>PIAGGIO</p> <p>PI GU057030730 BO 0001106407</p>	<p>STB6510 <i>New</i></p>  <p>12 CR </p> <p>24v 7.5kW a:87 b:49 o:30</p> <p>VOLVO</p> <p>BO 0001330014</p>
<p>STB6872</p>  <p>10 CR </p> <p>24v 4.0kW a:89 b:33 o:30</p> <p>RENAUT T4.38 Midliner</p> <p>RE 5010090911 BO 0001368072</p>	<p>STB6911</p>  <p>12 cr </p> <p>12v 1.2kW a:64 b:9 o:33</p> <p>RENAUT K9K608 Captur 1.5L Clio 1.5</p> <p>RE 233001073R BO 0001136007</p>	<p>STB7000 <i>New</i></p>  <p>13 ACR </p> <p>12v 1.1kW a:79 b:23 o:30</p> <p>SEAT CHYA SKODA CPGA WOLKSVAGEN CJZB</p> <p>WV 02M911024R BO 0001177000 LU LRS02631</p>	<p>STB7003 <i>New</i></p>  <p>10 CR </p> <p>12v 1.4kW a:76 b:22 o:30</p> <p>FIAT, LANCIA Panda Punto Epsilon</p> <p>FI 51872564 BO 0001137003 MH STB7003</p>

Starters

Bosch

STB7012	STB7030	STB7032	STB7040
 <p>12v a:79 b:52 o:30</p> <p>AUDI</p> <p>WV 02Z911024FX BO 0001177012</p>			
STB7049	STB7054	STB7059	STB7400 <i>New</i>
	<p>STB7054WA</p> <p>341 10 CR </p> <p>12v 3.0kW a:89 b:48 o:30</p> <p>HYSTER 4154 Fork Lift 4203</p> <p>HR 326460 BO 0001367054 CG 112175</p>		 <p>10 CR </p> <p>12v a:27 b:16 o:22</p> <p>MERCEDES-BENZ M278.951 C-CLASS (W204) C300/C350M278.957 E-CLASS (W212) E300/E350M276.955 E460 2011-> MZ A2769062300 M-CLASS (W166) ML350 11-BO 0001147400</p>
STB7402	STB7404 <i>New</i>	STB7408	STB7421 <i>New</i>
 <p>10 CR </p> <p>12v a:60 b:27 o:22</p> <p>MERCEDES-BENZ M276.957 M276.952 M276.820 MZ A2769061300 BO 0001147402</p>	 <p>10 CR </p> <p>12v a:60 b:28 o:22</p> <p>MERCEDES-BENZ M278922 E-Class M157981 M-Class M276821 S-Class MB A2789060600 BO 0001147404</p>	 <p>13 cr </p> <p>12v a:70 b:22 o:22</p> <p>MERCEDES-BENZ</p> <p>MZ A2719060200 BO 0001147408</p>	 <p>9 CR </p> <p>12V 1.2kW a:82.5 b:30 o:21</p> <p>VOLKSWAGEN BBJ AUDI A6, Q 3.0L 2005-2008</p> <p>VW 06C911023 BO 0001107421 MH STB7421</p>

Starters

Bosch

<p>STB7446 New</p> <p style="text-align:right">STB7446WA</p>  <p style="text-align:right">9 CR </p> <p>12V 1.1kW A:82.5 B:17 o:22</p> <p>AUDI TFSI A6 2.0l</p> <p>VW 06B911023B BO 0001107446 MH STB7446</p>	<p>STB7461 New</p> <p style="text-align:right">STB7461RB STB7461WA</p>  <p style="text-align:right">246 10 CR </p> <p>12V 1.1Kw A:60 B:29 o:22</p> <p>MERCEDES-BENZ C,E,G,GL,M,R,S-CLASS 2005-> C300/C350/C280/E350/E500</p> <p>MB 0061515901 BO 0001107461 MH STB7461</p>	<p>STB7812</p>  <p style="text-align:right">8 CR </p> <p>12v 1.1kW a:70 b:13 o:21</p> <p>NISSAN Sentra Primera Sunny</p> <p>1.4L 1.8L 2.0L NI 233005M000 BO 6004AA0004 WA 17812N</p>	<p>STB8003 New</p>  <p style="text-align:right">11 CR </p> <p>12v 2.2kW a:82 b:8 o:30</p> <p>CHEVROLET Malibu LBS OPEL Astra A20DTE, A20DTH OPEL Insignia A20DTJ, A20DTR OPEL Zafira OP 1202216 BO 0001148003 DR DRS0549</p>
<p>STB8012 New</p>  <p style="text-align:right">9 CR </p> <p>24v 4kW a:82 b:24 o:22</p> <p>VM</p> <p>VM 35532025A BO 0001368012 MH STB8012</p>	<p>STB8013 New</p>  <p style="text-align:right">10 CR </p> <p>12v a:65 b:24 o:21</p> <p>AUDI A4 A4 Avant</p> <p>VW 06 911021X BO 0001138013 MH STB8013</p>	<p>STB8019</p>  <p style="text-align:right">10 CR </p> <p>12v 1.7kW a:66 b:24 o:21</p> <p>AUDI A4 A5 A6 A7 A8 Q5</p> <p>CMUA,CGWC,CAKA CREC,CCBA,CTDA CGXC,CTUB VW 06E911021F BO 0001138069</p>	<p>STB8039 New</p>  <p style="text-align:right">11 cr </p> <p>12v 1.4kW a:74 b:49 o:22</p> <p>MINI Cooper D 2010-> One D 2010-></p> <p>N47C16A N47C20A BM 12417823314 BO 0001138039 MH STB8039</p>
<p>STB8050 New</p>  <p style="text-align:right">9 CR </p> <p>12v 1.7kW a:76 b:27 o:21</p> <p>BMW</p> <p>BM 12417626546 BO 0001138050</p>	<p>STB8055</p>  <p style="text-align:right">11 CR </p> <p>12v a:77 b:22 o:22</p> <p>HYUNDAI I20 1.4l I30 1.4l,1.6 KIA RIO III 1.4l SOUL 1.6l</p> <p>G4FA G4FD G4FG HY 361002B302 BO 0001138055</p>	<p>STB8069 New</p>  <p style="text-align:right">10 CR </p> <p>12v 1.7kW a:69 b:24 o:2</p> <p>AUDI A4, A5, A6, A7, A8 Q5</p> <p>CMUA, CAKA CCBA, CGWC CGXC, CTUB VW 06E911021F BO 0001138069</p>	<p>STB8206 New</p>  <p style="text-align:right">230 9 CR </p> <p>12v 1.7kW a:74 b:26 o:21</p> <p>AUDI A8 6.0l BHT, BRN VOLKSWAGEN Phaeton 6.0BAR, BTT VOLKSWAGEN Touareg 4.2BJN, CFRA VOLKSWAGEN Touareg 6.0VW 07C911023F BO 0001108206</p>

Starters

Bosch

<p>STB8237 <i>New</i></p>  <p>9 CR </p> <p>12v 1.4kW a:74 b:26 o:32</p> <p>AUDI</p> <p>VW 07C911023G BO 0001108237 MH STB8237</p>	<p>STB8411 <i>New</i></p>  <p>10 CR </p> <p>12v 1.4kW a:56 b:-2 o:20</p> <p>VOLVO S60, S80, V60, V70 XC60, XC70, XC90 3.0L T6/3.2L 2007-></p> <p>VO 30667299 BO 0001108411 FO 6G9N11000CC</p>	<p>STB8420</p>  <p>9 CR </p> <p>12v 1.4kW a:76 b:7</p> <p>FIAT</p> <p>FI 51787218 BO 0001108420 MH STB8420</p>	<p>STB8441 <i>New</i></p>  <p>10 CR </p> <p>12v 1.1kW a:68 b:39 o:20</p> <p>PORSCHE Panamera 3.0l Panamera 3.6l Panamera 4.8l Panamera 4.8l torbo</p> <p>MCW.DA MCG.EA M48.20 PO 94860420800 BO 0001108441 DR DRS0612</p>
<p>STB8450 <i>New</i></p>  <p>10 CR </p> <p>12v 1.1kW a:76 b:7 o:30</p> <p>SUZUKI SX4 D20AA</p> <p>SU 3110055L00000 BO 0001108450</p>	<p>STB9010 <i>New</i></p> <p>12v 1kW</p> <p>TOYOTA DAIHADSU</p> <p>4A 4AL 2AL TO 2810015070 BO 0986013531090 DA 2810015070000</p>	<p>STB9011 <i>New</i></p>  <p>STB9011RB STB9011WA</p> <p>11 ACR </p> <p>12v 1.6kW a:76 b:24 o:33</p> <p>PIAGGIO Ape Callesino Ape Classic Ape TM M500</p> <p>0.4d 0.5d PG 292083 BO 0001109011 MH STB9011</p>	<p>STB9012</p>  <p>12 CR </p> <p>24v 6kW a:89 b:51 o:30</p> <p>LIEBHERR SCANIA</p> <p>BO 0001330012</p>
<p>STB9021 <i>New</i></p>  <p>12v a:68 b:30 o:20</p> <p>PORSCHE CAYENNE 4.8 S 2010-></p> <p>BO 0001139021 MH STB9021</p>	<p>STB9023 <i>New</i></p>  <p>12 CR </p> <p>12v 2.5kW a:89 b:38 o:20</p> <p>FORD Tourneo Transit</p> <p>CYFA, CYFB DRFA, DRFB UHFA, UHFB FO CC1T11000DA BO 0001139023 DR DRS0856</p>	<p>STB9028</p>  <p>9 CR </p> <p>12v 1.8kW a:76 b:30 o:20</p> <p>LOMBARDINI</p> <p>LO 563R0610</p>	<p>STB9029 <i>New</i></p>  <p>STB9029WA</p> <p>13 CR </p> <p>12v 2.2kW a:70 b:16 o:22</p> <p>MERCEDES-BENZ Sprinter Viano Vito</p> <p>MO651.957 MO646.986 MO651.940 ME A6519060000 BO 0001139029 MH STB9029</p>

Starters

Bosch

<p>STB9031</p> <p>12 CR </p> <p>12v 2.2kW a:89 b:20 o:20</p> <p>FORD TRANSIT</p> <p>FO CC1T11000EA BO 0001139031</p>	<p>STB9041</p> <p> 10 CR </p> <p>12v a:66 b:26 o:21</p> <p>AUDI</p> <p>VW 059911021G BO 0001139041</p>	<p>STB9047</p> <p> 10 CR </p> <p>12v a:80 b:24 o:22</p> <p>JEEP Wrangler ENS</p> <p>CH 04801871AB BO 0001139047</p>	<p>STB9049</p> <p> 10 CR </p> <p>12v a:66 b:26 o:21</p> <p>VW 07L911021X BO 0001139049</p>
<p>STB9203 <i>New</i></p> <p> STB9203WA 9 CR </p> <p>12V 2.1kW A:76 B:20.5 o:22</p> <p>BMW ROLS-ROYCE 6.75L 7 (E65/E66) 03-></p> <p>BM 12417537514 BO 0001109203 MH STB9203</p>	<p>STB9265 <i>New</i></p> <p> 10 CR </p> <p>12v 2.2kW a:76 b:24 o:22</p> <p>BMW 7 series</p> <p>448D1 448D2</p> <p>BM 12417794953 BO 0001109265 LU LRS02396</p>	<p>STB9271 <i>New</i></p> <p> STB9271WA 10 CR </p> <p>12V 2.2kW A:68 B:30 o:22</p> <p>MERCEDES-BENZ</p> <p>M156985 M156982 M156980 MB 0061515301 BO 0001109271 MH STB9271</p>	<p>STB9280 <i>New</i></p> <p> 10 CR </p> <p>12v a:64 b:26 o:21</p> <p>AUDI A8 4.2 TDI quattro</p> <p>VW 057911021 BO 0001109280</p>
<p>STB9365 <i>New</i></p> <p> 9 CR </p> <p>12v 2.3kW a:84 b:30 o:30</p> <p>IVECO DALLY 3.0D</p> <p>F1CE0481HA</p> <p>IV 69503857 BO 0001109365</p>	<p>STB9369 <i>New</i></p> <p> STB9369WA 9 CR </p> <p>12v 2.5kW a:82 b:21</p> <p>DEUTZ KHD</p> <p>BO 0001109369 MH STB9369</p>	<p>STB9397 <i>New</i></p> <p> 12 CR </p> <p>12v 2.2kW a:76 b:2 o:32</p> <p>VOLVO C30 C70 S40 S60</p> <p>D5204T5 D5244T10 D5244T11 VO 36001408 BO 0001109397 DR DRS0446</p>	<p>STB9405 <i>New</i></p> <p> 9 CR </p> <p>12v 2.6kW a:108 b:29 o:30</p> <p>IVECO</p> <p>IV 5801441816 BO 0001109405</p>







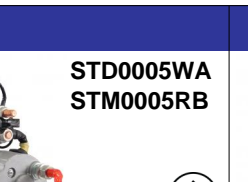

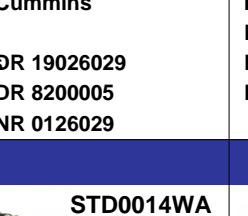

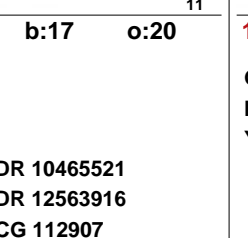







Starters

Bosch

STB9503		STB9515	
		<i>New</i>	
			
13 ACR		13 ACR	
			
12v	1.1kW	a:78	b:54
			o:30
AUDI A3	CZEA	AUDI	CPTA, CMBA
SCODA Octavia	CJSA	A3 1.4L 2012-	CXSA,
	CHPA	A3 1.8L 2012-	
	VW 02Z911024QX	SKODA	VW 02Z911024Q
	BO 0001179503	Octavia 1.8L 2012-	BO 0001179515
			MH STB9515

Starters

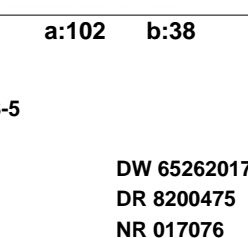Delco

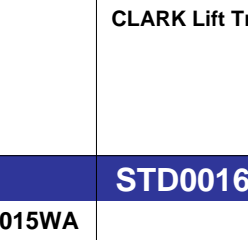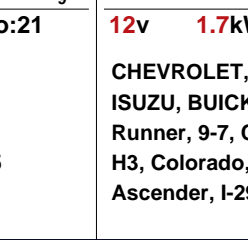STD0003	STD0005	STD0007	STD0012
<p>STD0003WA</p>  <p>8 CR </p> <p>12v 1.4kW</p> <p>HYUNDAI, KIA Amanti, Sedona Azera, Entourage Santa, Sonata Veracruz</p> <p>3.3L 3.8L</p> <p>KI 361003C130 DR 8000172 WA 6949N</p>	<p>STD0005WA STM0005RB</p>  <p>12 CR </p> <p>12v 4.6kW a:91 b:42 o:30</p> <p>FREIGHTLINER 38MT PETERBILT Cummins STERLING Medium&Heavy Duty Trucks</p> <p>DR 19026029 DR 8200005 NR 0126029</p>	<p>STD0007WA</p>  <p>10 CR </p> <p>12v 4.6kW a:91 b:45 o:30</p> <p>FORD 38MT International T444E F650, F750 F1400, F1600 F1700, F1800</p> <p>DR 8200007 DR 8300022 WA 6834N</p>	<p>STD0012</p>  <p>11 CR </p> <p>12v 2.5kW a:88 b:43 o:30</p> <p>DAEWOO CM50S CLARK Lift Trucks Perkins 4.0L</p> <p>DW 601110250 NR 0110250</p>
STD0013	STD0014	STD0015	STD0016
<p>STD0013WA</p>  <p>11 CR </p> <p>24v 4.5kW a:102 b:38 o:30</p> <p>DAEWOO DOOSAN D355S-5 FORKLIFT</p> <p>DW 65262017077 DR 8200475 NR 017076</p>	<p>STD0014WA</p>  <p>236 11 CR </p> <p>12v 1.7kW a:82 b:17 o:20</p> <p>CHEVROLET OLDSMOBILE PONTIAC</p> <p>Cavalier, Malibu Alero, Sunfire, Grand Am</p> <p>DR 10465521 DR 12563916 CG 112907</p>	<p>STD0015WA</p>  <p>9 CR </p> <p>12v 1.2kW a:82 b:18 o:21</p> <p>GM Vehicles Diesel HYSTER YALE Lift Trucks</p> <p>YL 580044885 DR 9000890 CG 113811</p>	<p>STD0016WA</p>  <p>11 CR </p> <p>12v 1.7kW a:81 b:34 o:20</p> <p>CHEVROLET, HUMMER ISUZU, BUICK, SAAB, GMC Runner, 9-7, Canyon H3, Colorado, Trailblazer Ascender, I-290, I-370</p> <p>IS 8890178460 DR 8000051 WA 6782N</p>
STD0082	STD0214 <i>New</i>	STD0216 <i>New</i>	STD0229 <i>New</i>
 <p>267 10 ACR </p> <p>12v 0.5kW a:68 b:28 o:20</p> <p>JOHNSON Marine, OMC Marine Various Models</p> <p>WL 91091035 DR RS41016 CG 112145</p>	<p>STD0214WA</p>  <p>12v 1.7kW a:68.5 b:9</p> <p>BUICK 3.2L V6, 3.8L V6 CADILLAC 5.7L V8, 7.0L V8 CHEVROLET 3.7L V6, 4.1L V6 JEEP MR 5046282 PONTIAC DR 1107247 CG 112897</p>	 <p>10 CR </p> <p>12v 1.5kW a:82.5 b:18 o:20</p> <p>CHEVROLET X20D1 Epica 2.0l LF4 Epica 2.5l</p> <p>CH 96647521 DR 96647521 CG 114503</p>	 <p>12 CR </p> <p>12v 7.3kW a:91 b:50 o:30</p> <p>FREIGHTLINER PETERBILT WESTERN STAR VOLVO Heavy Trucks</p> <p>MF 526927M91 DR 8200433 WA 6907N</p>

Starters

Delco

<p>STD0810</p>  <p>STD0810WA 9 CR </p> <p>12v 2kW a:68 b:9 o:20</p> <p>BUICK, CHEVROLET 8MT GMC, OLDSMOBILE LHO, LEZ PONTIAC</p> <p>DR 10455004 DR 1988722 HC US810</p>	<p>STD0811</p>  <p>STD0811WA 11 CR </p> <p>24v 7.5kW a:92 b:48.5 o:30</p> <p>CATERPILLAR, WHITE 40MT WESTERN STAR, CASE MACK, KENWORTH Industrial Machines</p> <p>DR 1113708 DR 1113842 HC US811</p>	<p>STD0818</p>  <p>STD0818WA 9 CR </p> <p>12v 1.4kW a:68 o:20</p> <p>BUICK, CADILLAC CHEVROLET, GMC JEEP, OLDSMOBILE PONTIAC</p> <p>DR 1109363 DR 1108789 HC US818</p>	<p>STD0823</p>  <p>STD0823WA STM0823WA 449.5 12 CR </p> <p>24v 7.5kW a:92 b:48.5 o:30</p> <p>CATERPILLAR 42MT FIAT-ALLIS</p> <p>DR 1114793 DR 1114793 HC US823</p>
<p>STD0824</p>  <p>12v a:89 b:47 o:30 </p> <p>CLARK LISTER</p> <p>DR 1113598 DR 1107588 HC US824</p>	<p>STD0826</p>  <p>STD0826WA 11 CR </p> <p>24v a:102 b:97 o:30</p> <p>CATERPILLAR WESTERN STAR KENWORTH PETERBILT WHITE</p> <p>FO D6OF11001AA DR 1109989 HC US826</p>	<p>STD0827</p>  <p>STD0827WA STD9827WA 11 CR </p> <p>24v 7.5kW a:92 b:47 o:30</p> <p>CATERPILLAR 42MT FIAT-ALLIS Caterpillar IVECO Mack MACK CT 3T8947 PETERBILT DR 1990274 HC US827</p>	<p>STD0830</p>  <p>12v a:69 b:5 o:20 </p> <p>CHEVROLET Camaro Caprice Malibu</p> <p>DR 1109521 DR 1109524 HC US830</p>
<p>STD0840</p>  <p>12v a:89 b:48 o:30 </p> <p>HYSTER Perkins Lift Trucks 6305 Straddle Trucks 6354</p> <p>DR 1113652 DR 1113683 HC US840</p>	<p>STD0842</p>  <p>12v a:89 b:20 o:30 </p> <p>CLARK Perkins CATERPILLAR 4236 Diesel BAKER</p> <p>WI 91014245 Lift Trucks DR 1108696 HC US842</p>	<p>STD0843</p>  <p>STD0843WA 10 CR </p> <p>12v 2.5kW a:89 b:46 o:30</p> <p>BOBCAT 22 MT PERKINS 27MT Industrial Engine 28MT</p> <p>DR 1990421 DR 10465049 HC US843</p>	<p>STD0844</p>  <p>STD0844WA STD0860 STD0860WA 12 CR </p> <p>12v a:89 b:45 o:30</p> <p>BOBCAT 22MT CLARK 28MT PERKINS</p> <p>Industrial Engines DR 10465058 Fork Lift DR 1113273 HC US844</p>







Starters

Delco

<p>STD0845</p>  <p>STD0845WA 10 CR </p> <p>12v 2.5kW a:89 b:45.5 o:30</p> <p>BOBCAT CUMMINS FORD Industrial Engines</p> <p>FO F3TU11000AA DR 10461285 HC US845</p>	<p>STD0855</p>  <p>STD0855WA 9 CR </p> <p>12v a:104 b:12 o:20</p> <p>CLARK Trucks Tow Tractors</p> <p>FORD 240 Engine 300 Engine DR 1108419 DR 1107694 HC US855</p>	<p>STD0857</p>  <p>STD0857WA STD2257 STD2257WA 339 10 CR </p> <p>24v 4.5kW a:89 b:47 o:30</p> <p>CASE CUMMINS SAMSUNG KAMAZ TIMBERJACK</p> <p>7MT 28MT CS C3918377 DR 10461283 HC US857</p>	<p>STD0858</p>  <p>STD0858WA 270 9 CR </p> <p>12v 1.2kW a:68 b:18 o:20</p> <p>CHEVROLET GMC, ISUZU JEEP OLDSMOBILE PONTIAC</p> <p>L32 V6 DR 10455050 DR 10455011 HC US858</p>
<p>STD0859</p>  <p>STD0859WA 9 CR </p> <p>12v 2kW a:72 b:19</p> <p>MERCURY</p> <p>DR 9000821 DR 9000789 HC US859</p>	<p>STD0863</p>  <p>STD0863WA 499.5 12 CR </p> <p>24v 7.5kW a:92 b:46 o:30</p> <p>CASE CATERPILLAR FIAT-ALLIS PETERBILT VOLVO</p> <p>42MT FO F6HZ11002EA DR 10461025 HC US863</p>	<p>STD0864</p>  <p>STD0864WA 497.5 11 CR </p> <p>24v 7.5kW a:92 b:47 o:30</p> <p>CATERPILLAR CLARK CUMMINS FIAT-ALLIS</p> <p>42MT FO E9HT11001BA DR 10461024 HC US864</p>	<p>STD0868</p>  <p>STD0868WA 10 CR </p> <p>12v 2.8kW a:89 b:19 o:30</p> <p>BOBCAT CLARK Fork Lift</p> <p>28MT DR 1998389 DR 1113285 HC US868</p>
<p>STD0877</p>  <p>STD0877WA 9 CR </p> <p>12v a:83 o:20</p> <p>BUICK, CADILLAC CHEVROLET, GMC JEEP, OLDSMOBILE PONTIAC</p> <p>10MT L4 DR 1998440 DR 1108523 HC US877</p>	<p>STD0931</p>  <p>STD0931WA 10 CR </p> <p>12v 4kW a:89 b:46 o:30</p> <p>JOHN DEERE Agricultural machine</p> <p>6076TRW JD RE13722 DR 10461039 HC JS931</p>	<p>STD0968</p>  <p>STD0968WA 10 CR </p> <p>12v a:89 b:45 o:30</p> <p>FIAT-ALLIS HYSTER PERKINS</p> <p>22MT 27MT 28MT DR 10465044 DR 10461446 HC US968</p>	<p>STD0969</p>  <p>STD0969WA 9 CR </p> <p>12v a:82.5 o:20</p> <p>CHEVROLET GMC MERCURISER OMC</p> <p>10MT VO 8553265 DR 1108755 HC US969</p>

Starters

Delco

<p>STD0970</p>  <p>STD0970WA 337.5 10 CR</p> <p>12v 2.5kW a:82 b:8 o:20</p> <p>CHEVROLET 27MT GMC 28MT</p> <p>WI 91013887 DR 10465013 HC US970</p>	<p>STD1029</p>  <p>STD1029RB STD1029WA 11 CR</p> <p>12v 2kW a:68 b:5 o:20</p> <p>CADILLAC, CHEVROLET L35 GMC, ISUZU LO5 OLDSMOBILE</p> <p>DR 9000860 DR 9000786 HC US1029</p>	<p>STD1210</p>  <p>STD1210WA STM1210WA 184.5 8 CR</p> <p>12v 1kW a:75 b:7 o:22</p> <p>CHEVROLET F8CV DAEWOO, SUZUKI K10A Spark K12A Matiz GM 96275481 Wagon DR 10455503 CG 111849</p>	<p>STD1240</p>  <p>STD1240WA 9 CR</p> <p>12v 1.4kW a:68.5 b:18 o:20</p> <p>MERCURISER MERCURY, OMC Marine</p> <p>OP 12570230 DR 10465001 HC US1240</p>
<p>STD1258</p>  <p>STD1258WA 11 CR</p> <p>12v 1.7kW a:68.5 b:9 o:20</p> <p>VOLVO PENTA Various Models</p> <p>VO 38547501 DR 9000820 HC CS1258</p>	<p>STD1291</p>  <p>STD1291WA 11 CR</p> <p>12v 1.8kW a:75 b:29 o:20</p> <p>OPEL, VAUXHALL Z22SE, Z20NET FIAT, SAAB 194A1000 Astra 2.2, Signum 2.0 B207E, B205E Croma 2.2, Vectra OP 12564088 40246 1.8, 40307 2.0 DR 9000936 HC CS1291</p>	<p>STD1381</p>  <p>STB1381RB STD1381WA 317.5 9, 11 CR</p> <p>24v 4kW a:89 b:45 o:30</p> <p>MERCEDES OM904907 Atego OM906921 Citaro OM902916 Econic MB A0041516201 Unimog DR 10461470 HC CS1381</p>	<p>STD1395</p>  <p>STD1395RB STD1395WA 214 9 CR</p> <p>12v 1.2kW a:75 b:30 o:20</p> <p>OPEL, VAUXHALL, SAAB Z20NET, Z22SE, Z22YH Astra, Signum, Vectra B207L Speedster, Zafira 9-3 OP 12575626 DR 9000902 HC CS1395</p>
<p>STD1422</p>  <p>STD1422WA 185 8 CR</p> <p>12v 0.8kW a:75 b:6.5 o:21</p> <p>DAEWOO, CHEVROLET B10D1, B12D1 Matiz, Kalos B10S, B12S1 Aveo, Spark B10S1, F12S3 DW 96469962 DR 96289430 HC CS1422</p>	<p>STD1431</p>  <p>STD1431WA 9 CR</p> <p>12v 1.8kW a:82.5 b:18 o:20</p> <p>OPEL, VAUXHALL KL1, Z20DM CHEVROLET Z20S, Z20MH Captiva, Cruze, Epica Z20DM Lacetti, Nubira OP 4805517 Antara DR 96843574 HC CS1431</p>	<p>STD1438</p>  <p>STD1438WA 9 CR</p> <p>12v 1.1kW a:68 b:19 o:20</p> <p>ALFA ROMEO, FIAT Z16XEP OPEL, VAUXHALL Z18XER Astra, Corsa 939A4000 Vectra OP 55556092 Zafira DR 8000048 HC CS1438</p>	<p>STD1510 New</p>  <p>STD1510 12 CR</p> <p>12v 5.5kW a:88 b:45 o:30</p> <p>CATERPILLAR</p> <p>CA 2071510 DR 1993851</p>

Starters

Delco

<p>STD1684 <i>New</i></p> <p>STD1684WA</p>  <p>9 CR </p> <p>12v 1.4kW a:68 b:18 o:20</p> <p>DAEWOO A16DMS OPEL A15MF VAUXHALL</p> <p>DW 96550782 DR 96208782 CG 111684</p>	<p>STD1707</p>  <p>11 CR </p> <p>24v 6.0kW a:47 b:22 o:33</p> <p>DOOSAN DAEWOO</p> <p>DA 65262017073 DR 8200475</p>	<p>STD2007</p> <p>STD2007WA</p>  <p>405 12 CR </p> <p>12v a:89 b:48 o:30</p> <p>CLARK, PERKINS Perkins Fork Lift Industrial Engines</p> <p>DR 1113639 DR 1993728 CG 111007</p>	<p>STD2089</p> <p>STD2089WA</p>  <p>500 11 CR </p> <p>12v 7.5kW a:92 b:46 o:30</p> <p>CASE, CUMMINS, FORD Cummins FREIGHTLINER, MACK INTERNATIONAL, VOLVO PERKINS, NEW HOLLAND CU 3610942 Trucks DR 10461033 CG 112089</p>
<p>STD2169</p> <p>STD2169WA</p>  <p>401 10 CR </p> <p>24v 4.5kW a:89 b:46 o:30</p> <p>CASE 37MT Agricultural 800 Series</p> <p>CU 3908594 DR 10479108 CG 112169</p>	<p>STD2221</p> <p>STD2221WA</p>  <p>322 10 CR </p> <p>12v 2.5kW a:82 b:33 o:20</p> <p>BOBCAT, CLARK JOHN DEERE Fork Lift Industrial Engine Agricultural machine</p> <p>JD RE509658 DR 1113271 CG 111221</p>	<p>STD2233</p> <p>STD2233WA</p>  <p>318.5 9 CR </p> <p>12v a:82.5 b:47 o:20</p> <p>CATERPILLAR, MERCURISER MARINE Forklift Various Models Engine</p> <p>DR 1993885 DR 1993709 CG 112233</p>	<p>STD2239 <i>New</i></p>  <p>232 9,11 CR </p> <p>12v 1.4kW a:68 b:18 o:20</p> <p>MERCURY MARINE</p> <p>ME 50809904A1 DR 9000839 CG 112239</p>
<p>STD2242</p>  <p>483 12 CR </p> <p>24v 7.0kW a:92 b:47 o:30</p> <p>SEDDON Trucks EU</p> <p>PT MS1410A DR 1993980 HC US1242</p>	<p>STD2243</p> <p>STD2243WA</p>  <p>401.5 12 CR </p> <p>24v 7.5kW a:92 b:48 o:30</p> <p>CASE, CLARK Agricultural machine Fork Lift</p> <p>CU 3043010 DR 10479175 CG 112243</p>	<p>STD2253</p> <p>STD2253WA</p>  <p>342 10 CR </p> <p>12v 2.5kW a:89 b:45 o:30</p> <p>FORD Cummins L 6000 L 7000 L 8000 L 9000</p> <p>FO F3HT11001DB DR 10465151 CG 112253</p>	<p>STD2255</p> <p>STD2255WA</p>  <p>401 12 CR </p> <p>12v a:92 b:48 o:30</p> <p>CLARK, CUMMINS Cummins FREIGHTLINER PETERBILT, STERLING Fork Lift Industrial Engines</p> <p>CU 3043008 DR 10461008 CG 112255</p>













Starters

Delco

<p>STD2256</p>  <p>STD2256WA 402 10 CR </p> <p>24v 7kW a:89 b:47 o:30</p> <p>CASE, DRESSER LISTER Agricultural machine Crawler Excavators Loaders, Marine</p> <p>AE CM8001 DR 1990499 CG 112256</p>	<p>STD2257</p>  <p>STD2257 339 10 CR </p> <p>24v 4.5kW a:89 b:46 o:30</p> <p>CASE, DRESSER CUMMINS, CHAMPION Graders, Loaders Agricultural machine Industrial Engine</p> <p>Cummins CU 3918378 DR 1113291 CG 111257</p>	<p>STD2258</p>  <p>STD2258WA 519 13 CR </p> <p>12v a:92 b:48 o:30</p> <p>CHEVROLET, GMC Trucks US</p> <p>CU 3603865RX DR 10461022 CG 112258</p>	<p>STD2259</p>  <p>STD2259WA 507 12 ACR </p> <p>12v 5.5kW a:92 b:61 o:30</p> <p>MASSEY FERGUSON Combines MF8570</p> <p>Cummins 6505 CT 0R2188 DR 10478816 CG 112259</p>
<p>STD2267</p>  <p>STD2267WA 339 10, 13 CR </p> <p>12v 2.5kW a:89 b:46.5 o:30</p> <p>BOBCAT, CUMMINS, FORD Industrial Engines Passenger Cars US</p> <p>Cummins CU 3904445 DR 10465407 CG 112267</p>	<p>STD2268</p>  <p>STD2268WA STD355 STD355WA 229.5 10 CR </p> <p>12v 2.8kW a:89 b:46 o:30</p> <p>ALIS CHALMERS HYSTER, NEW HOLLAND MASSEY FERGUSON</p> <p>28MT DR 1998340 DR 10461463 CG 112268</p>	<p>STD2269</p>  <p>STD2269WA 345 12 CR </p> <p>24v 4kW a:89 b:47 o:30</p> <p>LISTER Marine</p> <p>28MT DR 10479600 DR 10479600 CG 112269</p>	<p>STD2369</p>  <p>STD2369WA 401 10 CR </p> <p>24v 4.5kW a:89 b:46 o:30</p> <p>CASE Agricultural 800 Series</p> <p>37MT CU 3675116 DR 10479108 CG 112169</p>
<p>STD2370</p>  <p>STD2370WA 232.25 9 CR </p> <p>12v 1.2kW a:82.5 b:35 o:22</p> <p>VOLVO 340, 360 740, 940</p> <p>B19A, B230E, B230FK B200F, B200K, B230FB B19E, B230FD, B234F VO 1357373 DR DRS0650 HC JS370</p>	<p>STD2436</p>  <p>STD2436WA 506 12 CR </p> <p>12v 7.5kW a:92 b:46 o:30</p> <p>CATERPILLAR CLARK MACK Trucks US Fork Lift</p> <p>42MT FO E6HZ11002A DR 10461046 HC US1025</p>	<p>STD2546</p>  <p>STD2546WA 205.6 9 ACR </p> <p>12v 0.6kW a:63 b:8 o:20</p> <p>JOHN DEERE Agricultural machine</p> <p>Kohler JD AM107631 DR 10455516 CG 112546</p>	<p>STD2591</p>  <p>STD2591WA 10 cr </p> <p>24v 7.8kW a:89 b:26 o:30</p> <p>DN 4280002590</p>



Starters

Delco

<p>STD2652</p>  <p>STD2652WA 338.5 10 CR</p> <p>24v 4.5kW a:89 b:46 o:30</p> <p>DETROIT Industrial Engines 28MT</p> <p>DR 10479605 DR 10461461 CG 112652</p>	<p>STD2653</p>  <p>STD2653WA 339 10 CR</p> <p>12v 2.5kW a:89 b:46 o:30</p> <p>CLARK PERKINS 28MT</p> <p>DR 10461460 DR 10479604 CG 112653</p>	<p>STD2667</p>  <p>STD2667WA 339 10 CR</p> <p>12v 2.5kW a:89 b:46 o:30</p> <p>FORD Trucks US 28MT</p> <p>DR 10479614 DR 10465150 CG 112667</p>	<p>STD2668</p>  <p>STD2668WA 338 10 CR</p> <p>12v 2.5kW a:89 b:47 o:30</p> <p>HOUGH KOMATSU Agricultural Machine Fork Lift 28MT</p> <p>DR 1113284 DR 10461483 CG 112668</p>
<p>STD2691 <i>New</i></p>  <p>10 CR</p> <p>12v a:80 b:10 o:33</p> <p>DODGE NITRO 3.8L(231) V6 JEEP WRANGLER 4.0L(241) V6</p> <p>CH 4801269AB DR 8000160 WA 6763N</p>	<p>STD2861 <i>New</i></p>  <p>10 CR</p> <p>12v a:64 b:6 o:22</p> <p>DODGE Nitro 3.7L(226) V6 JEEP Liberty</p> <p>CR 4801292AB DR 8000161 WA 6761N</p>	<p>STD2869 <i>New</i></p>  <p>STD2869WA 236 9, 11 CR</p> <p>12v 1.4kW a:68 o:20</p> <p>CHEVROLET CADILLAC PONTIAC BUICK</p> <p>VO 38505251 DR 1998314 CG 111869</p>	<p>STD2898</p>  <p>STD2898WA 263.4 9, 11 CR</p> <p>12v 1.6kW a:63 b:19.5 o:20</p> <p>CHEVROLET, BUICK PONTIAC, OLDSMOBILE Corvette, Camaro, Lumina Lesabre, Custom, Ultra Firebird, Bonneville</p> <p>Z34 DR 9000806 DR 10465066 CG 112898</p>
<p>STD2899</p>  <p>STD2899WA 212 9 CR</p> <p>12v 1.4kW a:75 b:31 o:20</p> <p>CHEVROLET PONTIAC SATURN</p> <p>PG260D LN2 L61 DR 9000856 DR 12564089 CG 112899</p>	<p>STD2900</p>  <p>STD2900WA 218 9 CR</p> <p>12v 1.4kW a:68 b:10 o:20</p> <p>BUICK CHEVROLET GMC ISUZU OLDSMOBILE</p> <p>PG260F1 DR 9000868 DR 10465384 CG 112900</p>	<p>STD2901</p>  <p>STD2901WA 11 CR</p> <p>12v 1.5kW a:68 b:9 o:20</p> <p>BUICK CHEVROLET OLDSMOBILE PONTIAC</p> <p>PG260F2 DR 10465421 DR 12563718 CG 112901</p>	<p>STD2902</p>  <p>STD2902WA 214 9, 11 CR</p> <p>12v 1.2kW a:67 b:10 o:20</p> <p>BUICK CADILLAC CHEVROLET GMC</p> <p>PG260F2 GM 12578050 DR 10465463 CG 112902</p>

Starters

Delco

<p>STD2903 <i>New</i></p>  <p>11 CR </p> <p>12v a:67 b:4 o:20</p> <p>BUICK CHEVROLET PONTIAC</p> <p>GM 12574983 DE 10465525</p>	<p>STD2904</p> <p>STD2904WA</p>  <p>242.5 9 CR </p> <p>12v 1.7kW a:82.5 b:32 o:20</p> <p>CADILLAC Deville Concours Eldorado</p> <p>DR 12563919 DR 10465294 CG 112904</p>	<p>STD2905</p> <p>STD2905WA</p>  <p>232 11 CR </p> <p>12v 1.6kW a:82.5 b:29.5 o:20</p> <p>CHEVROLET, BUICK, GMC LT Trucks, Trailblazer Raider Envoy</p> <p>DR 9000875 DR 9000926 CG 112905</p>	<p>STD2906 <i>New</i></p>  <p>246 11 CR </p> <p>12v 1.7kW a:67.5 b:19 o:20</p> <p>CADILLAC, CHEVROLET 5.7L(350) V8 GMC, PONTIAC 6.0L(364) V8 C / K / R / V SERIES PICKUPS Escalade, Firebird GM 91014475 Camaro, Corvette DR 10465385 CG 112906</p>
<p>STD2912</p> <p>STD2912WA</p>  <p>268 9 CR </p> <p>12v 1.6kW a:65.5 b:9 o:20</p> <p>CHEVROLET, GMC LT Truck Suburban</p> <p>DR 10455065 DR 10465389 CG 112912</p>	<p>STD3007</p> <p>STD3007WA</p>  <p>339 10 CR </p> <p>24v 4kW a:83 b:33 o:20</p> <p>JOHN DEERE Industrials Agricultural machinr</p> <p>JD RE51725 DR 10461444 CG 113007</p>	<p>STD3010</p> <p>STD3010WA</p>  <p>10 CR </p> <p>24v 4kW a:89 b:44 o:30</p> <p>LISTER Industrial Engines</p> <p>DR 10479608 DR 10461464 CG 113010</p>	<p>STD3011</p> <p>STD3011WA</p>  <p>339 10 CR </p> <p>12v 2.8kW a:83 b:33 o:20</p> <p>JOHN DEERE 28MT</p> <p>DR 10479628 DR 10461471 CG 113011</p>
<p>STD3123</p> <p>STD3123WA</p>  <p>403 10 CR </p> <p>12v a:92 b:47 o:30</p> <p>CHEVROLET US 37MT GMC US 41MT FORD US Detroit Diesel Engines Medium&Heavy Duty Trucks DR 1993738 DR 1990308 CG 113123</p>	<p>STD3124</p> <p>STD3124WA</p>  <p>10 CR </p> <p>12v 3.2kW a:91 b:60 o:30</p> <p>CATERPILLAR 3046 CUMMINS 3204 INTERNATIONAL B Series DR 10461069 DR 10461108 CG 113124</p>	<p>STD3125</p> <p>STD3125WA</p>  <p>401 10 CR </p> <p>12v a:92 b:48.5 o:30</p> <p>FORD Agricultural machine Heavy Duty Trucks DR 10461006 DR 10461011 CG 113125</p>	<p>STD3126</p> <p>STD3126WA</p>  <p>434 10 CR </p> <p>12v a:89 b:46.5 o:30</p> <p>FORD Truck US CHEVROLET Truck US CATERPILLAR Industrial Engines DR 10461081 DR 10478806 CG 113126</p>

Starters

Delco

<p>STD3153</p>  <p>STD3153WA 11 CR </p> <p>12v 7.5kW a:92 b:45.5 o:30</p> <p>FREIGHTLINER 42MT FL FL112 FL120 FLC FLC112 FLC120 DR 10461028 DR 10479082 CG 113153</p>	<p>STD3435</p>  <p>STD3435WA 337 10 CR </p> <p>24v 4.5kW a:82 b:8 o:20</p> <p>HUMMER 28MT Hummer 6.5l Diesel MILITARY EQUIPMENT DR 10479611 DR 10461453 CG 113435</p>	<p>STD3452</p>  <p>STD3452WA 339 10 CR </p> <p>12v 2.5kW a:89 b:43 o:30</p> <p>AGCO WHITE Cummins 5.9L Tractors Cummins 6359 CHAMPION Graders CU 3604654 DR 10461466 CG 113452</p>	<p>STD3604</p>  <p>STD3604WA 340 12 CR </p> <p>12v 2.8kW a:89 b:46.5 o:30</p> <p>ALLIS CHALMERS 22MT PERKINS 27MT Agricultural Machine 28MT Industrial Engines DR 10465048 DR 10461448 CG 110604</p>
<p>STD3682</p>  <p>STD3682WA 307 10 CR </p> <p>12v 3.3kW a:89 b:47 o:30</p> <p>FREIGHTLINER 29MT FORD STERLING Trucks US DR 8200010 DR 10461770 CG 113682</p>	<p>STD3695</p>  <p>STD3695WA 433.5 12 CR </p> <p>24v 6kW a:89 b:47 o:30</p> <p>CATERPILLAR 37MT Agricultural machine Industrial Engine Excavators 325 LN CT 0R2735 LIAZ with cat 3116 DR 10461405 CG 113695</p>	<p>STD3826</p>  <p>STD3826WA 10 CR </p> <p>12v 4.6kW a:88 b:47.5</p> <p>FORD Cummins FREIGHTLINER KENWORTH Medium&Heavy Duty Trucks DR 8200076 DR 8300021 CG 113826</p>	<p>STD3827</p>  <p>STD3827WA 406 12 CR </p> <p>24v 7.6kW a:92 b:47 o:30</p> <p>CUMMINS Industrial Engine DR 19026030 DR 19026026 CG 113827</p>
<p>STD3883</p>  <p>STD3883 12 CR </p> <p>12v 5kW a:89 b:42 o:30</p> <p>INTERNATIONAL 37MT WAUKESHA PT M105R2501SE DR 1993883 MH STD3883</p>	<p>STD3910</p>  <p>STD3910WA 11 ACR </p> <p>24v a:92 b:50 o:30</p> <p>40MT 42MT DR 1990210 DR 1114840 WA 3288N</p>	<p>STD3912</p>  <p>STD3912WA 11 ACR </p> <p>12v a:92 b:49 o:30</p> <p>US Trucks 40MT DR 1114097 DR 1990212 WA 3290N</p>	<p>STD3916</p>  <p>STD3916WA 413 11 CR </p> <p>12v a:92 b:47 o:30</p> <p>KENWORTH 39MT PETERBILT DR 8200104 DR 8200090 CG 113916</p>


Starters

Delco

<p>STD3917</p>  <p>STD3917WA 414.5 12 CR</p> <p>12v 4kW a:92 b:47 o:30</p> <p>FREIGHTLINER WESTERN STAR STERLING Trucks US</p> <p>Mercedes MBE4000</p> <p>DR 10461773 DR 19011514 CG 113917</p>	<p>STD3920</p>  <p>STD3920WA 13 CR</p> <p>24v 7.0kW a:92 b:47</p> <p>GROVE MFG Granes</p> <p>40 MT DDAD 6V53N</p> <p>DR 1114921 DR 1114865 WA 3945N</p>	<p>STD4012</p>  <p>STD4012WA 12, 13 CR</p> <p>12v a:92 b:47 o:30</p> <p>Industrial Machine Trucks</p> <p>37MT</p> <p>DR 10461013 DR 1993873 WA 6444N</p>	<p>STD4013</p>  <p>STD4013WA 419 12 CR</p> <p>24v 8.3kW a:92 b:48 o:30</p> <p>CUMMINS MITSUBISHI SCANIA VOLVO</p> <p>38MT 39MT</p> <p>SC 571468 DR 10461758 VO 85000295</p>
<p>STD4023</p>  <p>STD4023WA 11 ACR</p> <p>12v a:92 b:48 o:30</p> <p>Industrial Trucks</p> <p>42MT</p> <p>DR 1990395 DR 10461023 WA 6261N</p>	<p>STD4027</p>  <p>STD4027WA 11 ACR</p> <p>24v a:91 b:47 o:30</p> <p>Industrial Machines Trucks</p> <p>42MT</p> <p>DR 1990436 DR 10461027 WA 6263N</p>	<p>STD4035</p>  <p>STD4035WA 11 CR</p> <p>12v 4.6kW a:87 b:46 o:30</p> <p>FREIGHTLINER MERCEDES-BENZ STERLING Medium&Heavy-Duty Trucks FL50, FL60, FL70, FL80</p> <p>38MT MBE900</p> <p>DR 19026035 DR 8200075 WA 6831N</p>	<p>STD4036</p>  <p>STD4036WA 10 CR</p> <p>12v 5kW a:89 b:49 o:30</p> <p>FORD Heavy Duty Diesel Trucks School Buses</p> <p>37MT Cummins FD1460</p> <p>DR 10479036 DR 10478953 WA 6464N</p>
<p>STD4039 <i>New</i></p>  <p>STD4039WA 9 CR</p> <p>12v 1.7kW a:81 b:20 o:21</p> <p>DAEWOO GM</p> <p>DR 96294039 MH STD4039</p>	<p>STD4049</p>  <p>STD4049WA 9 CR</p> <p>12v</p> <p>BUICK OLDSMOBILE PONTIAC CHEVROLET</p> <p>DR 10455049 DR 10465102 WA 6413N</p>	<p>STD4094</p>  <p>STD4094WA 10 CR</p> <p>12v 5.0kW a:88 b:47.5</p> <p>CHEVROLET GMC FORD Topkick Kodiak</p> <p>37MT</p> <p>DR 10461094 DR 1993947 WA 6504N</p>	<p>STD4132</p>  <p>STD4132WA 438 12 CR</p> <p>12v a:92 b:47 o:30</p> <p>KENWORTH PETERBILT STERLING</p> <p>Cummins 41MT</p> <p>DR 1993969 DR 10478999 CG 114132</p>






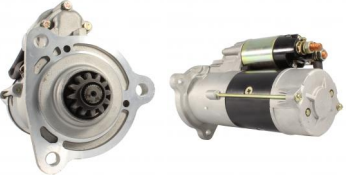








Starters

Delco

<p>STD4179</p>  <p>11 CR </p> <p>24v 4.5kW a:89 b:40</p> <p>YUCHAI Diesel Engines</p> <p>YC4108ZC YC4108CA YC4108</p> <p>UP STR7179</p>	<p>STD4181</p>  <p>STD4181WA 11 CR </p> <p>12v a:92 b:54 o:30</p> <p>41MT</p> <p>DR 10461181 DR 10479023 WA 6631N</p>	<p>STD4185</p>  <p>STD4185WA 12 CR </p> <p>12v 7.2kW a:92 b:42.5</p> <p>VOLVO Trucks D12</p> <p>39MT</p> <p>DR 8200186 DR 8300004 WA 6914N</p>	<p>STD4198</p>  <p>12 cr </p> <p>24v 7.5kW a:88 b:47.5 o:30</p> <p>CATERPILLAR ENG. 41MT</p> <p>CT 2071516 DR 10479197 NR 019197</p>
<p>STD4210</p>  <p>STD4210WA 11 CR </p> <p>12v 1.7kW a:82 b:29 o:20</p> <p>CHEVROLET, ISUZU, SAABPG260H Colorado, Canyon Ascender, I-290 9-7X HUMMER H3</p> <p>GM 19168039 DR 8000210 WA 6934N</p>	<p>STD4240</p>  <p>STD4240WA 12 CR </p> <p>24v 7.5kW a:92 b:60 o:30</p> <p>ATLAS COPCO CATERPILLAR Wheel Loaders</p> <p>41MT Caterpillar 3116 Cummins C8.3 DR 10461239 DR 10478817 WA 6634N</p>	<p>STD4322</p>  <p>STD4322WA 12 CR </p> <p>24v 8.3kW a:92 b:47 o:30</p> <p>CUMMINS</p> <p>6CT</p> <p>CU C3415325</p> <p>UP STR4395</p>	<p>STD4325</p>  <p>405 10 CR </p> <p>12v 4.6kW a:89 b:47 o:30</p> <p>CUMMINS Engines</p> <p>QSB QSC</p> <p>DR 8300024 DR 8200023 CG 114325</p>
<p>STD4326</p>  <p>STD4326WA 10 CR </p> <p>24v 7.5kW a:89 b:47 o:30</p> <p>CUMMINS Industrial Engines</p> <p>Cummins 38MT</p> <p>CU 3965282 DR 19026032 CG 114326</p>	<p>STD4330</p>  <p>STD4330WA 11 CR </p> <p>24v 7.5kW a:92 b:47 o:30</p> <p>CUMMINS Industrial Engines</p> <p>Cummins 39MT</p> <p>CU 3103914 DR 19011523 CG 114330</p>	<p>STD4334</p>  <p>STD4334WA 11 CR </p> <p>24v 8.3kW a:92 b:47 o:30</p> <p>CUMMINS Industrial Engines</p> <p>ISM 11.0L ISX 15.0L</p> <p>Cummins 39MT</p> <p>CU 3103305 DR 19011507 CG 114330</p>	<p>STD4397</p>  <p>12 CR </p> <p>12v a:91 b:48 o:30</p> <p>CATERPILLAR FREIGHTLINER VOLVO Trucks US Marine</p> <p>42MT Cummins 8.3L, 8.9L Caterpillar 3306 CT 3T2661 DR 10461078 WA 6516N</p>

Starters

Delco

<p>STD4402</p>  <p>STD4402WA 10 CR </p> <p>12v 3.3kW a:87 b:45 o:30</p> <p>FORD 29MT FREIGHTLINER Cummins FD1060 STERLING Medium&Heavy-Duty Trucks DR 8200067 DR 19011402 WA 6841N</p>	<p>STD4403</p>  <p>STD4403WA 9 CR </p> <p>12v 2.2kW a:89 b:47 o:30</p> <p>FREIGHTLINER 29MT Mercedes Engine DR 8200103 DR 19011403 NR 0111403</p>	<p>STD4415</p>  <p>STD4415WA 10 CR </p> <p>12v 4kW a:89 b:47.5 o:30</p> <p>CLARK, FORD 37MT Trucks Perkins Agricultural DR 10461416 DR 10461003 WA 6382N</p>	<p>STD4416</p>  <p>STD4416WA 448 11 CR </p> <p>24v 7.5kW a:92 b:47.5 o:30</p> <p>MACK CH Series CL Series DM Series DR 10461362 DR 10479067 CG 114416</p>
<p>STD4504</p>  <p>STD4504WA 12 CR </p> <p>12v 5.5kW a:91 b:45 o:30</p> <p>CLAAS 39MT MERCEDES-BENZ Trucks US MB 0051511001 DR 19011504 NR 0111504</p>	<p>STD4512</p>  <p>STD4512WA 12 CR </p> <p>24v 7.5kW a:90 b:42 o:30</p> <p>CUMMINS Cummins 39MT CU 3102763 DR 19011512 NR 015012</p>	<p>STD4606</p>  <p>STD4606WA 10 CR </p> <p>12v 3.3kW a:88 b:50 o:30</p> <p>INTERNATIONAL TRUCKS 29MT CUMMINS ISB DR 19011409 DR 10461765 CG 114606</p>	<p>STD4630</p>  <p>STD4630WA 12 CR </p> <p>12v a:91 b:49 o:30</p> <p>FREIGHTLINER 42MT VOLVO Trucks US FO F6HZ11002DA DR 1990451 CG 114630</p>
<p>STD4631</p>  <p>STD4631WA 12 CR </p> <p>24v 7.5kW a:91 b:50 o:30</p> <p>Trucks 42MT Cummins DR 10461410 DR 10479022 CG 114631</p>	<p>STD4636</p>  <p>STD4636WA 9 CR </p> <p>12v 3kW a:88 b:45 o:30</p> <p>FREIGHTLINER 28MT MERCEDES MB 0051511201 DR 10479648 CG 114636</p>	<p>STD4650</p>  <p>STD4650WA 10 CR </p> <p>12v 3.3kW a:89 b:48 o:30</p> <p>INTERNATIONAL 29MT Buses US 6.0L Diesel Engines Trucks US IHC VT-365 DR 19011404 DR 19011407 CG 114650</p>	<p>STD4802 <i>New</i></p>  <p>STD4802 9 CR </p> <p>12v a:82 b:23 o:30</p> <p>OPEL VAUXHALL OP 4802243 GM 25183761 DR DRS0827</p>

Starters

Delco

<p>STD4805 <i>New</i></p> <p>STD4805WA</p>  <p>11 CR </p> <p>24v 4.8kW a:92 b:49 o:30</p> <p>BIZON STAR</p> <p>BO 0001364001 DR 19024805</p>	<p>STD4818</p> <p>STD4818WA</p>  <p>12 CR </p> <p>12v a:92 b:46 o:30</p> <p>CUMMINS</p> <p>Cummins 41MT</p> <p>DR 10478818 DR 10479109 WA 6630N</p>	<p>STD4890</p> <p>STD4890WA</p>  <p>10 CR </p> <p>12v a:92 b:50 o:30</p> <p>INTERNATIONAL NAVISTAR Trucks</p> <p>37MT T444E 7.3L DR 10478890 DR 10461170 WA 6297N</p>	<p>STD4971</p> <p>STD4971WA</p>  <p>10 CR </p> <p>12v a:92 b:45.5 o:30</p> <p>INTERNATIONAL IHC 3000-3900 IHC 4000-4900</p> <p>37MT</p> <p>7.3L DR 1993971 WA 6295N</p>
<p>STD4997</p> <p>STD4997WA</p>  <p>12 CR </p> <p>12v a:91 b:53 o:30</p> <p>FREIGHTLINER INTERNATIONAL PETERBILT STERLING Medium&Heavy Duty Trucks</p> <p>37MT Cummins 8.3L IHC DT 360/408/466 DR 1993997 DR 10461387 WA 6394N</p>	<p>STD5008 <i>New</i></p>  <p>9 CR </p> <p>12v 0.9kW a:65 b:20 o:20</p> <p>CADILLAC</p> <p>5MT</p> <p>CM 1109546 DR 10455008 WA 6426N</p>	<p>STD6603 <i>New</i></p>  <p>11 CR </p> <p>24v 6kW a:89 b:49 o:30</p> <p>DAEWOO Solar 340 NLC-V</p> <p>DE12TIS</p> <p>DA 652017070D DR 500284 MH ALD6603</p>	<p>STD7093</p>  <p>11 CR </p> <p>24v 4.5kW a:105 b:45 o:30</p> <p>DAEWOO DOOSAN</p> <p>DA 968436577 DR 8200222 NR 017075</p>
<p>STD7108 <i>New</i></p>  <p>11 CR </p> <p>12v 1.5kW a:61 b:-9 o:20</p> <p>CHEVROLET GMC ISUZU OLDSMOBILE</p> <p>GM 12563176 DE 9000871</p>	<p>STD8296 <i>New</i></p> <p>STD8296WA</p>  <p>11 CR </p> <p>24v a:87 b:45 o:30</p> <p>29 MT</p> <p>MB A3761510301 DR 8200296 MH STD8296</p>		
























Starters

Denso

<p>STN0045</p>  <p>STN0045WA 10 CR </p> <p>12v 2.5kW</p> <p>CATERPILLAR</p> <p>CT 1430538 ND 2280001350 NR 010539</p>	<p>STN0046</p>  <p>STN0046WA 227 CR </p> <p>12v 1.2kW a:54 o:30</p> <p>HARLEY DAVIDSON Motorcycles Various Models</p> <p>HD 3155394 ND 2280002552 CG 111839</p>	<p>STN0047</p>  <p>STN0047WA 188 CR </p> <p>12v 1.2kW a:55 o:30</p> <p>HARLEY DAVIDSON Motorcycles Various Models</p> <p>HD 3155390 ND 1280008221 CG 111845</p>	<p>STN0048</p>  <p>STN0048WA 204 14 ACR </p> <p>12v 0.5kW a:65 b:9 o:22</p> <p>HONDA GX 0.5L Industrial Engines</p> <p>HO 31210ZE3013 ND 1280002750 CG 113231</p>
<p>STN0049</p>  <p>STN0049WA 180 9 ACR </p> <p>12v 0.6kW a:70 b:19 o:22</p> <p>JOHN DEERE, KAWASAKI KUBOTA Various Models Engine</p> <p>KW 211632073 ND 1280004020 CG 113596</p>	<p>STN0050</p>  <p>STN0050 205 9 CR </p> <p>12v 1kW a:66 b:18 o:20</p> <p>KUBOTA Front Mower</p> <p>F2260 F2560</p> <p>KU 1685363011 ND 2280005401 CG 114485</p>	<p>STN0051</p>  <p>STN0051 9 ACR </p> <p>12v 0.7kW a:75 b:18 o:22</p> <p>JOHN DEERE KUBOTA KAWASAKI Tractors Mowers</p> <p>17hp Engines</p> <p>KW 211632093 ND 1280007940 WA 18048N</p>	<p>STN0052</p>  <p>STN0052 10 CR </p> <p>12v 2.7kW</p> <p>HYSTER Perkins Lift Series Engines</p> <p>WL 91295430 ND 2280005210 WA 18560N</p>
<p>STN0053</p>  <p>STN0053WA 8 CR </p> <p>12v</p> <p>LYNX, SKI-DOO Adventure, Ranger Sport Touring, Yeti 600 Expedition, Grand Touring Snowmobiles</p> <p>BB 515175562 ND 4280001101 WA 18875N</p>	<p>STN0054</p>  <p>STN0054WA 9 CR </p> <p>12v 1.4kW a:74 b:21 o:22</p> <p>LEXUS GS300 IS300</p> <p>TO 2810046220 ND 2280007030 WA 17747N</p>	<p>STN0055</p>  <p>STN0055WA 9 CR </p> <p>12v 2kW</p> <p>LEXUS, TOYOTA LX570 Landcruiser Sequoia Tundra</p> <p>TO 281000S010 ND 4280004640 WA 19045N</p>	<p>STN0056</p>  <p>STN0056WA 10 CR </p> <p>12v 1.6kW a:64 b:23 o:22</p> <p>TOYOTA 4 Runner Tundra</p> <p>TO 2810031040 ND 4280001240 WA 17946N</p>










Starters

Denso

STN0057	STN0058	STN0059	STN0060
 <p>STN0057WA 10 CR </p>	 <p>STN0058 8 CR </p>	 <p>STN0059 9 CR </p>	 <p>STN0060 9 ACR </p>
<p>24v 5.5kW a:78 b:45 o:30</p> <p>CASE, SAMSUNG Excavators Crawler Tractors Crawler Dozer Wheel Loaders</p> <p>CU 3924466 ND 1280002560 WA 17391N</p>	<p>12v 0.8kW a:74 b:26 o:20</p> <p>TOYOTA Hiace 1.6L IQ 1.0L</p> <p>1KR-FE 12R</p> <p>ND 4280006120 MH STN0058</p>	<p>12v 0.8kW a:74 b:20 o:22</p> <p>TOYOTA, DAIHATSU Carina Celica Corolla LiteAce</p> <p>TO 2810027070 ND 0280007331 HC JS368</p>	<p>12v 1.4kW a:74 b:20.5 o:20</p> <p>DAIHATSU Charade Mk II 1.0L Charade Mk III 1.0L</p> <p>Diesel</p> <p>TO 2810087713 ND 1280002210 HC JS386</p>
STN0061	STN0096	STN0105	STN0125
 <p>STN0061 296 11 CR </p>	 <p>STN0096WA 220 10 CR </p>	 <p>STN0105WA 11 ACR </p>	 <p>STN0125 9 CR </p>
<p>12v 2.5kW a:81.5 b:21 o:22</p> <p>DAIHATSU Taft Rocky Wildcat</p> <p>DG, DL51 DL, DL52 DL50 DH 2810087601000 ND 0280006291 HC JS521</p>	<p>12v 1.4kW a:72.5 b:23 o:20</p> <p>DODGE Ram B Series Vans Dakota</p> <p>V8 V6</p> <p>CH 56027702 ND 2280003393 CG 113116</p>	<p>12v 4kW a:102 b:45 o:20</p> <p>CHEVROLET GMC ISUZU</p> <p>4HE1 4BD2 NPR, NQR IZ 8971477780 DN 2280008180 NR 017783</p>	<p>12v 0.7kW a:70 b:32 o:21</p> <p>HONDA</p> <p>HO 31200RSHE01 DN 4280003460 HC CS1489</p>
STN0154	STN0157	STN0159	STN0161
 <p>STN0154 8,9 CR </p>	 <p>STN0157 206.5 9 CR </p>	 <p>STN0159 9 ACR </p>	 <p>STN0161 9 ACR </p>
<p>12v 0.8kW a:74 b:4 o:22</p> <p>DAIHATSU Charade Feroza Gran Move</p> <p>TO 2810087606 DN 1280006750 HC JS1086</p>	<p>12v 1kW a:74 b:19.5 o:20</p> <p>MAZDA E Various Models</p> <p>NA</p> <p>FO D97Z11002A ND 028000665 HC JS320</p>	<p>12v 0.8kW a:82.5 b:34 o:20</p> <p>SUBARU</p> <p>SB 429917000 ND 0280009080 HC JS348</p>	<p>12v 0.6kW a:82.5 b:33 o:20</p> <p>SUBARU, SUZUKI Alto</p> <p>SZ 3110078010 ND 0280004271 HC JS372</p>













Starters

Denso

<p>STN0163</p>  <p>9 CR</p> <p>12v 1.4kW a:74 o:22</p> <p>TOYOTA Camry Celica</p> <p>TO 2810063040 ND 0280008391 HC JS391</p>	<p>STN0165</p>  <p>9 CR</p> <p>12v 2kW a:78 b:24 o:20</p> <p>LAYLAND SHERPA II</p> <p>ND 1280004391 HC JS641</p>	<p>STN0166</p>  <p>211 9 ACR</p> <p>12v 1.6kW a:75 b:40 o:20</p> <p>HONDA, ROVER Legend 800</p> <p>C25A1 C27A1 C25A2 HO 31200PH7661 ND 1280002830 HC JS653</p>	<p>STN0167</p>  <p>212 9 CR</p> <p>12v 1.4kW a:66 b:18 o:20</p> <p>KUBOTA, PETER Engine</p> <p>ZB600</p> <p>KU 1921563011 ND 1280004900 HC JS676</p>
<p>STN0173</p>  <p>211 15 CR</p> <p>12v 1.4kW a:55 b:30 o:21</p> <p>THERMO KING Super II</p> <p>YA 17102277010 ND 128000072 HC JS732</p>	<p>STN0174</p>  <p>9 CR</p> <p>12v 1.4kW a:74 b:10 o:30</p> <p>CATERPILLAR Lift Trucks</p> <p>T40D, TC60D T45D, V30D T55D, V45D CT 6T7002 ND 1280000591 HC JS899</p>	<p>STN0215 <i>New</i></p>  <p>STN0215WA</p> <p>9 ACR</p> <p>12v 0.7kW a:66 b:17 o:20</p> <p>JOHN DEERE KAWASAKI</p> <p>KAWASAKI 23HP 617 cc</p> <p>KW 211632114 ND 2280002210 CG 113663</p>	<p>STN0218 <i>New</i></p>  <p>9 CR</p> <p>12v 1.0kW a:74 b:20 o:20</p> <p>TOYOTA Crown Supra</p> <p>5ME 7GE 7GTE</p> <p>TO 2810041060 ND 0280007620 HC JS659</p>
<p>STN0228 <i>New</i></p>  <p>STN0228RB</p> <p>8 CR</p> <p>12v 0.7kW a:69 b:2 o:21</p> <p>SUBARU</p> <p>SU 23300KA350 ND 1280007580 WA 31345R</p>	<p>STN0244 <i>New</i></p>  <p>13 ACR</p> <p>12v 1.3kW a:59 b:67 o:20</p> <p>TOYOTA Rav4 III 2.0l</p> <p>1AZFE</p> <p>TO 2810028080 TO 2810028081 DN DSN977</p>	<p>STN0284 <i>New</i></p>  <p>9 CR</p> <p>12v</p> <p>LEXUS GS460 LS460</p> <p>4.6L V8 5.0L V8</p> <p>TO 2810038020 ND 4280003980 WA 19044R</p>	<p>STN0312</p>  <p>9 CR</p> <p>12v 1kW a:74 b:21.2 o:22</p> <p>TOYOTA Corolla</p> <p>TO 2810027030 ND 0280007321 HC JS312</p>
























Starters

Denso

<p>STN0334</p>  <p>12v 0.8kW a:74 b:19 o:21</p> <p>DAIHATSU TOYOTA</p> <p>TO 2810025010 ND 0280003051 HC JS331</p>	<p>STN0335</p>  <p>12v 0.9kW a:74 b:20 o:20</p> <p>TOYOTA Celica 2.0 Corona</p> <p>RA40 RA6, 3RC, 18RC RT104, RX12, R20 TO 2810020540 ND 0280002660 HC JS335</p>	<p>STN0381</p>  <p>12v 0.8kW a:74 b:9 o:22</p> <p>TOYOTA</p> <p>TO 2810015140 ND 0280007981 HC JS381</p>	<p>STN0382</p>  <p>12v 1kW a:74 b:8.5 o:22</p> <p>TOYOTA Camry Celica</p> <p>TO 2810063020 ND 0280008060 HC JS382</p>
<p>STN0385</p>  <p>12v 1kW a:74 b:18 o:22</p> <p>DAIHATSU TOYOTA, VW Taro Dyna Hiace</p> <p>STN0385WA</p> <p>181 9 CR</p> <p>2Y, 4Y 13B, 3Y 2J, 3YC TO 2810046130 ND 0280009260 HC JS385</p>	<p>STN0525</p>  <p>12v 1kW a:74 b:5.5 o:22</p> <p>TOYOTA Corolla Starlet</p> <p>2EL, 2E 2ELC 4EFE, 2E TO 2810010040 ND 1280001441 HC JS525</p>	<p>STN0527</p>  <p>12v 1.4kW a:74 b:20 o:22</p> <p>TOYOTA</p> <p>TO 2810004010 ND 0280009260 HC JS527</p>	<p>STN0534</p>  <p>12v 1.2kW a:89 b:22 o:20</p> <p>OPEL, HONDA, ISUZU Campo 2.3 Passport Piazza 2.0, Trooper 2.3</p> <p>STN0534WA</p> <p>23P, 4ZD1 4ZE1 4ZC1T, 4ZD1 IZ 8941566710 ND 1280002040 HC JS534</p>
<p>STN0552</p>  <p>12v 2kW a:95 b:20 o:20</p> <p>CHEVROLET ISUZU OPEL Trooper Campo</p> <p>STN0552WA</p> <p>232.5 9 CR</p> <p>4JB1 C223T C223 IZ 8944179250 ND 0280007000 HC JS552</p>	<p>STN0557</p>  <p>12v 0.8kW a:82.5 b:40 o:20</p> <p>SUBARU Justy Rex</p> <p>STN0557WA</p> <p>213.75 8, 10 ACR</p> <p>EF10, EK42 EF12 EK23 NI 23300KA010 ND 1280004430 HC JS557</p>	<p>STN0560</p>  <p>12v 1kW a:74 b:8 o:21</p> <p>GEO TOYOTA Carina Corolla</p> <p>STN0560WA</p> <p>199 9 CR</p> <p>4AF 4AF TO 2810016110 ND 1280004420 HC JS560</p>	<p>STN0563</p>  <p>12v 1kW a:74 b:8.5 o:21</p> <p>TOYOTA Corolla</p> <p>STN0563WA</p> <p>9 CR</p> <p>4AFE TO 2810016080 ND 1280005700 HC JS563</p>

























Starters

Denso

<p>STN0626</p>  <p>9 CR </p> <p>12v 1.4kW a:75 b:40 o:20</p> <p>HONDA</p> <p>HO 31200PH3006 ND 1280002600 HC JS626</p>	<p>STN0630</p> <p>STN0630WA</p>  <p>231 8 ACR </p> <p>12v 0.6kW a:82.5 b:34 o:20</p> <p>SUZUKI F8B Alto</p> <p>SZ 3110051A90 ND 1280001950 HC JS630</p>	<p>STN0631</p>  <p>8 CR </p> <p>12v 0.6kW a:74 b:5 o:22</p> <p>TOYOTA Corolla Starlet</p> <p>TO 2810010021 ND 1280003091 HC JS631</p>	<p>STN0632</p> <p>STN0632WA</p>  <p>236 13 ACR </p> <p>12v 1.4kW a:55 b:65 o:20</p> <p>TOYOTA Camry Carina Celica MR2</p> <p>3SFE, 2VZFE, 1L 3SGTE, 5SFE 3SGE, 2SELC TO 2810074020 ND 1280003480 HC JS632</p>
<p>STN0642</p> <p>STN0642WA</p>  <p>232.5 11 CR </p> <p>12v 2kW a:82.5 b:15.5 o:21</p> <p>RENAULT VI TOYOTA VW Land Cruiser Taro</p> <p>2L L 3L TO 2810054170 ND 0280007370 HC JS642</p>	<p>STN0644</p>  <p>9 CR </p> <p>12v 1kW a:74 b:8 o:22</p> <p>TOYOTA Celica 2.0</p> <p>3SGEL 3SGELC ND 1280001370 TO 2810063050 HC JS644</p>	<p>STN0645 <i>New</i></p> <p>STN0645WA</p>  <p>211.5 9 CR </p> <p>12v 1.4kW a:75 b:33.5 o:20</p> <p>HONDA Accord Civic Concerto Jazz</p> <p>H23A3, F18A3 D16A6 D15B2, L13A1, D15B2 HO 31200P01005 ND 1280002190 HC JS645</p>	<p>STN0648</p>  <p>9 CR </p> <p>12v 1kW a:75 b:40.5 o:20</p> <p>HONDA ROVER Accord 618</p> <p>F18A3, F20Z2 F20A2, F20Z1 F20B3, H23A3 HO 31200P45G01 ND 2280006680 HC JS648</p>
<p>STN0652</p>  <p>226 13 ACR </p> <p>12v 1kW a:55 b:66 o:20</p> <p>TOYOTA Camry Carina</p> <p>3SFE 3SGTE 3VZFE TO 2810074060 ND 1280003471 HC JS652</p>	<p>STN0656</p> <p>STN0656WA</p>  <p>11 CR </p> <p>24v 4.5kW a:105 b:14.5 o:21</p> <p>TOYOTA Dyna</p> <p>TO 2810056011 ND 0280005530 HC JS656</p>	<p>STN0657</p> <p>STN0657WA</p>  <p>203 9 CR </p> <p>12v 1kW a:74 b:3.5 o:21</p> <p>DAIHATSU Applause Charade</p> <p>HDE, HD HCE, HC HEE TO 2810087731 ND 1280006240 HC JS657</p>	<p>STN0661</p>  <p>231.55 8 ACR </p> <p>12v 0.8kW a:74 b:31 o:20</p> <p>DAIHATSU Charade Cuore</p> <p>CB22, CB60, CB20 ED10, ED20, ED10K DH 2810087214 ND 0280009501 HC JS661</p>


Starters

Denso

<p>STN0664</p>  <p>STN0664WA 11 ACR </p> <p>12v 2kW a:75 b:39 o:20</p> <p>ROVER XUD7TE 218 BB 418 Montego 2.0 TD</p> <p>RO ADU7457 ND 1280001181 HC JS664</p>	<p>STN0665</p>  <p>9 ACR </p> <p>12v 1kW a:60 b:49 o:20</p> <p>DAIHATSU Charade</p> <p>TO 2810087719 ND 1280003381 HC JS665</p>	<p>STN0666</p>  <p>STN0666WA 296 11 CR </p> <p>24v 4.5kW a:105 b:17 o:20</p> <p>TOYOTA 2H Land Cruiser 12HT</p> <p>TO 2810031625 ND 0280005890 HC JS666</p>	<p>STN0669</p>  <p>189.3 9 CR </p> <p>12v 1.4kW a:74 b:20 o:20</p> <p>TOYOTA 22RE, 22R Hilux 2.4 Land Cruiser 2.4</p> <p>TO 2810034042 ND 0280005820 HC JS669</p>
<p>STN0673</p>  <p>STN0673WA 188 9 CR </p> <p>12v 0.8kW a:66 b:16 o:20</p> <p>KUBOTA SUZUKI LJ SJ</p> <p>F8A, F10A</p> <p>KU 1609761361 ND 0280002151 HC JS673</p>	<p>STN0675</p>  <p>9 CR </p> <p>12v 1kW a:82 b:25 o:20</p> <p>KUBOTA</p> <p>KU 1550163011 ND 0280008430 HC JS675</p>	<p>STN0678</p>  <p>9 CR </p> <p>12v 1.4kW a:82 b:25 o:20</p> <p>KUBOTA PETER</p> <p>KUBOTA Engines CT4114TV CT4134, CT4134TV KU 1666163013 ND 2280000662 HC JS678</p>	<p>STN0730</p>  <p>199.5 9 CR </p> <p>12v 1kW a:66 b:18 o:20</p> <p>KUBOTA, Universal Industrial Engine Tractors Excavators Mowers</p> <p>DM1102 D722, D722EBH V1200A, V12005B KU 1550463011 ND 0280008320 HC JS730</p>
<p>STN0731</p>  <p>STN0731WA 15 CR </p> <p>12v 1.4kW a:95 b:19 o:20</p> <p>THERMO KING YANMAR</p> <p>4JH YANMAR Engines 366, 374, 388, 395, 3T80 YA 12477277020 ND 1280000710 HC JS731</p>	<p>STN0733</p>  <p>STN0733WA 295 11 CR </p> <p>24v 4.5kW a:90 b:15.5 o:20</p> <p>TOYOTA Fork Lift Lift Trucks</p> <p>5FD 1Z, 11Z, 12Z 2J, 2JT TO 2810022060 ND 0280005860 HC JS733</p>	<p>STN0734</p>  <p>STN0734WA 188 9 CR </p> <p>12v 1.4kW a:82.5 b:25 o:20</p> <p>KUBOTA BOBCAT Industrial Engine</p> <p>D1302 V1502 D1402 KU 1546163014 ND 0280004200 HC JS734</p>	<p>STN0735</p>  <p>10 CR </p> <p>12v 2.5kW a:89 b:24 o:30</p> <p>CATERPILLAR</p> <p>CT 6T7001 ND 0280000960 HC JS735</p>
























Starters

Denso

<p>STN0736</p>  <p>STN0736WA 11 CR </p> <p>24v 4.5kW a:105 b:56 o:30</p> <p>TOYOTA Lift Trucks</p> <p>2D Engine</p> <p>IZ 2810077090 ND 0280005300 HC JS736</p>	<p>STN0746</p>  <p>STN0746WA STQ4621 STQ4621WA 11 CR </p> <p>24v 4.5kW a:105 b:41 o:30</p> <p>ISUZU</p> <p>6BB1 6BD1 6BF1</p> <p>IZ 1811001910 ND 0210003661 HC JS746</p>	<p>STN0757</p>  <p>188 9 ACR </p> <p>12v 1.4kW a:82.5 b:33 o:20</p> <p>SUBARU</p> <p>Legacy Baja Outback</p> <p>EJ18SPI, EJ20, EJ22 EJ18, EJ20EMPI EJ20, EJ20E NI 23300AA230 ND 1280008321 HC JS757</p>	<p>STN0760</p>  <p>201 9 CR </p> <p>12v 0.8kW a:74 b:8 o:21</p> <p>TOYOTA</p> <p>Carina Corolla MR2</p> <p>4AF, 4AFE 7AFE, 4AGZE</p> <p>TO 2810016040 ND 1280002680 HC JS760</p>
<p>STN0761</p>  <p>STN0761WA 11 CR </p> <p>24v 4.5kW a:105 b:16 o:22</p> <p>TOYOTA Industrial</p> <p>TO 2810056260 ND 1280001561 HC JS761</p>	<p>STN0764 <i>New</i></p>  <p>9 CR </p> <p>12v 1.4kW a:74 b:20 o:20</p> <p>TOYOTA Lift Trucks</p> <p>4Y 4P</p> <p>TO 281002055071 ND 1280000622 HC JS764</p>	<p>STN0765</p>  <p>9 CR </p> <p>12v 1.4kW a:74 b:33 o:20</p> <p>HONDA</p> <p>Accord Prelude</p> <p>1.8L 2.0L</p> <p>HO 31200PC66615 ND 0280009321 HC JS765</p>	<p>STN0774</p>  <p>234.5 10 CR </p> <p>12v 2.2kW a:74 b:3.5 o:22</p> <p>TOYOTA</p> <p>Carina Camry Liteace</p> <p>2CT, 1CL 2CL 2C, 1C</p> <p>TO 2810064040 ND 2280000200 HC JS774</p>
<p>STN0780</p>  <p>9 CR </p> <p>12v 2kW a:82 b:26 o:20</p> <p>KUBOTA THOMAS EQUIPMENT Loaders Skid Steers</p> <p>V2203E V2203</p> <p>KU 1542563011 ND 2280004570 HC JS780</p>	<p>STN0894</p>  <p>9 CR </p> <p>12v 1.6kW a:74 b:20 o:32</p> <p>TOYOTA</p> <p>Previa 2.4L</p> <p>2TZFE</p> <p>TO 2280002851 ND 1280008200 HC JS894</p>	<p>STN0896</p>  <p>11 CR </p> <p>12v 1.4kW a:82.5 b:25 o:20</p> <p>CARRIER TRANSICOLD KUBOTA BOBCAT NEW HOLLAND Compact Excavators</p> <p>KUBOTA Engines D1902 CT4114 KU 1982163011 ND 1280000140 HC JS896</p>	<p>STN0897</p>  <p>11 CR </p> <p>12v 1.4kW a:82.5 b:25.5 o:20</p> <p>CARRIER TRANSICOLD KUBOTA THOMAS EQUIPMENT Tractors Utility Skid Steers</p> <p>CT4114</p> <p>KU 1738163015 ND 2280001000 HC JS897</p>

Starters

Denso

<p>STN0901</p>  <p>209.8 8 ACR</p>  <p>12v 0.8kW a:64.5 b:30 o:20</p> <p>DAIHATSU CB41 Hi-Jet CD CB42 DH 2810087510 ND 1280003621 HC JS901</p>	<p>STN0906</p>  <p>STN0906WA 10 CR</p>  <p>12v 2.5kW a:89 b:47.5 o:30</p> <p>CATERPILLAR 4JB1PK-03 Dsl R70, R80, V60F, V80F BOBCAT853 CT 8T8619 ND 2280002290 HC JS906</p>	<p>STN0908</p>  <p>209.5 9 CR</p>  <p>12v 1.4kW a:66 b:18 o:20</p> <p>TORO D850 KUBOTA BOBCAT CASE KU 1661163012 Mowers, Trenchers ND 2280000990 HC JS908</p>	<p>STN0909</p>  <p>199.45 11 CR</p>  <p>12v 1kW a:95 b:21 o:20</p> <p>JOHN DEERE 3T7A7 YANMAR MUSTANG Tractors, Mowers YA 11962077011 Skid Steer Loaders ND 1280001152 HC JS909</p>
<p>STN0910 <i>New</i></p>  <p>228 9 CR</p>  <p>12v 2.0kW a:74 b:19 o:30</p> <p>CATERPILLAR Peugeot Diesel Engine Industrial Lift Trucks CT 3T8208 ND 1280007030 HC JS910</p>	<p>STN0912</p>  <p>223.5 13 ACR</p>  <p>12v 1kW a:55 b:65 o:20</p> <p>TOYOTA 3SFE Avensis 3VZFE Camry 3SGE Carina TO 2810074250 RAV 4 ND 2280003331 HC JS912</p>	<p>STN0913</p>  <p>STN0913WA 217 13 ACR</p>  <p>12v 1.4kW a:55 b:66 o:20</p> <p>TOYOTA 5SFE Camry 3SGE Celica 3SFE Rav4 TO 2810003070 Carina ND 2280000830 HC JS913</p>	<p>STN0918</p>  <p>201 9 CR</p>  <p>12v 0.8kW a:74 b:8.5 o:21</p> <p>TOYOTA 4AF, 4AFE Carina 7AFE Corolla TO 2810016070 ND 1280004480 HC JS918</p>
<p>STN0929</p>  <p>STN0929WA 11 CR</p>  <p>12v 2.5kW a:82.5 b:35.5 o:20</p> <p>BOBCAT CLARK ATLAS COPCO XAS90 JOHN DEERE 3029 JD RE51694 CASE SPX2130 4045 ND 0280008400 HC JS929</p>	<p>STN0930</p>  <p>STN0930WA 10 CR</p>  <p>24v 5.5kW a:89 b:48.5 o:30</p> <p>CATERPILLAR Excavators Tractors Tool Carriers CT 3E5381 ND 1280005730 HC JS930</p>	<p>STN0933</p>  <p>9 CR</p>  <p>12v 0.8kW a:74 b:19.5 o:20</p> <p>KOMATSU 5FG10, 5FG14 TOYOTA 5FG15, 5FG18 Fork Lift 5FGL10, 5FGL15, 5FGL18 TO 281002380071 ND 1280008130 HC JS933</p>	<p>STN0942</p>  <p>STN0942WA 226.5 9, 10, 11 CR</p> <p>12v 1.4kW a:82 b:8 o:32</p> <p>NISSAN, PLYMOUTH VQ25DE CHRYSLER, DODGE Maxima, Caravan, Voyager New Yorker, Dynasty CH 4686045 Town & Country Van ND 1280009380 HC JS942</p>













Starters

Denso

<p>STN0943</p>  <p>9 CR </p> <p>12v 1.4kW a:55 b:17.5 o:21</p> <p>TOYOTA 3.0L 4 Runner T-100 Pickup Pickup</p> <p>TO 2810065020 ND 1280005561 HC JS943</p>	<p>STN0998</p> <p>STN0998WA</p>  <p>8 CR </p> <p>12v 0.8kW a:74 b:4 o:21</p> <p>DAIHATSU HD, HE Applause HDE, HDEP Charade HEEG Sportrak TO 2810087106 Feroza ND 1280009220 HC JS998</p>	<p>STN1005</p> <p>STN1005WA</p>  <p>237 9 CR </p> <p>12v 2.2kW a:82.5 b:21 o:22</p> <p>DAIHATSU DL Rocky D, TD DL51 DL52 TO 2810087316 ND 1280005760 HC JS1005</p>	<p>STN1012</p> <p>STN1012WA</p>  <p>13 CR </p> <p>12v 2.5kW a:89 b:47 o:30</p> <p>FORD 6.9L CASE 1835B, D188, 1845, 1845B Wheel Loaders Lift Trucks CS A39341 Crawler Tractors ND 0280005880 HC JS1012</p>
<p>STN1013</p>  <p>9 CR </p> <p>12v 2kW a:82.5 b:22 o:21</p> <p>CARRIER THERMO KING</p> <p>TK 451170 ND 1280000570 HC JS1013</p>	<p>STN1015</p> <p>STN1015WA</p>  <p>9 CR </p> <p>12v 1kW a:74 b:20 o:22</p> <p>TOYOTA 1RZ Hiace 2RZE Hilux 2RZFE Tacoma TO 2810075010 ND 2280002611 HC JS1015</p>	<p>STN1018</p> <p>STN1018RB STN1018WA</p>  <p>9 CR </p> <p>12v 1.2kW a:74 b:8 o:21</p> <p>TOYOTA 4AFE Carina 7AFE Corolla</p> <p>TO 2810016270 ND 2280000900 HC JS1018</p>	<p>STN1021</p> <p>STN1021WA</p>  <p>292 12 CR </p> <p>24v 4.5kW a:91 b:16.5 o:20</p> <p>TOYOTA 1HDT Land Cruiser 1HDFT Coaster 1HZ</p> <p>TO 2810017030 ND 1280008280 HC JS1021</p>
<p>STN1022</p>  <p>211.5 9 CR </p> <p>12v 1.4kW a:75 b:33.5 o:20</p> <p>HONDA, ROVER F20Z1, F22Z2 Accord H23A3, D15B2, D16Y8 Civic F18A3, D16A6 600 HO 31200PM3J02 ND 1280002190 HC JS1022</p>	<p>STN1023</p> <p>STN1023WA</p>  <p>9 CR </p> <p>12v 0.8kW a:74 b:5 o:22</p> <p>TOYOTA E10 Corolla EE101 Starlet 1.3 4EFE Paseo TO 2810011080 ND 2280004020 HC JS1023</p>	<p>STN1024</p>  <p>206 9 CR </p> <p>12v 1.2kW a:74 b:4.5 o:22</p> <p>TOYOTA 4EFE Corolla 5EFE Starlet Paseo</p> <p>TO 2810011100 ND 2280004320 HC JS1024</p>	<p>STN1080</p> <p>STN1080WA</p>  <p>217 13 ACR </p> <p>12v 1.4kW a:55 b:66 o:20</p> <p>TOYOTA 5SFE, 3VZFE Camry 3SGE, 3SFE Carina Picnic TO 2810074130 RAV 4 ND 2280000831 HC JS1080</p>

Starters

Denso

<p>STN1082</p>  <p>STN1082WA 212 9 CR</p> <p>12v 1.4kW a:74 b:20 o:22</p> <p>LEXUS TOYOTA SC 3.0 Supra</p> <p>2JZGE 7MGE, 7MGTE TO 2810046090 ND 1280009300 HC JS1082</p>	<p>STN1084</p>  <p>STN1084WA 189 9 CR</p> <p>12v 1.4kW a:74 b:20 o:32</p> <p>TOYOTA Previa</p> <p>2TZFE TO 2810076070 ND 1280008210 HC JS1084</p>	<p>STN1088</p>  <p>STN1088WA 234 10 CR</p> <p>12v 2.2kW a:74 b:4 o:22</p> <p>TOYOTA Carina Corolla</p> <p>1CDFTV 2C 2CT TO 2810064300 ND 2280009220 HC JS1088</p>	<p>STN1089</p>  <p>STN1089RB STN1089WA 220 10, 11 CR</p> <p>12v 2kW a:82.5 b:15 o:21</p> <p>TOYOTA Dyna Hiace Hilux</p> <p>2L 2LT 2RZE TO 2810054380 ND 2280000640 HC JS1089</p>
<p>STN1090</p>  <p>STN1090WA 305 11 CR</p> <p>12v 2.7kW a:82.5 b:15 o:21</p> <p>TOYOTA Dyna Hiace Hilux Land Cruiser</p> <p>2L 3L 2LT TO 2810054320 ND 0280006870 HC JS1090</p>	<p>STN1099</p>  <p>STN1099 9 CR</p> <p>12v 1.4kW a:55 b:17 o:21</p> <p>TOYOTA 4Runner 3.0L PickUp 3.0L</p> <p>3VZE TO 2810065090 ND 2280002750 HC JS1099</p>	<p>STN1101</p>  <p>STN1101WA 186 9 CR</p> <p>12v 1.4kW a:72 b:20 o:22</p> <p>TOYOTA Hiace Hilux</p> <p>2RZE, 1RZ 3RZFE 2RZFE TO 281000C010 ND 2280002570 HC JS1101</p>	<p>STN1103</p>  <p>STN1103WA 9 CR</p> <p>12v 1kW a:74 b:20 o:22</p> <p>TOYOTA Avensis Carina Corolla</p> <p>4AFE 4AF TO 2810042040 ND 1280007680 HC JS1103</p>
<p>STN1149</p>  <p>STN1149WA 210.5 11 ACR</p> <p>12v 1.8kW a:75 b:38.5 o:21</p> <p>HONDA MG ROVER Accord Civic</p> <p>20T2N 20T2R RO NAD100790 ND 2280004960 HC JS1149</p>	<p>STN1150</p>  <p>STN1150WA 210 9 CR</p> <p>12v 1.6kW a:75 b:40 o:20</p> <p>HONDA, ROVER Accord Prelude 600</p> <p>CC7, BB2, CB3, RH, CB7 F20Z2, H23A3 F20Z1, F18A3 HO 31200P5M004 ND 2280006680 HC JS1150</p>	<p>STN1151</p>  <p>STN1151WA 9 CR</p> <p>12v 1.4kW a:75 b:40 o:20</p> <p>HONDA Accord Prelude 2.2</p> <p>F22A3, F22B2 F22A8, F22B1 H22A2, F23A4 HO 31200POA003 ND 228000226 HC JS1151</p>	<p>STN1154</p>  <p>STN1154WA 136 10 CR</p> <p>12v 2.2kW a:82.5 b:18 o:21</p> <p>TOYOTA 4 Runner Land Cruiser</p> <p>1KZT 1KZTE 1KDFTV TO 2810030060 ND 2280001780 HC JS1154</p>













Starters

Denso
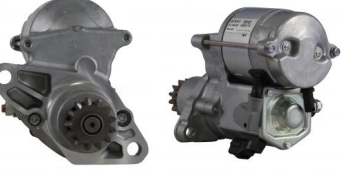
<p>STN1155</p>  <p>258 11 CR</p> <p>12v 2.7kW a:82.5 b:18 o:21</p> <p>TOYOTA Hiace Hilux Land Cruiser</p> <p>1KDFTV 1KZE 2KDFTV TO 2810067070 ND 2280005340 HC JS1155</p>	<p>STN1218</p>  <p>13 ACR</p> <p>12v 1.4kW a:55 b:66 o:20</p> <p>TOYOTA LEXUS, RX 300 Camry Previa Rav 4</p> <p>1MZFE, V20, 5SFE 2AZFE, SXV20, 5SNFE MCV20, 1AZFE TO 2810074260 ND 2280006281 HC JS1218</p>	<p>STN1220 <i>New</i></p>  <p>201 8 CR</p> <p>12v 0.8kW a:74 b:8 o:22</p> <p>DAIHATSU Terios 1.3L</p> <p>K3VE HEEJ</p> <p>DH 2810087401000 ND 2280006620 HC JS1220</p>	<p>STN1223</p>  <p>9 CR</p> <p>12v 1kW a:74 b:12 o:21</p> <p>TOYOTA Yaris 1.0L Yaris 1.3L</p> <p>CP10 SCP10</p> <p>TO 2810023030 ND 2280009530 HC JS1223</p>
<p>STN1224</p>  <p>204 9 CR</p> <p>12v 1kW a:74 b:14 o:21</p> <p>TOYOTA Yaris 1.3 Yaris 1.5L</p> <p>1NZFE 2NZFE</p> <p>TO 2810021030 ND 2280008550 HC JS1224</p>	<p>STN1228</p>  <p>11 CR</p> <p>12v 4kW a:89 b:47 o:30</p> <p>JOHN DEERE Combines Tractors</p> <p>5VZFE</p> <p>JD RE501298 ND 2280006530 HC JS1228</p>	<p>STN1229</p>  <p>11 CR</p> <p>12v 1.2kW a:74 b:5.5 o:20</p> <p>ROVER GROUP 75</p> <p>K18</p> <p>RO NAD100971 ND 2280007791 HC JS1229</p>	<p>STN1230</p>  <p>9 CR</p> <p>12v 0.8kW a:74 b:16 o:21</p> <p>TOYOTA Auris 1.4 Celica Corolla RAV 4 1.8</p> <p>4ZZFE, 3ZZFE 2ZZGE, 1ZRFE 1ZZFE</p> <p>TO 2810022030 ND 2280007581 HC JS1230</p>
<p>STN1231</p>  <p>188 9 CR</p> <p>12v 1.4kW a:55 b:17 o:22</p> <p>TOYOTA Land Cruiser 3.4l</p> <p>5VZFE</p> <p>TO 2810062040 ND 2280005290 HC JS1231</p>	<p>STN1233</p>  <p>204 9 CR</p> <p>12v 1kW a:74 b:14 o:21</p> <p>TOYOTA Yaris Verso</p> <p>2NZFE, 1NZFE</p> <p>TO 2810021021 ND 2280008550 HC JS1233</p>	<p>STN1236</p>  <p>204 11 CR</p> <p>12v 1.1kW a:74 b:16 o:21</p> <p>TOYOTA Avensis Celica Corolla RAV</p> <p>4ZZFE 1ZZFE 3ZZFE, 2ZZGE</p> <p>TO 2810022030 ND 2280007591 HC JS1236</p>	<p>STN1237</p>  <p>186 9 CR</p> <p>12v 1.4kW a:72 b:20 o:22</p> <p>TOYOTA Hiace Hilux</p> <p>2RZE 3RZFE 1RZ</p> <p>TO 2810075150 ND 2280002573 HC JS1237</p>























Starters

Denso

<p>STN1239</p>  <p>STN1239WA</p> <p>214 13, 15 CR</p> <p>12v 1.4kW a:95 b:21 o:20</p> <p>CHRYSLER, YANMAR THERMO KING JOHN DEERE</p> <p>4JH F00</p> <p>YA 11920977010 ND 1280000710 HC JS1239</p>	<p>STN1242</p>  <p>STN1242WA</p> <p>220 9 CR</p> <p>12v 2.2kW a:66 b:21 o:30</p> <p>LAND ROVER Defender Discovery</p> <p>AUB 10P</p> <p>RG NAD101240 ND 2280007220 HC CS1242</p>	<p>STN1292</p>  <p>STN1292WA</p> <p>315 10 CR</p> <p>24v 5kW a:92 b:49 o:30</p> <p>IVECO EsroStar EuroTech EuroTrakker Trakker</p> <p>WAI F3AE0681E, F3BE0681E F3AE0681B, F3AE0681D IV 42498115 ND 2280007550 HC CS1292</p>	<p>STN1299</p>  <p>STN1299WA</p> <p>187 8 CR</p> <p>12v 0.7kW a:74 b:11.5 o:21</p> <p>TOYOTA Yaris</p> <p>1SZFE 2SZFE</p> <p>TO 281000J010 ND 2280008350 HC JS1299</p>
<p>STN1302</p>  <p>STN1302WA</p> <p>217 13 ACR</p> <p>12v 1.4kW a:55 b:66 o:20</p> <p>TOYOTA LEXUS Avensis, Camry Previa, RAV 4 RX</p> <p>1AZFSE, 5SFE 1AZFE 1MZFE</p> <p>TO 2810003100 ND 2280006282 HC JS1302</p>	<p>STN1308</p>  <p>STN1308DN STN1308WA</p> <p>8 CR</p> <p>12v 1.2kW a:74 b:12 o:21</p> <p>TOYOTA Yaris</p> <p>CP10 SCP10</p> <p>TO 281000J050 ND 2280009540 HC JS1308</p>	<p>STN1310</p>  <p>STN1310WA</p> <p>8 CR</p> <p>12v 1kW a:70 b:29 o:22</p> <p>SUZUKI Grand Vitara Ignis 1.3 Swift 1.3 SX4</p> <p>M16A M13A M15A SZ 3110063J00 ND 2280008930 HC JS1310</p>	<p>STN1314</p>  <p>STN1314WA</p> <p>220 11 ACR</p> <p>12v 1.7kW a:75 b:39 o:20</p> <p>HONDA LAND ROVER ROVER Civic Freelander</p> <p>20T2N 20T2R XUD7TE RO NAD100580 ND 2280001180 HC JS1314</p>
<p>STN1320</p>  <p>STN1320WA</p> <p>15 ACR</p> <p>12v 2kW a:55 b:66 o:30</p> <p>LAND ROVER, MG, ROVER 25K4F Freelander ZT 190, ZT 160 75</p> <p>20K4F KV6 RO NAD100952 ND 2280007710 HC JS1320</p>	<p>STN1321</p>  <p>STN1321RB STN1321WA</p> <p>221 9 CR</p> <p>12v 2kW a:76 b:21 o:21</p> <p>LAND ROVER MG ROVER Freelander 75</p> <p>204D2 M47R M47 RO NAD101500 ND 2280007800 HC JS1321</p>	<p>STN1350</p>  <p>STN1350WA</p> <p>227 10 ACR</p> <p>12v 1.2kW a:75 b:39 o:20</p> <p>LAND ROVER Freelander 1.8 i 16V</p> <p>18K4F</p> <p>RO NAD101090 ND 2280006121 CG 113601</p>	<p>STN1357</p>  <p>STN1357WA</p> <p>10 CR</p> <p>12v 1.4kW a:74 b:14 o:21</p> <p>TOYOTA Yaris Yaris Verso</p> <p>NLP10 NLP22</p> <p>TO 2810033050 ND 4280000570 HC JS1357</p>


















Starters

Denso

<p>STN1358</p>  <p>STM1358RB STN1358RB STN1358WA</p> <p>222 9 CR</p>  <p>12v 2kW a:74 b:14 o:21</p> <p>MINI TOYOTA One Corolla Yaris</p> <p>1ND 1NDTV</p> <p>TO 2810033070 ND 4280000500 HC JS1358</p>	<p>STN1360</p>  <p>9 CR</p>  <p>12v 0.8kW a:75 b:33.5 o:20</p> <p>HONDA Civic</p> <p>D14Z5 D14Z2 D15B HO 31200PLCT01 ND 2280009580 HC JS1360</p>	<p>STN1362</p>  <p>9 CR</p>  <p>12v 1.3kW a:74 b:15.5 o:21</p> <p>TOYOTA Avensis Corolla</p> <p>1ZZFE 3ZZFE</p> <p>TO 281000D090 ND 4280007710 HC JS1362</p>	<p>STN1363</p>  <p>13 ACR</p>  <p>12v 1.6kW a:55 b:66 o:20</p> <p>TOYOTA, LEXUS RX330, RX350 Avalon, Camry Sienna, Solara Venza</p> <p>1AZFS 2AZFSE</p> <p>TO 281000A010 ND 4280001840 HC JS1363</p>
<p>STN1366</p>  <p>8, 9 ACR</p> <p>12v 1kW a:65 b:48 o:20</p> <p>SUBARU Forester Impreza Legacy Outback</p> <p>EJ20 EJ16 EJ18 SB 23300AA270 ND 2280009270 HC JS1366</p>	<p>STN1368</p>  <p>21 ACR</p>  <p>12v 2.2kW b:6 o:30</p> <p>CITROEN, PEUGEOT C5 C6 407 607</p> <p>DT17ED4 DT17TED4</p> <p>PE 9649448380 ND 4280004810 HC JS1368</p>	<p>STN1383</p>  <p>293 10 CR</p>  <p>24v 4.5kW a:89 b:48.5 o:30</p> <p>IVECO, VAUXHALL EuroTech, EuroTrakker Stralis Frontera</p> <p>23DTR F2BE0681A F2BE3681B IV 42498714 ND 2280005641 HC CS1383</p>	<p>STN1443</p>  <p>11 CR</p>  <p>24v 4kW a:89 b:48 o:30</p> <p>VOLVO 610, 611, 612 613, 614, F 616 F7 FL 180, 220, 250</p> <p>TD60C TD60B, D6B, 20NE TD70F, TD70FS, TD70G VO 8192262 ND 1280007603 HC CS1443</p>
<p>STN1448 <i>New</i></p> <p>STN1448WA</p> <p>11 CR</p>  <p>12v 2.7kW a:82.5 b:18 o:21</p> <p>TOYOTA Hi-Lux LCV OPEL</p> <p>TO 281000L051 ND 4280002630 HC CS1488</p>	<p>STN1455</p>  <p>9 CR</p>  <p>12v 1kW a:75 b:40 o:20</p> <p>HONDA CR-V</p> <p>B20B, B20Z1</p> <p>HO 31200P3FJ01 ND 2280006450 HC CS1455</p>	<p>STN1456</p>  <p>9 CR</p>  <p>12v 1kW a:75 b:33 o:20</p> <p>HONDA Civic CR-V FR-V Stream 2.0</p> <p>K20A2 K24A1, K20A4 K20A9, K20A1 HO 31200PNEG01 ND 2280009872 HC CS1456</p>	<p>STN1458</p>  <p>9 CR</p>  <p>12v a:75 b:38 o:20</p> <p>HONDA Civic Accord CR-V FR-V</p> <p>R18A2 R20A R20A2, R18A1 HO 31200RNAA01 ND 4280005001 HC CS1458</p>



















Starters

Denso

<p>STN1468</p>  <p>STN1468WA 9 CR </p> <p>12v 2kW a:70 b:24.5 o:32</p> <p>LAND ROVER TDVM Discovery Range Rover Sport</p> <p>RO NAD500080 ND 4280001941 HC CS1468</p>	<p>STN1484 <i>New</i></p>  <p>12v 2.0kW a:82.5 b:18.5 o:21</p> <p>TOYOTA 2KDFTV Hilux II 2.5L 2001-2005</p> <p>TO 2810030040 ND 4280000250 HC CS1484</p>	<p>STN1498 <i>New</i></p>  <p>12v 0.8kW a:73 b:16 o:22</p> <p>TOYOTA K3VE DAIHATSU 3SZVE K3VE2</p> <p>TO 2810097214 DN 4280000860 DH 2810097214000</p>	<p>STN1527 <i>New</i></p>  <p>STN1527RB STN1527WA 12 CR </p> <p>12v 1.8kW a:70 b:15 o:2</p> <p>MERCEDES-BENZ C-Class E-Class CLK Vito</p> <p>MB A0061514501 ND 4280005510 HC CS1527</p>
<p>STN2036</p>  <p>STN2036WA 291 11 CR </p> <p>12v 2.5kW a:90 b:16 o:20</p> <p>TOYOTA 7FD Fork Lift</p> <p>TO 281004029171 ND 1280000970 CG 112036</p>	<p>STN2315</p>  <p>12v 1kW a:75 b:34 o:31</p> <p>HONDA</p> <p>HO 31200PC5892 ND 0280004011 HC JS315</p>	<p>STN2316</p>  <p>STN2316WA 197 9 CR </p> <p>12v 1.0kW a:74 b:20 o:20</p> <p>TOYOTA, VW Celica, Hiace Hilux, Land Cruiser Taro Coaster</p> <p>18R, 22R, 22RE 21RC, 21RU, 18RG 3Y</p> <p>TO 2810034060 ND 0280005900 HC JS316</p>	<p>STN2317</p>  <p>12v 1kW a:74 b:8 o:22</p> <p>TOYOTA, CHEVROLET Nova Celica Corolla MR2</p> <p>4AL, 4AGE, 4AGELC 4AC</p> <p>TO 2810046020 ND 0280009720 HC JS317</p>
<p>STN2333</p>  <p>12v 0.6kW a:66 b:17 o:22</p> <p>TOYOTA</p> <p>TO 2810024000 ND 0280004050 HC JS333</p>	<p>STN2336</p>  <p>12v 0.8kW a:83 b:32.5 o:20</p> <p>DAIHATSU, TOYOTA Taft Hiace</p> <p>12R</p> <p>TO 2810031022 ND 0280001013 HC JS336</p>	<p>STN2337</p>  <p>12v 1kW a:82.5 b:20 o:20</p> <p>TOYOTA</p> <p>TO 2810060040 ND 0280000430 HC JS337</p>	<p>STN2341</p>  <p>STN2341WA 298 11 CR </p> <p>12v 2.5kW a:105 b:42 o:30</p> <p>DAEWOO ISUZU Fork Lift Industrial</p> <p>4BD1 6BD1</p> <p>IS 5811001081 ND 0280006560 CG 112344</p>

Starters

Denso

<p>STN2356</p>  <p>9 CR </p> <p>12v 1kW a:75 b:32 o:30</p> <p>HONDA</p> <p>HO 31200PC60033 ND 0280009580 HC JS356</p>	<p>STN2357</p>  <p>232 8, 9 CR</p> <p>12v 0.8kW a:74 b:5 o:22</p> <p>TOYOTA Corolla Starlet</p> <p>2E, 2EL 2EE, 2ELC 4EFE, 1EL TO 2810010030 ND 1280001620 HC JS357</p>	<p>STN2365</p>  <p>STM2365RB STN2365RB STN2365WA</p> <p>9, 10 CR</p> <p>12v 2.0kW a:88 b:7 o:32</p> <p>FORD, KIA MAZDA, SUZUKI Econovan, Grand Vitara Sportage, Vitara 323, 626, E</p> <p>R2, RF, RFCX RF46, RFN KI 0K71118400 ND 1280000040 HC JS365</p>	<p>STN2373</p>  <p>STN2373WA</p> <p>8, 9 ACR</p> <p>12v 1kW a:82.5 b:33 o:20</p> <p>SUBARU 1800 XT 1.8L Impreza, Standard Leone, Loyale</p> <p>EA82 EJ16E EA81, EA82 SB 429917210 ND 0280008580 HC JS373</p>
<p>STN2375</p>  <p>9 CR </p> <p>12v 0.8kW a:75 b:33 o:31</p> <p>HONDA Accord Civic Prelude</p> <p>HO 31200PC5015 ND 0280007651 HC JS375</p>	<p>STN2376</p>  <p>8 ACR </p> <p>12v 0.8kW a:74 b:23.5 o:20</p> <p>Daihatsu Charade II Daihatsu Charade III Daihatsu Cuore Daihatsu Move</p> <p>CB20 CB22 CB61 TO 2810048708 ND 2810087709 HC JS376</p>	<p>STN2383</p>  <p>9 CR </p> <p>12v 1.4kW a:74 b:21 o:20</p> <p>TOYOTA Celica Crown Supra</p> <p>5MGE 5M, 5ME 7MGE TO 2810041020 ND 0280002330 HC JS383</p>	<p>STN2387</p>  <p>STN2387WA</p> <p>8, 9 ACR</p> <p>12v 0.6kW a:65 b:26 o:20</p> <p>BEDFORD SUZUKI Carry Rascal</p> <p>FA10A F10A F8A SZ 3110079661 ND 0280003730 HC JS387</p>
<p>STN2390</p>  <p>STN2390WA</p> <p>232 9, 10 CR</p> <p>12v 2.2kW a:88 b:6 o:32</p> <p>MAZDA, KIA, SUZUKI, FORDF, RF46, RFN 323, 626, B 2200, E Sportage, Besta, Retona Vitara, Grand Vitara Econovan</p> <p>RFCX, RFG5, R2 KI 0K71118400 ND 2280003840 CG 110389</p>	<p>STN2392</p>  <p>STN2392WA</p> <p>11 CR </p> <p>12v 2.5kW a:82.5 b:15 o:21</p> <p>TOYOTA VW Hiace Land Cruiser Taro</p> <p>L, 2L, 2LT H TO 2810054010 ND 0280005580 HC JS392</p>	<p>STN2393</p>  <p>9 ACR </p> <p>12v 0.8kW a:82.5 b:33.5</p> <p>SUBARU Leone MK II</p> <p>EA71 EA65 SB 429917100 ND 0280008780 HC JS393</p>	<p>STN2489</p>  <p>295 11 CR </p> <p>12v 2.7kW a:89 b:48 o:30</p> <p>BOBCAT CLARK Forklift Industrial</p> <p>EA82 EJ16E EA81, EA82 SB 429917210 ND 0280008580 HC JS373</p> <p>BC 6667587 ND 2280005811 CG 112489</p>
























Starters

Denso

<p>STN2544</p>  <p>STN2544WA 314 10 CR </p> <p>24v 7.5kW a:92 b:47 o:30</p> <p>CUMMINS 6CT Industrial Engines 8.3L BLUEBIRD BUS HYUNDAI 290 CU 3675247RX SAMSUNG SE24 ND 2280007380 CG 112544</p>	<p>STN2545</p>  <p>STN2545WA 187 11 CR </p> <p>12v 1.4kW a:89 b:27 o:22</p> <p>LISTER Marine LI 75721700 ND 2280001881 CG 112545</p>	<p>STN2547</p>  <p>STN2547WA 194 9, 13 CR</p> <p>12v 1.4kW a:66 b:17 o:20</p> <p>KUBOTA D905EBX Tractors Sub Compact D1105BH Excavators V1505BH KU 1623563010 ND 4280002640 CG 112547</p>	<p>STN2582</p>  <p>STN2582WA 205 11 CR </p> <p>12v 1.5kW a:27 b:8 o:20</p> <p>CHEVROLET 1YY Corvette WL 91295246 ND 1280008111 CG 112582</p>
<p>STN2583</p>  <p>STN2583WA 290 11 CR </p> <p>12v 2.5kW a:105 b:17 o:20</p> <p>TOYOTA LAND CRUISER J4, J6, J8 ND 0280007231 ND 0280007221 CG 110583</p>	<p>STN2764</p>  <p>STN2764WA 240.5 10 CR </p> <p>12v 1.4kW a:71 b:23.5 o:20</p> <p>DODGE US B1500, W150 Dakota Ramcharger Ram CH 53005984 DN 1280005280 CG 111764</p>	<p>STN2837</p>  <p>STN2837WA 188.5 CR</p> <p>12v 1.0kW a:55 b:24 o:30</p> <p>HARLEY DAVIDSON Motorcykel HD 3155289 ND 1280005750 CG 111837</p>	<p>STN2849 <i>New</i></p>  <p>10 CR </p> <p>12v 2.0kW a:47 b:20 o:33</p> <p>LAND ROVER RANGE ROVER LR 6G9N11000NA ND 4280004840 MH STH2840</p>
<p>STN2911 <i>New</i></p> <p>10 CR </p> <p>12v 2.5kW a:88 b:52 o:20</p> <p>DN 4280002911 MH STN2911</p>	<p>STN2915</p>  <p>STN2915WA 205.5 9 ACR </p> <p>12v 0.6kW a:61 b:21.5 o:31</p> <p>BOMBARDIER SEA DOO Marine BB 278000484 ND 2280004550 CG 111915</p>	<p>STN2918</p>  <p>205 9 ACR </p> <p>12v 0.6kW a:61 b:22.5 o:22</p> <p>CHALLENGER SEA DOO Marine BB 278000301 ND 2280004560 CG 111918</p>	<p>STN2920</p>  <p>181.5 10 CR/ACR</p> <p>12v a:30 b:32 o:20</p> <p>Honda Motorcycles ATC TRX HO 31200HA0682 ND 1280001491 CG 111920</p>


















Starters

Denso

<p>STN3021</p>  <p>15 CR </p> <p>12v a:73 b:28 o:21</p> <p>TOYOTA</p> <p>DN 281000Y020 DN 4280006360 MH STN3021</p>	<p>STN3101</p>  <p>STN3101WA 13 CR </p> <p>12v 2.5kW a:89 b:46 o:30</p> <p>CUMMINS DODGE</p> <p>CU 3604630RX ND 1280004911 CG 113101</p>	<p>STN3102</p>  <p>STN3102WA 9 CR </p> <p>12v 0.8kW a:70 b:35 o:20</p> <p>HONDA Fit</p> <p>HO 31200PWA901 ND 4280003390 WA 17998N</p>	<p>STN3107</p>  <p>STN3107WA 9 CR </p> <p>12v 1.4kW a:74 b:21 o:22</p> <p>LEXUS TOYOTA</p> <p>TO 2810046140 ND 2280001960 CG 113107</p>
<p>STN3112</p>  <p>STN3112WA 188 9 CR </p> <p>12v 1.6kW a:55 b:17 o:21</p> <p>TOYOTA</p> <p>TO 2810065100 ND 2280002750 CG 113112</p>	<p>STN3114</p>  <p>STN3114WA 13 CR </p> <p>12v 2.5kW a:89 b:44 o:30</p> <p>CUMMINS 3.9L DODGE 5.9L Ram Industrial Engine</p> <p>CH 4741012 ND 2280002290 CG 113114</p>	<p>STN3115</p>  <p>STN3115WA 192 9 CR </p> <p>12v 1.4kW a:74 b:11 o:21</p> <p>CHRYSLER DODGE PLYMOUTH</p> <p>CH 4609703 ND 2280003020 CG 113115</p>	<p>STN3120</p>  <p>220 10 CR </p> <p>12v 1.4kW a:72.5 b:23 o:20</p> <p>DODGE US DODGE ASIA Dakota Durango Ram</p> <p>CH 56027702AB ND 2280007421 CG 113120</p>
<p>STN3131</p>  <p>STN3131WA 320 11 CR </p> <p>12v 3kW a:105 b:41 o:30</p> <p>ISUZU N Series 4BD1 Chevrolet, GMC Medium 3.9L EVR, FSR, FTR, FVR, NRR 5.8L</p> <p>IS 8971197490 ND 1280000490 CG 113131</p>	<p>STN3132</p>  <p>STN3132WA 237 9 CR </p> <p>12v 2.2kW a:95 b:10 o:20</p> <p>HYSTER 6BD1T ISUZU 4203 Industrial Engine</p> <p>IZ 8970429970 ND 2280008041 CG 113132</p>	<p>STN3168</p>  <p>STN3168WA 232.5 9 CR </p> <p>12v 2.0kW a:55 b:34 o:22</p> <p>LEXUS US 1UZFE LS SC</p> <p>TO 2810050020 ND 1280007380 CG 113168</p>	<p>STN3169</p>  <p>STN3169WA 218.5 9, 10 CR</p> <p>12v 2.2kW a:55 b:33 o:20</p> <p>LEXUS 1FZFE TOYOTA LX Land Cruiser</p> <p>TO 2810066060 ND 2280001560 CG 113169</p>
















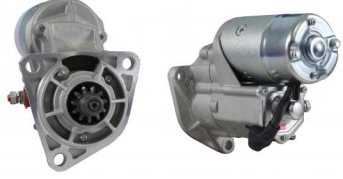








Starters

Denso

<p>STN3171</p>  <p>STN3171WA</p> <p>220 9 CR</p>  <p>12v 2kW a:5.5 b:33.5 o:22</p> <p>JAGUAR LEXUS XJ GS LS</p> <p>1UZF V12</p> <p>TO 2810050100 ND 2280004300 CG 113171</p>	<p>STN3172</p>  <p>STN3172WA</p> <p>249 9, 10 CR</p> <p>12v 2kW a:89 b:46 o:20</p> <p>CATERPILLAR HYSTER YALE Fork Lift</p> <p>PERKINS4236</p> <p>HS 8504304 ND 2280005860 CG 113172</p>	<p>STN3173</p>  <p>STN3173WA</p> <p>209 9 CR</p>  <p>12v 1.8kW a:55 b:17 o:22</p> <p>TOYOTA EU TOYOTA US 4 Runner Tundra Tacoma</p> <p>TO 2810062030 ND 2280004080 CG 113173</p>	<p>STN3203</p>  <p>STN3203WA</p> <p>298 11 CR</p>  <p>24v 4.5kW a:105 b:14 o:20</p> <p>KOMATSU Fork Lift Lift Trucks</p> <p>FD40 4D52</p> <p>KM 6008133240 ND 2280001430 CG 113203</p>
<p>STN3204</p>  <p>STN3204WA</p> <p>200 9 CR</p>  <p>24v 1.4kW a:66 b:18 o:20</p> <p>KUBOTA Industrial Engines</p> <p>V1200</p> <p>KU 1988363011 ND 2280004780 CG 113204</p>	<p>STN3206</p>  <p>STN3206WA</p> <p>292 11 CR</p>  <p>12v 2.5kW a:95 b:21 o:20</p> <p>KOMATSU Fork Lift</p> <p>4D95</p> <p>KM 6008131420 ND 1280009971 CG 113206</p>	<p>STN3208 <i>New</i></p>  <p>18 9 CR</p>  <p>12v 0.8kW a:74 b:20 o:22</p> <p>TORO DAIHATSU Industrial</p> <p>Daihatsu Engine</p> <p>TO 2810087803 ND 2280004620 CG 113208</p>	<p>STN3214</p>  <p>STN3214WA</p> <p>296 11 CR</p>  <p>12v 2.5kW a:105 b:31 o:21</p> <p>HINO FA Series FB Series</p> <p>FA14, FA15 FB14, FB15</p> <p>TO 2810089106 ND 1280005090 CG 113214</p>
<p>STN3237</p>  <p>STN3237WA</p> <p>315 10 CR</p>  <p>12v 3kW a:89 b:47 o:30</p> <p>CATERPILLAR Industrial Engines</p> <p>3114 3116</p> <p>CT 3E5382 ND 2280005730 CG 113237</p>	<p>STN3239</p>  <p>STN3239WA</p> <p>299 12 CR</p>  <p>12v 2.5kW a:91 b:16 o:20</p> <p>TOYOTA Land Cruiser 2.4L - 4.5L</p> <p>1KDFTV H, 2H, 3H 2UZFE</p> <p>TO 2810017070 ND 2280001610 CG 113239</p>	<p>STN3241</p>  <p>STN3241WA</p> <p>182 9 CR</p>  <p>12v 1.2kW a:74 b:10 o:21</p> <p>DODGE CHRYSLER PLYMOUTH</p> <p>CH 91295244 ND 2280003010 CG 113241</p>	<p>STN3244</p>  <p>217 13 ACR</p>  <p>12v 1.4kW a:55 b:65.5 o:20</p> <p>LEXUS TOYOTA ES Camry Avalon</p> <p>1MZFE 5SFE 1AZFE</p> <p>TO 2810074240 ND 2280006273 CG 113244</p>

Starters

Denso

<p>STN3311 <i>New</i></p>  <p>13 CR </p> <p>12v 2.5kW a:89 b:47 o:20</p> <p>CATERPILLAR 4T-390 FREIGHTLINER 6BTA STERLING KOMATSU TO 2810036E03 DN 1280000210 NR 014220</p>	<p>STN3402</p>  <p>STN3402RB STN3402WA</p> <p>188.5 9 CR </p> <p>12v 1.4kW b:15.5 o:20</p> <p>HONDA 6VD1 ISUZU 6VE1 OPEL Monterey CH 91295296 Passport ND 1280009700 CG 113402</p>	<p>STN3428</p>  <p>STN3428WA</p> <p>297 11 CR </p> <p>12v 2.5kW a:105 b:41 o:30</p> <p>ISUZU 4BD1 N series 6BD1 ND 0280005490 CG 113428</p>	<p>STN3429</p>  <p>STN3429WA</p> <p>326 10 CR </p> <p>12v 4.2kW a:92 b:47.5 o:30</p> <p>CASE 6CT CUMMINS 6CTA Agricultural machine Industrial Engines JD A187615 ND 0280007430 CG 113429</p>
<p>STN3434</p>  <p>206 9 CR </p> <p>12v 0.8kW a:74 b:4 o:21</p> <p>TOYOTA Tercel TO 2810011150 ND 2280006760 CG 113434</p>	<p>STN3490 <i>New</i></p>  <p>10 CR </p> <p>12v 1.4kW a:60 b:45 o:20</p> <p>HARLEY DAVIDSON 1584cc HA 3161906 ND 4280003490 WA 18905N</p>	<p>STN3620</p>  <p>180 9 CR </p> <p>12v 1.2kW a:74 b:15 o:21</p> <p>TOYOTA US 2ZZGE TOYOTA EU 1ZZFE Celica TO 281000D010 ND 2280007740 CG 113620</p>	<p>STN3630</p>  <p>STN3630WA</p> <p>214.5 9 CR </p> <p>12v 1.2kW a:66 b:37 o:20</p> <p>HONDA S2000 F20C1 HO 31200PCXA01 ND 2280008330 CG 113630</p>
<p>STN3635 <i>New</i></p>  <p>STN3635WA</p> <p>176.5 13 ACR </p> <p>12v 1.2kW a:75 b:33 o:22</p> <p>KUBOTA CARRIER TRANSICOLD KU 1146063011 ND 1280008480 CG 113635</p>	<p>STN3696 <i>New</i></p>  <p>STN3696WA</p> <p>11 ACR </p> <p>12v 2kW a:74 b:21</p> <p>FORD 4122, 4135 NEW HOLLAND N844 Agricultural machine FORD VSG Industrials NH 185086530 ND 2280002970 CG 113696</p>	<p>STN3704 <i>New</i></p>  <p>206 9 CR </p> <p>12v 0.8kW a:75 b:33 o:20</p> <p>ACURA EI HONDA Civic HO 31200PLRA02 ND 4280000320 CG 113704</p>	<p>STN3725 <i>New</i></p>  <p>STN3725WA</p> <p>300 13 CR </p> <p>12v 2.5kW a:89 b:49 o:20</p> <p>CASE Cummins 5.9L ISB KENWORTH STERLING FREIGHTLINER Trucks, Tractors CU 3675154RX ND 1280000210 CG 113725</p>

























Starters

Denso

<p>STN3732</p>  <p>STN3732WA 206 12 ACR 12</p> <p>12v 1.0kW a:54 b:1.5</p> <p>CUB CADET HONDA Big Country GX</p> <p>Honda Engine HO 31200ZJ1841 ND 2280007850 CG 113732</p>	<p>STN3736</p>  <p>STN3736WA 11 CR 11</p> <p>12v 4.8kW a:89 b:47 o:30</p> <p>JOHN DEERE KOMATSU Fork Lift Agricultural machine</p> <p>JD RE504244 ND 2280006530 CG 113736</p>	<p>STN3744</p>  <p>11 CR 11</p> <p>12v 2.5kW a:110 b:15 o:22</p> <p>DAIHATSU Light Trucks TOYOTA Carina Camry</p> <p>TO 2810056160 ND 0280009040 WA 19744N</p>	<p>STN3750</p>  <p>STN3750WA 9 CR 9</p> <p>12v 1kW a:74 b:20</p> <p>LEXUS IS200 1999- Sportcross200 2002-</p> <p>TO 2810070050 ND 2280005960 MH STN3750</p>
<p>STN3809</p>  <p>STN3809WA 9cr</p> <p>12v 2.2kW a:73 b:20 o:22</p> <p>TOYOTA US TOYOTA EU 4 runner Land Cruiser Tundra</p> <p>1GRFE TO 2810031050 ND 4280001250 CG 113809</p>	<p>STN3825</p>  <p>STN3825WA 447 13 CR 13</p> <p>12v 5kW a:92 b:46 o:30</p> <p>FORD School Buses Medium&Heavy Duty Trucks</p> <p>WL 91295577 ND 4280001420 CG 113825</p>	<p>STN3915</p>  <p>STN3915WA 10 CR 10</p> <p>12v 5kW a:92 b:50 o:30</p> <p>VOLVO US Trucks VE-12 Engines</p> <p>VED12 39MT 42MT VO 1909056 ND 4280005430 CG 113915</p>	<p>STN3983</p>  <p>STN3983WA 315 11 CR 11</p> <p>12v 3.0kW a:89 b:48 o:30</p> <p>ISUZU Trucks JOHN DEERE Agricultural machine Industrials</p> <p>F2BE0681D F2BE0681A JD RE70474 ND 2280006552 CG 113983</p>
<p>STN3985</p>  <p>297 10 CR 10</p> <p>12v 2.7kW a:89 b:48 o:20</p> <p>HYASTER YALE Fork Lift</p> <p>PE 1388721 ND 2280007810 CG 113985</p>	<p>STN4000</p>  <p>STK4000WA STN4000WA 10 ?r</p> <p>24v 5kW a:89 b:50 o:30</p> <p>CUMMINS KOMATSU</p> <p>S6D102 CU 3957596 ND 2280005000 NR 015050</p>	<p>STN4017</p>  <p>STN4017WA 326 11 CR 11</p> <p>24v 5.5kW a:100 b:23 o:30</p> <p>HINO Trucks</p> <p>TO 281001863 ND 1280004686 CG 114017</p>	<p>STN4043</p>  <p>STN4043WA 10 CR 10</p> <p>12v a:73 b:22 o:22</p> <p>TOYOTA Crown</p> <p>TO 2810031070 ND 4280002340 WA 19043N</p>

Starters

Denso

<p>STN4051</p>  <p>STN4051WA 13 CR </p> <p>12v 1.4kW a:49 b:8 o:21</p> <p>DODGE 4.7L Durango 2004-05 5.7L CHRYSLER CH 56029750AA ND 4280002050 WA 17884N</p>	<p>STN4090</p>  <p>STN4090WA 9 CR </p> <p>12v 2.4kW a:62 b:34 o:20</p> <p>JAGUAR QDV XK QEV XJ CCX XF FO 96JV11001AC S-Type DN 2280005092 MH STN4090</p>	<p>STN4100</p>  <p>11 cr </p> <p>12v 2.5kW a:90 b:17 o:20</p> <p>TOYOTA Industrial TO 2810042800 ND 1280004100 UP STR6094</p>	<p>STN4103</p>  <p>166 9 ACR </p> <p>12v a:30 b:39 o:20</p> <p>SUZUKI Motorcycles GN250 LT250EF HO 31200MEE003 ND 0280008721 CG 114103</p>
<p>STN4121</p>  <p>STN4121WA 9 CR </p> <p>12v 1.6kW a:95 b:34 o:20</p> <p>KUBOTA 3LA1 ISUZU IS 8970489650 ND 2280001121 NR 011133</p>	<p>STN4135</p>  <p>STN4135WA 230 10 CR </p> <p>12v 1.2kW a:81.5 b:7.5 o:20</p> <p>CHRYSLER EGM DODGE EGH PLYMOUTH EGP Caravan CH 04686045AB Voyager ND 2280007641 HC CS1501</p>	<p>STN4168 <i>New</i></p>  <p>STN4168WA 188 9 CR </p> <p>12v 1.2Kw a:74 B:b: o:20</p> <p>CATERPILLAR CA 1604648 DN 114168 MH STN4168</p>	<p>STN4170 <i>New</i></p>  <p>10 ACR </p> <p>12v 1.0kW a:73 b:33 o:20</p> <p>DAIHADSU ED20 DA 2280004170 DN 2280004171</p>
<p>STN4182</p>  <p>173 9 CR </p> <p>12v 0.7kW a:30 b:44 o:20</p> <p>SUZUKI Motorcycles Burgman SZ 3110014F00 ND 2280007541 CG 114182</p>	<p>STN4190</p>  <p>STN4190WA 13 CR </p> <p>12v 2.7kW a:89.5 b:53 o:30</p> <p>DODGE Ram5.9l CH 5086932AA ND 4280001190 WA 17892N</p>	<p>STN4197</p>  <p>209 9 CR </p> <p>12v 1.1kW a:89 b:17 o:20</p> <p>JOHN DEERE YANMAR Agricultural machine YA 11951577010 ND 2280007471 CG 114197</p>	<p>STN4200</p>  <p>13 CR </p> <p>12v 1.4kW a:49 b:5 o:33</p> <p>CHRYSLER 5.7 V8 300 6.1 V8 DODGE Challenger, Charger CH 04608801AA Magnum ND 4280002200 MH STN4200</p>

























Starters

Denso

<p>STN4221</p>  <p>STN4221WA STN9221WA</p> <p>11 CR </p> <p>24v 4.5kW a:105 b:47 o:20</p> <p>ISUZU Engines FRR33 6HH Bus 6HE Forvard IZ 8943998261 ND 1280008064 NR 013031</p>	<p>STN4224</p>  <p>298 10 CR </p> <p>12v 2.7kW a:89 b:19 o:20</p> <p>NEW HOLLAND Industrials</p> <p>NH 86992395 ND 4280001691 CG 114224</p>	<p>STN4226</p>  <p>228 9 CR </p> <p>12v 1.1kW a:74 b:40 o:20</p> <p>HONDA B20B CRV 2.0L w/ AT 1997-2001</p> <p>HO 31200P3FA51 ND 2280006460 CG 114226</p>	<p>STN4239</p>  <p>195 10 CR </p> <p>12v 1.6kW a:74 b:15.5 o:21</p> <p>SCION 1NZFE TOYOTA 2NZFE Yaris Echo TO 2810021060 XA ND 4280000024 CG 114239</p>
<p>STN4250</p>  <p>13 CR </p> <p>12v 1.4kW a:93 b:24 o:20</p> <p>YANMAR Yanmar 31HP Diesel JOHN DEERE</p> <p>YA 12452077012 ND 2280000250 CG 114400</p>	<p>STN4256 <i>New</i></p>  <p>9 CR </p> <p>12v a:64 b:4 o:22</p> <p>DODGE Dakota 3.7L (226) V6 DODGE Ram 4.7L (285) V8 DODGE Durango MITSUBISHI Raider</p> <p>CH 4801256AB ND 4280007360 WA 17950N</p>	<p>STN4268 <i>New</i></p>  <p>10 CR </p> <p>24v 4.5kW a:89 b:29 o:30</p> <p>CATERPILLAR Wheel Loader Paving Equipment</p> <p>CT OR4321 ND 2280001831 CG 114268</p>	<p>STN4332</p>  <p>234 9 CR </p> <p>12v 2.2kW a:95 b:19 o:20</p> <p>CUMMINS Cummins B3.3L Engine Industrial Engines</p> <p>KO 6008631410 ND 4280002650 CG 114332</p>
<p>STN4333</p>  <p>216.5 9 CR </p> <p>12v 2.2kW a:82 b:25 o:20</p> <p>CARRIER TRANSICOLD Engines Generator Sets Trailer Units</p> <p>KU 1G91163012 ND 4280000931 CG 114333</p>	<p>STN4336</p>  <p>296 11 CR </p> <p>24v 4.5kW a:82.5 b:29 o:22</p> <p>TOYOTA 2J Toyoace</p> <p>TO 2810048011 ND 0280006460 CG 114336</p>	<p>STN4337</p>  <p>11 CR </p> <p>24v 5.5kW a:100 b:64 o:30</p> <p>HINO EC100, EH100, DM100 KL, KM, KQ, RM, BM, FM DQ100, EH300, EH700 Hitachi Excavator EX220</p> <p>SA 03304020010 WAI 232412W CG 114337</p>	<p>STN4339</p>  <p>13 CR </p> <p>12v 3.0kW a:89 b:48 o:30</p> <p>DODGE Ram 5.9L Pickup Ram 6.7L Pickup</p> <p>CH 68002981AA ND 4280006110 WA 19029N</p>

Starters

Denso
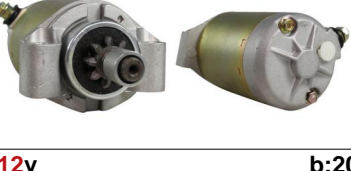
<p>STN4340</p>  <p>STN4340WA</p> <p>10 CR </p> <p>24v 4.5kW a:89 b:49</p> <p>CUMMINS Engines B SERIES 5.9L KOMATSU Wheel Loaders KO 6008634130 WA120 4B, WA120 6B ND 2280000633 CG 114340</p>	<p>STN4346</p>  <p>317 11 cr </p> <p>24v 5.5kW a:105 b:57 o:20</p> <p>ISUZU Trucks TCM Fork Lift IZ 1811002462 ND 1280004251 CG 114346</p>	<p>STN4375 <i>New</i></p>  <p>181.5 10 ACR </p> <p>12v 0.6kW a:70 b:13.5 o:22</p> <p>HONDA Motorcycles GXC HONDA Engines TORO Lawn Mowers HO 31200Z0A003 ND 2280009480 CG 114375</p>	<p>STN4417</p>  <p>297 11 CR </p> <p>12v 2.5kW a:105 b:14.5 o:20</p> <p>TOYOTA 2L Dyna 14B TO 2810056040 ND 2280005520 CG 114417</p>
<p>STN4419</p>  <p>STN4419WA</p> <p>194 10 CR </p> <p>12v 1.2kW a:74 b:15 o:20</p> <p>PONTIAC 2ZZGE Vibe TOYOTA Corolla TO 281000D080 Matrix ND 4280000340 CG 114419</p>	<p>STN4420</p>  <p>STN4420WA</p> <p>11 CR </p> <p>24v 5.5kW a:105 b:57</p> <p>ISUZU 6SA1 Industrial Engines IZ 1811002461 ND 1280002740 CG 114420</p>	<p>STN4423</p>  <p>STN4423WA</p> <p>10 CR </p> <p>12v 5kW a:92 b:48 o:30</p> <p>VOLVO DD 50, DD 60 Series MACK Cummins M11 FREIGHTLINER 40MT, 42MT PETERBILT VO 1909052 KENWORTH ND 4280004420 WA 19502N</p>	<p>STN4424 <i>New</i></p>  <p>10 CR </p> <p>12v 2.0kW a:76 b:12 o:21</p> <p>TOYOTA 1NDTV Auris 1.4 D Blade 1.4 D TO 281000N050 ND 4280006200 DN DSN946</p>
<p>STN4429</p>  <p>STN4429WA</p> <p>9 CR </p> <p>12v 2kW a:95.5 b:16 o:20</p> <p>ISUZU 4JA1 TFR 4JB1 TFS IZ 8979410230 ND 2280008890 CG 114429</p>	<p>STN4430</p>  <p>STN4430WA</p> <p>11 CR </p> <p>24v 5.5kW a:99 b:35 o:30</p> <p>VOLVO VE12 US Trucks HINO TO 281002490B ND 4280005430 MH STN4430</p>	<p>STN4440</p>  <p>186 9 CR </p> <p>12v 1.4kW a:55 b:32.5 o:20</p> <p>LEXUS 2UZFE TOYOTA Land Cruiser 4Runner Sequoia TO 2810050090 ND 2280008800 CG 114440</p>	<p>STN4486 <i>New</i></p>  <p>9 ACR </p> <p>12v b:20 o:20</p> <p>JOHN DEERE KAWASAKI JD AM102628 DN 1280002760</p>


















Starters

Denso

<p>STN4501 New</p>  <p>9 CR </p> <p>12v 1kW a:77 b:18 o:20</p> <p>KUBOTA</p> <p>KU 6A10031150 DN 2280005590</p>	<p>STN4560</p>  <p>STN4560DN STN4560WA</p> <p>9 CR </p> <p>12v 1kW a:74 b:26 o:21</p> <p>TOYOTA Yaris 1.0</p> <p>1KRFE 2SZFE</p> <p>TO 281000J020 ND 4280004560 DN DSN948</p>	<p>STN4611</p>  <p>STN4611WA</p> <p>11 CR </p> <p>12v a:59 b:29 o:22</p> <p>LANDROVER SAAB 9-3</p> <p>RO NAD500280 ND 4280004611 MH STN4611</p>	<p>STN4620</p>  <p>STN4620WA</p> <p>145 11 ACR </p> <p>12v 1.4kW a:55 b:65 o:20</p> <p>ROVER 75 MG ZT</p> <p>RO NAD101180 ND 2280007620 NR 011011</p>
<p>STN4638</p>  <p>STN4638WA</p> <p>10 CR </p> <p>12v 1.4kW a:48 b:7 o:22</p> <p>DODGE Dakota Durango Ram</p> <p>3.7L, 4.7L, 5.7L V8</p> <p>CH 56028715AD ND 4280000100 CG 114638</p>	<p>STN4645</p>  <p>STN4645WA</p> <p>10 CR </p> <p>12v 4.8kW a:87 b:45 o:20</p> <p>BLUEBIRD STERLING THOMAS BUILT WESTERN STAR FORD</p> <p>CATERPILLAR 3126 CUMMINS 8.3L FD1460</p> <p>IN 2585347C91 ND 2280005850 CG 114645</p>	<p>STN4646</p>  <p>STN4646WA</p> <p>10 ACR </p> <p>12v 3kW a:92 b:51 o:30</p> <p>School or Comercial Buses BLUEBIRD THOMAS BUILT</p> <p>Cummins 6C Cummins 6CG Cummins ISC IN 2509687C91 ND 2280005310 CG 114646</p>	<p>STN4660</p>  <p>STN4660WA</p> <p>9 CR </p> <p>12v 2.0kW a:76 b:24 o:22</p> <p>BMW X5 3.0i Diesel</p> <p>BM 12412155827 ND 4280000660 HC CS1473</p>
<p>STN4670</p>  <p>STN4670WA</p> <p>245 9 CR </p> <p>12v 1.4kW a:76 b:23 o:30</p> <p>BMW Z4 X3 320, 325, 330 Series 525, 530 Series</p> <p>BM 12417515392 ND 4280000670 MH STN4670</p>	<p>STN4674 New</p>  <p>12v 0.6kW a:62 b:17</p> <p>GRAVELY JOHN DEERE KUBOTA</p> <p>JD AM127877 DN 2280007990 KU E719563010</p>	<p>STN4690</p>  <p>9 CR </p> <p>12v 1kW a:74 b:13</p> <p>TOYOTA Vitz Blade</p> <p>ZE15 RE15 P9 TO 281000N040 ND 4280006190 DN DSN945</p>	<p>STN4712 New</p>  <p>316 11 CR </p> <p>24v 7.5kW a:89 b:47.5 o:30</p> <p>JOHN DEERE Agricultural Industrial</p> <p>JD RE504245 ND 2280009150 CG 114712</p>


Starters

Denso

<p>STN4823 <i>New</i></p>  <p>9 ACR </p> <p>12v 0.6kW a:66 b:18 o:20</p> <p>CUB CADET JOHN DEERE Agricultural machines</p> <p>KW 211632077 ND 1280005500 CG 114823</p>	<p>STN4830</p>  <p>9 CR </p> <p>12v 1.3kW a:74 b:14</p> <p>TOYOTA Avensis Verso</p> <p>TO 281000T060 ND 4280005830 DN DSN947</p>	<p>STN4840</p>  <p>STN4840WA 11 cr </p> <p>24v 5.5kW a:100 b:25 o:30</p> <p>HYUNDAI D6DA HD120 D6DA19 AERO TOWN D6DA22 KIA RHINO, COSMOS KI 0K87T18400 MH STN4840</p>	<p>STN4923</p>  <p>13 ACR </p> <p>12v 2.0kW a:79 b:57</p> <p>AUDI, SEAT, VW A3 Altea Tiguan VW 0AH911023F Sharan ND 4280007040 DN DSN964</p>
<p>STN4950</p>  <p>9 CR </p> <p>12v 2.0kW a:82 b:26 o:20</p> <p>KUBOTA CARRIER TRANSICOLD</p> <p>KU 1946063011 ND 2280006952 NR 016952</p>	<p>STN5190 <i>New</i></p>  <p>STN5190WA 10 CR </p> <p>12v 5.0kW a:91 b:46 o:30</p> <p>KENWORTH PETERBILT</p> <p>ND 4280005190 WA 19505N</p>	<p>STN5298 <i>New</i></p>  <p>11 CR </p> <p>12v 4.0kW</p> <p>JOHN DEERE</p> <p>JD RE501298 ND 2280008080 WA 18566N</p>	<p>STN5480 <i>New</i></p>  <p>9 CR </p> <p>12v</p> <p>BMW X6 4.4i</p> <p>BM 12417577257 ND 4280005480 WA 19079R</p>
<p>STN5590 <i>New</i></p>  <p>10 CR </p> <p>12v 2.0kW a:89 b:20 o:20</p> <p>CASE</p> <p>CS 235907A1 DN 2280006070 NR 015590</p>	<p>STN5622 <i>New</i></p>  <p>318 10 CR </p> <p>12v 4.0kW a:89 b:47.5 o:30</p> <p>CASE Agricultural Sprayers Tractors Trenchers Loaders</p> <p>CS 259720A1 ND 1280005622 CG 114449</p>	<p>STN5643 <i>New</i></p>  <p>12v 2.7kW</p> <p>TOYOTA 4.5D V8 Land Cruiser 200 1VD-FTV 2008-></p> <p>TO 2810051071 ND 4280005643 MH STN5643</p>	<p>STN5740</p>  <p>10 CR </p> <p>12v 1.4kW a:47 b:47 o:20</p> <p>BOBCAT CATERPILLAR TRUCK HYSTER LIFT TRUCKS TOWMOTOR</p> <p>BC 6669633 ND 1280006880</p>



















Starters

Denso

<p>STN5795 <i>New</i></p>  <p>9 CR </p> <p>12v a:68 b:27 o:22</p> <p>LYNX SKI-DOO Snowmobiles</p> <p>BM 515175795 ND 4280001000 WA 18873N</p>	<p>STN5950 <i>New</i></p>  <p>9 CR </p> <p>12v 2.0kW a:70 b:25 o:22</p> <p>ROVER GROUP 306DT Land Rover 3.0L 2009- 30DDTX</p> <p>LR AH2211001AC ND 4280005950 MH STN5950</p>	<p>STN6030 <i>New</i></p>  <p>10 CR </p> <p>12v 3.0kW a:89 b:26 o:30</p> <p>NEW HOLLAND C185 3.4L C190 4.5L</p> <p>HO 87638510 DN 4280009910 NR 016030</p>	<p>STN6050 <i>New</i></p>  <p>13 ACR </p> <p>12v a:55 b:66 o:20</p> <p>TOYOTA Avensis</p> <p>TO 281000H070 DN 4280006050</p>
<p>STN6309 <i>New</i></p>  <p>9 CR </p> <p>12v 2kW a:73 b:19 o:30</p> <p>CATERPILLAR</p> <p>CA 3E5127 DN 0280009830</p>	<p>STN6313 <i>New</i></p>  <p>9 CR </p> <p>12v 2.2kW a:93 b:19 o:20</p> <p>DAEWOO DOOSAN</p> <p>HY A403603 NR 013603</p>	<p>STN6560 <i>New</i></p>  <p>STN6560WA 11 ACR </p> <p>24v 7.8kW a:88 b:48 o:30</p> <p>JOHN DEERE Crawlers Excavators</p> <p>6059 6068 6329D JD RE501060 ND 0280005250 MH STN6560</p>	<p>STN6570 <i>New</i></p>  <p>317 11 CR </p> <p>24v 7.5kW a:89 b:47.5 o:30</p> <p>JOHN DEERE Agricultural</p> <p>JD RE70475 ND 2280006570 CG 114277</p>
<p>STN6640 <i>New</i></p>  <p>10 CR </p> <p>12v a:80 b:11 o:33</p> <p>CHRYSLER DODGE JEEP VOLKSWAGEN</p> <p>VW 7B0911023 DN 4280006640 WA 17949N</p>	<p>STN6709 <i>New</i></p>  <p>10 CR </p> <p>24v 4.8kW a:89 b:46 o:20</p> <p>CUMMINS ENGINES</p> <p>CU 4996709 DN 4280007120 NR 017120</p>	<p>STN6825 <i>New</i></p>  <p>STN6825WA 12/13 CR</p> <p>12v 5.0kW a:90 b:54 o:30</p> <p>JOHN DEERE</p> <p>JD RE506825 ND 4280000120 WA 19849N</p>	<p>STN6840 <i>New</i></p>  <p>9 CR </p> <p>12v 1.1kW a:74 b:9 o:20</p> <p>TOYOTA Corolla 1.6l 1.8l</p> <p>4A-FE 7A-FE</p> <p>TO 2810016150 DN 2280006840</p>

Starters

Denso

STN7039 New		STN7720 New		STN7802 New		STN8042 New													
 <p>9 CR </p>		 <p>STN7720RB 15 CR </p>		 <p>STN7802WA 13 CR </p>		 <p>10 CR </p>													
12v	2kW	a:92	b:20	o:20	12v	2.0kW	a:76	b:24	o:31	12v	4kW	a:87	b:34	o:20	12v	2.7kW	a:89	b:26	o:20
ISUZU BIGHORN (UBS) CAMPO (KB) FASTER (KB) TROOPER (UBS)		C223 IS 5811001830 DN 65262017039 DO 65262017059		AUDI A3 Q7 VOLKSWAGEN Touareg		VW 059911024K ND 4280007720 MH STN7720		FORD E-Series Vans F-Series Pickups Excursion Trucks E450, F450, F550		7.3L (445) V8 Diesel 7.3L (446) V8 Diesel FO 1876222 ND 2280008420 WA 17802N		HOLLAND CASE		CA 87040161 DN 4280003140 CG 114399					
STN8470 New		STN8510 New		STN8775		STN9030 New													
 <p>11 CR </p>		 <p>STN8510WA 10 CR </p>				 <p>13 CR </p>													
12v	4.8kW	a:89	b:48	o:30	12v	4.0kW	a:91	b:51	o:30						12v	1.4kW	a:48	b:9	o:33
JOHN DEERE		JD AT195414 DN 2280008470		INTERNATIONAL 37MT		ND 2280008510 WA 18406N		IVECO		IV 504357253 DN 4280007360		CHRYSLER DODGE		CH 5030076AB ND 4280003500 WA 19030N					
STN9970		STN9972																	
 <p>10 CR </p>		 <p>13 CR </p>																	
12v	1.8kW	a:76	b:53	o:20	12v	1.7kW	a:76	b:53	o:20										
PORSCHÉ 3.8 I Turbo 3.8 I Carrera GTS 3.4 I Spyder		MA101 MA102 MA121 PO 9A160410300 DN 4280005580 DN DSN970		PORSCHÉ 3.4 Carrera 3.8 Carrera S		MA1.04 MA1.03 MA1.22 PO 9A160410900 DN 4280008700 DN DSN972													

Starters

Ford

<p>STF0011</p> <p style="text-align: right;">STF0011WA</p>  <p>12 CR</p> <p>12v 1.4kW</p> <p>FORD Taurus 3.0L Taurus 3.2L</p> <p>V6</p> <p>FO F3DZ11002B FO F3DU11000BA CG 112601</p>	<p>STF0017</p> <p style="text-align: right;">STF0017WA</p>  <p>12 CR</p> <p>12v 1.4kW</p> <p>FORD Explorer LINCOLN Aviator MERCURY Mountaineer</p> <p>4.6L V8</p> <p>FO 1L2U11000AA FO 1L2U11000AB CG 113813</p>	<p>STF0018</p> <p style="text-align: right;">STF0018WA</p>  <p>9 CR</p> <p>12v a:104 b:18 o:20</p> <p>FORD</p> <p>FO C20F11001A FO C20F11001E HC US628</p>	<p>STF0078</p> <p style="text-align: right;">STB0078RB</p>  <p>10 CR</p> <p>12v 0.75kW a:89 b:29 o:30</p> <p>FORD Granada, Sierra Capri, Transit Cortina Escort</p> <p>J1E, LCE, G1, J2, J3D TV13L, LCN, G2, J1, J3 LAC, LEC, LE, J1F, J1F FO 79AB11000BO FO 82GB11000CA HC CS78</p>
<p>STF0086</p>  <p>10 CR</p> <p>12v 1kW a:89 b:29 o:30</p> <p>FORD Capri, Consul Escort, Scorpio Granada, P 100 Sierra, Taurus</p> <p>LAC, LCE, LCN, LEC, REEORD, MAZDA TL20H, TV20H, NE, LAR NEK, NEP, NYP, LCR FO 85GB11000EA FO 76BB11000AA HC CS86</p>	<p>STF0093</p> <p style="text-align: right;">STF0093WA</p>  <p>10 CR</p> <p>12v 1.4kW a:105 b:4 o:20</p> <p>FORD Ranger, Mustang Explorer B Series Pickups</p> <p>V6</p> <p>FO F87Z11002BA FO F87U11000BA CG 112590</p>	<p>STF0095</p> <p style="text-align: right;">STF0095WA</p>  <p>225 22 ACR</p> <p>12v 1.4kW o:20</p> <p>FORD, LINCOLN, MERCURY DOHC Taurus Continental Sable</p> <p>FO F5OU11000AB FO F6DU11000AA CG 112591</p>	<p>STF0122</p>  <p>10 CR</p> <p>12v 0.6kW a:76 b:13.5 o:22</p> <p>FORD Escort 1.1L, 1.3L Fiesta 1.0L, 1.1L, 1.3L</p> <p>FO 77FB11000EA FO 77FB11000CA HC CS122</p>
<p>STF0123</p> <p style="text-align: right;">STF0123WA</p>  <p>217 10 CR</p> <p>12v 0.8kW a:76 b:13 o:33</p> <p>FORD Escort Fiesta Orion</p> <p>F4B, F6F, FUH, JPA F6C, FUB, GLA, JPC F6D, FUC, JBB, LP1 FO 77FB11000BA FO 79FB11000AC HC CS123</p>	<p>STF0149</p> <p style="text-align: right;">STF0149WA</p>  <p>10 CR</p> <p>12v 1.4kW a:76 b:14 o:30</p> <p>FORD Sierra 2.0L</p> <p>FO V90BB11000BA FO V90BB11000BB HC CS787</p>	<p>STF0278</p> <p style="text-align: right;">STF0278WA</p>  <p>235 10 CR</p> <p>12v 0.85kW a:76 b:13 o:33</p> <p>FORD Escort Fiesta Orion</p> <p>GSE, JBB, FUA, GMA LUG, GLB, JLA, F6D L4B, JLB, LPA, F6B FO 81AB11000BA FO 81AB11000CA HC CS278</p>	<p>STF0324</p>  <p>139.75 9 CR</p> <p>12v 1.1kW a:89 b:29.5 o:30</p> <p>FORD Transit</p> <p>4RB, N6T, NBA 4RC, NAT, NCA LAT, NAV FO 78VB11000DA FO 89VB11000AA HC CS324</p>

Starters

Ford

<p>STF0349</p>  <p>24v 4kW a:92 b:21 o:30</p> <p>DAF FORD Trucks</p> <p>CT 1327A490 FO 82DB11000FA HC CS349</p>	<p>STF0592</p> <p>STF0592WA</p>  <p>12v 0.8kW a:76 b:13.5 o:33</p> <p>FORD, MAZDA, ROVER AUSTIN, Maestro Escort, Fiesta 121 800</p> <p>GLB, JLA, TKB, GUE 20HC51AA, 20HC81 20HDM16, JHC FO 89FB11000CA FO 86GB11000GA HC CS592</p>	<p>STF0609</p> <p>STF0609RB</p>  <p>12v 0.9kW a:76 b:13 o:30</p> <p>FORD Granada 2.0L Sierra 2.0L</p> <p>FO 87BB11000DA FO 87BB11000FA HC CS609</p>	<p>STF0613</p> <p>STF0613WA</p>  <p>12v 2.2kW a:76 b:15 o:33</p> <p>FORD, MAZDA Escort 1.8l Diesel Fiesta 1.8l Diesel Mondeo 1.8l Diesel</p> <p>RTA, RTB RFD, RFK BHDA, BHDB FO 91BB11000BB FO 91BB11000BB HC CS613</p>
<p>STF0625</p> <p>STF0625RB</p>  <p>12v 1.1kW a:76.5 b:4 o:20</p> <p>FORD Scorpio Sierra</p> <p>BOA, BRC, BRD BRE, BRF, BRG B4B, B4C FO 91BB11000KA FO 88BB11000BA HC CS625</p>	<p>STF0708</p>  <p>12v 0.85kW a:89 b:29 o:30</p> <p>FORD Sierra</p> <p>LCS, N4I, REF LSD, NES N4A, RED FO 91BB11000BA FO 86BB11000NA HC CS708</p>	<p>STF0722</p>  <p>12v 1.8kW a:76 b:14.5 o:33</p> <p>FORD P 100 Sierra</p> <p>RFA RFL</p> <p>FO F91BB11000MA FO 91BB11000MA HC CS722</p>	<p>STF0786 <i>New</i></p>  <p>12v 1.4kW a:76 b:14.5 o:30</p> <p>FORD Sierra</p> <p>FO 6565322 FO V90BX11000AA HC CS789</p>
<p>STF0813</p> <p>STF0813WA</p>  <p>12v a:104 b:8 o:20</p> <p>FORD US</p> <p>FO D2AF11001DA FO C7ZF11001A HC US813</p>	<p>STF0814</p> <p>STF0814WA</p>  <p>12v a:104 b:15.5 o:20</p> <p>FORD, LINCOLN MERCURY Capri Galaxie Gran Torino</p> <p>FO D7OZ11002A FO E1AF11002B HC US814</p>	<p>STF0837</p>  <p>12v a:82.5 b:18 o:21</p> <p>JEEP</p> <p>FO D6FF11001AA FO D8FF11001AA HC US837</p>	<p>STF0866</p> <p>STF0866WA</p>  <p>12v a:104 b:15 o:20</p> <p>FORD, LINCOLN MERCURY Mustang Thunderbird Cougar</p> <p>FO F7SU11000A1B FO E7SU11000AA HC US866</p>













Starters

Ford

<p>STF0961</p>  <p>STF0961WA 219 22 ACR 22</p> <p>12v 1.4kW b:22 o:20</p> <p>FORD, JAGUAR MAZDA, MERCURY Mondeo Tribute Cougar</p> <p>LCBA, SGA LCBC, LCBE SEA, CFBA VI 2S7T11000AC FO 93BB11000KD HC CS961</p>	<p>STF0971</p>  <p>STE0971RB STF0971WA STM0971RB 218.5 23 CR 23</p> <p>12v 1.1kW a:71 b:14 o:32</p> <p>FORD, MAZDA Escort Fiesta 121</p> <p>J4B, J4B, J6A J4C, JJK, JJC, J4Q JHC, DHF, DHG, JJK VI 2010001006 FO 95FB11000BG HC CS971</p>	<p>STF0977</p>  <p>STF0977RB STF0977WA STF977WA 258 13 CR 13</p> <p>12v 2.3kW a:92 b:20 o:30</p> <p>FORD, LDV Transit Convoy</p> <p>ET70 4GB, 4GC 4FA, 4FB FO 98VB11000BA FO 97VB11000AA HC CS977</p>	<p>STF1028</p>  <p>STF1028WA 225 10 CR 10</p> <p>12v 1.4kW a:104 b:16 o:20</p> <p>FORD, MAZDA Aerostar Explorer Navajo Ranger</p> <p>FO F07U11000BA WAI F7PU11000KA HC US1028</p>
<p>STF1058</p>  <p>STF1058WA 226 10 CR 10</p> <p>12v 1.5kW a:76 b:3 o:33</p> <p>FORD, MAZDA, MERCURY Cougar Mondeo Tribute Mystique</p> <p>EDBA, L1F EDBB, L1J NGA, RKF FO F3RZ11002B FO 93BB11000JB HC CS1058</p>	<p>STF1107</p>  <p>STF1107WA 225 10 CR 10</p> <p>12v 1.4kW a:76 b:13.5 o:32</p> <p>FORD MAZDA, MERCURY Escort Focus Mondeo</p> <p>EDBA, L1H EYDC, RDA EDDC, RKB FO 8A011840SA FO 96BB11000AB HC CS1107</p>	<p>STF1245</p>  <p>STF1245RB STF1245WA 250.8 19 CR 19</p> <p>12v 2.1kW b:36 o:20</p> <p>FORD, JAGUAR Mondeo Transit X-Type</p> <p>QJBD, QJBC D5BA, HJBA HJBB, HJBC VI 2010001022 FO 1S7U11000BC HC CS1245</p>	<p>STF1246</p>  <p>STF1246RB STF1246WA 251 11 CR 11</p> <p>12v 1.4kW a:78 b:28.5 o:20</p> <p>FORD Mondeo</p> <p>CGBB CHBA CJBA FO 1S7U11000 FO 1S7U11000AB HC CS1246</p>
<p>STF1275</p>  <p>STD1275RB STF1275WA 12 CR 12</p> <p>12v 1.4kW a:61 b:13.5 o:32</p> <p>FORD, MAZDA B-Max Fiesta Fusion 2 1.6L Diesel</p> <p>F6JA, F6JD HHJA, HHJB HHJD, HHJF FO 2S6U11000EA WAI 2S6U11000ED HC CS1275</p>	<p>STF1336</p>  <p>STF1336WA 209 10 CR 10</p> <p>12v 1.4kW a:76 b:15 o:33</p> <p>FORD Tourneo Transit</p> <p>RWPA BHPA HCPA, HCPB FO 2T1411000BA FO 2T1411000BC HC CS1336</p>	<p>STF1341</p>  <p>STF1341WA 11 CR 11</p> <p>12v 1.2kW a:63.5 b:15.5 o:32</p> <p>FORD, MAZDA, VOLVO C-Max Focus S40 V50</p> <p>D6B, D4164T HHDA, HHDB Y6, Y601 FO 3M5T11000CB FO 3M5T11000CF HC CS1341</p>	<p>STF1377</p>  <p>STF1377WA 11 CR 11</p> <p>12v 2.2kW a:63 b:-5.5 o:33</p> <p>FORD, VOLVO C-Max, Focus Galaxy, Kuga Mondeo, S-Max C30, C70, S40, V50</p> <p>D4204T, TXDB TD100A D6B, TYDA VI 2010001036 FO 6G9N11000FA HC CS1377</p>

Starters

Ford

<p>STF1396</p>  <p>STF1396WA 256 10 CR</p> <p>12v 2.2kW a:76 b:14.5 o:33</p> <p>FORD Focus</p> <p>F9DA F9DB FFDA FO 1S4U1100AA FO 98AB11000AD HC CS1396</p>	<p>STF1402</p>  <p>STF1402RB STF1402WA STL1402RB 169 11 CR</p> <p>12v 1.2kW b:29 o:20</p> <p>FORD C-Max Focus</p> <p>QQDD Q7DA CSDA FO 5M5T11000CC FO 4M5T11000AA HC CS1402</p>	<p>STF1403</p>  <p>STF1403RB STF1403WA STL1403RB 169 11 CR</p> <p>12v 1.2kW b:29 o:20</p> <p>FORD, VOLVO C-Max Focus S80 V70</p> <p>B4204S4 B4184S8 QQDD, CSDB FO 5M5T11000BB FO 6G9N11000AB HC CS1403</p>	<p>STF1408</p>  <p>STF1408WA 9 CR</p> <p>12v 2kW a:76 b:6 o:33</p> <p>FORD C-Max, S-Max Focus Galaxy Mondeo</p> <p>FFWA, FFBA KKDA, KHBA QYWA, QYBA FO 6G9N11000EB FO 6G9N11000EC HC CS1408</p>
<p>STF1426</p>  <p>22 ACR</p> <p>12v 1.6kW b:15.5 o:20</p> <p>FORD Mondeo</p> <p>LCBD MEBA REBA FO 3S7T11000AD FO 3S7T11000AB HC CS1426</p>	<p>STF1430</p>  <p>STF1430WA 10 CR</p> <p>12v 1.4kW a:70.5 b:-1.5 o:32</p> <p>FORD, VOLVO Focus Kuga S80 V70</p> <p>HUWA D5254T3 B5254T7 FO 6G9N11000JA FO 6G9N11000JB HC CS1430</p>	<p>STF2016</p>  <p>242 9 CR</p> <p>12v 1.4kW b:15 o:20</p> <p>FORD Ranger Bronco Aerostar</p> <p>FO E3TZ11002E FO E47F10001AA CG 112016</p>	<p>STF2030</p>  <p>225.5 10 CR</p> <p>12v 1.4kW a:106 b:4 o:20</p> <p>FORD, MAZDA Explorer Mustang Navajo Pickup</p> <p>FO F07U11000AA FO F07Z11002A CG 112030</p>
<p>STF2372</p>  <p>STF2372WA 225 9 CR</p> <p>12v 1.2kW a:63.5 b:15.5 o:32</p> <p>FORD, MAZDA, MERCURY Ranger Tempo B3000 Topaz</p> <p>FO F13U11000AA FO F4FU11000AA CG 111370</p>	<p>STF2515 <i>New</i></p>  <p>STF2515WA 11 CR</p> <p>12v 1.2kW a:98 b:29</p> <p>FORD Fiesta V 2.0L</p> <p>VI 2010001024 FO 5S6Y11000AA WA 32515N</p>	<p>STF2584</p>  <p>STF2584WA 226.5 10 CR</p> <p>12v 1.4kW a:76 b:15 o:32</p> <p>FORD, LINCOLN MERCURY Windstar Taurus Continental</p> <p>FO F2DZ11002A FO F3DU11000AA CG 112584</p>	<p>STF2586</p>  <p>STF2586WA 225 10 CR</p> <p>12v 1.4kW a:76 b:15 o:32</p> <p>FORD, LINCOLN Freestar, Taurus, Tempo Windstar Continental</p> <p>FO F68U11000AA FO F8DU11000AA CG 112586</p>

Starters

Ford

<p>STF2588</p>  <p>STF2588WA 225 10 CR</p> <p>12v 1.4kW a:76 b:15 o:33</p> <p>FORD, MAZDA Ranger, Tempo, Taurus Probe, Aerostar B3000</p> <p>FO F89U11000AA FO F89Z11002AA CG 112588</p>	<p>STF2593</p>  <p>STF2593WA 225 12 CR</p> <p>12v 1.4kW a:76 b:15 o:30</p> <p>FORD, LINCOLN Aerostar, Crown, E Mark, Town Car</p> <p>FO F3LU11000AA FO F2VU11000AD CG 112592</p>	<p>STF2597</p>  <p>10 CR</p> <p>12v 1.4kW a:102 b:19 o:20</p> <p>FORD MAZDA MERCURY</p> <p>MA 1F8218400 FO 4R3T11000AA</p>	<p>STF2605</p>  <p>STF2605WA 10 CR</p> <p>12v 1.4kW a:103 b:51 o:20</p> <p>FORD</p> <p>FO XL1UAA FO XL1U11000AA CG 112605</p>
<p>STF2608</p>  <p>STF2608WA 220 12 CR</p> <p>12v 1.4kW a:76 b:14 o:30</p> <p>FORD, LINCOLN Excursion Expedition Blackwood Navigator</p> <p>FO F81U11000AA FO F77U11000AA CG 112608</p>	<p>STF2646</p>  <p>STF2646WA 225 12 CR</p> <p>12v 1.4kW a:76 b:15 o:30</p> <p>FORD, LINCOLN Crown Victoria E150, 250, 350</p> <p>FO F6VU11000AA FO F7LU11000AA CG 112646</p>	<p>STF2963</p>  <p>STF2963WA 243.25 9 CR</p> <p>12v 1.4kW a:105 b:14 o:30</p> <p>FORD, MERCURY Aerostar, Fairmont, Granada LTD Cougar, Marquis Capri</p> <p>FO E2BF11001AA FO E2BZ11002A CG 112963</p>	<p>STF2965</p>  <p>STF2965WA 242 9 CR</p> <p>12v a:105 b:6 o:20</p> <p>FORD Bronco E F</p> <p>FO E3TG11001AA FO E4TZ11002A CG 112965</p>
<p>STF2966</p>  <p>STF2966WA 212 9 CR</p> <p>12v 2.2kW a:76 b:15 o:32</p> <p>FORD MERCURY LINCOLN</p> <p>FO E6DZ11002C FO E6DF11001BA CG 112966</p>	<p>STF3222</p>  <p>STF3222WA 225 10 CR</p> <p>12v 1.4kW a:103.5 b:14.5 o:30</p> <p>FORD, MAZDA Mustang, Ranger B2300</p> <p>FO F17U11000AB FO F1TZ11002A CG 113222</p>	<p>STF3703</p>  <p>STF3703WA 248 12 CR</p> <p>12v 3.6kW a:76 b:47 o:21</p> <p>FORD Excursion E Series Pickup</p> <p>FO 3C3U11000AB FO 3C3Z11002AA CG 113703</p>	<p>STF3762</p>  <p>STF3762WA 250 12 CR</p> <p>12v 3.6kW a:89 b:34 o:20</p> <p>FORD E F</p> <p>FO 1C2411000AA FO 1C3U11000AE CG 113762</p>













Starters

Ford

STF3812	STF3814	STF4407	STF4418
 <p>STF3812WA 11 CR </p>	 <p>STF3814WA 11 CR </p>	 <p>STF4407WA 10 CR </p>	 <p>STF4418WA 10 CR </p>
<p>12v 1.4kW a:83 b:17 o:20</p> <p>FORD, MAZDA Ranger Pickup</p> <p>MZ 1F2018400 FO 1L5T11000AA CG 113812</p>	<p>12v a:65 b:19 o:20</p> <p>FORD, MAZDA, MERCURY LX, SE Focus ZTS, ZTW Escape ZX3, ZX5 Tribute FO 3S4T11000AB Mariner FO 4S4Z11002AA CG 113814</p>	<p>12v a:76 b:4 o:32</p> <p>FORD Focus 2.0L</p> <p>FO 98AB11000EC FO YS4Z11002EB WA 6655N</p>	<p>12v 1.4kW b:15</p> <p>FORD, MAZDA, MERCURY Aerostar, Explorer Mustang, Ranger Pickup FO 4R5T11000AA Mountaineer FO F89U11000BB WA 3273N</p>
STF4580	STF6645 <i>New</i>		
 <p>STF4580WA 22 ACR </p>	 <p>10 CR </p>		
<p>12v 1.4kW a:66 b:46 o:20</p> <p>FORD, MAZDA, MERCURY Escape Tribute Mariner</p> <p>FO 5L8T11000AC FO 5L8Z11002AA WA 6676N</p>	<p>12v 1.4kW a:76 b:18 o:32</p> <p>FORD MERCURI</p> <p>FO F0CF11000BA</p>		

Starters

Hitachi

<p>STH0019</p>  <p>STH0019WA 213 9 CR</p> <p>12v 2.0kW a:95 b:21.5 o:20</p> <p>THERMO KING YANMAR DIVERSE Various Models</p> <p>YA 12968577011 HI S13407A CG 114253</p>	<p>STH0021</p>  <p>9 CR</p> <p>12v a:65 b:19 o:20</p> <p>SUZUKI Engines Marine outboard</p> <p>DF100T, DF140T DF115T, 140HP 115HP, 90HP SZ 3110090J00 HI S114837A NR 014837</p>	<p>STH0192 <i>New</i></p>  <p>STH0192WA 8 cr</p> <p>12v 1.1kW a:74 b:25 o:21</p> <p>BYD F0 1.0</p> <p>BY 371QA3708020 VA D6GC203</p>	<p>STH0211 <i>New</i></p>  <p>9 CR</p> <p>12v 0.9kW a:94.5 b:20.5 o:20</p> <p>YANMAR Industrial</p> <p>4TNE84</p> <p>YA 11963177011 HI S114655 CG 112291</p>
<p>STH0213 <i>New</i></p>  <p>11 CR</p> <p>12v 1.3kW a:88 b:24 o:20</p> <p>YANMAR Agricultural Marine</p> <p>2 Cyl, 0.586L Diesel 2 Cyl, 0.662L Diesel 2T73, 2TR13 YA 12407077010 HI S114230 CG 112674</p>	<p>STH0221 <i>New</i></p>  <p>STH0221WA 9 CR</p> <p>12v 3.0kW a:94 b:20 o:20</p> <p>YANMAR</p> <p>YA 12994077010 HI S14102 MH STH0221</p>	<p>STH0250 <i>New</i></p>  <p>9 CR</p> <p>12v 2.5kW a:95 b:12 o:20</p> <p>FORD Maverick NISSAN Pick Up NISSAN Terrano NISSAN Urvan</p> <p>NI 2330058N00 HI 2506912 MH STH0250</p>	<p>STH0251 <i>New</i></p>  <p>10 CR</p> <p>12v 1.2kW a:81 b:24 o:21</p> <p>NISSAN Primera</p> <p>QR20DE</p> <p>NI 233006N200 HI S114840 MH STH0251</p>
<p>STH0252 <i>New</i></p>  <p>12 CR</p> <p>12v a:67 b:27 o:22</p> <p>NISSAN 350Z V6 3.5 2005-></p> <p>NI 23300EV10A HI S114928A WA 17983R</p>	<p>STH0253 <i>New</i></p>  <p>10 CR</p> <p>12v 1.6kW a:65 b:28 o:22</p> <p>INFINITI G NISSAN 370Z</p> <p>VQ37VHR</p> <p>NI 23300EY00E HI S114932 LE 17934</p>	<p>STH0254 <i>New</i></p>  <p>9 CR</p> <p>12v a:94 b:11 o:20</p> <p>NISSAN Cabstar</p> <p>ZD30H HD5 ZD30 ZD30DDTi NI 23300MA70C HI 2506925 MH STH0254</p>	<p>STH0255 <i>New</i></p>  <p>9 CR</p> <p>12v 2.8kW a:81 b:11 o:20</p> <p>NISSAN Patrol GR II</p> <p>ZD30DDTi</p> <p>NI 23300VC111 HI S14407</p>

Starters

Hitachi

<p>STH0273</p>  <p>9 CR </p> <p>12v 2.5kW a:81 b:11 o:20</p> <p>NISSAN Cabstar 3.0L</p> <p>ZD30 ZD30DDTI ZD30HHD5 NI 23300MA71C HI 2506950</p>	<p>STH0279</p>  <p>8 CR </p> <p>12v 1.2kW a:69 b:12 o:21</p> <p>NISSAN</p> <p>NI 233006N160 HI S114841</p>	<p>STH0281</p>  <p>10 CR </p> <p>12v 1.4kW a:66 b:36 o:21</p> <p>NISSAN Skyline 2.5 L Stagea 2.5 L</p> <p>VQ25DD</p> <p>NI 23300AL600 HI S114847</p>	<p>STH0300</p>  <p>STH0300WA</p> <p>216 9 CR </p> <p>12v 1kW a:70 b:11.5 o:20</p> <p>NISSAN Vanette Sunny</p> <p>A14, GA14S A15, A15S</p> <p>NI 23300H5003 HI S114160E HC JS300</p>
<p>STH0301</p>  <p>STH0301WA</p> <p>8 CR </p> <p>12v 0.8kW a:70 b:13 o:20</p> <p>NISSAN CHERRY</p> <p>N10 VN10</p> <p>NI 23300M0111 HI S114161B HC JS301</p>	<p>STH0302</p>  <p>9 CR </p> <p>12v 0.8kW a:82.5 b:8 o:20</p> <p>NISSAN Bluebird</p> <p>L18 L18S L18T</p> <p>NI 2330078511 HI S114170B HC JS302</p>	<p>STH0304</p>  <p>STH0304WA</p> <p>8, 10 CR</p> <p>12v 0.8kW a:82.5 b:4 o:22</p> <p>NISSAN Praire Stanza 1.6/1.8L</p> <p>NI 23300D0100 HI S114319 HC JS304</p>	<p>STH0307</p>  <p>9 CR </p> <p>12v 1.2kW a:82.5 b:7.5 o:20</p> <p>NISSAN</p> <p>NI 2330047501 HI S114254 HC JS306</p>
<p>STH0309</p>  <p>8, 10 CR</p> <p>12v 0.8kW a:82.5 b:4 o:22</p> <p>NISSAN</p> <p>NI 2330006E10 HI S114390A HC JS309</p>	<p>STH0311</p>  <p>STH0311WA</p> <p>9 CR </p> <p>12v 0.8kW a:75 b:33 o:20</p> <p>HONDA, NISSAN, ROVER</p> <p>Civic Integra 200</p> <p>D16A3 EW2 D15A1 HO 31200PM5L03 HI S114566 HC JS311</p>	<p>STH0517</p>  <p>STH0517WA</p> <p>243 9 CR </p> <p>12v 2.5kW a:95 b:10 o:20</p> <p>FORD NISSAN Maverick King Van Terrano</p> <p>TD25 YD25DDTI TD27T</p> <p>NI 2330080G01 HI S13327 HC JS517</p>	<p>STH0520</p>  <p>STH0520RB</p> <p>8, 9 ACR</p> <p>12v 1.2kW a:70 b:42 o:20</p> <p>NISSAN 100 NX Sunny</p> <p>GA16DS GA14DS E16S</p> <p>NI 2330036A00 HI S114475 HC JS520</p>












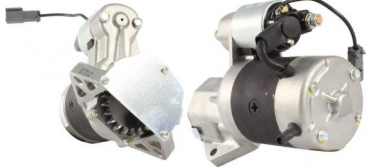









Starters

Hitachi

<p>STH0522</p>  <p>STH0522WA 227.5 9 CR</p> <p>12v 2kW a:82.5 b:11.5 o:20</p> <p>NISSAN SD25 Cabstar</p> <p>NI 2330010G02 HI S1392A HC JS522</p>	<p>STH0539</p>  <p>STH0539WA 218 9 CR</p> <p>12v 2kW a:82.5 b:3.5 o:22</p> <p>NISSAN CD17 Almera Primera Sunny</p> <p>CD20 CD20T NI 2330054A05 HI S13105 HC JS539</p>	<p>STH0540</p>  <p>STH0540WA 333.6 11 CR</p> <p>24v 3.5kW a:105 b:9 o:30</p> <p>NISSAN SD33T Patrol</p> <p>NI 23300C8601 HI S25156 HC JS540</p>	<p>STH0629</p>  <p>9 CR</p> <p>12v 2kW a:89 b:21.5 o:20</p> <p>ISUZU BEDFORD</p> <p>IS 8941155672 HI S13121 HC JS629</p>
<p>STH0639</p>  <p>STN0639WA 223.5 9 CR</p> <p>12v 2kW a:95 b:11 o:20</p> <p>ISUZU, OPEL Campo Trooper Frontera Monterey</p> <p>4JA1 4JG2T 4JB1T IS 8944339120 HI S13112 HC JS639</p>	<p>STH0650</p>  <p>STH0650WA 9 CR</p> <p>12v 2kW a:82.5 b:8 o:20</p> <p>NISSAN, TOYOTA Laurel, Patrol Corolla</p> <p>RD28, RD28T, RB30S 4AFE NI 233000Y000 HI S13102 HC JS650</p>	<p>STH0651</p>  <p>STH0651RB STH0651WA 199 9 CR</p> <p>12v 1.4kW a:78 b:18 o:21</p> <p>OPEL, VAUXHALL Combo Corsa Belmont Nova</p> <p>17D, 15D, X17D X15DT 15DT IZ 8944548911 HI S114850 HC JS651</p>	<p>STH0660</p>  <p>STH0660WA 224 9, 10 CR</p> <p>12v 2kW a:95 b:12 o:20</p> <p>NISSAN Cabstar King Cab Pick Up Terrano</p> <p>TD25 TD27 TD25Ti, TD27T NI 233003T700 HI S13106 HC JS660</p>
<p>STH0672</p>  <p>STH0672WA 8 CR</p> <p>12v 1kW a:70 b:11 o:21</p> <p>NISSAN Primera Hatchback Traveller</p> <p>P10 W10 NI 2330050Y12 HI S114775 HC JS672</p>	<p>STH0729</p>  <p>STH0729WA 194 11 CR</p> <p>12v 1.3kW a:89 b:15 o:20</p> <p>YANMAR TAKEUCHI MINI TRACTOR</p> <p>3T72 3TNA72 3TNA75 YA 12145077010 HI S114625 HC JS729</p>	<p>STH0748</p>  <p>STH0748WA 9 CR</p> <p>24v 3.5kW a:95 b:21 o:20</p> <p>ISUZU NKR YANMAR</p> <p>4BC2 YA 11913177010 HI S2403A HC JS748</p>	<p>STH0753</p>  <p>STH0753RB STH0753WA STM0753RB 214 9 CR</p> <p>12v 1.2kW a:77.5 b:18.5 o:31</p> <p>OPEL, VAUXHALL Corsa Astra Kadett Vectra</p> <p>T4EC1 TC4EE1 17DT OP 1202015 HI S114481A HC JS753</p>

Starters

Hitachi

<p>STH0754</p>  <p>STH0754WA 21 ACR </p> <p>12v 1.4kW a:10 b:13.5 o:20</p> <p>NISSAN Maxima 3.0</p> <p>VG30E</p> <p>NI 2330016E03 HI S114439 HC JS754</p>	<p>STH0755</p>  <p>9 CR </p> <p>12v 1kW a:70 b:11 o:20</p> <p>NISSAN Sunny</p> <p>A14, GA14S</p> <p>NI 23300M5903 HI S114163 HC JS755</p>	<p>STH0759</p>  <p>STH0759WA 221.7 8 ACR </p> <p>12v 0.8kW a:70 b:43 o:20</p> <p>NISSAN 100 Almera Sunny</p> <p>GA14DE GA16DE GA16DS NI 2330085A01 HI S114535 HC JS759</p>	<p>STH0763</p>  <p>8 CR </p> <p>12v 1.2kW a:70 b:12 o:21</p> <p>NISSAN Sunny</p> <p>NI 2330077A01 HI S114517 HC JS763</p>
<p>STH0766</p>  <p>STH0766WA 207 8 CR </p> <p>12v 1.2kW a:70 b:12.5 o:21</p> <p>JAGUAR NISSAN S-Type Primera Sunny</p> <p>GA16I GA14DE GA16DE NI 2330050Y10 HI S114802 HC JS766</p>	<p>STH0767</p>  <p>STH0767WA 9 CR </p> <p>12v 2kW a:95 b:20 o:20</p> <p>ISUZU, OPEL THERMO KING</p> <p>IS 8944299780 HI S1384 HC JS767</p>	<p>STH0776</p>  <p>STH0776WA 229 9 CR </p> <p>12v 2kW a:95 b:19.5 o:20</p> <p>THERMO KING SUPER II VARIOS MODELS</p> <p>IZ 8944299772 HI S13289 HC JS776</p>	<p>STH0778</p>  <p>9 CR </p> <p>12v 1.0kW a:80 b:22.5 o:20</p> <p>ISEKI, ISUZU Agricultural</p> <p>3KC1 3KR1</p> <p>IZ 5811001921 HI S114385 HC JS778</p>
<p>STH0890</p>  <p>STH0890WA 199 8, 9 CR </p> <p>12v 1.4kW a:82.5 b:4 o:22</p> <p>NISSAN 200 Serena</p> <p>SR20DET SR20DE</p> <p>NI 2330052F01 HI S114705 HC JS890</p>	<p>STH0893</p>  <p>STH0893WA 9 CR </p> <p>12v 1.2kW a:82.5 b:8 o:20</p> <p>NISSAN Urvan Caravan</p> <p>E24</p> <p>NI 2330001N00 HI S114527 HC JS893</p>	<p>STH0924</p>  <p>STH0924RB STH0924WA STM0924RB 229.85 8, 10, 11 ACR </p> <p>12v 1.4kW a:75 b:55 o:20</p> <p>INFINITI, NISSAN 130 Maxima</p> <p>VQ30DE VQ20E</p> <p>NI 233002Y900 HI S114801D HC JS924</p>	<p>STH0938</p>  <p>STH0938WA 9 CR </p> <p>12v 1.4kW a:82.5 b:15 o:22</p> <p>NISSAN Terrano Pathfinder D21 Pickup</p> <p>VG30I VG30</p> <p>NI 2330012G03 HI S114503 HC JS938</p>

Starters

Hitachi

<p>STH0941</p>  <p>STH0941WA 188 9 CR</p> <p>12v 1.4kW a:78 b:19 o:21</p> <p>OPEL, VAUXHALL Combo Corsa Corsavan</p> <p>15D, X15DT 15DT, 17D X17D OP 1202026 HI S114850 HC JS941</p>	<p>STH0999</p>  <p>STH0999WA 230 9 CR</p> <p>12v 2.8kW a:95 b:11 o:20</p> <p>OPEL Campo Monterey</p> <p>4JA1 4JG2T 4JX1 OP 1202152 HI S13514 HC JS999</p>	<p>STH1087</p>  <p>STH1087WA 292 11 CR</p> <p>24v 3.5kW a:105 b:33 o:30</p> <p>NISSAN Cabstar</p> <p>FD6 FE6 SD33 NI 23300Z5505 HI S25110 HC JS1087</p>	<p>STH1091</p>  <p>STH1091WA 193.5 11 CR</p> <p>12v 1.2kW a:78 b:20 o:21</p> <p>OPEL Astra Vectra</p> <p>X17DT 17DT TC4EE1 IS 8971502040 HI S114808 HC JS1091</p>
<p>STH1093</p>  <p>STH1093WA 9 CR</p> <p>12v 1.2kW a:82.5 b:11.5 o:20</p> <p>NISSAN Patrol</p> <p>NI 2330037J00 HI S114471A HC JS1093</p>	<p>STH1104</p>  <p>STH1104WA 196.5 9 CR</p> <p>12v 1.4kW a:82.5 b:14.5 o:22</p> <p>NISSAN Terrano Pathfinder D21</p> <p>VG30E NI 2330088G00 HI S114528 HC JS1104</p>	<p>STH1137</p>  <p>STH1137RB STH1137WA 8 CR</p> <p>12v 1.4kW a:82.5 b:44 o:22</p> <p>INFINITI, NISSAN Almera Primera 200 SX Sentra</p> <p>SR20DE SR20D NI 2330063J10 HI S114804 HC JS1137</p>	<p>STH1145</p>  <p>STH1145WA 217 9 CR</p> <p>12v 1kW a:70 b:18 o:20</p> <p>YANMAR Marine</p> <p>YA 12817077010 HI S114303 HC JS1145</p>
<p>STH1158</p>  <p>STH1158RB STH1158WA 194 13 CR</p> <p>12v 1.4kW a:78 b:19 o:21</p> <p>OPEL, VAUXHALL Astra, Combo Corsa, Meriva Signum, Zafira</p> <p>A17DTC, Z17DTH Y17DTL, A17DTR Y17DT, Z17DTL IZ 8980147432 HI S114829 HC JS1158</p>	<p>STH1159</p>  <p>STH1159WA 224 9 CR</p> <p>12v 2.2kW a:95 b:11 o:20</p> <p>NISSAN Trade ECO-T</p> <p>BD30TI BD30II NI 233001S900 HI S13122 HC JS1159</p>	<p>STH1215</p>  <p>STH1215WA 9 CR</p> <p>12v 0.8kW a:75 b:34 o:20</p> <p>HONDA Civic Logo</p> <p>D14A3 D13B7 HO 31200P01003 HI S114566 HC JS1215</p>	<p>STH1225</p>  <p>STH1225WA 10 CR</p> <p>12v 1.7kW a:82.5 b:43 o:21</p> <p>NISSAN Almera Primera</p> <p>SR20DE NI 233004J606 HI S114871 HC JS1225</p>

Starters

Hitachi

<p>STH1301</p>  <p>STH1301WA STM2139 STM2139WA</p> <p>219 8 ACR</p>  <p>12v 1.2kW a:70 b:42 o:20</p> <p>NISSAN Almera 1.4l Almera 1.6l Sunny 1.6l</p> <p>GA14DE GA16DE</p> <p>NI 233001M211 HI S114535 HC JS1301</p>	<p>STH1306</p>  <p>STH1306WA</p> <p>13 ACR</p>  <p>12v 1.4kW a:75 b:61 o:20</p> <p>NISSAN X-Trail 2.0l X-Trail 2.5l</p> <p>QR20DE QR25DE</p> <p>ND 233008H300 HI S114844 HC JS1306</p>	<p>STH1356</p>  <p>STH1356WA</p> <p>192 8 CR</p>  <p>12v 0.9kW a:80 b:13.5 o:20</p> <p>YANMAR Marine</p> <p>3TN66 3TN68</p> <p>YA 11922577011 HI S114653 HC JS1356</p>	<p>STH1390</p>  <p>STH1390WA</p> <p>15 ACR</p>  <p>12v 2.3kW b:38</p> <p>AUDI, SEAT, VW A3 Alhambra Bora Golf</p> <p>ASZ, ATD, AXR BVK, AJM</p> <p>VW 09A911023B HI S13550 HC CS1390</p>
<p>STH1418</p>  <p>STH1418WA</p> <p>10 CR</p>  <p>12v 1kW a:70 b:19 o:20</p> <p>NISSAN, RENAULT Qashqai X-Tail Megane Scenic</p> <p>MR20DE M4R704 M4R700</p> <p>NI 23300EN200 HI S114902R HC CS1418</p>	<p>STH1766 <i>New</i></p>  <p>STH0244</p> <p>222 9 ACR</p>  <p>12v 1.1kW a:67 b:32 o:22</p> <p>YAMAHA MARINE Outboard Motors</p> <p>YA 6E58180010 HI S114323 CG 111766</p>	<p>STH2003</p>  <p>STH2003WA</p> <p>8 CR</p>  <p>12v 1.4kW a:82 b:43 o:22</p> <p>NISSAN, INFINITI 200SX, Primera Sentra, Almera G20</p> <p>PMGR SR20DE SR20DI</p> <p>NI 233002J260 HI S114806 CG 112003</p>	<p>STH2008</p>  <p>201 9 ACR</p>  <p>12v 0.6kW a:67 b:30 o:22</p> <p>SUZUKI Marine DT20, DT25, DT30, DT35 DT40, PU40, PU55</p> <p>SU 3110094400 HI S108112 CG 112008</p>
<p>STH2247</p>  <p>STH2247WA</p> <p>243.25 9 CR</p>  <p>24v 3.5kW a:95 b:21 o:20</p> <p>ISUZU Elf</p> <p>4BJ1</p> <p>IS 8944234520 HI S25121 CG 111247</p>	<p>STH2310</p>  <p>9 CR</p>  <p>12v 0.8kW a:75 b:33 o:30</p> <p>HONDA Civic</p> <p>1.3L 1.5L</p> <p>HO 31200PA0005 HI S114211 HC JS310</p>	<p>STH2343</p>  <p>191 9 CR</p>  <p>12v 1kW a:83 b:7.5 o:20</p> <p>HYUNDAI, NISSAN Elantra Urvan</p> <p>G4EDG H20</p> <p>NI 23300P5110 HI S11491 HC JS343</p>	<p>STH2359</p>  <p>242 9 CR</p>  <p>12v 1.8kW a:82.5 b:10 o:20</p> <p>NISSAN King Cab Pick Up Urvan Fork Lift</p> <p>SD23 SD22 SD25</p> <p>NI 2330031W01 HI S1363A HC JS359</p>





















Starters

Hitachi

<p>STH2364</p>  <p>25 ACR  25</p> <p>12v 1.2kW a:10.5 b:205 o:20</p> <p>NISSAN 1.2L Micra 1.6L Pulsar</p> <p>NI 23300M8502 HI S114345B HC JS364</p>	<p>STH2371</p>  <p>226 9 CR  9</p> <p>12v 2.2kW a:95 b:21.5 o:20</p> <p>TOYOTA THERMO KING YANMAR Various Models</p> <p>YA 12948677011 HI S13207A CG 112371</p>	<p>STH2374</p>  <p>STH2374WA 241 15 CR  15</p> <p>12v 2.5kW a:95 b:22 o:20</p> <p>YANMAR 4LH Marine</p> <p>YA 12125477010 HI S1341D CG 112374</p>	<p>STH2478</p>  <p>STH2478WA 192 8 ACR  8</p> <p>12v 0.8kW a:66 b:16 o:20</p> <p>YANMAR GA, L YAMAHA, HITACHI Marine Industrial Engine</p> <p>YA 11436277010 HI S114651 CG 112478</p>
<p>STH2618</p>  <p>STH2618WA 241 9 CR  9</p> <p>24v 3.2kW a:82.5 b:11 o:20</p> <p>NISSAN Urvan SD22 CONDOR MANLIFT SD23</p> <p>NI 23300R8300 HI S25106 CG 111618</p>	<p>STH2672</p>  <p>STH2672WA 292 9 CR  9</p> <p>12v 3kW a:94.5 b:20 o:20</p> <p>YANMAR 4TNE98 Marine 3TG66</p> <p>YA 12995377010 HI S13138A CG 112672</p>	<p>STH2676</p>  <p>STH2676WA 233 9 CR  9</p> <p>12v 2.2kW a:95 b:20.5 o:20</p> <p>KOMATSU 4TNE84 Fork Lift YANMAR Industrial Engines</p> <p>YA 12990077010 HI S13204 CG 112676</p>	<p>STH2840</p>  <p>225 9 ACR  9</p> <p>12v 0.6kW a:62 b:27 o:22</p> <p>KAWASAKI JS Marine</p> <p>KW 211633002 HI S10861A CG 111840</p>
<p>STH2986</p>  <p>STH2986WA 197 9 CR  9</p> <p>12v 1.4kW b:12 o:20</p> <p>ACURA C32A ISUZU C32A2 Legend 6VD1 SLX IZ 8912762340 HI S114753 CG 112986</p>	<p>STH3191</p>  <p>STH3191WA 301 11 CR  11</p> <p>24v 3.5kW a:105 b:10.5 o:30</p> <p>NISSAN TD42 Patrol 4.2 Diesel</p> <p>NI 2330006J02 HI S25158A CG 113191</p>	<p>STH3210</p>  <p>STH3210WA 240 10 CR  10</p> <p>24v 3.2kW a:105 b:11 o:30</p> <p>NISSAN ED33 Cabstar 3.3 Diesel</p> <p>NI 23300T9010 HI S25302 CG 113210</p>	<p>STH3408</p>  <p>STH3408WA 193 11 CR  11</p> <p>12v 1.4kW a:95 b:19.5 o:20</p> <p>HONDA, YANMAR H22A5 Prelude Marine</p> <p>YA 12924277010 HI S114815 CG 113408</p>

Starters

Hitachi

<p>STH3480</p>  <p>STH3480WA 10 CR </p> <p>12v a:68 b:33 o:20</p> <p>INFINITI FX35 3.5L G35 3.5L M35 3.5L</p> <p>NI 23300AM60A HI S114880 WA 17904N</p>	<p>STH3481</p>  <p>STH3481WA 10 CR </p> <p>12v 1.4kW a:68 b:35 o:21</p> <p>INFINITI FX35 3.5l G35 3.5l M35 3.5l</p> <p>PMGR</p> <p>NI 23300AL900 HI S114881A WA 17927N</p>	<p>STH3557</p>  <p>STH3557WA 9 CR </p> <p>12v 2.5kW a:95 b:10 o:20</p> <p>NISSAN Versa 1.6L</p> <p>HI S13557A MH STH3557</p>	<p>STH3603</p>  <p>STH3603WA STN3603WA 11 CR </p> <p>12v 2.5kW a:105 b:10 o:30</p> <p>NISSAN Forklift Trucks</p> <p>TD42</p> <p>NI 2330006J03 HI S13118A NR 013118</p>
<p>STH3656</p>  <p>STH3656WA 8 CR </p> <p>12v 0.8kW a:68 b:20 o:20</p> <p>YANMAR L100</p> <p>PMDD</p> <p>YA 11435177010 HI S114650 WA 18494N</p>	<p>STH3675</p>  <p>STH3675WA STH9675WA 236 13 ACR </p> <p>24v 5kW a:94 b:44 o:20</p> <p>ISUZU NISSAN Cabstar Bogdan</p> <p>FE6 4BE1 SD33 IZ 8913239352 HI S25505G CG 113675</p>	<p>STH3680</p>  <p>STH3680WA 189 9 CR </p> <p>12v 0.9kW a:88.5 b:16 o:20</p> <p>YANMAR Industrial Engines Agricultural machine</p> <p>2T73 3TNA72</p> <p>YA 11986577010 HI S114656 CG 113680</p>	<p>STH3730</p>  <p>STH3730WA STK3730WA 11 CR </p> <p>24v 11kW a:121 b:45 o:30</p> <p>HITACHI Excavators LINK-BELT Excavators Isuzu Industrials</p> <p>Isuzu Engines 6RB1, 6RB1T 12PB1 IZ 1811001800 HI S21525 NR 017040</p>
<p>STH3818 <i>New</i></p>  <p>9 ACR </p> <p>12v 0.6kW</p> <p>YAMAHA Outboard Motors</p> <p>6H3</p> <p>YA 6H38180010 HI S10897 WA 18311N</p>	<p>STH3823</p>  <p>STH3823WA 10 CR </p> <p>12v 1.0kW a:99 b:10 o:40</p> <p>CHEVROLET Small & Big Block</p> <p>HI S114823 WA 19695N</p>	<p>STH3832</p>  <p>STH3832WA 10</p> <p>12v 1.4kW a:89 b:20 o:20</p> <p>NISSAN</p> <p>HI S114832 MH STH3832</p>	<p>STH3840</p>  <p>10 CR </p> <p>12v 1.2kW a:82.5 b:24.5 o:21</p> <p>NISSAN Primera 2.0L</p> <p>P12E</p> <p>NI 233006N20B HI S114840 MH STH3840</p>

Starters

Hitachi

<p>STH3863 <i>New</i></p> <p>STH3863WA</p>  <p>8 acr </p> <p>12v 1.4kW a:70 b:44 o:20</p> <p>NISSAN E 13, E13 E Cherry 1,3L, 1.5L E 15S, MA10S Micra 1.0L, 1.2L, 1.3L CS13DE, GA14S Sunny 1.3L, 1.5L, 1.6L NI 23300F420A HI S114862 BO 9007045016</p>	<p>STH3877</p> <p>STH3877WA</p>  <p>10 CR </p> <p>12v 1.4kW a:68 b:12.5 o:30</p> <p>RENAULT</p> <p>RE 8200718435 HI S114877C MH STH3877</p>	<p>STH4032</p> <p>STH4032WA</p>  <p>214 9 CR </p> <p>12v 2kW a:95 b:11 o:20</p> <p>NISSAN, OPEL ZD30 RENAULT ZD3202 Terrano ZD3 Movano NI 233002W200 Master HI S13556 CG 114032</p>	<p>STH4098</p> <p>STH4098WA</p>  <p>256.3 9 CR </p> <p>12v 3kW a:95 b:21 o:20</p> <p>GEHL 4TNE106 YANMAR Skid Steer Industrials YA 12390077010 HI S13160 CG 114098</p>
<p>STH4110</p> <p>STH4110WA</p>  <p>11 CR </p> <p>24v 4.5kW a:104 b:35 o:30</p> <p>NISSAN FD6 Cabstar Diesel FE6 Lift Truck F05 SD33T Lift Truck YE03, YGF03 NI 2330025578 HI S25110C NR 015578</p>	<p>STH4112</p> <p>STH4112WA</p>  <p>11 CR </p> <p>24v 4.5kW a:61 b:37 o:30</p> <p>NISSAN ND6 NE6 CK10 NI 2330095006 HI S25112A MH STH4112</p>	<p>STH4308</p> <p>STH4308WA</p>  <p>235 10 ACR </p> <p>12v 1.4kW b:52 o:20</p> <p>AUDI, VW AQA, AUQ A3 AUE, BDE, AGU Bora, Golf 2.8 V6 SHARAN (7M8, 7M9, 7M6) VW 09A911023 FORD GALAXY (WGR) HI S114875 HC CS1477</p>	<p>STH4378 <i>New</i></p> <p>235 9</p> <p>24v 4.5kW a:95 b:18 o:20</p> <p>ISUZU 4BG1 Industrial IZ 8972251991 HI S25177B CG 114378</p>
<p>STH4410 <i>New</i></p> <p>STH4412RB</p>  <p>192 9 CR </p> <p>12v 2.2kW a:48 b:20 o:30</p> <p>OPEL Signum 3.0L Diesel OPEL Vectra P9X715 RENAULT Espace D308L, Z30DT RENAULT Vel Satis RE 8200084114 SAAB 9-5 HI S14410A MH STH4410</p>	<p>STH4412</p> <p>STH4412RB</p>  <p>9 CR </p> <p>12v a:51 b:20 o:20</p> <p>OPEL VAUXHALL Signum 3.0Dti HI S14412 IS 8972542200</p>	<p>STH4551</p> <p>STH4551WA</p>  <p>9 CR </p> <p>12v 2.5kW a:81 b:10 o:20</p> <p>NISSAN Y61 Patrol GR II 3.0 Dtl NI 23300VC101 HI S13551 NR 0113551</p>	<p>STH4828</p> <p>13 acr </p> <p>12v 1.4kW a:71 b:50 o:41</p> <p>MERCURY YAMAHA YA 67F8180002 HI S114828 ME 50804312T1</p>








Starters

Hitachi

STH4870	STH4877 <i>New</i>	STH4955 <i>New</i>	STH6359 <i>New</i>
 <p>STH4870WA 9 CR </p>	 <p>STH4877WA 11 CR </p>	 <p>10 CR </p>	 <p>204 11 ACR </p>
<p>12v 1.4kW a:70 b:12 o:20</p> <p>NISSAN TD48DE Patrol TB45E Safari</p> <p>NI 23300VC20A HI S114870 MH STH4870</p>	<p>12v 1.4kW a:68 b:17 o:20</p> <p>RENAULT 3.5l Espace Vel Satis</p> <p>RE 8200126298 HI S114877 MH ALH4877</p>	<p>12v a:70 b:19 o:20</p> <p>NISSAN L4 1.8l Cube L4 2.0l Sentra MR16DDT Versa NI 23300EN20C HI S114955A MH STH4955</p>	<p>12v 0.6kW a:67 b:32 o:22</p> <p>MARINER 26.2ci - 25 H.P. MERCURY 30.3ci - 30 H.P. YAMAHA 36.1ci - 40 H.P. Marine Outboard MM 5096359M Outboard Engines HI S10880 CG 114675</p>
<p>STH9072 <i>New</i></p>			
 <p>11 ACR </p>			
<p>12v 1.2kW a:70 b:25 o:22</p> <p>JOHN DEERE</p> <p>JD AM879072 HI S114821 YA 11840077010</p>			

Starters

Iskra

<p>STI0022</p>  <p>295 9 CR</p> <p>9</p> <p>12v 2.7kW a:82.5 b:21.5 o:20</p> <p>VM Motori 2105 NEW HOLLAND FERRARI</p> <p>VM 35532022A IS AZJ3140 CG 114265</p>	<p>STI0100</p> <p>STI0100WA</p>  <p>299 10 CR</p> <p>10</p> <p>12v 3.2kW a:89 b:28 o:30</p> <p>JCB, PERKINS 8 Various Models</p> <p>Perkins 6-354 CT 2253148 IS AZE4172 CG 114387</p>	<p>STI0233 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 2.4kW a:82.5 b:24 o:20</p> <p>FERRARI LOMBARDINI PASQUALI RUGGERINI</p> <p>IS AZJ3552</p>	<p>STI0505</p>  <p>9 CR</p> <p>9</p> <p>12v 0.8kW a:67 b:13 o:33</p> <p>YUGO</p> <p>IS AZE3508 IS AZE3502 HC CS505</p>
<p>STI0950</p> <p>STI0950WA</p>  <p>11 CR</p> <p>11</p> <p>24v 4kW a:75 b:37</p> <p>IFA W50</p> <p>IS IS9141 IS AZK5539 HC CS950</p>	<p>STI1605</p>  <p>10 CR</p> <p>10</p> <p>12v 3,2kW a:89 b:32 o:30</p> <p>HATTAT JCB PERKINS</p> <p>Perkins 6-354 JC 71440159 IS 11131605 MH STI4388</p>	<p>STI1784 <i>New</i></p>  <p>10 CR</p> <p>10</p> <p>12v 4.2kW a:89 b:32.5 o:30</p> <p>AGCO LINDNER Tractors</p> <p>1104DE44TA BC 7169479 IS 11131784 NR 011202</p>	<p>STI2575 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 1.4kW a:81 b:23 o:20</p> <p>DEUTZ HITTNER</p> <p>DE 998710700054 IS AZE2575</p>
<p>STI2641 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 2.0kW a:75 b:29 o:20</p> <p>DEUTZ DITER</p> <p>IS AZE2641 AS S9096</p>	<p>STI3139 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 2.7kW</p> <p>BPM FARYMANN MOSA RUGGERINI</p> <p>RU 56351 IS AZJ3139</p>	<p>STI3484</p> <p>STI3484WA</p>  <p>340 11 CR</p> <p>11</p> <p>24v 4kW a:89 b:47.5 o:30</p> <p>VALTRA, SISU 400 Series, 600 Series SK</p> <p>411C, 611C 611CSBA IS AZJ3186 IS IS0595 CG 113484</p>	<p>STI3570</p> <p>STI3570WA</p>  <p>321 11 CR</p> <p>11</p> <p>12v 4.2kW a:89 b:48.5 o:30</p> <p>VALTRA T Various Models</p> <p>Diesel IS AZF4513 IS IS0836 CG 113570</p>

Starters

Iskra

<p>STI3690</p>  <p>STI3690WA 185 8 ACR 8</p> <p>12v 1kW a:66 b:17 o:20</p> <p>YANMAR L Series</p> <p>YA 11436277011 IS 11131186 CG 113690</p>	<p>STI3982 <i>New</i></p>  <p>233.5 9 CR 9</p> <p>12v 2.0kW a:82.5 b:40.5 o:20</p> <p>HATZ Industrial 1D81</p> <p>HZ 50495901 IS 11130923 CG 113982</p>	<p>STI4183 <i>New</i></p>  <p>10 CR 10</p> <p>12v 3kW a:92 b:24 o:30</p> <p>FORD NEW HOLLAND</p> <p>NH 82013134 IS AZF4183 MH STI4183</p>	<p>STI4264</p>  <p>345 11 CR 11</p> <p>12v 4.2kW a:89 b:24 o:30</p> <p>JCB Industrials Various Models</p> <p>JC 32009035 IS 11131292 CG 114264</p>
<p>STI4435</p>  <p>STI4435WA 365.5 10 CR 10</p> <p>24v 7.5kW a:89 b:47 o:30</p> <p>HOWO, SINO, HANIA Various Models Beifan Shaanxi</p> <p>WD615 HW VG1560090001 IS AZF4653 CG 114435</p>	<p>STI4524</p>  <p>10 CR 10</p> <p>12v 3kW a:89 b:51</p> <p>NEW HOLLAND 720, 740, 760 780, 820, 840</p> <p>NH 84447906 IS IS0941 MH STI4524</p>	<p>STI4617 <i>New</i></p>  <p>10 CR 10</p> <p>24v 5.5kW a:100 b:35 o:30</p> <p>KRAMER MINSK TRACTORS ZIL</p> <p>TD 2011,?-260 ?-245 ?-240</p> <p>IS 11131214</p>	<p>STI4684</p>  <p>11 CR 11</p> <p>24v 7.5kw a:89 b:49 o:3</p> <p>CNHTC HOWO SINOTRUK HANIA A7</p> <p>Steyr WD612 BO 0001261015 IS 11131807 MH STI4684</p>
<p>STI6308 <i>New</i></p>  <p>9 CR 9</p> <p>12v 3.1kW a:89 b:51 o:30</p> <p>URSUS ZETOR</p> <p>10520 Z1203 7520 ZE 78350925 IS 11130863</p>	<p>STI6742 <i>New</i></p>  <p>11 CR 11</p> <p>24v 4.0kW a:89 b:24 o:30</p> <p>JCB</p> <p>JC 32009033 IS IS1106 WA AZF4267</p>	<p>STI8245 <i>New</i></p>  <p>10 cr 10</p> <p>12v 3kW a:82 b:38 o:20</p> <p>CLAAS RENAULT AGRICULTURE SPAREX</p> <p>6068T2 4045T 6068T2 RE 7700072251 IS AZF4582 SP 36207</p>	<p>STI9846</p>  <p>12 CR 12</p> <p>24v 5.5kW a:88 b:50 o:30</p> <p>BOMAG DEUTZ MATROT SENNEBOGEN WIRTGEN</p> <p>BFM1015 BF4M2012 BF6M1015 DE 01183035 IS 11131871</p>

Starters

LU

<p>STL0025</p>  <p>9 CR </p> <p>12v 0.8kW a:82.5 b:13 o:30</p> <p>TALBOT</p> <p>DU 534005 LU LRS00323 HC CS130</p>	<p>STL0026</p>  <p>STL0026WA 9 CR </p> <p>12v 1.4kW a:89 b:26 o:22</p> <p>JAGUAR XK34 XJ 6 8L XK42 LU 25742 LU 25684 HC CS591</p>	<p>STL0027</p>  <p>9 ACR </p> <p>12v 0.8kW a:74 b:33 o:20</p> <p>DAIHATSU Charade 1.0L DH 2810087706 LU LRS00495 HC JS360</p>	<p>STL0106</p>  <p>STL0106WA 333 10 CR </p> <p>12v 2.8kW a:89 b:47 o:30</p> <p>CASE 188D Agricultural machine 207D LU LRS240 LU 26433 HC CS106</p>
<p>STL0107</p>  <p>STL0107WA 10, 11 CR</p> <p>12v 2.0kW a:89 b:29 o:30</p> <p>MASSEY FERGUSON</p> <p>DU 6180 LU 26413 HC CS107</p>	<p>STL0109</p>  <p>STL0109WA 309.5 10 CR </p> <p>12v 2kW a:92 b:25 o:30</p> <p>BUHRER EICHER MASSEY FERGUSON Agricultural machine PS 2873143 Industrial Engine LU 27480 HC CS109</p>	<p>STL0146</p>  <p>9 CR </p> <p>12v 0.8kW a:89 b:29 o:20</p> <p>ROVER GROUP 1.0L MG 1.3L BMC RO GXE4529 LU 26618 HC CS528</p>	<p>STL0148</p>  <p>STL0148WA 9 CR </p> <p>12v 1.4kW a:73 b:40 o:20</p> <p>LAND ROVER, LEYLAND LU 26267 HC CS587</p>
<p>STL0200</p>  <p>STL0200WA 319.5 10 CR </p> <p>12v 2.8kW a:92 b:21 o:30</p> <p>BUHRER 158CID FORD 175CID NEW HOLLAND 256CID Agricultural machine FO D8NN11000CA Various Models LU 26329 HC CS200</p>	<p>STL0201</p>  <p>STL0201WA 313 10 CR </p> <p>12v 2.8kW a:89 b:29 o:30</p> <p>EICHER MASSEY FERGUSON MF 1868285R3 LU 26410 HC CS201</p>	<p>STL0247 <i>New</i></p>  <p>9 CR </p> <p>12v 0.8kW a:89 b:60.5 o:20</p> <p>HILLMAN FM3 MG FM11 MORRIS TRIUMPH CH 71801824 VAUXHALL LU 25024 CG 111103</p>	<p>STL0336</p>  <p>STL0336WA 309 10 CR </p> <p>12v 2.8kW a:92 b:21 o:30</p> <p>FORD Trucks 4 CYL Cargo 6 CYL FO 1624968 LU 26360 HC CS336</p>


Starters

LU

<p>STL0337</p>  <p>STB0337RB STI0337RB STL0337RB</p> <p>272 12, 13 CR</p> <p>12v 2.5kW a:92 b:21 o:30</p> <p>FORD 4AA LANCER BOSS 4AB Transit 4CC Various Agriculture FO 835FX11000BB LU 26355 HC CS337</p>	<p>STL0345</p>  <p>STL0345WA</p> <p>307 10 CR</p>  <p>10</p> <p>12v 3kW a:92 b:20 o:30</p> <p>FORD 6 CYL Cargo 1506CA 1307AA BU 860106 LU 26312 HC CS345</p>	<p>STL0579</p>  <p>10 ACR</p>  <p>10</p> <p>12v 0.9kW a:75 b:40 o:20</p> <p>AUSTIN, ROVER GROUP 20HA50AA, 20HC51AA Maestro 2.0 16HC37, 20HSC, 20H Montego 2.0 16H, 20T4H, 20M4F 216, 220 RO ADU9362 820 LU 26722 HC CS579</p>	<p>STL0590</p>  <p>STL0590WA</p> <p>9 CR</p>  <p>9</p> <p>12v 2.1kW a:91.5 b:18 o:30</p> <p>LAND ROVER 23L Defender 19J Land Rover 256T Range Rover FI 943227446 LU 27460 HC CS590</p>
<p>STL0604</p>  <p>STL0604WA</p> <p>335 11 CR</p>  <p>11</p> <p>12v 2.8kW a:89 b:47 o:30</p> <p>CHANG FENG 634DS VALTRA 620DS Agricultural machine 634DA Industrial Engine MT 443115144620 LU 26242 HC CS604</p>	<p>STL0623</p>  <p>10 CR</p>  <p>10</p> <p>12v 2.8kW a:89 b:49.5 o:30</p> <p>MASSEY FERGUSON Perkins AT6-354 Diesel Tractors Farm Perkins 6-354 Diesel FI 63227601 LU 27601 HC CS623</p>	<p>STL0693</p>  <p>309 10 CR</p>  <p>10</p> <p>12v 2.4kW a:89 b:28 o:30</p> <p>MASSEY FERGUSON 20HD ROVER 20T4H MF 3000 800 FI 63227486 LU 27435 HC CS693</p>	<p>STL0701</p>  <p>10 CR</p>  <p>10</p> <p>12v 2.8kW a:89 b:47 o:30</p> <p>BEDFORD 220 TJ 330 TL LU 26416 LU 27545 HC CS701</p>
<p>STL0703</p>  <p>STL0703WA</p> <p>315 10 CR</p>  <p>10</p> <p>12v 2.8kW a:89 b:28.5 o:30</p> <p>ATLAS BEDFORD FIAT-ALLIS MASSEY FERGUSON PE 2873A102 PERKINS LU 26294 HC CS703</p>	<p>STL0705</p>  <p>309 11 CR</p>  <p>11</p> <p>12v 2kW a:92 b:25 o:30</p> <p>CASE 188D FIAT-ALLIS 207D MASSEY FERGUSON Agricultural machine KI OK6S818400 LU 27463 HC CS705</p>	<p>STL0720</p>  <p>11 ACR</p>  <p>11</p> <p>12v 0.9kW a:75 b:41 o:20</p> <p>ROVER 1.6L MG 2.0L Maestro Montego RO ADU8983 216 LU 25411 HC CS720</p>	<p>STL0851</p>  <p>16 ACR</p>  <p>16</p> <p>12v 0.65kW a:77 b:34 o:30</p> <p>BRIGGS & STRATTON Industrial Engines BG 391423 LU LRS02170 HC US851</p>

Starters

LU

<p>STL0889</p>  <p>STL0889WA 340 10 CR</p> <p>12v 2.8kW a:89 b:47 o:30</p> <p>ERF, LDV E Series International, Roadrunner</p> <p>Cummins B PW 8212852 LU 27564 HC CS889</p>	<p>STL0944</p>  <p>STL0944WA 335 11 CR</p> <p>12v 3kW a:89 b:48 o:30</p> <p>VALTRA, ZETOR 500, 600, 700 Series 8000 Series, 800 Series 3000 Series, 4000 Series 5000 Series</p> <p>620DS, 620DW 634DA, 634DS MF 3539390M91 BO 0001367032 HC CS944</p>	<p>STL0946</p>  <p>STL0946WA 309 10 CR</p> <p>12v 2.1kW a:89 b:29 o:30</p> <p>BALKANCAR CONVEYANCER MASSEY FERGUSON MATBRO</p> <p>PR 2873A103 LU 27473 HC CS946</p>	<p>STL0947</p>  <p>10 CR</p> <p>12v 2.1kW a:92 b:24 o:20</p> <p>LEYLAND LDV Sherpa 1, 8</p> <p>PT 20500261 LU 27431 HC CS947</p>
<p>STL0948</p>  <p>STL0948WA 10 CR</p> <p>12v 2.8kW a:89 b:29 o:30</p> <p>ATLAS COPCO DRONNINGBORG JCB MASSEY FERGUSON SEDDON ATKINSON</p> <p>JC 71440159 LU 27503 HC CS948</p>	<p>STL0949</p>  <p>336.5 10 CR</p> <p>12v 2.1kW a:89 b:29.5 o:30</p> <p>DAF FG Series</p> <p>SK 91428729 LU 27465 HC CS949</p>	<p>STL0994</p>  <p>314.5 10 CR</p> <p>12v 2.8kW a:89 b:29 o:30</p> <p>MASSEY FERGUSON MF100 MF200 MF300 MF4000</p> <p>JC 71440005 LU 27568 HC CS994</p>	<p>STL0997</p>  <p>10 CR</p> <p>12v 2.1kW a:92 b:20 o:30</p> <p>LAND ROVER 100 2.25l Diesel LR 2.3l Diesel</p> <p>PT 20500139 LU 27446 HC CS997</p>
<p>STL1032</p>  <p>STL1032WA 311 10 CR</p> <p>12v 2.8kW a:92 b:21 o:30</p> <p>EICHER MASSEY FERGUSON PERKINS Agricultural machine Industrial Engine</p> <p>RE 6005700082 LU 27522 HC CS1032</p>	<p>STL1056</p>  <p>10 CR</p> <p>12v 1.4kW a:78 b:16 o:20</p> <p>ROVER 820i Montego</p> <p>16V 2.0L RO ADU1239 LU 26804 HC CS1056</p>	<p>STL1270</p>  <p>10 ACR</p> <p>12v 1.4kW a:75 b:40 o:20</p> <p>MG, ROVER MGF TF, ZR 25, 45, 218, 620 400, 418, 420, 800</p> <p>18K4K, 18K4K 18K4F RO GNU4771 LU LRT00186 HC CS1270</p>	<p>STL2092</p>  <p>372 10 CR</p> <p>24v 5.2kW a:89 b:47 o:30</p> <p>PERKINS Various Models</p> <p>CA 1321G033 LU LRT00611 CG 112091</p>

Starters

LU

STL2248	STL2277	STL2452	STL2579
 <p>366 11 CR</p> <p>11</p>	 <p>261 10 CR</p> <p>10</p>	 <p>13 CR</p> <p>13</p>	 <p>371 9 CR</p> <p>9</p>
<p>12v 3.6kW a:89 b:48.5 o:30</p> <p>CUMMINS Various Models</p> <p>CA 1320G934 LU LRS01536 CG 112248</p>	<p>12v 1.8kW a:89 b:30 o:30</p> <p>PERKINS Various Models VOLVO PENTA</p> <p>Komatsu</p> <p>VO 859722 LU LRS01339 CG 112277</p>	<p>12v 3.6kW a:89 b:48 o:30</p> <p>PERKINS Various Models</p> <p>CA 1320F906 LU LRT00619 CG 110452</p>	<p>12v 6.5kW a:110 b:27 o:30</p> <p>IVECO Various Models</p> <p>IVE 802208 LU LRS02221 CG 112579</p>
<p>STL2627 <i>New</i></p>	<p>STL2655</p>	<p>STL2798</p>	<p>STL3453</p>
 <p>11 ACR</p> <p>11</p>	 <p>10 CR</p> <p>10</p>	 <p>372 11 CR</p> <p>11</p>	 <p>370.5 9 CR</p> <p>9</p>
<p>12v 2.1kW a:92 b:29 o:30</p> <p>LISTER-PETTERS Engines Tractors</p> <p>ST1 Engine (CCW) ST2 Engine (CCW) ST3 Engine (CCW) LI 20413273 LU 26270 WA 17643N</p>	<p>12v 3.6kW a:89 b:30 o:30</p> <p>BEDFORD, CLARK Various Models</p> <p>CA 1327040 PE 2873A026 CG 112655</p>	<p>24v 7.8kW a:89 b:48 o:30</p> <p>FORD Marine FORD Agricultural Various Models</p> <p>CA 1327A570 CG 111798 MH STL2798</p>	<p>24v 6.5kW a:110 b:27 o:30</p> <p>IVECO, Marine Aifo</p> <p>CA 1231G938 LU LRS02222 CG 113453</p>

Starters

Magneti Marelli

STE0002	STE0090	STE0111	STE0112
 <p>STE0002WA 10 CR</p> <p>12v 1.8kW a:77 b:9 o:30</p> <p>HYUNDAI H1</p> <p>HY 3610042450 MM 63187001 MH STE0002</p>	 <p>STE0090 236.5 9 CR</p> <p>12v 0.8kW a:62 b:13 o:33</p> <p>FIAT, LANCIA, SEAT Fiorino, Panda A 112 Ibiza, Fura</p> <p>100GL000, 141B000 112A000, 112B2000 100GL7000, 146A000 FI 77175430 MM 63220703 HC CS90</p>	 <p>STE0111WA 9 CR</p> <p>12v 0.7kW a:76 b:27.5 o:20</p> <p>ALFA ROMEO Alfa</p> <p>AR 510332 MM 63221302 HC CS131</p>	 <p>9 CR</p> <p>12v 0.9kW a:64 b:10 o:33</p> <p>FIAT, LANCIA, SEAT Stada</p> <p>FI 4412878 MM 63221330 HC CS133</p>
STE0134	STE0137	STE0141	STE0142
 <p>233.75 9 ACR</p> <p>12v 0.5kW a:62 b:8 o:30</p> <p>FIAT, RENAULT 126 500 Manager</p> <p>126A000, 126A1048 141A000, 110F000 MIDR060226W FI 77276430 MM 63201004 CG 110608</p>	 <p>9 CR</p> <p>12v 0.8kW a:67 b:14 o:33</p> <p>FIAT 238</p> <p>FI 4474918 MM 63220746 HC CS363</p>	 <p>11 CR</p> <p>12v 1kW a:82.5 b:21 o:33</p> <p>FIAT LANCIA</p> <p>DU 531035 MM 63221404 HC CS379</p>	 <p>9 CR</p> <p>12v 0.5kW a:62 b:11 o:30</p> <p>FIAT Panda</p> <p>FI 4451826 MM 63220506 HC CS380</p>
STE0145	STE0147	STE0152	STE0217 New
 <p>9 ACR</p> <p>12v 0.6kW a:62 b:13 o:30</p> <p>FIAT, SEAT</p> <p>FI 77129430 MM 63220900 HC CS397</p>	 <p>9 CR</p> <p>12v 0.8kW a:67 b:12 o:33</p> <p>FIAT, LANCIA 127, 242 Series Fiorino 1.0L, Ritmo Y10</p> <p>127A000, 124B3000, 132A2000 127A6000 146A5046, 156B000 FI 77168430 MM 63220734 HC CS147</p>	 <p>10 CR</p> <p>12v 2.2kW a:82.5 b:23 o:33</p> <p>FIAT Brava</p> <p>FI 46414610 MM 63222206 HC CS992</p>	 <p>STE0217WA 9 CR</p> <p>12v 0.8kW a:66 b:12 o:33</p> <p>FIAT LANCIA ZASTAVA</p> <p>128A000 138B2000 149C1000 FI 77145430 MM 63220701 HC CS91</p>



Starters

Magneti Marelli

<p>STE0240</p>  <p>STE0240WA 340 9, 10 CR</p> <p>12v 3kW a:110 b:26 o:30</p> <p>FIAT, IVECO BENFRA, FIAT-ALLIS Agricultural machine Industrial Engines</p> <p>804505359 804505 804506 FI 4988513 MM 63216831 HC CS240</p>	<p>STE0285</p>  <p>STE0285WA 224 11 CR</p> <p>12v 0.8kW a:64.5 b:11 o:33</p> <p>FIAT, LANCIA Elba, Fiorino, Regata Ritmo, Tempra, Uno Delta, Prisma Dedra</p> <p>146A3011, 146C6000 149A000, 138A3000 159B9000, 138C2048 FI 7666528 MM 63221431 HC CS285</p>	<p>STE0289</p>  <p>STE0289WA 293 9 CR</p> <p>12v 2kW a:110 b:27 o:30</p> <p>ALFA ROMEO, FIAT Ducato, Argenta 131, 132 AR 6</p> <p>814461, 814465 CRD93L, 814467220 814467 FI 77515430 MM 63217154 HC CS289</p>	<p>STE0333</p>  <p>STE0333 8 CR</p> <p>12v 3.5kW a:110 b:26.5 o:30</p> <p>RENAULT Master 2.4 Trafic 2.5</p> <p>S8U730, S8U731 814061240, S8U720 S8U722 RE 5000612741 MM 63216851 HC CS333</p>
<p>STE0344</p>  <p>STE0344WA 9, 11 CR</p> <p>12v 0.8kW a:62 b:12 o:33</p> <p>SEAT Ibiza Malaga Ronda</p> <p>021A1000, 021C1000 021B2000, 021C2000 021D2000 FI 532027A MM 63221832 HC CS344</p>	<p>STE0364</p>  <p>STE0364 232 11 CR</p> <p>12v 1.1kW a:67 b:12.5 o:33</p> <p>FIAT, LANCIA Panda, Uno Delta</p> <p>156A5000, 146B1000 127A5000, 836C4000 836A2000, 835C2000 FI 77235430 MM 63221533 HC CS364</p>	<p>STE0368</p>  <p>STE0368 230 9, 11 CR</p> <p>12v 0.9kW a:67 b:13 o:33</p> <p>FIAT Fiorino Penny Van Premio Uno, 127</p> <p>100GL000, 127A6000 100GL048, 127A5000 146A5000, 127A011 FI 63221500 MM 63221530 HC CS368</p>	<p>STE0393</p>  <p>STE0393 9 CR</p> <p>12v 0.9kW a:66 b:23 o:30</p> <p>FIAT, LANCIA Croma Regata Ritmo Delta</p> <p>154A048, 160A1046 149A2000, 149A4000 149A4000, 138AR048 FI 5991832 MM 63221539 HC CS393</p>
<p>STE0536</p>  <p>STE0536WA 219 9, 11 CR</p> <p>12v 1.1kW a:64 b:12.5 o:33</p> <p>FIAT, LANCIA Tempra, Tipo, Uno Dedra</p> <p>160A1046, 836A4000 159A3048, 835C1000 835A1046, 835A1000 FI 63223035 MM 63221637 HC CS536</p>	<p>STE0584</p>  <p>STE0584 243.35 11 CR</p> <p>12v 1.4kW a:66 b:23 o:30</p> <p>FIAT, LANCIA, ALFA ROMEO Coupe, Tempra, Tipo Dedra, Delta Alfa 155</p> <p>075A1000, 835C2000 835A8000, 836C4000 AR67203 FI 63223431 MM 63223436 HC CS584</p>	<p>STE0689</p>  <p>STE0689WA 295.65 9 CR</p> <p>12v 2.5kW a:110 b:27 o:31</p> <p>FIAT Campagnola IVECO Daily I</p> <p>814461200, 8140072700 814027S, 8140472700 8140472721, 814047R2790 FI 4856055 MM 63217410 HC CS689</p>	<p>STE0692</p>  <p>STE0692 9 ACR</p> <p>12v 0.6kW a:62 b:9 o:30</p> <p>FIAT 126</p> <p>FI 7533231 MM 63251871 HC CS692</p>

Starters

Magneti Marelli

<p>STE0796</p>  <p>STE0796WA 206 9, 10 CR</p> <p>12v 0.8kW a:64 b:11.5 o:31</p> <p>FIAT, LANCIA Brava Punto Marea Seicento</p> <p>176B2000 188A4000 156C046 FI 7772459 MM 63101002 HC CS796</p>	<p>STE0800</p>  <p>9 CR</p> <p>12v 0.9kW a:64.5 b:14 o:33</p> <p>FIAT Punto 1.6</p> <p>176A9000 FI 46774417 MM 63102008 HC CS800</p>	<p>STE0883</p>  <p>STE0883WA 9 CR</p> <p>12v 0.9kW a:64.5 b:11 o:33</p> <p>FIAT Punto Tempra Uno 1.4</p> <p>176A4000 159A2000, 159A3046 835C1000, 146A8000 FI 7772462 MM 63223303 HC CS883</p>	<p>STE0963</p>  <p>STE0963RB 9 CR</p> <p>12v 0.8kW a:64 b:11 o:31</p> <p>FIAT, LANCIA Uno 1.1 Y10 1.1</p> <p>156C046, 146C3000 FI 46231511 MM 63221834 HC CS963</p>
<p>STE0965</p>  <p>11 CR</p> <p>12v 1.4kW a:66 b:23 o:30</p> <p>FIAT, LANCIA Croma Kappa 2.0</p> <p>154C3046, 834B146 154C4046 838A4000 FI 7727483 MM 63223532 HC CS965</p>	<p>STE0975</p>  <p>STE0975WA 206 8, 9 CR</p> <p>12v 0.9kW a:64 b:11 o:33</p> <p>CITROEN, FIAT, LANCIA Jumpy Brava Punto Tempra</p> <p>1580SPI 182A4000 159B9000 FI 46417006 MM 63103022 HC CS975</p>	<p>STE0981</p>  <p>STE0981WA 205.5 9 CR</p> <p>12v 0.9kW a:64 b:10 o:31</p> <p>FIAT Brava Marea</p> <p>182A5000 182A3000 FI 46419332 MM 63102003 HC CS981</p>	<p>STE1038</p>  <p>STE1038WA 206 9 CR</p> <p>12v 0.8kW a:62 b:12 o:33</p> <p>FIAT Panda Uno</p> <p>1170A1046 1170A1000 146A000 FI 63222905 MM 63222908 HC CS1038</p>
<p>STE1043</p>  <p>STE1043WA 8, 9 CR</p> <p>12v 0.9kW a:64.5 b:11 o:32</p> <p>FIAT Brava Marea</p> <p>182A6000 182A4000 FI 46431502 MM 63222901 HC CS1043</p>	<p>STE1052</p>  <p>STE1052RB 9 CR</p> <p>12v 0.9kW a:64 b:11 o:31</p> <p>LANCIA Y 1.4L</p> <p>840A2000 840A4000 FI 46401068 MM 63223108 HC CS1052</p>	<p>STE1076</p>  <p>9 CR</p> <p>12v 0.8kW a:64 b:10 o:31</p> <p>FIAT, LANCIA Punto 1.2 Y 1.2</p> <p>176B1000, 176B4000 840A3000 FI 63222909 MM 63223109 HC CS1076</p>	<p>STE1109</p>  <p>STE1109WA 276 9 CR</p> <p>12v 2.6kW a:81.5 b:23.5 o:33</p> <p>CITROEN, FIAT IVECO, PEUGEOT Jumper Ducato Boxer</p> <p>814043S 814063 814067 IV 131955508 MM 63114014 HC CS1109</p>

Starters

Magneti Marelli

<p>STE1124</p>  <p>STE1124WA 9 CR </p> <p>12v 2.2kW a:81.5 b:10 o:30</p> <p>ALFA ROMEO, FIAT Alfa 156, Alfa 166 Brava, Bravo, Marea Strada, Palio 1.3</p> <p>839A6000, AR32501, AR34202 182B4000, 182B9000 182A8000, 182A7000, 182A4000 FI 46463250 MM 63114010 HC CS1124</p>	<p>STE1125</p>  <p>STE1125WA 190 8, 9 CR</p> <p>12v 0.8kW a:64 b:12 o:32</p> <p>FIAT Palio, Strada Panda, Doblo Seicento Siena</p> <p>141C2000, 178A1000 156C046, 178E2000 176B2000, 187A1000 FI 46763530 MM 63101022 HC CS1125</p>	<p>STE1142</p>  <p>STE1142WA 8 CR </p> <p>12v 0.9kW a:70 b:11.5 o:21</p> <p>NISSAN Primera 1.6L</p> <p>GA16DE FI 63192000 MM 63102000 HC JS1142</p>	<p>STE1156</p>  <p>STE1156WA 8 CR </p> <p>12v 1.4kW a:82 b:43 o:22</p> <p>NISSAN Primera</p> <p>SR20DE NI 233002F200 MM 63191001 HC JS1156</p>
<p>STE1170</p>  <p>9 CR </p> <p>12v 2.2kW a:82 b:9.5 o:30</p> <p>LANCIA Kappa</p> <p>838A3000, 838A7000 FI 46406938 MM 63222204 HC CS1170</p>	<p>STE1171</p>  <p>STE1171WA 239 9 CR </p> <p>12v 2.2kW a:76 b:21 o:22</p> <p>BMW, LAND ROVER, OPEL X25DT Omega Range Rover X</p> <p>M51D25 M57306D1 BM 12412247391 MM 63222005 HC CS1171</p>	<p>STE1191</p>  <p>STE1191WA STV1191RB 9, 11 CR</p> <p>12v 1.4kW a:66 b:11 o:33</p> <p>FIAT, LANCIA Brava Marea Dedra Lybra</p> <p>182A6000 182A4000 186A4000 FI 46451529 MM 63111008 HC CS1191</p>	<p>STE1192</p>  <p>STE1192WA 191 8, 10 CR</p> <p>12v 0.8kW a:64 b:11 o:31</p> <p>FIAT, LANCIA Palio 1.2i Punto 1.2i Y</p> <p>188A5000 178E2000 176A7000 FI 51833880 MM 63101015 HC CS1192</p>
<p>STE1195</p>  <p>9 CR </p> <p>12v 1.4kW a:66 b:9 o:30</p> <p>LANCIA Kappa</p> <p>838A1000, 838A6000 838A2027 FI 46406974 MM 63223639 HC CS1195</p>	<p>STE1206</p>  <p>STE1206WA 179.5 9 CR </p> <p>12v 0.8kW a:70 b:14.5 o:22</p> <p>SMART (MCC) Cabrio City Fortwo Crossblade</p> <p>M160910 MB 0003188V006 MM 63101007 HC CS1206</p>	<p>STE1265</p>  <p>STE1265WA 215 11 CR </p> <p>12v 1.8kW a:76 b:21 o:32</p> <p>BMW 3 5</p> <p>M47D20 M47204D1 BM 12412247063 MM 63113001 HC CS1265</p>	<p>STE1434</p>  <p>STE1434WA 9 CR </p> <p>12v 2.3kW a:81.5 b:1.5 o:33</p> <p>FIAT Ducato</p> <p>F1AE0481D F1AE0481N FI 55195967 MM 63521093 HC CS1434</p>

Starters

Magneti Marelli

STE2520		STE3654		STE3655		STE6327														
<p>STE2520WA</p> <p>343 9 CR</p> 		<p>STE3654WA</p> <p>292 10 CR</p> 		<p>STE3655WA</p> <p>291 10 CR</p> 		<p>11 CR</p> 														
24v	4kW	a:89	b:47.5	o:30	12v	3kW	a:89	b:30.5	o:30	12v	3kW	a:89	b:30.5	o:30	12v	1.3kW	a:64	b:12	o:31	
CUMMINS	Cummins	JCB 69, PERKINS	Perkins	HATTAT TARIM	Perkins	ALFA ROMEO	AR3503,AR38501													
FIAT-ALLIS		Industrial Engines	Sisu	JCB		Alfa 145, 146 1.4 16V	AR34103,AR16201													
Agricultural machine		MASSEY-FERGUSON MF		PERKINS		Alfa 166 2.0 16V	AR32310,AR32301													
Industrial Engines	FI 77563430		PK 2873K404	Agricultural machine	PK 2873K405	Alfa GTV 2.0 16V	FI 71211270													
	MM 30281017		MM 63280040	Industrial Engines	MM 63280041	Alfa Spider 2.0	MM 60664128													
	CG 110520		CG 113654		CG 113655															

Starters

Magnetron

<p>STG0156</p>  <p>STG0156WA 9 ACR 9</p> <p>12v 0.8kW a:76 b:25 o:20</p> <p>SKODA Rapid</p> <p>OHV 74212 74212X SK 443115142112 MG 9141312 HC CS156</p>	<p>STG0503</p>  <p>STB0503 STG0503WA 342 9 CR 9</p> <p>12v 2.7kW a:89 b:48 o:30</p> <p>CASE, PAYLOADES Various Trucks</p> <p>IN 3218677R91 MG 9142805 HC CS503</p>	<p>STG0550</p>  <p>STB0550RB STG0550WA 294 9 CR 9</p> <p>12v 2.4kW a:89 b:21 o:30</p> <p>FENDT, RENAULT Agricultural machine</p> <p>D226 TD226</p> <p>RE 7700525064 MG 443115142801 HC CS550</p>	<p>STG0798</p>  <p>STG0798RB STG0798WA 194.75 9 ACR 9</p> <p>12v 1kW a:76 b:27 o:20</p> <p>SKODA, VW Favorit Felicia Forman Caddy</p> <p>OHV 136L 781135 VW 6U0911023 MG 443115141310 HC CS798</p>
<p>STG0806</p>  <p>STG0806WA 433 11 CR 11</p> <p>24v 8kW a:74 b:55</p> <p>TATRA LIAZ</p> <p>MG 9187340 MG 443115187340 HC CS806</p>	<p>STG1204</p>  <p>STG1204WA 199 9 ACR 9</p> <p>12v 1kW a:50 b:20 o:31</p> <p>SKODA Fabia 1.0l Fabia 1.4l Forman 1.3l Octavia 1.4l</p> <p>AME, ATZ AQW, ARV AQV, AZE VW 047911023C MG 443115141331 HC CS1204</p>	<p>STG3133</p>  <p>STG3133WA 9 CR 9</p> <p>12v 1kW a:67 b:15 o:30</p> <p>DAEWOO Lanos 1.4l</p> <p>MEMZ317</p> <p>MG 9141322 MH STG3133</p>	<p>STG3269</p>  <p>STG3269WA 235 10 CR 10</p> <p>12v 3kW a:89 b:32 o:30</p> <p>DAEWOO CASE, PERKINS Avia Industrial Engines Agricultural machine</p> <p>SK 9142702 MG 443115142702 CG 113269</p>
<p>STG3723</p>  <p>STG3723WA 190 9cr 11</p> <p>12v 2.7kW a:89 b:47 o:30</p> <p>DAEWOO GAZEL UAZ Hunter</p> <p>2.4 4CT90 Andoria</p> <p>SK 9142723 MG 443115142723 MH STG3723</p>	<p>STG3742</p>  <p>STG3742WA 11 CR 11</p> <p>12v 2.7kW a:89 b:45 o:30</p> <p>DAEWOO URSUS 1012 4.5, 1014 4.5 ZETOR 10011, 10045, 12011</p> <p>SK 9142742 MG 447115144722 MH STG3742</p>	<p>STG3745</p>  <p>STG3745WA 10 CR 10</p> <p>12v 2.7kW a:89 b:47 o:30</p> <p>DAEWOO JOHN DEERE</p> <p>MG 9142745 MH STG3745</p>	

Starters

Mando

<p>STA0004</p>  <p>11 ACR </p> <p>12v 2.2kW a:88 b:44</p> <p>KIA Pregio 2.7L K2700 2.7L</p> <p>KI OK60118400 MD MG122423 WA 32534N</p>	<p>STA0396</p>  <p>STA0396WA 8 CR </p> <p>12v 0.7kW a:77 b:17.5 o:22</p> <p>HYUNDAI, MITSUBISHI G4EH, G4EB, G4ECG Accent G4EK, G4DG, 4G12T Excel 4G32TC, G32BT, 4G32 Colt KI 3610011150 Tredia 1.6 MD MC107023 HC JS396</p>	<p>STA0448</p>  <p>11 CR </p> <p>24v 5kW a:95 b:21 o:20</p> <p>HALLA HEAVY INDUSTRIES VOLVO</p> <p>VO F13210170 MD TM000A08601AS NR 010448</p>	<p>STA0643</p>  <p>STA0643WA 8 CR </p> <p>12v 0.9kW a:77 b:11 o:22</p> <p>HYUNDAI, MITSUBISHI G4EH, G4EK, G4ECG Accent, Lantra, Scoupe G4DJ, 4G93, 4G15 Galant Lancer KI 3610021770 Space Runner MD MC109032 HC JS643</p>
<p>STA0922</p>  <p>STA0922WA 207.5 8 CR </p> <p>12v 1.2kW a:77 b:10 o:22</p> <p>HYUNDAI, KIA G4GF Coupe, Elantra 4G61 Lantra, Matrix G4BB Tiburon, Cerato HY 3610023000 MD M52100 HC JS922</p>	<p>STA0923</p>  <p>STA0923WA 8 CR </p> <p>12v 1.2kW a:77 b:17.5 o:22</p> <p>HYUNDAI G4GF KIA 4G61 Tucson, Sonata G4GC Cerato HY 3610023100 Lantra MD M53436 HC JS923</p>	<p>STA1000</p>  <p>STA1000WA 8 CR </p> <p>12v 0.9kW a:74 b:15 o:32</p> <p>FORD TB, S6D, T8 KIA FE, A3E, A5D MAZDA B3, B5, FE Rio, Sportage HY 361002Y100 323, 626, MX MD MC109028 HC JS1000</p>	<p>STA1004</p>  <p>STA1004RB STM1004RB STM1004WA 8 CR </p> <p>12v 1.2kW a:77 b:9.5 o:22</p> <p>HYUNDAI 4G63 KIA G4CN MITSUBISHI G4GM Galant, Space Wagon HY 3610032640 Lantra MD MP112042 HC JS1004</p>
<p>STA1303</p>  <p>STA1303WA 187.5 9 CR </p> <p>12v 0.8kW a:75 b:14 o:22</p> <p>HYUNDAI, KIA G4HC, G4HCE, G4HD Atos, Atos Prime G4HG, G4HE Getz, i10 Picanto HY 3610002500 MD M56290 HC JS1303</p>	<p>STA1304</p>  <p>STA1304WA 213 8 CR </p> <p>12v 1.2kW a:77 b:18 o:22</p> <p>HYUNDAI, KIA G4JP, G4GC Santa Fe 4G64, G4BP Trajet G4JSG, G4JPEG Sorento HY 3610038090 Sportage MD M60082 HC JS1304</p>	<p>STA1349</p>  <p>STA1349WA 223 9 CR </p> <p>12v 1.7kW a:82.5 b:24 o:22</p> <p>HYUNDAI D3EA Accent D4FA Getz Matrix HY 3610027510 MD BN3610027510 HC JS1349</p>	<p>STA1351</p>  <p>STA1351WA STM1351RB 239 10, 12 CR </p> <p>12v 2.2kW a:77 b:9 o:22</p> <p>HYUNDAI, KIA, MITSUBISHI D456T, K74T Pajero D4BA, D4BH L 200 K2500 2.5 HY 3610042250 Porter MD TM000A34101 HC JS1351</p>












Starters

Mando

<p>STA1355</p>  <p>STA1355RB STA1355WA</p> <p>240 10 CR</p>  <p>10</p> <p>12v 2.2kW a:78 b:16.5 o:22</p> <p>HYUNDAI KIA H1 Satellite Sorento</p> <p>HY 361004A000 MD TM000A23601 HC JS1355</p>	<p>STA1365</p>  <p>STA1365WA</p> <p>223.4 8 CR</p>  <p>8</p> <p>12v 1.7kW a:77 b:17 o:22</p> <p>HYUNDAI, KIA Accent, Elantra, Getz ix20, Matrix, i30 Cee'd, Cerato</p> <p>D4FA, D4FB D4FBL, D4FCM</p> <p>HY 361002A000 MD TM000A33401 HC JS1365</p>	<p>STA1370</p>  <p>STA1370WA</p> <p>8 CR</p>  <p>8</p> <p>12v 1.2kW a:77 b:9.5 o:22</p> <p>HYUNDAI, KIA Coupe 2.0L Ceed 2.0L Pro Ceed 2.0L</p> <p>G4GF G4GC</p> <p>HD 3610023000 MD M52100 HC JS1370</p>	<p>STA1433</p>  <p>8 CR</p>  <p>8</p> <p>12v 1.2kW a:77 b:17 o:22</p> <p>HYUNDAI, KIA Coupe 2.0L i30 2.0L Cee'd 2.0L Sportage 2.0L</p> <p>G4GF G4GCG</p> <p>KI 3610023170 MD TM000A38001 HC CS1433</p>
<p>STA1462</p>  <p>STA1462WA</p> <p>8 CR</p>  <p>8</p> <p>12v 0.9kW a:77 b:21</p> <p>HYUNDAI i30</p> <p>G4FA G4FC</p> <p>KI 361002B020 MD S0001250303 HC CS1462</p>	<p>STA2146</p>  <p>9 ACR</p>  <p>9</p> <p>12v 0.8kW a:77 b:62</p> <p>MERCURY</p> <p>ME 50819968A2</p>	<p>STA2305</p>  <p>9 CR</p>  <p>9</p> <p>12v 2kW a:100 b:33 o:30</p> <p>HYUNDAI FORK LIFT</p> <p>HY 3610042C10 MD MG122447 NR 012447</p>	<p>STA2330 <i>New</i></p>  <p>10 cr</p>  <p>10</p> <p>12v 2.5kW a:67 b:26 o:22</p> <p>NISSAN Infiniti Navara (D40) 3.0 dCi 4WD</p> <p>NI 233005X20C VA 458416 MH STA2330</p>
<p>STA2501 <i>New</i></p>  <p>10 cr</p>  <p>10</p> <p>12v 2.7kW a:81 b:34 o:20</p> <p>HYUNDAI Bering</p> <p>LD15</p> <p>HY 3610051000 VA TM000A22501</p>	<p>STA2539 <i>New</i></p>  <p>11 CR</p>  <p>11</p> <p>12v 2.0kW a:80 b:24 o:22</p> <p>KIA, HYUNDAI Ix 35 2.0L 2010- Santa Fe II 2.2L 2009- Sorento II 2.2L 2009- Sportage 2.0L 2010-</p> <p>D4HA Diesel D4HB Diesel</p> <p>HY 361002F000 LU M42373 MH STA2539</p>	<p>STA3020</p>  <p>217 8 CR</p>  <p>8</p> <p>12v 1.2kW a:70 b:10 o:20</p> <p>HYUNDAI, KIA Sonata, Santa Fe, XG Sportage Optima, Sedona</p> <p>G6BA G6AV</p> <p>HY 3610037210 MD M62957 CG 113020</p>	<p>STA3456</p>  <p>386 11 CR</p>  <p>11</p> <p>24v 6kW a:89 b:48 o:30</p> <p>DAEWOO Fork Lift DOOSAN</p> <p>D1146 DH220-3</p> <p>DA 65262017049 MD M000A0301 CG 113456</p>
























Starters

Mando

<p>STA3500</p>  <p>STA3500WA 9 CR </p> <p>24v 5kW a:60 b:16 o:20</p> <p>HYUNDAI D4DD County HD78</p> <p>HY 3610045500 MD S0001251025 VA 602037</p>	<p>STA3505</p>  <p>STA3505WA 11 CR </p> <p>24v 5kW a:60 b:18 o:20</p> <p>HYUNDAI EURO3 HD65 HD72 HD78 County</p> <p>HY 3610045501 MS 220509</p>	<p>STA3521</p>  <p>STD3521WA 8 CR </p> <p>12v 1.2kW a:70 b:26 o:20</p> <p>HYUNDAI, KIA CM10 Azera, Sonata H1 Magentis, Cerato Optima, Rondo Sportage</p> <p>HY 3610025020 DR 8000285 MS 220477</p>	<p>STA3727</p>  <p>STA3727WA 286 11 CR </p> <p>12v 2.7kW a:89 b:47 o:30</p> <p>BOBCAT Skid loader S175, S185 S250, S310 Kubota V2200, V2205 V3300</p> <p>BB 6676957 MD TM000A28901 CG 113727</p>
<p>STA3805</p>  <p>STA3805WA 213 8 CR </p> <p>12v 1.2kW a:70 b:18 o:22</p> <p>HYUNDAI G6BV Sonata G6AV, G6BVG KIA G6CTG, G6BAG Magentis HD 3610037110 Sportage MD M62956 CG 113805</p>	<p>STA4184</p>  <p>11 CR </p> <p>24v 4.5kW a:85 b:22 o:21</p> <p>KIA BESTA [TP]</p> <p>KI 0K71E18400B MD MG122420 MH STA4184</p>	<p>STA4841</p>  <p>11 acr </p> <p>12v 2.2kW a:88 b:44 o:30</p> <p>KIA Pregio BESTA 2.7L</p> <p>KI 0VS0118400A VA TM000A04901 MH STV4841</p>	<p>STA4901 <i>New</i></p>  <p>12v 2kW a:63 b:7 o:33</p> <p>KIA J3 HYUNDAI SSANGYONG</p> <p>HY 361004X901 MD 031114272 MH STL4901</p>
<p>STA6132 <i>New</i></p>  <p>8 CR </p> <p>12v 1.2kW a:69 b:11 o:11</p> <p>HYUNDAI, KIA Santa fe Optima Magentis RONDO</p> <p>HY 361003E020 WA 19023N</p>	<p>STA8415 <i>New</i></p>  <p>10 cr </p> <p>12v 2.4kW a:66 b:30 o:22</p> <p>INFINITI 30d [VX9] FX II (S51) M (Y51)</p> <p>NI 233001BY0A VA TS24E7 VA 458415</p>		

Starters

Mitsuba

<p>STU0071</p>  <p>9 CR </p> <p>12v a:30 b:38</p> <p>YAMAHA Motorcycles FJ1100 FJ1200</p> <p>FJ1100 FJ1200</p> <p>YA 36Y818001000 MU SM229D WA 18734N</p>	<p>STU0073</p>  <p>STU0073WA 212 9 CR </p> <p>12v 1.2kW a:75 b:33 o:20</p> <p>HONDA Civic</p> <p>D16B2, D16Y7 D16Y5, D16Y8 D16Y6, D16W4 HO 31200P2MA61 MU SM44209 CG 113390</p>	<p>STU0075</p>  <p>STU0075WA 205 9 CR </p> <p>12v 1.6kW a:75 b:33 o:20</p> <p>HONDA Prelude</p> <p>H22A5 H22A4</p> <p>HO 31200P5M902 MU SM44224 CG 113393</p>	<p>STU0080</p>  <p>STU0080WA 9 CR </p> <p>12v 1.6kW a:75 b:40 o:20</p> <p>HONDA C-RV</p> <p>K24A</p> <p>HO 31200PPAA02 MU SM61206 WA 17844N</p>
<p>STU0236 <i>New</i></p>  <p>10 ACR </p> <p>12v 0.6kW a:27 b:45 o:20</p> <p>HONDA TRX Motorcycles</p> <p>HO 31200HM7003 MU SM13449 CG 114715</p>	<p>STU0319</p>  <p>STU0319WA 9 CR </p> <p>12v 1kW a:75 b:33 o:20</p> <p>HONDA ROVER Civic</p> <p>D14A1 D16A6 D15B2</p> <p>200 400</p> <p>HO 31200P28G02 MU SM42207 HC JS319</p>	<p>STU1017</p>  <p>STU1017WA 9 CR </p> <p>12v 1.2kW a:75 b:40 o:20</p> <p>HONDA Civic CRX</p> <p>HO 31200PR3004 MU SM40201 HC JS1017</p>	<p>STU2010</p>  <p>STU2010WA 189 9 CR </p> <p>12v a:30 b:41 o:30</p> <p>KAWASAKI Motorcycles KAWASAKI Marine POLARIS Marine SEA DOO Marine</p> <p>KW 211633709 MU 3240110 CG 112010</p>
<p>STU2011</p>  <p>STU2011WA 182 9 CR/ACR</p> <p>12v 0.6kW a:30 o:00</p> <p>YAMAHA Marine</p> <p>YA 63M8180000 MU 63M81800 CG 112011</p>	<p>STU2917</p>  <p>STU2917WA 168 9 CR </p> <p>12v a:30 b:41 o:20</p> <p>YAMAHA Marine YAMAHA Motorcycles</p> <p>YA 64X818000000 MU SM13237 CG 111917</p>	<p>STU3024</p>  <p>STU3024WA 211 9 CR </p> <p>12v 1.6kW a:75 b:33 o:20</p> <p>HONDA Shuttle Accord Odyssey Prelude</p> <p>F22B8 F22A1 F22A6 HO 31200P13904 MU SM40203N CG 113024</p>	<p>STU3205</p>  <p>STU3205WA 9 CR </p> <p>12v 1.2kW a:75 b:32 o:20</p> <p>HONDA ACCORD Civic Concerto</p> <p>HO 31200PNDA01 MU SM61205 WA 17816N</p>







Starters

Mitsuba

<p>STU3211</p>  <p>STU3211WA 9 CR </p> <p>12v 1kW a:76 b:32 o:20</p> <p>HONDA Civic 1.6L ACURA EL 1.6L</p> <p>HO 31200P2A004 MU SM44210 WA 17721N</p>	<p>STU3392</p>  <p>STU3392WA 210 9 ACR </p> <p>12v 1.6kW a:75 b:33 o:20</p> <p>ACURA V6 HONDA J30A1 Accord CL NSX</p> <p>HO 31200P8AA01 MU SM44201 CG 113392</p>	<p>STU3394</p>  <p>197 9 CR </p> <p>12v 1kW a:75 b:40 o:20</p> <p>HONDA Civic 1.6L</p> <p>D16B5 B16A2 D16Y7 HO 31200P2TJ01 MU SM44213 CG 113394</p>	<p>STU3398</p>  <p>STU3398WA 208 9 CR </p> <p>12v 1.6kW a:75 b:33 o:20</p> <p>ACURA F23A7 HONDA F22B2 ISUZU F22B1 Shuttle HO 31200P0AA04 CL MU SM442202 CG 113398</p>
<p>STU3400 <i>New</i></p>  <p>9 CR </p> <p>12v 1.6kW a:75 b:33 o:20</p> <p>ACURA EI 1.6L HONDA Civic 1.6L</p> <p>HO 31200P2EA51 MI SM442081N CG 113400</p>	<p>STU3409</p>  <p>209 9 CR </p> <p>12v 1.6kW a:75 b:32.5 o:20</p> <p>HONDA Prelude 2.2L SEE</p> <p>HO 31200P5M901 MU SM442228 CG 113409</p>	<p>STU3528</p>  <p>STU3528WA 160 9 CR </p> <p>12v a:30 b:41 o:20</p> <p>POLARIS All-Terrain Vehicle 4-Wheeler</p> <p>PL 3084981 MU 3084981 CG 113528</p>	<p>STU3541</p>  <p>255 CR</p> <p>12v a:48 o:20</p> <p>YAMAHA Motorcycles XV</p> <p>YA 5A8818006000 MU SM13277 CG 113541</p>
<p>STU3648</p>  <p>209 9 ACR </p> <p>12v 1.6kW a:75 b:33 o:20</p> <p>HONDA Odyssey 3.5L Pilot 3.5L ACURA MDX 3.5L</p> <p>J35A3 J35A4</p> <p>HO 31200PGKA01 MU SM44231 CG 113648</p>	<p>STU3722 <i>New</i></p>  <p>12v a:29 b:35 o:20</p> <p>HONDA Motorcycles VTR250 Interceptor 249cc</p> <p>HO 31200KV0722 HO 31200KV0721 WA 18658N</p>	<p>STU3821</p>  <p>STU3821WA 210 9 CR </p> <p>12v 1.6kW a:75 b:33 o:20</p> <p>ACURA K24A4 HONDA Accord TSX</p> <p>HO 31200RAAA01 MU SM61209 CG 113821</p>	<p>STU4137</p>  <p>STU4137WA 215 9 CR </p> <p>12v 1.2kW a:75 b:34 o:20</p> <p>HONDA Civic 1.8L</p> <p>R18A1 R18A4</p> <p>HO 31200RNAA50 MU SM71001 CG 114137</p>

Starters

Mitsuba

STU5016 New	STU6002 New	STU6120 New
 <p style="text-align: right;">10 CR </p>	 <p style="text-align: right;">9 CR </p>	 <p style="text-align: right;">9 ACR </p>
<p>12v a:30 b:40 o:20</p>	<p>12v 1.4kW a:74 b:32 o:20</p>	<p>12v 1.0kW a:74 b:40 o:20</p>
<p>SUZUKI Atctic Cat</p> <p style="text-align: right;">AR 3545016 MS 3110038F00 WA 18809N</p>	<p>HONDA</p> <p style="text-align: right;">HO 31200PK2006 MI SM30222 MH SM30223</p>	<p>HONDA Insight</p> <p style="text-align: right;">HO 31200PHMA01 MU SM61202 WA 17814N</p>











Starters

Mitsubishi

<p>STM0028</p>  <p>STM0028WA 274 9 CR</p> <p>12v 2kW a:70 b:51 o:21</p> <p>HONDA, ACURA Legend NSX</p> <p>C32A1 C30A3, C30A4, C32B2</p> <p>MI M2T80081 MI M2T80681 CG 113042</p>	<p>STM0029</p>  <p>STM0029WA 210 9 ACR</p> <p>12v 0.8kW a:74 b:30 o:20</p> <p>MITSUBISHI Engines</p> <p>WI 91273082 MI M2T32581 CG 113141</p>	<p>STM0030</p>  <p>STM0030WA 8 CR</p> <p>12v 1.4kW a:70 b:28 o:22</p> <p>NISSAN Altima</p> <p>PMGR</p> <p>NI 233009E010 MI M0T85081 CG 114625</p>	<p>STM0031</p>  <p>STM0031WA 10 CR</p> <p>24v 4kW a:80 b:34 o:10</p> <p>ONAN</p> <p>Engines MDL6</p> <p>MI M2T65771 NR 011550 CG 114635</p>
<p>STM0032</p>  <p>STM0032WA 10 CR</p> <p>12v 1.2kW a:65 b:7 o:22</p> <p>CHRYSLER, DODGE 300 Charger Magnum</p> <p>PMGR</p> <p>CH 4896464AC MI M0T21071 MH STM0032</p>	<p>STM0033</p>  <p>8, 9 CR</p> <p>12v 1kW a:70 b:21 o:20</p> <p>NISSAN, MERCURY</p> <p>NI 23300B5013 MI M2T20281 HC JS384</p>	<p>STM0034</p>  <p>8 CR</p> <p>12v 0.8kW a:74 b:20 o:20</p> <p>MAZDA</p> <p>MI M3T20381 MI M3T27782 HC JS395</p>	<p>STM0035</p>  <p>8 CR</p> <p>12v 1.4kW a:70 b:16 o:21</p> <p>MITSUBISHI Outlander</p> <p>3.0L</p> <p>MI M000T22371 MI M0T22371 MH STM0035</p>
<p>STM0036</p>  <p>19 ACR</p> <p>12v 1.6kW</p> <p>ACURA TL 3.2 TL 3.5</p> <p>HO 31200RDAA01 MI M0T15971 MH STM0036</p>	<p>STM0037</p>  <p>12 CR</p> <p>12v 1.4kW a:77 b:57 o:21</p> <p>INFINITI QX4</p> <p>PMGR</p> <p>MI M0T50371 MI M0T50471 WA 17834N</p>	<p>STM0038</p>  <p>13 CR</p> <p>12v 1.4kW a:54 b:33 o:31</p> <p>HONDA Marine Outboards</p> <p>BF115 BF130</p> <p>HO 31200ZW5A0032 MI M0T60381 WA 19603N</p>	<p>STM0039</p>  <p>8 CR</p> <p>12v 0.9kW a:76 b:20 o:22</p> <p>KUBOTA Industrials Tractors Compact</p> <p>D1105-E23-D22 D1105-E2 D1005-E KU 6C14059211 MI M0T90282 WA 18396N</p>

Starters

Mitsubishi

<p>STM0040</p>  <p>STM0040WA 22 ACR </p> <p>12v 1.4kW b:38 o:20</p> <p>MAZDA MPV 3.0</p> <p>MZ AJ5118400 MI M1T96681 WA 17862N</p>	<p>STM0041</p>  <p>STM0041WA 9 ACR </p> <p>12v 0.8kW a:65 b:40 o:30</p> <p>JOHN DEERE Engine</p> <p>MI M2T43381 MI M3T10977 WA 17332N</p>	<p>STM0042</p>  <p>STM0042WA 11 CR </p> <p>12v 5.5kW a:92 b:51</p> <p>INTERNATIONAL Harvester Trucks Medium&Heavy-Duty Truck</p> <p>39MT Cummins Caterpillar WL 91273423 DR M9T71478 MH STM0042</p>	<p>STM0043</p>  <p>STM0043WA 12 CR </p> <p>12v 5.5kW a:90 b:50 o:30</p> <p>VOLVO MD13</p> <p>WL 9019542 MI M009T72079 MH STM0043</p>
<p>STM0044</p>  <p>STM0044WA 12 CR </p> <p>12v 5.5kW a:91 b:45 o:30</p> <p>39MT</p> <p>DR 39MT MI M9T72178 MH STM0044</p>	<p>STM0102</p>  <p>STM0102WA 287.6 9 CR </p> <p>12v 3.6kW a:60 b:18 o:20</p> <p>MITSUBISHI Canter FE Series</p> <p>4D34-2AT, 4D34 4D33</p> <p>MI M008T55071 MI M8T55071 CG 114418</p>	<p>STM0124</p>  <p>STM0124WA 10 CR </p> <p>12v 1kW a:74 b:17 o:33</p> <p>MAZDA 2</p> <p>MZ ZJ3818400 MI M0T32771 HC CS1469</p>	<p>STM0128</p>  <p>STM0128WA 11 CR </p> <p>12v 1.7kW a:75 o:22</p> <p>SZ 3110065G00 MI M1T80181 HC CS1504</p>
<p>STM0177</p>  <p>STM0177WA 10 CR </p> <p>24v 5kW a:77 b:11</p> <p>CATERPILLAR, MITSUBISHI Excavator Gas</p> <p>317B 318B CT 0R1903 MI M8T60771 NR 0160771</p>	<p>STM0303</p>  <p>STM0303WA 8, 9 CR</p> <p>12v 0.8kW a:82.5 b:8 o:20</p> <p>NISSAN King Van Laurel Urvan Vanette</p> <p>L20A L24 Z20 NI 23300E3010 MI M3T27581 HC JS303</p>	<p>STM0305</p>  <p>STM0305WA 227.5 8 ACR </p> <p>12v 0.8kW a:70 b:42 o:20</p> <p>NISSAN Micra VW Polo</p> <p>BNM MA10S CG10DE NI 23300M8000 MI M003T27781 HC JS305</p>	<p>STM0318</p>  <p>STM0318WA 9 CR </p> <p>12v 1.2kW a:77 b:19 o:22</p> <p>MITSUBISHI, NISSAN 280ZX Bluebird Laurel</p> <p>W910 JC31 MI M2T53083 MI M2T53081 HC JS318</p>

Starters

Mitsubishi New

<p>STM0362</p>  <p>STM0362WA 206.8 8 CR</p> <p>12v 1.1kW a:76 b:19 o:20</p> <p>MITSUBISHI Fork Lift FG</p> <p>MI M003T15971 MI M3T25981 HC JS362</p>	<p>STM0363</p>  <p>10, 11 CR</p> <p>12v 1.8kW a:82.5 b:8 o:20</p> <p>NISSAN</p> <p>NI 23300V0711 MI M2T54871 HC JS363</p>	<p>STM0380</p>  <p>STM0380WA 189 8, 9 CR</p> <p>12v 1kW a:66 b:4 o:20</p> <p>CHEVROLET, GEO SUZUKI Grand Vitara Jimny Samurai</p> <p>G16B, J20A G13BB, M13A G13A, G13BA MI M1T72481 MI M1T72483 HC JS380</p>	<p>STM0408 New</p>  <p>11 CR</p> <p>12v 1.4kW a:78 b:41 o:20</p> <p>MAZDA MX-5 III</p> <p>L828 L8DE</p> <p>MA LFG118400 MI M0T36371 DE DRS0408</p>
<p>STM0428 New</p>  <p>13 CR</p> <p>12v 3.5kW a:98 b:32 o:30</p> <p>YALE Lift Truck</p> <p>HY 220052106R MI M3T66572 NR 010471</p>	<p>STM0512</p>  <p>STM0512WA 190.5 8 CR</p> <p>12v 0.8kW a:75 b:7.8 o:22</p> <p>SUZUKI, SUBARU Alto, Baleno, Swift Wagon Justy</p> <p>G10B, F10DN, G13BA G13A, M13A, G13BB EF13 SZ 3110092330 MI M3T33781ZC HC JS512</p>	<p>STM0553</p>  <p>STM0553WA 9 CR</p> <p>24v 3.2kW a:60 b:17 o:31</p> <p>MITSUBISHI Canter 3.9 Diesel</p> <p>4D342AT4 4D30A 4D31 MI M2T67881 MI M2T66873 HC JS553</p>	<p>STM0627</p>  <p>STM0627RB STM0627WA 216 8 CR</p> <p>12v 1.4kW a:82 b:43 o:22</p> <p>INFINITI NISSAN Primera Sunny G20</p> <p>SR20DE SR20DI</p> <p>NI 2330063J11 MI M1T78881 HC JS627</p>
<p>STM0628</p>  <p>STA0628RB STM0628RB STM0628WA 206.5 8 CR</p> <p>12v 1.2kW a:77 b:17 o:22</p> <p>HYUNDAI, KIA MAZDA, MITSUBISHI Lantra, Sonata Eclipse, Gallant L200, L300, Pajero</p> <p>4G63, 4G64 G4CS, G4CR G4CP, 4G67 HY 3610032630 MI M0T70481 HC JS628</p>	<p>STM0633</p>  <p>STA0633RB STM0633WA 197 8 ACR</p> <p>12v 0.85kW a:70 b:20.5 o:20</p> <p>FORD, KIA MAZDA, OPEL Pride, 121 Frontera Aspire, Festiva</p> <p>B3, B1 B116 4JB1T FO F4BZ11002B MI M3T33081 HC JS633</p>	<p>STM0634</p>  <p>10 CR</p> <p>12v 2.2kW a:88 b:2 o:22</p> <p>MAZDA 323</p> <p>1.7L</p> <p>MI M2T92171 MI M2T92172 HC JS634</p>	<p>STM0635</p>  <p>STM0635RB STM0635WA 12 CR</p> <p>12v 1.7kW a:67 b:16 o:33</p> <p>MAZDA MPV 929</p> <p>MZ JE1618400B MI M1T74381 HC JS635</p>































Starters

Mitsubishi

<p>STM0636</p>  <p>STM0636WA 10 CR </p> <p>12v 1.4kW a:74 b:15 o:33</p> <p>MAZDA B Series Pickup</p> <p>MI M1T71881A MI M1T71881 HC JS636</p>	<p>STM0637</p>  <p>STH0637RB STM0637RB STM0637WA 208 10 CR </p> <p>12v 1.4kW a:74 b:15 o:32</p> <p>FORD, KIA, MAZDA Probe Clarus, Sephia Spectra</p> <p>5BP, T8 FE, T8D F2, BPC, FS FO F12Z11002A MI M1T71281 HC JS637</p>	<p>STM0640</p>  <p>STD0640RB STM0640RB STM0640WA 197 8, 10 CR</p> <p>12v 0.85kW a:74 b:16 o:32</p> <p>FORD, KIA, MAZDA</p> <p>TB, T8 S6D, FE A3E, ASD KI 0K24118400 MI M3T24482H HC JS640</p>	<p>STM0654</p>  <p>STM0654WA 8, 9 CR</p> <p>12v 1.4kW a:82.5 b:4 o:22</p> <p>NISSAN Pulsar</p> <p>NI 2330057M60 MI M1T71681 HC JS654</p>
<p>STM0658</p>  <p>STM0658WA 207.8 8 CR </p> <p>12v 1.2kW a:73 b:17 o:22</p> <p>DODGE, HYUNDAI KIA, MITSUBISHI Galloper, Sonata Terracan, Sorento Pajero, Galant</p> <p>HY 3610035900 MI M1T71381 HC JS658</p>	<p>STM0667</p>  <p>STM0667RB 206 10 CR </p> <p>12v 1.4kW a:82.5 b:3 o:22</p> <p>NISSAN 200SX Laurel</p> <p>CA18DET NI 2330030F10 MI M1T71481 HC JS667</p>	<p>STM0670</p>  <p>STM0670WA STN0670WA 210.5 9 ACR </p> <p>12v 1.4kW a:82.5 b:33 o:20</p> <p>SUBARU Forester Impreza Legacy Leone</p> <p>EJ20 EJ18 EA82 SU 23300AA190 MI M1T84481 HC JS670</p>	<p>STM0671</p>  <p>STM0671WA 204 8, 9 ACR</p> <p>12v 1kW a:65 b:49 o:20</p> <p>SUBARU Forester Impreza Legacy Baja</p> <p>EJ253 EJ22 EJ20EMPI MI M1T77181 MI M0T81681 HC JS671</p>
<p>STM0674</p>  <p>STM0674WA 201.5 8, 11 CR</p> <p>12v 0.9kW a:74 b:20 o:20</p> <p>MITSUBISHI FG25 YALE Fork Lift Agricultural machine</p> <p>MZ FESE18400 MI M0T84381 HC JS674</p>	<p>STM0747</p>  <p>STM0747WA 231.6 12 ACR </p> <p>12v 1.7kW a:72 b:45 o:30</p> <p>FORD, MAZDA Probe 323 626 MX, Xedos</p> <p>KF, KL K819 B69, FS FO F32Z11002B MI M1T75581 HC JS747</p>	<p>STM0751</p>  <p>STM0751WA 191 8 CR </p> <p>12v 0.8kW a:82.5 b:8 o:20</p> <p>TCM Fork Lift</p> <p>A15 NI 2330060S10 MI M3T21281 HC JS751</p>	<p>STM0752</p>  <p>STM0752WA 12 ACR </p> <p>12v 2kW a:67 b:45 o:20</p> <p>MAZDA RX-7</p> <p>MI M1T70781A MI M1T70781 HC JS752</p>













Starters

Mitsubishi

<p>STM0756</p> <p>STM0756WA</p>  <p>20 ACR  20</p> <p>12v 1.6kW a:11 b:24.5 o:30</p> <p>MAZDA XEDOX 323 MX-6 626</p> <p>MZ K80118400 MI M2T25681 HC JS756</p>	<p>STM0768</p> <p>STM0768RB STM0768WA</p>  <p>12 CR  12</p> <p>12v 1.4kW a:67 b:16 o:33</p> <p>MAZDA MPV 3.0L 929 3.0L</p> <p>MZ JE2718400B MI M1T71781 HC JS768</p>	<p>STM0769</p> <p>STM0769WA</p>  <p>240 13 CR  13</p> <p>12v 2.2kW a:76.5 b:3.5 o:22</p> <p>DODGE, HYUNDAI MITSUBISHI Galopper, H-1, H100 Terracan, Galant L200, Pajero, Lancer</p> <p>4D55T, 4D56T D4BH, D4BA D4BF, D4BB HY 3610042050 MI M2T60171 HC JS769</p>	<p>STM0770</p> <p>STM0770WA</p>  <p>240 9 CR  9</p> <p>12v 2kW a:77 b:9 o:22</p> <p>HYUNDAI, KIA MITSUBISHI Galopper, H-1 Pregio Pajero</p> <p>4D56T, 4D56TD G6AT, D4BH HY 3610047600 MI M2T74171 HC JS770</p>
<p>STM0772</p>   <p>21 ACR  21</p> <p>12v 1kW a:11 b:14 o:20</p> <p>NISSAN</p> <p>NI 23300M8310 MI M2T23685 HC JS772</p>	<p>STM0773</p> <p>STM0773RB STM0773WA</p>  <p>10 CR  10</p> <p>12v 1.4kW a:82.5 b:3 o:21</p> <p>NISSAN</p> <p>NI 2330001Y11 MI M1T70985 HC JS773</p>	<p>STM0775</p>   <p>21 CR  21</p> <p>12v 1.2kW a:10.5 b:15 o:20</p> <p>NISSAN</p> <p>NI 2330037A10 MI M3T26685 HC JS775</p>	<p>STM0777</p> <p>STM0777WA</p>   <p>250.5 9, 11 CR</p> <p>24v 3.2kW a:82.5 b:22 o:20</p> <p>MITSUBISHI Lift Trucks</p> <p>4DQ5 S4E S4E2 MI 3446620102 MI M2T65271 HC JS777</p>
<p>STM0779</p> <p>STM0779WA</p>   <p>198.5 9 CR  9</p> <p>12v 1.2kW a:82.5 b:8 o:20</p> <p>MITSUBISHI NISSAN YE03 Fork Lift</p> <p>FG20 H30</p> <p>NI 23300K9160 MI M1T60081 HC JS779</p>	<p>STM0781</p> <p>STM0781WA</p>   <p>8 CR  8</p> <p>12v 1.2kW a:73 b:9 o:22</p> <p>HYUNDAI MITSUBISHI Sonata Pajero Sigma</p> <p>G6AT 6G72 6G74 HY 3610035510 MI M1T73281 HC JS781</p>	<p>STM0892</p> <p>STM0892WA</p>   <p>239 13 CR  13</p> <p>12v 2.2kW a:77 b:10 o:22</p> <p>HYUNDAI, KIA MITSUBISHI Galopper Pajero H-1</p> <p>D4BA D4BH 4D56T HY 3610047650 MI M2T60185 HC JS892</p>	<p>STM0895</p>   <p>15 CR  15</p> <p>12v 1.4kW a:77 b:30 o:20</p> <p>ISEKI Various Models</p> <p>MI M2T50371 MI M2T50391 HC JS895</p>










Starters

Mitsubishi

<p>STM0907 New</p>  <p>190 8 CR</p> <p>12v 0.8kW: a:74 b:16.75 o:20</p> <p>SUMITOMO DBFE YALE</p> <p>MA 478018400 MI M003T30981 HC JS907</p>	<p>STM0911</p> <p>STM0911WA</p>  <p>10 CR</p> <p>12v 1.4kW a:82.5 b:3.5 o:21</p> <p>NISSAN CA20E Prairie</p> <p>NI 23300D0513 MI M1T70981 HC JS911</p>	<p>STM0914</p>  <p>9 CR</p> <p>12v 1.4kW a:82.5 b:42 o:22</p> <p>NISSAN B13 Sunny N14 Primera W10, WP11 NI 2330063J02 MI M1T60185 HC JS914</p>	<p>STM0915</p> <p>STM0915WA</p>  <p>214.5 11 CR</p> <p>12v 1.2kW a:77 b:18 o:20</p> <p>CLARK FG20 MITSUBISHI FG25 Fork Lift</p> <p>MI M2T58581 MI M1T79781 HC JS915</p>
<p>STM0919</p> <p>STM0919WA</p>  <p>12 ACR</p> <p>12v 1.4kW a:72 b:50.5 o:30</p> <p>MAZDA FORD</p> <p>MZ KL3618400 MI M1T77081 HC JS919</p>	<p>STM0920</p> <p>STM0920RB STM0920WA</p>  <p>10 CR</p> <p>12v 1.4kW a:82.5 b:3.5 o:22</p> <p>NISSAN CA20E Praire 2.0L CA20S Praire Pro Stanza 2.0L</p> <p>NI 2330044R10 MI M1T71081 HC JS920</p>	<p>STM0925</p> <p>STM0925WA</p>  <p>190.5 8 CR</p> <p>12v 0.9kW a:77 b:10.5 o:22</p> <p>MITSUBISHI 4G13, 4G93 Carisma 4G15 Colt 4G92 Lancer</p> <p>MI M003T44181 MI M003T44182 HC JS925</p>	<p>STM0937</p> <p>STM0937WA</p>  <p>8, 9 CR</p> <p>12v 1.4kW a:70 b:28 o:33</p> <p>NISSAN KA24E Prairie KA24DE 240SX KA24DE Axxess 2.4 NI 2330030R12 Stanza 2.4 MI M1T72285 HC JS937</p>
<p>STM0939</p> <p>STM0939WA</p>  <p>9 CR</p> <p>12v 1.2kW a:82.5 b:8 o:20</p> <p>FORD KA24E NISSAN Maverick 2.4l King Cab 2.4l Terrano 2.4l</p> <p>NI 2330086G12 MI M1T60281 HC JS939</p>	<p>STM0940</p> <p>STM0940WA</p>  <p>9 CR</p> <p>12v 1.2kW a:73.5 b:16 o:33</p> <p>MAZDA R5A2 B2200 G6 B2600 MPV</p> <p>MZ G60118400A MI M1T50471 HC JS940</p>	<p>STM1003</p> <p>STM1003RB</p>  <p>8 CR</p> <p>12v 0.9kW a:77 b:18 o:22</p> <p>MITSUBISHI, HYUNDAI G4FK Galant, Lancer G15B Accent, Pony, Coupe 4G92 MI MD192227 MI M3T43381 HC JS1003</p>	<p>STM1006</p> <p>STM1006WA</p>  <p>230 10 CR</p> <p>12v 1.2kW a:82.5 b:6 o:21</p> <p>JEEP ERH, MX Cherokee S01 Wrangler 6L Grand Cherokee MI M1T74283 MI M1T74281 HC JS1006</p>


Starters

Mitsubishi

<p>STM1007</p>  <p>STM1007WA 11 CR </p> <p>12v 2kW a:82.5 b:22 o:20</p> <p>FORD Agricultural machine Fork Lift</p> <p>MI M2T61371 MI M2T56472 HC JS1007</p>	<p>STM1009</p>  <p>STM1009WA 260 10 CR </p> <p>12v 2.2kW a:82.5 b:24 o:20</p> <p>MITSUBISHI CATERPILLAR CLARK Fork Lift</p> <p>SZ 32A6600600 MI M2T62271 HC JS1009</p>	<p>STM1011</p>  <p>STM1011WA 13 CR </p> <p>12v 2.7kW a:100 b:31 o:30</p> <p>MAZDA HYSTER YALE Fork Lift</p> <p>DBHA HA XA MZ 484018400 MI M2T54571 HC JS1011</p>	<p>STM1014</p>  <p>STM1014WA 238.5 13, 15 CR</p> <p>12v 2kW a:77 b:31 o:20</p> <p>MITSUBISHI Marine</p> <p>MI M002T56272 MI M002T56271 HC JS1014</p>
<p>STM1016</p>  <p>STM1016WA 8 CR </p> <p>12v 0.9kW a:70 b:11.5 o:21</p> <p>NISSAN Micra Note 1.4</p> <p>CG10DE, CR12DE CG13DE, CR14DE</p> <p>NI 2330041B71 MI M2T42881 HC JS1016</p>	<p>STM1092</p>  <p>STM1092WA 8 CR </p> <p>12v 1.2kW a:75 b:6 o:22</p> <p>CHEVROLET GEO SUZUKI Swift Wagon</p> <p>G13A G13B G16B SZ 3110064B12 MI M1T70281 HC JS1092</p>	<p>STM1094</p>  <p>STM1094WA 229 21 ACR </p> <p>12v 1.4kW b:15 o:20</p> <p>NISSAN Micra Vanette Serena</p> <p>MA10S MA12S GA16DE NI 233000C010 MI M2T23685 HC JS1094</p>	<p>STM1095</p>  <p>STM1095RB STM1095WA 8 CR </p> <p>12v 1kW a:77 b:9.5 o:22</p> <p>MITSUBISHI</p> <p>MI M0T70381 MI MD174482 HC JS1095</p>
<p>STM1096</p>  <p>STM1096WA 208 10 CR </p> <p>12v 1kW a:74 b:13 o:32</p> <p>MAZDA PEUGEOT 323, 626, MPV Protégé 206</p> <p>FP, FS7G FS7E, FP9A RFK, EW10J4S FO F7RU11000AA MI M0T80381 HC JS1096</p>	<p>STM1097</p>  <p>STM1097WA 12 ACR </p> <p>12v 1kW a:72 b:46 o:30</p> <p>MAZDA 323, 626 MX3, MX6 Xedos</p> <p>V6 MZ KL3618400B MI M0T80881 HC JS1097</p>	<p>STM1098</p>  <p>STD1098RB STM1098RB STM1098WA 8 CR </p> <p>12v 0.9kW a:74 b:11 o:32</p> <p>KIA Carens Pride Rio Shuma</p> <p>FJ DA DC, FB KI 361002X000 MI M3T33281 HC JS1098</p>	<p>STM1100</p>  <p>STH1100RB STM1100WA 207 8 CR </p> <p>12v 1.2kW a:70 b:12.5 o:21</p> <p>JAGUAR NISSAN S-Type Primera Sunny</p> <p>GA14DE GA16DS QG18DE NI 233000M302 MI M1T72085 HC JS1100</p>

Starters

Mitsubishi

<p>STM1102</p>  <p>STM1102WA 214.6 11, 12 CR</p> <p>12v 1.4kW a:74 b:19.5 o:20</p> <p>BOBCAT MD2040 FORD VOLVO PENTA Agricultural machine MI M2T54085 Marine MI M1T66081 HC JS1102</p>	<p>STM1136</p>  <p>STM1136RB STM1136WA 196.7 8 CR</p> <p>12v 1kW a:74 b:15.5 o:32</p> <p>MAZDA OM651955 MERCEDES-BENZ BPZE, Z5DE 323 ZL, ZM, B3ME MX MZ BPD418400 Sprinter MI M0T80081 HC JS1136</p>	<p>STM1139</p>  <p>STM1139RB STM1139WA 195 8 CR</p> <p>12v 1.2kW a:77 b:10 o:22</p> <p>MITSUBISHI 4G93 Carisma 4G92 Colt 4G13 Lancer MI M0T30771 Pajero MI M0T80581 HC JS1139</p>	<p>STM1140</p>  <p>STM1140WA 238 10 CR</p> <p>12v 2.2kW a:77 b:2.5 o:22</p> <p>HYUNDAI 4D65, 4D55T MITSUBISHI 4D56T, 4D56 H1, H100 D4BH, D4BF Galant, Lancer HY 3610042200 L200, L300, L400, Pajero MI M2T87071 HC JS1140</p>
<p>STM1146</p>  <p>STM1146WA 202 8 CR</p> <p>12v 0.95kW a:74 b:15 o:32</p> <p>MAZDA B64F MX BPF1 Xedos B6 MZ B61R18400 MI M3T48181 HC JS1146</p>	<p>STM1153</p>  <p>STM1153WA 208 8 CR</p> <p>12v 1.4kW a:66 b:4.5 o:22</p> <p>CHEVROLET H25A SUZUKI J20A Tracker H27A Vitara SZ 3110065DA0 Grand Vitara MI M1T79581 HC JS1153</p>	<p>STM1160</p>  <p>STM1160WA 272 9 CR</p> <p>12v 2.2kW a:72 b:0.5 o:30</p> <p>OPEL, RENAULT, VAUXHALL S9W702, X25XE Movano S9W702, S8U772 Master Vectra OP 4500256 MI M2T87671 HC CS1160</p>	<p>STM1175</p>  <p>STM1175WA 207.5 10 CR</p> <p>12v 1.2kW a:60 b:10 o:20</p> <p>DODGE EPE JEEP HX Cherokee 4L Wrangler CH 56041013 Dakota MI M1T79481 HC CS1175</p>
<p>STM1219</p>  <p>STM1219WA 199 9 CR</p> <p>12v 1.4kW a:82.5 b:8 o:20</p> <p>NISSAN KA24E Terrano KA24DE Frontier 2.4I Xterra 2.4I NI 233001S711 MI M0T60081 HC JS1219</p>	<p>STM1221</p>  <p>STM1221WA 240.5 10 CR</p> <p>12v 2.2kW a:77 b:11 o:22</p> <p>MITSUBISHI 4M40 Pajero 2.8I Diesel 4M41 Pajero 3.2I Diesel 4M40A Canter 2.8I Diesel MI M2T63271 Canter 3.0I Diesel MI M8T75071 HC JS1221</p>	<p>STM1227</p>  <p>STM1227WA 239 10, 12 CR</p> <p>12v 2.2kW a:77 b:9 o:22</p> <p>HYUNDAI D4BH MITSUBISHI 4D56T Pajero 2.5I Diesel H1 2.5I Diesel MI M2T88071 MI M2T87171 HC JS1227</p>	<p>STM1235</p>  <p>STM1235WA 233 12 ACR</p> <p>12v 2.2kW a:72.5 b:56 o:20</p> <p>NISSAN YD22DDT Almera 2.2I Diesel NI 23300BN301 MI M8T71371 HC JS1235</p>


Starters

Mitsubishi

<p>STM1238</p>  <p>STM1238WA 226.5 10 CR</p> <p>12v 2.2kW a:88 b:5 o:32</p> <p>MAZDA NISSAN 323, 626 E, Premacy Almera</p> <p>RF1G, RF RF4F, RF3F QG15DE MZ RF1H18400 MI M2T87471 HC JS1238</p>	<p>STM1252</p>  <p>STM1252WA 12 CR</p> <p>12v 1.4kW a:65 o:33</p> <p>RENAULT Kangoo Megane Scenic</p> <p>F9Q F9Q744 F9Q782 RE 7700116282 MI M1T85781 HC CS1252</p>	<p>STM1273</p>  <p>STM1273WA 198 12 CR</p> <p>12v 1.1kW a:65 b:-2 o:32</p> <p>DACIA, NISSAN RENAULT, SUZUKI Logan, Almera Kubistar, Micra Kangoo, Jimny</p> <p>K9K700 K9K710 K9K722 NI 2330000QAW MI M0T86181 HC CS1273</p>	<p>STM1295</p>  <p>STM1295WA 233 12 ACR</p> <p>12v 1.7kW a:70 b:54 o:20</p> <p>NISSAN Almera Primera X-Trail</p> <p>YD22DDT YD22ETI NI 233008H801 MI M8T71471 HC JS1295</p>
<p>STM1296</p>  <p>STM1296WA 226 12 CR</p> <p>12v 2.3kW a:88 b:5 o:33</p> <p>MAZDA 3 5 6 MPV</p> <p>RF5C RF7J SZ RF5C18400 MI M2T88671 HC JS1296</p>	<p>STM1300</p>  <p>STM1300RB STM1300WA 194.5 8 CR</p> <p>12v 0.9kW a:77 b:10.5 o:22</p> <p>mitsubishi Galant Space Runner</p> <p>4G63 MI M003T44481 MI M3T44481 HC JS1300</p>	<p>STM1313</p>  <p>STA1313RB STM1313RB STM1313WA 194.5 8 CR</p> <p>12v 1.2kW a:77 b:10 o:22</p> <p>AUDI, HYUNDAI KIA, MITSUBISHI A4, Accent, Santa Fe Sonata, Trajet Galant, Optima</p> <p>KI 3610038050 MI M1T84884 HC JS1313</p>	<p>STM1316</p>  <p>STM1316RB STM1316WA 9 CR</p> <p>12v 1.2kW a:74 b:9 o:21</p> <p>CHRYSLER PT Cruiser</p> <p>ECC EJD EDZ CH 5033067AA MI M0T84881ZC HC JS1316</p>
<p>STM1317</p>  <p>STH1317RB STM1317RB STM1317WA 11 CR</p> <p>12v 1kW b:21 o:20</p> <p>MAZDA 3 5 6</p> <p>LF17, LF18 L823 L813 MZ L81318400 MI M0T90981 HC JS1317</p>	<p>STM1318</p>  <p>STM1318WA 13 ACR</p> <p>12v 1.4kW a:82.5 b:56 o:20</p> <p>NISSAN X-Trail Primera</p> <p>QR20DE QR25DE NI 233008H500 MI M1T87181ZC HC JS1318</p>	<p>STM1325</p>  <p>STM1325WA 350 12 CR</p> <p>24v 6kW a:89 b:40 o:30</p> <p>RENAULT VI Kerax Premium</p> <p>DCI11C DCI11G DCI11E RE 5001847428 MI M9T60371 HC CS1325</p>	<p>STM1332</p>  <p>STM1332RB STM1332WA 201 12, 13 CR</p> <p>12v 1.4kW a:63 o:33</p> <p>DACIA, NISSAN RENAULT, SUZUKI Sandero, Kubistar Qashqai, Megane Scenic, Jimny</p> <p>K9K768 K9K704 K9K792 RE 233001073R MI M0T21471 HC CS1332</p>



Starters

Mitsubishi

<p>STM1348</p>  <p>STM1348WA 350.5 12 CR</p> <p>24v 6kW a:89 b:40 o:30</p> <p>MERCEDES RENAULT VI 420 Kerax Premium</p> <p>MIDR062356A41 M119971 M119981 RE 5010508384 MI M9T60672 HC CS1348</p>	<p>STM1352</p>  <p>STN1352WA 234 10, 12 CR</p> <p>12v 2.2kW a:81.5 b:17.5 o:33</p> <p>FORD MAZDA Ranger B2500 BT</p> <p>MD25NA WLE7 WLT MZ WL0118400 MI M002T872712T HC JS1352</p>	<p>STM1354</p>  <p>STM1354WA 9 CR</p> <p>24v 3.2kW a:60 b:17 o:31</p> <p>MITSUBISHI Fuso Canter</p> <p>4D342AT4 FB6 FE6 MI M2T66872 MI M8T80071 HC JS1354</p>	<p>STM1359</p>  <p>STM1359WA 8 ACR</p> <p>12v 0.9kW a:75 b:44.5 o:20</p> <p>MITSUBISHI, SMART Colt Lancer Forfour</p> <p>CX2 CY2 M135950 MI MR994922 MI M0T45271 HC JS1359</p>
<p>STM1361</p>  <p>STM1361WA 8 CR</p> <p>12v 1kW a:74 b:15.5 o:22</p> <p>MAZDA 3</p> <p>Z6 B6ZE</p> <p>MZ ZJ0118400 MI M0T91381 HC JS1361</p>	<p>STM1367</p>  <p>STH1367WA STH3491 STM1367WA 10 CR</p> <p>12v 1kW a:69 b:18.5 o:44</p> <p>NISSAN Cube 1.6 Micra 1.6 Note 1.6 Qashqai 1.6</p> <p>HR16DE NI 23300BC20B MI M0T32172 HC JS1367</p>	<p>STM1386</p>  <p>STM1386WA 350 11 CR</p> <p>24v 5.5kW a:92 b:47 o:30</p> <p>RENAULT VI Kerax Premium</p> <p>DC11C DC11E DC11G RE 5010508380 MI M9T60471 HC CS1386</p>	<p>STM1388</p>  <p>STM1388WA 350 12 CR</p> <p>24v 4.5kW a:92 b:48 o:30</p> <p>VOLVO FH Series FM Series</p> <p>DH12D380 D12D340 D12D460 VO 85000677 MI M9T61171 HC CS1388</p>
<p>STM1424</p>  <p>STM1424RB STM1424WA 233 11 CR</p> <p>12v 2.0kW a:70 b:31 o:22</p> <p>NISSAN Navara Pathfinder</p> <p>YD25DDTi NI 23300EB300 MI M8T76071 HC CS1424</p>	<p>STM1425</p>  <p>M0T45971 STM1425WA 8 CR</p> <p>12v 1.1kW a:61.5 b:1 o:33</p> <p>RENAULT Clio Modus Twingo</p> <p>K4M800, K4M801, K4J7800 K4M790, K4M791, K4J770 K4M754, K4M854 RE 8200298371 MI M0T45371ZT HC CS1425</p>	<p>STM1427</p>  <p>STM1427RB STM1427WA 9 CR</p> <p>12v 2kW a:75 b:33 o:20</p> <p>HONDA accord CRV</p> <p>N22A1 N22A2 HO MHG020 MI M2T85671 HC CS1427</p>	<p>STM1428</p>  <p>STM1428WA 220 10 CR</p> <p>12v 1.7kW a:82 b:4 o:30</p> <p>OPEL, SAAB Astra Zafira 9-3</p> <p>A19DTR Z19DTH A20DTH OP 55352882 MI M1T30171 HC CS1428</p>

Starters

Mitsubishi

<p>STM1432</p>  <p>STM1432WA 12 CR</p> <p>24v 5kW a:92 b:42 o:30</p> <p>IVECO F3BE3681D EuroCargo F3BE3681B EuroStar F3A3681A EuroTrakker IV 504042667 MI M9T61671 HC CS1432</p>	<p>STM1436</p>  <p>STM1436WA 11 CR</p> <p>12v 1.4kW b:22.5 o:20</p> <p>MAZDA BK14 3 5 6 CX-7 MZ L32718400 MI M0T87681 HC CS1436</p>	<p>STM1439</p>  <p>STM1439WA 267 12 CR</p> <p>12v 2.2kW a:70 b:31.5 o:22</p> <p>NISSAN YD25DDTI King Cab 2.5L Pickup 2.5L NI 23300VK50A MI M2TS0571 HC CS1439</p>	<p>STM1442</p>  <p>STM1442WA 8 CR</p> <p>12v 0.8kW a:66 b:-1 o:33</p> <p>DACIA K7J710 RENAULT K7M750 Logan Kangoo RE 8200584664 MI M0T45171ZT HC CS1442</p>
<p>STM1444</p>  <p>STM1444RB STM1444WA 227.5 10 CR</p> <p>12v 2.0kW a:66 b:3 o:30</p> <p>SUZUKI RHW Grand Vitara 2.0l Diesel RHZ SZ 3110068D00 MI M2T85271 HC CS1444</p>	<p>STM1451</p>  <p>STM1451WA 12 CR</p> <p>24v 7kW a:92 b:46 o:30</p> <p>VOLVO D16C610 FH Series D16C550 VO 20450305 MI M9T82672 HC CS1451</p>	<p>STM1452</p>  <p>STM1452WA 8 CR</p> <p>12v 0.8kW a:65 b:52 o:20</p> <p>SMART (MCC) M132910 Fortwo M132930 MZ A1321510001 MI M0T46171ZT HC CS1452</p>	<p>STM1454</p>  <p>STM1454WA 10 CR</p> <p>12v 2kW a:82.5 o:32</p> <p>CHRYSLER ENC Voyager ENJ CH 4727313AC MI M2T88473 HC CS1454</p>
<p>STM1457</p>  <p>9 CR</p> <p>12v 2.0kW a:75 b:33 o:30</p> <p>HONDA N22A2 Civic 2.2L Cr-v 2.2L HO 31200RSRE01 MI M002T85871</p>	<p>STM1459</p>  <p>STM1459WA 8 CR</p> <p>12v 1.4kW a:77 b:9 o:22</p> <p>MITSUBISHI EA3A Galant 2.4 N64W Space Runner 2.4 N84W, N94W Space Wagon MI M1T84883ZC Grandis 2.4 MI M1T84883 HC CS1459</p>	<p>STM1460</p>  <p>STM1460WA 22 CR</p> <p>12v 2kW b:14 o:30</p> <p>DODGE, MITSUBISHI ECD Avenger 2.0, Caliber 2.0 NA8W Grandis 2.0 CY8A, CW8W Lancer 2.0 MI M1T93071 Outlander 2.0 MI M1T93371 HC CS1460</p>	<p>STM1461</p>  <p>STM1461WA 12 CR</p> <p>12v 1.4kW a:75 b:31 o:20</p> <p>ALFA ROMEO, FIAT 939A6000, 939A5000 Alfa 159 194A1000 Brera 2.2 Spider 2.2 AR 55183906 Croma 2.2 MI M0T35471 HC CS1461</p>








Starters

Mitsubishi

<p>STM1463</p>  <p>STB1463RB STM1463WA</p> <p>348.5 12 CR</p>  <p>12</p> <p>24v 6.2kW a:92 b:47 o:30</p> <p>MERCEDES Actros Axor Integro</p> <p>OM541945 M115954 OM541920 MB A0061516901 MI M9T80472 HC CS1463</p>	<p>STM1750</p>  <p>13 CR</p>  <p>13</p> <p>12v a:70 b:21 o:21</p> <p>NISSAN Pathfinder</p> <p>VQ40DE</p> <p>NI 23300-EA200 MI M1TA0071ZC</p>	<p>STM1941 <i>New</i></p>  <p>22 ACR</p>  <p>22</p> <p>12v a:55 b:53 o:20</p> <p>MAZDA 6 MAZDA CX-9</p> <p>3.5l 3.7l</p> <p>MZ CY0118400 MI M0T15871 MH STM1941</p>	<p>STM2139</p>  <p>8 ACR</p>  <p>8</p> <p>12v 1.2kW a:70 b:41.5</p> <p>NISSAN Almera 1.4l Almera 1.6l Sunny 1.6l</p> <p>GA14DE GA16DE</p> <p>MI M0T80281 MI M0T80281 HC JS1031</p>
<p>STM2177 <i>New</i></p>  <p>STM2177WA</p> <p>213 9,11 CR</p>  <p>9,11</p> <p>12v 1.7kW a:74 b:20 o:20</p> <p>FORD CASE NEW HOLLAND TERRAMITE Agricultural Machine</p> <p>3-77 3-91 3-81 FO SBA185086551 MI M2T58971 MH STM2177</p>	<p>STM2185 <i>New</i></p>  <p>15 CR</p>  <p>15</p> <p>12v 1.2kW a:76 b:18 o:22</p> <p>LDV PEL JOB VENUS MITSUBISHI</p> <p>L25D</p> <p>MI M002T53681</p>	<p>STM2271</p>  <p>11 CR</p>  <p>11</p> <p>24v 5.0kW a:110 b:65 o:20</p> <p>MITSUBISHI Fuso</p> <p>MI M008T62271</p>	<p>STM2272</p>  <p>STM2272WA</p> <p>11 CR</p>  <p>11</p> <p>12v 1.4kW a:70 b:7 o:22</p> <p>JEEP Wrangler TJ Series</p> <p>4.0L(242) V6</p> <p>CH 56041914AC MI M0T20272 MH STM2272</p>
<p>STM2275</p>  <p>STM2275WA</p> <p>288 12 CR</p>  <p>12</p> <p>12v 2.5kW a:89 b:41 o:30</p> <p>FORD</p> <p>FO F4TZ11002B MI M8T50172 CG 112275</p>	<p>STM2276</p>  <p>STM2276WA</p> <p>288 12 CR</p>  <p>12</p> <p>12v 3kW a:88.9 b:34 o:30</p> <p>FORD E Excursion F F Series</p> <p>FO 1C3U11000AA MI M8T50071 CG 112276</p>	<p>STM2323</p>  <p>STM2323WA</p> <p>292 10 CR</p>  <p>10</p> <p>24v 5kW a:82.5 b:23 o:20</p> <p>CATERPILLAR MITSUBISHI Fork Lift</p> <p>FD20, FD25 FD30 FD35 CT 1146864 MI M3T56172 CG 112323</p>	<p>STM2325</p>  <p>STM2325WA</p> <p>198 8, 9 CR</p> <p>12v 0.9kW a:74 b:15 o:32</p> <p>MAZDA MERCURY 323 626 MX</p> <p>FE18, B3, B5 FE, F6, ZL E1, E3, E5 MI M3T24488 MI M3T24481 HC JS325</p>

Starters

Mitsubishi

<p>STM2329</p>  <p>STM2329WA 192 8 CR</p> <p>12v 0.8kW a:82.5 b:8 o:20</p> <p>KOMATSU H20 NISSAN A15 TCM Fork Lift NI 23300T5070 Urvan MI M3T41181 HC JS329</p>	<p>STM2342</p>  <p>STM2342WA 368 13 CR</p> <p>24v 5.5kW a:100 b:68 o:30</p> <p>HYUNDAI 6D22 MITSUBISHI 6D22CT KOBELCO SK400-III MI M3T95081 MI M3T95071 CG 112342</p>	<p>STM2344</p>  <p>STA2344RB STM2344RB STM2344WA 10, 12 CR</p> <p>12v 2kW a:77 b:3.5 o:22</p> <p>DODGE, HYUNDAI 4D68, D4BH MITSUBISHI, PROTON 4D56T, D4BA Galopper, H-1 D4BF, 4D65T Pajero, L200 HD 3610042011 Gallant, Persona MI M2T56171 HC JS344</p>	<p>STM2345</p>  <p>STM2345WA 9, 11 CR</p> <p>12v 1.2kW a:82.5 b:8 o:21</p> <p>NISSAN Vanette NI 2330005E00 MI M2T51085 HC JS345</p>
<p>STM2348</p>  <p>STM2348WA 230 10 CR</p> <p>12v 1.2kW a:82.5 b:6 o:21</p> <p>JEEP Cherokee 4.0l Grand Cherokee 4.0l Wrangler 4.0l CH 56041012AE MI M0T91082 CG 111349</p>	<p>STM2349</p>  <p>STM2349RB STM2349WA 189 8 CR</p> <p>12v 0.9kW a:77 b:16 o:22</p> <p>DODGE, HYUNDAI G4EH, G4EK KIA, MITSUBISHI 4G13, 4G15 PLYMOUTH, PROTON MD2020 VALPADANA, VOLVO KI 3610022000 Accent, Lancer MI M2T40081 HC JS349</p>	<p>STM2350</p>  <p>STM2350WA 233 8 CR</p> <p>12v 0.7kW a:77 b:17 o:22</p> <p>DODGE, HYUNDAI 4G93, 4G16 MITSUBISHI, PLYMOUTH G4EH, G15B Accent, Lantra 4G15, SATURN Sonata, Colt MI M3T25882 Lancer, Space Wagon MI M3T22581 HC JS350</p>	<p>STM2378</p>  <p>STM2378WA 8, 10 CR</p> <p>12v 1kW a:82.5 b:5 o:21</p> <p>NISSAN T72, CA16 Bluebird WU11 Silvia 1.8 CA18ET NI 2330057M05 MI M3T33981 HC JS378</p>
<p>STM2394</p>  <p>STM2394WA 185.5 8, 9 CR</p> <p>12v 0.8kW a:66 b:18 o:20</p> <p>SUZUKI F10A Samurai SJ SZ 3110080092 MI M002T30581 HC JS394</p>	<p>STM2471</p>	<p>STM2580</p>  <p>STM2580WA 248 8 CR</p> <p>12v 1.7kW a:70 b:40 o:20</p> <p>INFINITI VH45D Q45 4.5L MI M1T74785 MI M1T74781 CG 112580</p>	<p>STM2703</p>  <p>STM2703WA 250 13 CR</p> <p>12v 2kW a:74 b:20 o:20</p> <p>FORD Agricultural machine MI M2T63371 MI M2T63371 CG 111703</p>













Starters

Mitsubishi New

<p>STM2844</p>  <p>STM2844WA 207 8 CR</p> <p>12v 1.4kW a:70 b:29 o:20</p> <p>NISSAN Altima 2.4L</p> <p>GLE GXE SE, XE NI 233001E410 MI M1T73881 CG 112844</p>	<p>STM2845</p>  <p>STM2845WA 240 10 CR</p> <p>12v 1.4kW a:82 b:8 o:33</p> <p>CHRYSLER, DODGE EAGLE, PLYMOUTH B100, B150 Prowler Concorde</p> <p>MI M1T77777 MI M1T77781 CG 112845</p>	<p>STM2846</p>  <p>STM2846WA 231 10 CR</p> <p>12v 1.4kW a:82 b:8 o:30</p> <p>CHRYSLER DODGE Stratus Cirrus Sebring</p> <p>EEB MI M1T78581ZC MI M1T78581 CG 112846</p>	<p>STM2871</p>  <p>13 CR</p> <p>12v 1.7kW a:82 b:25 o:20</p> <p>NISSAN Rogue Sentra</p> <p>3.5 L NI 23300ET80B MI M0TA0271 WA 19061N</p>
<p>STM3005</p>  <p>STM3005WA 11 CR</p> <p>12v 1kW a:69 b:29 o:22</p> <p>NISSAN Altima 2.4l</p> <p>NI 233009E012 MI M0T90685 WA 17828N</p>	<p>STM3008</p>  <p>STM3008WA 10 CR</p> <p>12v 1.2kW a:82 b:6 o:32</p> <p>CHRYSLER DODGE Neon</p> <p>CH 4727314AB MI M0T90482 MH STM3008</p>	<p>STM3009</p>  <p>STM3009WA 13 ACR</p> <p>12v 1.7kW</p> <p>NISSAN Altima Maxima Murano</p> <p>NI 23300JA10C MI M0TA0072 WA 19063N</p>	<p>STM3044</p>  <p>215 10 CR</p> <p>12v 1.4kW a:72 b:23 o:20</p> <p>JEEP Grand Cherokee 5.2l Grand Cherokee 5.9l</p> <p>MI M1T76081 MI M1T76081/ZC CG 113044</p>
<p>STM3045</p>  <p>STM3045WA 193 9 CR</p> <p>12v 1.4kW a:82.5 b:17 o:22</p> <p>INFINITI, NISSAN QX4 Pathfinder</p> <p>VG33E MI M000T60181 MI M000T60181A CG 113045</p>	<p>STM3046</p>  <p>STM3046WA 193 8 CR</p> <p>12v 1.2kW a:70 b:10 o:20</p> <p>CHRYSLER MISUBISHI Sebring 3.0l Dodge Stratus 3.0l Galant 3.0l</p> <p>MI MD351508 MI M0T80783 CG 113046</p>	<p>STM3047</p>  <p>STM3047WA 10 CR</p> <p>12v 1.4kW a:72 b:11 o:20</p> <p>DODGE JEEP</p> <p>MI M0T83381 MI M0T83381 CG 113047</p>	<p>STM3129</p>  <p>290 11 CR</p> <p>24v 4.5kW a:110 b:64.5 o:21</p> <p>MITSUBISHI Fuso</p> <p>6D15 6D10 KI 3610093010 MI M3T56072 CG 113129</p>


Starters

Mitsubishi

<p>STM3135</p>  <p>STM3135WA 232 13 ACR 13</p> <p>12v 1.2kW a:67 b:46 o:20</p> <p>MAZDA RX7</p> <p>RE13B</p> <p>MZ N31818400 MI M1T70881 CG 113135</p>	<p>STM3136</p>  <p>STM3136WA 219 13 ACR 13</p> <p>12v 2kW a:61 b:56 o:20</p> <p>NISSAN MERCURY Quest Villager</p> <p>VG30E</p> <p>NI 233000B711 MI M1T64285 CG 113136</p>	<p>STM3140</p>  <p>STM3140WA 250 9 CR 9</p> <p>12v 2kW a:60 b:20 o:20</p> <p>MITSUBISHI Canter 4DR7 FB308</p> <p>4D30</p> <p>MI M2T61771 MI M2T56871 CG 113140</p>	<p>STM3166</p>  <p>STM3166WA 18 ACR 18</p> <p>12v 1.7kW</p> <p>MAZDA MPV 2.5L</p> <p>PMGR</p> <p>MZ GY0118400B MI M1T95681 WA 17798N</p>
<p>STM3188</p>  <p>STM3188WA 8 CR 8</p> <p>12v 1.6kW a:65 b:6 o:22</p> <p>CHEVROLET Tracker 2.0L Tracker 2.5L SUZUKI Grand Vitara</p> <p>PMGR</p> <p>MI M1T86081 MI M1T86081 WA 17837N</p>	<p>STM3194</p>  <p>STM3194WA 240 9 CR 9</p> <p>24v 3.2kW a:100 b:22 o:30</p> <p>CATERPILLAR MITSUBISHI Canter</p> <p>4D30A</p> <p>CT 8S9096 MI M2T64271 CG 113194</p>	<p>STM3229</p>  <p>STM3229WA 216 8 CR 8</p> <p>12v 1.2kW a:73 b:17 o:22</p> <p>DODGE MITSUBISHI Pajero Sigma Galant</p> <p>6G72 6G74</p> <p>CH 59017557 MI M1T78481 CG 113229</p>	<p>STM3257</p>  <p>STM3257WA 10 CR 10</p> <p>24v 6.5kW a:105 b:42 o:30</p> <p>MITSUBISHI NISSAN</p> <p>39MT</p> <p>NI 2330000Z05 MI M9T82571 MH STM3257</p>
<p>STM3286</p>  <p>STM3286WA 12 ACR 12</p> <p>24v 4.5kW a:100 b:44 o:30</p> <p>MAZDA Titan</p> <p>Diesel</p> <p>MI M2T78071 MI M2T78072 NR 017807</p>	<p>STM3287</p>  <p>STM3287WA 240 10 CR 10</p> <p>12v 1.4kW a:82 b:7 o:33</p> <p>CHRYSLER DODGE Sebring Avenger</p> <p>2.5L (152) V6</p> <p>MI M1T78681ZC MI M1T78681 CG 113287</p>	<p>STM3288</p>  <p>STM3288WA 10 CR 10</p> <p>12v 2.2kW a:69 b:24 o:22</p> <p>INFINITI, NISSAN QX56 Armada Pathfinder</p> <p>NI 233007S000 MI M2T85571 WA 17867N</p>	<p>STM3299</p>  <p>STM3299WA 9 CR 9</p> <p>12v 2.2kW a:82 b:9.5 o:30</p> <p>CHRYSLER Grand Voyager Voyager</p> <p>PLGR</p> <p>CH 4868860AA MI M2T88971 HC CS1482</p>













Starters

Mitsubishi

<p>STM3315</p>  <p>STM3315WA 8 CR </p> <p>12v 1.2kW a:70 b:28 o:22</p> <p>DODGE, CHRYSLER, JEEP 1.8L (110) L4 Avenger, Caliber 2.0L (122) L4 Sebring 2.4L (144) L4 Compass, Patriot CH 5034555AA MI M0T32071 WA 17994N</p>	<p>STM3355</p>  <p>STM3355WA 12 CR </p> <p>12v 1.4kW a:68.5 b:29 o:30</p> <p>OPEL, VAUXHALL Insignia Signum SAAB CH 55353669 9-3 2.8L MI M0T35671 HC CS1488</p>	<p>STM3357</p>  <p>STM3357WA 12 CR </p> <p>12v 1.4kW a:67 b:30</p> <p>ALFA ROMEO FIAT FI 55184922 MI M0T35771 MH STM3357</p>	<p>STM3371</p>  <p>STM3371WA 10 CR </p> <p>12v 1.7kW a:63 b:8 o:20</p> <p>DODGE 5.7L (345) V8 Ram Pickups CH 4801253AA MI M0T21371 MH STM3371</p>
<p>STM3375</p>  <p>STM3375WA 14 CR </p> <p>24v 5kW a:100 b:22</p> <p>CATERPILLAR 4D32 KOBELCO SK210-IV 4D30T MI M3T57575 MI ME019911 NR 015757</p>	<p>STM3388</p>  <p>STM3388WA 11 CR </p> <p>24v 5kW a:100 b:22 o:20</p> <p>MITSUBISHI FUSO FK330 6D31 KOBELCO Excavator SK200LS MI M2T78382 MI ME087507 CG 113560</p>	<p>STM3449</p>  <p>STM3449WA 15 CR </p> <p>24v 7.5kW a:91 b:48 o:30</p> <p>CATERPILLAR 3Y8850 CATERPILLAR 3304 CT 3Y8850 MI M4T95478 MH STM3449</p>	<p>STM3471</p>  <p>STM3471WA 13 ACR </p> <p>12v 2kW a:67 b:34 o:20</p> <p>MAZDA PMGR RX8 MZ N3H118400A MI M1T30471 WA 17993N</p>
<p>STM3473</p>  <p>STM3473WA 13 CR </p> <p>24v 5kW a:99 b:32 o:30</p> <p>MAZDA DSL 4100 DSL T2000 MZ V10118400 MI M4T51371 NR 015647</p>	<p>STM3475</p>  <p>STM3475WA 10 CR </p> <p>12v 1.2kW</p> <p>JEEP 3.7L (226) V6 Grand Cherokee Commander CH 56044734AA MI M0T31471ZC WA 17939N</p>	<p>STM3488</p>  <p>STM3488WA 11 CR </p> <p>12v 1.4kW a:82.5 b:18</p> <p>NISSAN Frontier 3.3L Xterra 3.3L NI 233004S103 MI M0T87481 WA 17859N</p>	<p>STM3527</p>  <p>STM3527WA 10 CR </p> <p>12v 1.2kW a:61 b:12 o:20</p> <p>BUICK 3.8L (231) V6 Reatta Riviera OLDSMOBILE Totonado CH 9016868 MI M1T50271 WA 21408MI</p>

Starters

Mitsubishi

<p>STM3550</p>  <p>STM3550RB STM3550WA</p> <p>403 11, 12 CR</p> <p>12v 6.2kW a:92 b:46 o:30</p> <p>MACK FREIGHTLINER STERLING WESTERN STAR Medium & Heavy-Duty Trucks</p> <p>MERCEDES MBE4000 CU 3103304 MI M9T70379 CG 113550</p>	<p>STM3551</p>  <p>STM3551WA</p> <p>258 9 CR</p> <p>12v 2.2kW a:82.5 b:27 o:20</p> <p>KUBOTA Tractors Utility Generator Sets THOMAS EQUIPMENT Skid Steers</p> <p>Kubota V3300 Kubota V3800 KU 1C01063010 MI M8T70971 CG 113551</p>	<p>STM3571</p>  <p>STM3571WA</p> <p>11 CR</p> <p>12v 4kW a:89 b:48 o:30</p> <p>VOLVO Trucks LM9 FM9</p> <p>MI M009T70371 MI M9T70371 MH STM3571</p>	<p>STM3572</p>  <p>STM3572WA</p> <p>10 CR</p> <p>12v 1.2kW</p> <p>JEEP Commander 4.7L Grand Cherokee 4.7L Liberty 4.7L DODGE Ram Pickup 5.7L</p> <p>CH 56044735AB MI M0T31572 WA 17937N</p>
<p>STM3581</p>  <p>STM3581WA</p> <p>160 8 CR</p> <p>12v 1kW a:73 b:8 o:21</p> <p>mitsubishi Galant VII</p> <p>MI MD188721 MI M0T71581 MH STM3581</p>	<p>STM3583</p>  <p>STM3583WA</p> <p>8 CR</p> <p>12v 1.4kW a:77 b:20 o:22</p> <p>MITSUBISHI Galant 2.4L Eclipse 2.0L Eclipse 2.4L</p> <p>CH 59017768 MI M1T74883 WA 17768N</p>	<p>STM3587</p>  <p>STM3587WA</p> <p>11 CR</p> <p>12v 2.5kW a:94 b:18 o:20</p> <p>BOBCAT DAEWOO ISUZU Fork Lift</p> <p>4JB1 DH55 IS 8971704000 MI M8T77075 NR 017071</p>	<p>STM3616</p>  <p>STM3616WA</p> <p>194 8 CR</p> <p>12v 1.2kW a:74 b:15 o:21</p> <p>MAZDA Protégé 1.8L Protégé 2.0L</p> <p>MZ FP5018400 MI M0T82281 HC CS1479</p>
<p>STM3618</p>  <p>STM3618WA</p> <p>215 10 CR</p> <p>12v 1.6kW a:65 b:5 o:21</p> <p>JEEP Grand Cherokee 4.7l</p> <p>EVA CH 56041207AC MI M0T91182 CG 113618</p>	<p>STM3642</p>  <p>STM3642WA</p> <p>226 10 CR</p> <p>12v 1.6kW a:65 b:5 o:22</p> <p>JEEP Liberty Wrangler Cherokee</p> <p>CH 56041641AC MI M1T86882 CG 113642</p>	<p>STM3668</p>  <p>STM3668WA</p> <p>13 ACR</p> <p>12v 1.7kW a:73 b:51 o:20</p> <p>NISSAN Murano 3.5L Maxima 3.5L</p> <p>Z50 VQ35DE NI 23300CA000 MI M1T68681 WA 17863N</p>	<p>STM3669</p>  <p>STM3669WA</p> <p>287.8 11 CR</p> <p>24v 5kW a:110 b:66 o:20</p> <p>CATERPILLAR Lift Trucks DP115, FK618 KOBELCO SK370-IV TADANO TR600XL</p> <p>6D17 FK618 MI ME077796 MI M8T60071 CG 113669</p>

Starters

Mitsubishi

<p>STM3672</p>  <p>STM3672WA 8 CR</p> <p>12v 1.2kW a:74 b:9 o:20</p> <p>CHRYSLER PT Cruiser</p> <p>2.4L (148) L4</p> <p>CH 5033141AB MI M0T30672 WA 17873N</p>	<p>STM3688</p>  <p>STM3688WA 12 cr</p> <p>12v 1.9kW a:66 b:-2 o:43</p> <p>NISSAN Primera</p> <p>RE 8200096510 MI M1T85682 MH STM3688</p>	<p>STM3698</p>  <p>STM3698RB STM3698WA CR</p> <p>12v 1.4kW</p> <p>FORD MAZDA</p> <p>Zetec</p> <p>MZ YF4718400 MI M0T86981 MH STM3698</p>	<p>STM3746</p>  <p>STM3746WA 318 11 CR</p> <p>24v 5.5kW a:100 b:68 o:30</p> <p>HONDA Pilot MITSUBISHI Fuso</p> <p>6D22 J35AB</p> <p>MI ME152487 MI M9T60171 CG 113746</p>
<p>STM3763</p>  <p>STM3763WA 11 CR</p> <p>12v 2.5kW a:60 b:18 o:63</p> <p>MITSUBISHI Fuso FE, FG Series</p> <p>4D31 4D34</p> <p>MI M3T67281 MI M3T67283 NR 017281</p>	<p>STM3771</p>  <p>STM3771 8 CR</p> <p>12v 1.4kW a:65 o:22</p> <p>SUZUKI Grand Vitara XL7</p> <p>2.7L</p> <p>SZ 3110065J30 MI M0T21771 WA 19057N</p>	<p>STM3778</p>  <p>STM3778WA 11 CR</p> <p>24v 5kW a:100 b:21 o:20</p> <p>Kobelco Excavator SK200 NEW HOLLAND</p> <p>6D31 6D34</p> <p>MI ME049303 MI M8T87171 NR 0187171</p>	<p>STM3808</p>  <p>STM3808WA 11 CR</p> <p>12v 1.4kW a:78 b:13 o:20</p> <p>FORD MERCURY Fusion Milan</p> <p>2.3L (140) L4</p> <p>FO 6E5Z11002AA MI M0T88481 WA 17944N</p>
<p>STM3810</p>  <p>STM3810WA 12 CR</p> <p>12v 1kW a:67 b:16</p> <p>MAZDA MPV 3.0L</p> <p>MZ JE2718400D MI M0T81081 WA 17691N</p>	<p>STM3813</p>  <p>STM3813WA 11 CR</p> <p>24v 7.5kW a:105 b:45 o:30</p> <p>MITSUBISHI ISUZU</p> <p>6WF1 CXZ51K</p> <p>IS 1811003522 MI M9T81471 MH STM3813</p>	<p>STM3842</p>  <p>STM3842WA 11 CR</p> <p>24v 5kW a:60 b:16 o:63</p> <p>MITSUBISHI Industrial</p> <p>4D31</p> <p>MI ME013390 MI M2T78481 NR 013390</p>	<p>STM3861</p>  <p>STM3861WA 13 CR</p> <p>24v 5kW a:100 b:19 o:30</p> <p>MITSUBISHI RUBBER TRACK CARRIER</p> <p>4D31 4D32 4D33</p> <p>MI ME049186 MI M8T60271 NR 0160271</p>










Starters

Mitsubishi

<p>STM3865</p>  <p>STM3865WA 11 CR </p> <p>24v 5.5kW a:100 b:75 o:30</p> <p>MITSUBISHI FUSO FT410 6D40 KOBELCO EXCAVATOR</p> <p>MI M9T60271 MH STM3865</p>	<p>STM3866</p>  <p>STM3866WA 11 CR </p> <p>24v 4.5kW a:105 b:11 o:30</p> <p>NISSAN PICK UP 2003- FD42 NISSAN PAHFINDER 2003- FD46 Trucks Condor 4200, 4600</p> <p>NI 233000T005 MI M2T78682 NR 012530</p>	<p>STM3867</p>  <p>STM3867WA 11 CR </p> <p>24v 5kW a:105 b:25 o:30</p> <p>NISSAN Industrial</p> <p>FD6, FE6 CM80, CM90</p> <p>NI 23300Z5570 MI M8T60171 NR 010171</p>	<p>STM3875</p>  <p>STM3875WA 11 CR </p> <p>12v 1.4kW b:28</p> <p>MAZDA 6</p> <p>2.3L</p> <p>FO 3M8111002BB MI M0T87781 MH STM3875</p>
<p>STM3879</p>  <p>STM3879WA 11 CR </p> <p>12v 3.6kW a:88 b:48</p> <p>VOLVO-PENTA</p> <p>VO 3594614 MI M8T55579 ER 220553</p>	<p>STM3880</p>  <p>STM3880WA 11 CR </p> <p>24v 3.2kW a:100 b:20 o:30</p> <p>MITSUBISHI Industrial</p> <p>4D31</p> <p>MI ME049185 MI M8T80171 NR 018071</p>	<p>STM3881</p>  <p>STM3881WA 11 ACR </p> <p>24v 4.0kW a:93.5 b:37 o:20</p> <p>ISUZU, Hicom Truck Elf 100P, Bogdan NKR, NPR, NKR58 NKR66, NKS58 NPR66, NPS66</p> <p>4HF1, 4BE1, 4HE1 4HG1, 4HH1, 4HJ1</p> <p>IS 8971769800 MI M8T85371 MH STM3881</p>	<p>STM3882</p>  <p>STM3882WA 11 CR </p> <p>24v 3.7kW a:65 b:14 o:43</p> <p>MITSUBISHI Industrial</p> <p>4M51</p> <p>MI ME240241 MI M8T85271 UP STR7133</p>
<p>STM3884</p>  <p>STM3884WA 260 11 CR </p> <p>24v 3.2kW a:95 b:19 o:20</p> <p>ISUZU KOBELCO SK60 KOBELCO SK70</p> <p>4JB1</p> <p>IS 8971374780 MI M8T80371 CG 114185</p>	<p>STM3885</p>  <p>STM3885WA 12 CR </p> <p>24v 7.5kW a:100 b:58</p> <p>MITSUBISHI Fuso</p> <p>8DC93 FV515</p> <p>MI ME164620 MI M9T80572 NR 0180571</p>	<p>STM3886</p>  <p>STM3886WA 9 CR </p> <p>24v 3.2kW a:60.5 b:17 o:20</p> <p>MITSUBISHI</p> <p>4D32 4D33 4D35</p> <p>MI M8T85071 MI M8T80671 MH STM3886</p>	<p>STM3887</p>  <p>STM3887WA 10 CR </p> <p>24v 5kW a:82 b:24 o:20</p> <p>CATERPILLAR Excavators 320B</p> <p>Caterpillar 3066T</p> <p>CT 1252988 MI M8T60871 NR 015938</p>

























Starters

Mitsubishi

STM3888	STM3889	STM3908	STM3919
 <p>160 8 CR</p> <p>8</p> <p>12v 1kW a:71 b:9 o:20</p> <p>MITSUBISHI Galant VI</p> <p>2.5L V6</p> <p>MI MD319770 MI M0T81481 UP STR3592</p>	 <p>STM3889WA</p> <p>11 cr</p> <p>11</p> <p>24v 5kW a:98 b:22 o:20</p> <p>MITSUBISHI Fuso</p> <p>6D32</p> <p>MI M8T87071 MH STM3889</p>	 <p>12 CR</p> <p>12</p> <p>24v 7kW a:92 b:47</p> <p>MAN D26 TRUCK 2006-> D2676 (Euro4), 6Cyl 12.4L/I6</p> <p>MN 51262017231 MI M9T83071 MH STM3908</p>	 <p>STM3919WA</p> <p>10 CR</p> <p>10</p> <p>12v 1.2kW</p> <p>CHRYSLER DODGE Concorde Intrepid</p> <p>2.7L (167) V6</p> <p>CH 4609345AF MI M0T91781ZC WA 17848N</p>
STM3955	STM3966	STM3971	STM3977
 <p>STM3955WA</p> <p>11 CR</p> <p>11</p> <p>24v 7.5kW a:99 b:70 o:30</p> <p>MITSUBISHI KOBELCO Industrial</p> <p>6D24</p> <p>MI ME153418 MI M5T50276 NR 0180771</p>	 <p>STM3966WA</p> <p>12 CR</p> <p>12</p> <p>24v 5.5kW a:89 b:26</p> <p>DEUTZ RENAULT MIDLUM, PREMIUM ML D DXi3, 7.2L D DXi7 VOLVO 2006-></p> <p>RE 7420997672 MI M9T62671 HC CS1496</p>	 <p>STM3971WA</p> <p>12 CR</p> <p>12</p> <p>12v 4.7kW a:89 b:29</p> <p>DEUTZ TCD2012L6, FENDT</p> <p>KH 1182761 MI M9T50471 NR 0150471</p>	 <p>12 CR</p> <p>12</p> <p>24v 7kW a:92 b:47</p> <p>VOLVO PENTA Scania DC16 2008-></p> <p>SC 1797880 MI M9T83771 MH STM3977</p>
STM3979	STM3981	STM3989	STM3991
 <p>12 CR</p> <p>12</p> <p>24v 7kW a:92 b:48</p> <p>VOLVO PENTA</p> <p>VO 21103722 MI M9T83879 MS 220573</p>	 <p>STM3819 STM3819WA</p> <p>12 CR</p> <p>12</p> <p>24v 7kW a:92 b:48 o:30</p> <p>VOLVO Trucks Various</p> <p>VO 21103718 MI M9T84079 MS 220574</p>	 <p>STM3989WA</p> <p>11 CR</p> <p>11</p> <p>24v 7.5kW a:104 b:40 o:30</p> <p>ISUZU JOHN DEERE Excavators</p> <p>6WA1 6WG1 6WG1X IZ 1811003413 MI M9T80971 NR 0180971</p>	 <p>STM3991WA</p> <p>11 CR</p> <p>11</p> <p>24v 5.5kW a:88 b:59 o:20</p> <p>MITSUBISHI Fuso Super Star Great Star</p> <p>6M70</p> <p>MI ME180049 MI M9T60971 MH STM3991</p>













Starters

Mitsubishi

<p>STM3992</p>  <p>STM3992WA</p> <p>12 CR </p> <p>24v 7.5kW a:105 b:31 o:30</p> <p>MITSUBISHI 10PE1 ISUZU GD143 GD152 CXZ81K GD161, 10PE1 CXZ81K</p> <p>IS 1811002453 MI M9T80871 NR 0180871</p>	<p>STM3995 <i>New</i></p>  <p>STM3995WA</p> <p>242 13 CR </p> <p>12v 2.0kW a:77 b:29.5 o:20</p> <p>CATERPILLAR S3L Excavators</p> <p>MI 31B6600100 MI M1T68281 CG 113995</p>	<p>STM3996</p>  <p>STM3996WA</p> <p>12 CR </p> <p>24v 5.5kW a:92 b:47</p> <p>MAN</p> <p>MN 51262017226 MI M9T62971 MH STM3996</p>	<p>STM4011</p>  <p>STM4011WA</p> <p>10 CR </p> <p>12v 1.2kW a:81 b:6 o:33</p> <p>CHRYSLER, DODGE 3.5L (215) V6 300 Series 2.7L (167) V6 Challenger Charger Magnum</p> <p>CH 4608800AA MI M0T21171 WA 19025N</p>
<p>STM4031</p>  <p>STM4031WA</p> <p>318.5 12 CR </p> <p>24v 5.5kW a:92 b:48 o:30</p> <p>MAN D2066LF06, D2066LF49 26t D2066LF31, D2066LF50 19t D2066LF48, D2066LF63 40t MN 51262019199 MI M9T61971 CG 114031</p>	<p>STM4057</p>  <p>STM4057WA</p> <p>19 ACR </p> <p>12v 1.6kW a:57 b:28 o:20</p> <p>HONDA Odyssey 3.5L HO 31200RGLA02 MI M0T15771ZC WA 19008N</p>	<p>STM4071</p>  <p>STM4071WA</p> <p>19 CR </p> <p>12v b:50 o:20</p> <p>HONDA 3.5L FORD Pilot Ridgeline</p> <p>HO 31200RJEAO1 MI M0T15571 WA 17964N</p>	<p>STM4072</p>  <p>STM4072WA</p> <p>19 CR </p> <p>12v 1.6kW b:50 o:20</p> <p>HONDA 3.5L Acura MDX</p> <p>HO 31200RDJA01 MI M0T15072 WA 17868N</p>
<p>STM4074</p>  <p>STM4074WA</p> <p>215 10 CR </p> <p>12v 1.4kW a:81 b:10 o:20</p> <p>NISSAN, OPEL, RENAULT X-trail Movano Latitude, Master Megane</p> <p>NI 233009Z400 MI M0T87381ZC MH STM4074</p>	<p>STM4100</p>  <p>STM4100WA</p> <p>11 CR </p> <p>24v 7.5kW a:92 b:47 o:30</p> <p>RENAULT VII</p> <p>RE 5010306631 MI M9T80072 CG 114100</p>	<p>STM4144</p>  <p>STM4144WA</p> <p>227 12 CR </p> <p>12v 2.2kW a:82.5 b:26 o:22</p> <p>CHRYSLER ENF JEEP EDJ PT Cruiser Grand Cherokee</p> <p>CH 05033125AB MI M2T88571 HC CS1481</p>	<p>STM4167</p>  <p>STM4167WA</p> <p>287.3 9 CR </p> <p>12v 3.6kW a:82.5 b:27 o:20</p> <p>TCM Fork Lift Various Models</p> <p>Kubota V3300 KU 1K01263011 MI M8T50471 CG 114167</p>






Starters

Mitsubishi

<p>STM4169</p>  <p>STM4169WA 287 10 CR</p> <p>24v 5kW a:82 b:22.5 o:20</p> <p>CATERPILLAR S6E MITSUBISHI S6S Fork Lift FD CT 32B6600200 MI M8T60371 CG 114169</p>	<p>STM4193</p>  <p>STM4193WA STM471 STM472 316 11 CR</p> <p>24v 5.5kW a:92 b:48 o:30</p> <p>RENAULT VI D9A260 VOLVO DX11 Kerax Premium VO 20397219 FM Series MI M9T61479 CG 114193</p>	<p>STM4225</p>  <p>STM4225WA 207 8 CR</p> <p>12v 1.6kW a:66 b:4.5 o:20</p> <p>CHEVROLET J20A GEO, SUZUKI Tracker Grand Vitara SZ 3110060AD0 MI M1T85881 CG 114225</p>	<p>STM4236</p>  <p>STM4236WA 12 CR</p> <p>24v 5kW a:88 b:26 o:30</p> <p>MAN TGL/TGM 2005-D0836 (Euro4&5) 6Cyl, 5.87L/I6 MN 51262017236 MI M8T62671 NR 017236</p>
<p>STM4238</p>  <p>STM4238WA 206 10 CR</p> <p>12v 1.4kW a:58.5 b:9 o:40</p> <p>JEEP EPE Cherokee 2.5l P00 Wrangler 2.5l CH 56041013AB MI M1T79483 CG 114238</p>	<p>STM4271</p>  <p>STM4271WA 9 ACR</p> <p>12v 1.4kW a:82.5 b:33.5</p> <p>SAAB, SUBARU PMGR 9-2X Forester, Impreza Legacy, Outback SB 23300??460 MI M0T20171 WA 17840N</p>	<p>STM4277</p>  <p>STM4277WA 11 CR</p> <p>12v 1.7kW a:66 b:16 o:22</p> <p>NISSAN Altima 3.5l Quest 3.5l Maxima 3.5l NI 233008Y000 MI M0T20771ZC WA 17872N</p>	<p>STM4279</p>  <p>STM4279WA 227.5 10 CR</p> <p>12v 2.2kW a:82 b:20 o:30</p> <p>JEEP R425 Cherokee 2.5l Diesel ENR Cherokee 2.8l Diesel CH 56041579AA MI M2T88372 CG 114279</p>
<p>STM4280</p>  <p>STM4280WA 241 11 CR</p> <p>24v 3.2kW a:77 b:10.5 o:20</p> <p>CATERPILLAR Agricultural machine CT 0R1903 MI M8T80471 CG 114280</p>	<p>STM4323</p>  <p>STM4323WA 287 10 CR</p> <p>24v 5kW a:89 b:26.5 o:30</p> <p>DENNIS D7E240 VOLVO FE Series FL Series MI M8T62471 MI M8T62471AM CG 114323</p>	<p>STM4328</p>  <p>STM4328WA 239 10 CR</p> <p>12v 1.6kW a:82 b:8 o:33</p> <p>CHRYSLER EER 300 Concorde CH 04609345 MI M1T84181 CG 114328</p>	<p>STM4329</p>  <p>STM4329WA 232.6 13 ACR</p> <p>12v 1.6kW a:75 b:62 o:20</p> <p>NISSAN QR25DE Altima 2.5L NI 233008J001 MI M1T68781 CG 114329</p>

Starters

Mitsubishi

<p>STM4331</p>  <p>STM4331WA 358 11 CR 11</p> <p>24v 8.3kW a:92 b:47 o:30</p> <p>CUMMINS Industrial Engines</p> <p>MI M9T82479 MI M9T82471 CG 114330</p>	<p>STM4343</p>  <p>STM4343WA 13 CR 13</p> <p>24v 6kW a:100 b:77 o:30</p> <p>MITSUBISHI FUSO 305, 310, 320, 355 AERO QUEEN MU525 V8</p> <p>8DC9T MI ME060401 MI M5T50081 CG 114343</p>	<p>STM4371</p>  <p>STM4371WA 8 CR 8</p> <p>12v 0.85kW a:61 o:33</p> <p>RENAULT DACIA Logan 2005-></p> <p>RE 8200815083 MI M0T46371ZT MH STM4371</p>	<p>STM4434</p>  <p>STM4434WA 13 CR 13</p> <p>24v 5.5kW a:89 b:47</p> <p>MERCEDES BENZ Atego 2007-></p> <p>BR900 MB A0061514801 MI M9T64371 NR 0164371</p>
<p>STM4439</p>  <p>STM4439WA 204.2 11 ACR 11</p> <p>12v 2.5kW a:100 b:49 o:30</p> <p>MAZDA E T</p> <p>XB SL SLT MZ S51518400A MI M2T57671 CG 114439</p>	<p>STM4479</p>  <p>STM4479WA 9 CR 9</p> <p>12v 1.2kW a:83.5 b:19 o:20</p> <p>NISSAN Fork Lift</p> <p>NI 23300GS20A MI M0T65381 CG 114479</p>	<p>STM4497</p>  <p>11 CR 11</p> <p>24v 5.5kW a:89 b:47</p> <p>VOLVO LM9 FM9</p> <p>RE 20563533 MI M9T61473 MS 220560</p>	<p>STM4537</p>  <p>12 CR 12</p> <p>24v 5.5kW a:89 b:30 o:30</p> <p>DEUTZ, KHD, VOLVO</p> <p>KH 1183067 MI M9T65371 NR 0165371</p>
<p>STM4613</p>  <p>STM4613WA 9 CR 9</p> <p>12v 1.6kW a:81 b:27 o:22</p> <p>ACURA RL 3.5i</p> <p>HO 31200P5AA01 MI M2T84471 CG 114613</p>	<p>STM4614</p>  <p>STM4614WA 18 ACR 18</p> <p>12v 1.6kW a:63 b:62 o:30</p> <p>MAZDA 626 Millenia MX6</p> <p>MZ KLK318400 MI M1T95281 CG 114614</p>	<p>STM4626</p>  <p>STM4626WA 9 CR 9</p> <p>12v 1.4kW a:82 b:15</p> <p>NISSAN Xterra Frontier</p> <p>3.3L NI 233004S100 MI M0T60186 CG 114626</p>	<p>STM4627 <i>New</i></p>  <p>12 ACR 12</p> <p>12v 1.4kW a:74 b:52 o:20</p> <p>NISSAN Altima Maxima</p> <p>3.5L NI 233005Y715 MI M0T87281 CG 114627</p>





















Starters

Mitsubishi

<p>STM4653</p>  <p>STM4653WA</p> <p>11 ACR </p> <p>12v 1.4kW a:75 b:56</p> <p>NISSAN Altima 3.5l Maxima 3.5l Quest 3.5l</p> <p>NI 233008J120 MI M0T87187 CG 114653</p>	<p>STM4671</p>  <p>STM4671WA</p> <p>8 CR </p> <p>12v 1.4kW</p> <p>MITSUBISHI Lancer Outlander</p> <p>MI 1810A205 MI M0T31671 WA 19037N</p>	<p>STM4672 <i>New</i></p>  <p>STM4672WA</p> <p>11 CR </p> <p>12v 2.2kW a:70 b:31 o:32</p> <p>NISSAN Navara Pathfinder (R51M)</p> <p>YD25DDTi</p> <p>NI 233005X00A MI M2TS0672 MH STM4672</p>	<p>STM4686 <i>New</i></p>  <p>12v 1.3kW a:66 b:18 o:20</p> <p>GRASSHOPPER</p> <p>KU 1682463011 MI M0T88081 MH STM4686</p>
<p>STM4871</p>  <p>STM4871WA</p> <p>10 CR </p> <p>12v 1.7kW a:70 b:28 o:20</p> <p>DODGE Ram</p> <p>5.7L</p> <p>CH 56029274AA MI M0T21271 WA 17932N</p>	<p>STM4972</p>  <p>STM4972WA</p> <p>10 CR </p> <p>12v 1.4kW a:65 b:0.5 o:20</p> <p>JEEP Commander 5.7L Grand Cherokee 5.7L</p> <p>CH 56044736AB MI M0T20972 WA 17938N</p>	<p>STM4979</p>  <p>STM4979WA</p> <p>12 CR </p> <p>12v 7.2kW a:92 b:49 o:30</p> <p>MERCEDES-BENZ FREIGHTLINER WESTERN STAR STERLING</p> <p>MBE4000</p> <p>MI M9T70279 UP STR4293</p>	<p>STM5071 <i>New</i></p>  <p>12v 2.0kW a:69 b:46 o:20</p> <p>INFINITI M45</p> <p>V8 4.5L</p> <p>NI 23300AR000 MI M2T85071 MH STM5071</p>
<p>STM5281</p>  <p>8 CR </p> <p>12v a:68 b:28 o:22</p> <p>NISSAN Bassara Caravan X-Trail</p> <p>KA24DE</p> <p>NI 233005V110 MI M000T85281</p>	<p>STM5282 <i>New</i></p>  <p>20 ACR </p> <p>12v 1.4kW a:73 b:12 o:10</p> <p>INFINITI NISSAN</p> <p>NI 2330030P15 MI M2T25282 WA 17179</p>	<p>STM5371</p>	<p>STM5417 <i>New</i></p>  <p>11 CR </p> <p>12v 2.0kW a:82 b:27 o:20</p> <p>MITSUBISHI</p> <p>MI M5T20171 MI M5T10073 NR 015909</p>

Starters

Mitsubishi

<p>STM5671 <i>New</i></p>  <p>9 CR </p> <p>24v 3.7kW a:75 b:10 o:22</p> <p>MITSUBISHI FUSO CANTER GUTS</p> <p>MI ME193062 MI M8T85671</p>	<p>STM5971 <i>New</i></p> <p>STM5971WA</p>  <p>9 CR </p> <p>12v 2.2kW a:76 b:9 o:22</p> <p>MITSUBISHI FUSO CANTER GUTS</p> <p>FB70B 2002</p> <p>MI M8T75971 MH STM5971</p>	<p>STM6151 <i>New</i></p> <p>STM6151WA</p>  <p>12 ACR </p> <p>12v 1.8kW a:69 b:35 o:20</p> <p>SMART Forfour 1.5 CDI MITSUBISHI Colt VI 1.5 DI-D</p> <p>OM639</p> <p>MB A0061510401 MI M1T30271 NR 010271</p>	<p>STM6571 <i>New</i></p>  <p>12 CR </p> <p>12v 1.4kW a:70 b:29 o:30</p> <p>BUICK Allure Lacrosse Rendezvous CADILLAC CTS, SRX</p> <p>3.6L(217) V6</p> <p>GM 12598756 MI M0T36571 GM 17986N</p>
<p>STM6671 <i>New</i></p> <p>STM6671WA</p>  <p>11 CR </p> <p>24v 4.0kW a:100 b:23 o:30</p> <p>FORD</p> <p>39MT</p> <p>MI M9T64671 MH STM6671</p>	<p>STM6688</p>  <p>10 cr </p> <p>24v a:82 b:18 o:20</p> <p>MITSUBISHI Industrial</p> <p>MI 32G6610100 NK 0240000188</p>	<p>STM6871 <i>New</i></p>  <p>12 CR </p> <p>24v 5.5kW a:87 b:46 o:30</p> <p>KHD VOLVO DEUTZ</p> <p>VO 20900793 MI M9T62871</p>	<p>STM6875 <i>New</i></p>  <p>10 CR </p> <p>12v 1.6kW a:81 b:8 o:22</p> <p>CHRYSLER DODGE</p> <p>GM 4606875AA MI M1T86282ZC WA 22328MI</p>
<p>STM8104 <i>New</i></p>  <p>14 CR </p> <p>12v 1.6kW a:76 b:19 o:22</p> <p>CASE NEW HOLLAND</p> <p>Diesel</p> <p>MI 30L6610600 MI M0T60481</p>	<p>STM9132</p>  <p>24 acr </p> <p>12v 2.0kW a:60 b:34 o:30</p> <p>MITSUBISHI CHRYSLER</p> <p>CH 05082388AA MI M1T93271</p>		

Starters

Nikko

<p>STK0023</p>  <p>STK0023WA 407 12 CR</p> <p>24v 7.5kW a:92 b:44 o:30</p> <p>KOMATSU Industrial KOMATSU Engines</p> <p>KM 6008635910 NK 0230003341 CG 114396</p>	<p>STK0219 <i>New</i></p>  <p>STK0219WA 9 CR</p> <p>12v 2.2kW a:95 b:19 o:20</p> <p>KOMATSU 4D95 Fork Lifts</p> <p>KM 6008131721 NK 0230000260 HC JS745</p>	<p>STK0220 <i>New</i></p>  <p>STK0220WA 11 CR</p> <p>24v 3.5kW a:105 b:33 o:30</p> <p>NISSAN FD6, FE6 Hitachi Excavator FD33, ED6 CM80, CM85, CM87, CM90 SD33T RM80, RM90, EX60 NI 2330090064 NK 0230001360 HC JS904</p>	<p>STK0223 <i>New</i></p>  <p>STK0223WA 13 CR</p> <p>24v 4.5kW a:89 b:10 o:31</p> <p>HITACHI Excavator ZX200 Isuzu Forward, Elf</p> <p>IZ 8980019150 NK 0240000088 NR 019150</p>
<p>STK0739</p>  <p>STK0739WA 12 CR</p> <p>24v 7.5kW a:92 b:46 o:30</p> <p>KOMATSU 6D125 Fork Lift 6D105 Industrials 6D140 KT 6008134530 NK 0230003270 HC JS739</p>	<p>STK0740</p>  <p>STK0740WA 13 CR</p> <p>24v 7.5kW a:100 b:53 o:30</p> <p>KOMATSU OM615 MERCEDES-BENZ 6D110 4t 6D105 Fork Lift KT 6008133560 Industrials NK 0230003160 HC JS740</p>	<p>STK0741 <i>New</i></p>  <p>STK0741WA 11 CR</p> <p>24v 2.8kW a:105 b:14 o:20</p> <p>KOMATSU 6D95 Engine Fork Lift Lift Trucks Generators</p> <p>KT 6008133142 NK 0230000150 HC JS741</p>	<p>STK0742</p>  <p>STK0742WA 13 CR</p> <p>24v 7.5kW a:100 b:53 o:30</p> <p>KOMATSU 4D130 Engine Crawlers</p> <p>KT 6008132650 NK 0210003411 HC JS742</p>
<p>STK0743</p>  <p>STK0743WA 11 CR</p> <p>24v 11kW a:136 b:45 o:30</p> <p>KOMATSU 4D155 Engine Crawlers 6D155 Engine Generators D95S, D150 D155, D355</p> <p>KT 6008134811 NK 0210003790 HC JS743</p>	<p>STK0750</p>  <p>STK0750WA 11 CR</p> <p>24v 5.5kW a:105 b:14 o:20</p> <p>KOMATSU 6D105 Industrials 4D105 D31, D41, FD40, FD50 6D95 EM436A, EM636A</p> <p>KT 6008134420 NK 0230001550 HC JS750</p>	<p>STK0934</p>  <p>STK0934WA 13 CR</p> <p>24v 5.5kW a:100 b:53 o:30</p> <p>KOMATSU Industrials 6D105 Excavators 6D95</p> <p>KT 6008133390 NK 0230002570 HC JS934</p>	<p>STK1010</p>  <p>STK1010WA 9 CR</p> <p>24v 4.5kW a:95 b:19 o:20</p> <p>ISUZU JOHN DEERE NEW HOLLAND Excavators</p> <p>IZ 8970298630 NK 0230001700 HC JS1010</p>



Starters

Nikko

<p>STK1980 New</p>  <p>11 CR </p> <p>12v 5.5kW a:105 b:43 o:30</p> <p>KOMATSU 6D125 GD, PC 6D105 Excavators 6D650</p> <p>NK 0230001980 IS 8943675660</p>	<p>STK2020</p>  <p>STK2020WA 407 12 CR </p> <p>24v 7.5kW a:91 b:47 o:30</p> <p>KOMATSU 6D125 GD, PC 6D105 Excavators 6D650</p> <p>KT 6008136632 NK 0230007020 CG 111020</p>	<p>STK2212</p>  <p>STK2212WA 328 9 CR </p> <p>24v 2.8kW a:95 b:21 o:20</p> <p>KOMATSU 4D95 Lift Trucks Industrial Engine FD30 Series</p> <p>KT 6008133130 NK 0230000040 CG 111212</p>	<p>STK2553</p>  <p>STK2553WA 11 CR </p> <p>24v 3.7kW a:105 b:55 o:30</p> <p>ISUZU DA120 DA220 DA640 LINK-BELT Excavators</p> <p>NI 0230001070 NK 0210003651 CG 110553</p>
<p>STK2649</p>  <p>STK2649WA 348 11 CR </p> <p>24v 4.5kW a:105 b:39.5 o:30</p> <p>ISUZU 6BD1 LINK-BELT 6BD1T Excavators</p> <p>IZ 1811002530 NK 0230001071 CG 112649</p>	<p>STK3150</p>  <p>STK3150WA 11 CR </p> <p>24v 7.5kW a:92 b:47 o:30</p> <p>KOMATSU SA6D170A Industrial SA12V140</p> <p>KT 6008134930 NK 0230007000 NR 014930</p>	<p>STK3260 New</p>  <p>STK3260WA 230 11 CR </p> <p>24v 4.5kW a:104 b:41 o:30</p> <p>JCB ISUZU Engines Excavators</p> <p>IS 1811004010 NK 0240003260 CG 114483</p>	<p>STK3292</p>  <p>STK3292WA 11 CR </p> <p>24v 7.5kW a:105 b:54 o:20</p> <p>ISUZU 6SD1 6SA1 6SD1TP IZ 1811002880 NK 0230007290 NR 017292</p>
<p>STK3499 New</p>  <p>419 12 CR </p> <p>24v 7.5kW a:92 b:46 o:30</p> <p>KOMATSU 6BD1 Industrials</p> <p>KM 6008133550 NK 0230003290 CG 113499</p>	<p>STK3602</p>  <p>STK3602WA 11 CR </p> <p>24v 6kW a:105 b:34 o:30</p> <p>NISSAN RF8</p> <p>NI 03506020610 NK 23300Z6007 MH STK3602</p>	<p>STK3968</p>  <p>STD3968WA 11 CR </p> <p>24v 4.5kW a:95 b:46 o:20</p> <p>ISUZU 6HK1 Medium Duty Trucks HK1 HITACHI Excavator</p> <p>MI M9T6087 NK 0240003041 NR 015939</p>	<p>STK4040</p>  <p>STK4040WA 9 CR </p> <p>24v 5kW a:95 b:17 o:20</p> <p>KOMATSU 4D105 Excavators 4D94 Generators 4D942 Compressors Crawlers</p> <p>KT 6008132161 NK 0210004830 NR 014830</p>

Starters

Nikko

<p>STK4060</p>  <p>STK4060WA</p> <p>10 CR </p> <p>10</p> <p>24v 4.5kW a:89 b:48 o:20</p> <p>KOMATSU ??128U1</p> <p>S4D102E</p> <p>KT 6008634510 NK 0240003060 NR 013240</p>	<p>STK4164</p>  <p>395 12 CR </p> <p>12</p> <p>24v 7.5kW a:92 b:46 o:30</p> <p>KOMATSU Industrials Crawlers Motor Graders</p> <p>SA6D125 6D125</p> <p>KM 6008136610 NK 0230003280 CG 114164</p>	<p>STK4165</p>  <p>410 11 CR </p> <p>11</p> <p>24v 7.5kW a:92 b:45 o:30</p> <p>KOMATSU Marine Industrial Engines</p> <p>SA6D170A</p> <p>KT 6008137110 NK 0230007161 CG 114165</p>	<p>STK4209</p>  <p>11 CR </p> <p>11</p> <p>24v 4.5kW a:95 b:15 o:20</p> <p>KOMATSU Excavators</p> <p>4D95 PC1307 PC607</p> <p>KT 6008633110 NK 0240003210 NR 013210</p>
<p>STK4267</p>  <p>STK4267WA</p> <p>288 11 CR </p> <p>11</p> <p>24v 4.5kW a:105 b:41.5 o:30</p> <p>JOHN DEERE Industrials Excavators</p> <p>6BG1T</p> <p>IZ 1811003380 NK 0240003150 CG 114267</p>	<p>STK4278</p>  <p>STK4278WA</p> <p>13 cr </p> <p>13</p> <p>24v 5kW a:90 b:13 o:31</p> <p>ISUZU ZX240, ZH23, ZAX15 ZX200-3</p> <p>4HK1 4HK1T</p> <p>IZ 8980700630 NK 0240000178 NR 010178</p>	<p>STK4324</p>  <p>STK4324WA</p> <p>10 CR </p> <p>10</p> <p>24v 4.5kW a:95 b:45 o:20</p> <p>HITACHI Agricultural machine ISUZU Industrial ZX160W</p> <p>4BG1TCG03</p> <p>IZ 8972202970 NK 0240003250 CG 114324</p>	<p>STK4335</p>  <p>297 9 CR </p> <p>9</p> <p>12v 2.5kW a:89 b:48 o:30</p> <p>ISUZU Passangers Cars EU KB Series</p> <p>CG 114335</p>
<p>STK4338</p>  <p>298 10 CR </p> <p>10</p> <p>24v 4.5kW a:89 b:47 o:30</p> <p>CUMMINS PERKINS Industrial Engines</p> <p>CG 114338</p>	<p>STK4390</p>  <p>STK4390WA</p> <p>11 CR </p> <p>11</p> <p>24v 6kW a:92 b:45</p> <p>KOMATSU Lift Trucks Crawlers Motor Graders Generators</p> <p>NH220C1</p> <p>KT 6008132590 NK 0210003391 NR 013391</p>	<p>STK4442</p>  <p>STK4442WA</p> <p>12 CR </p> <p>12</p> <p>24v 6kW a:105 b:29</p> <p>ISUZU Trucks EU</p> <p>10PC1 10PD1 10PB1SS</p> <p>IZ 1811002161 NK 0230006070 CG 114442</p>	<p>STK4610</p>  <p>12 CR </p> <p>12</p> <p>24v 7.5kW a:96 b:45 o:30</p> <p>KOMATSU Compressors Crawlers Lift Trucks</p> <p>6D125 S6D125 SA6D125</p> <p>KT 6008133530 NK 230006531 NR 016612</p>

STK9322



24v **11kW** a:92 b:50 o:30

KOMATSU
wheel loader
WA500 2001->

KM 6008139321
NK 0230007733
NR 018021











Starters

Other

<p>STZ0212 New</p>  <p>10 ACR </p> <p>12v 0.5kW b:41 o:20</p> <p>TE 37425 CG 112566</p>	<p>STZ0248 New</p>  <p>24v 5.8kW</p> <p>TATRA Trucks</p> <p>OE 443115187724 MH STZ0248</p>	<p>STZ0852</p>  <p>STZ0852WA 16 ACR </p> <p>12v b:13 o:20</p> <p>BRIGGS & STRATTON Agricultural machine Industrial Engines</p> <p>JD AM39287 BG 394808 HC US852</p>	<p>STZ1026</p>  <p>240 10 ACR </p> <p>12v 1.7kW a:54.5 b:47.5 o:10</p> <p>MERCURY Marine</p> <p>ME 5073521 HC US1026</p>
<p>STZ2563</p>  <p>STZ2563WA 182 16 ACR </p> <p>12v 0.8kW a:75 b:32 o:20</p> <p>BRIGGS & STRATTON Industrial Engines</p> <p>JD AM39285 BS 795121 CG 112563</p>	<p>STZ2826</p>  <p>231 10 ACR </p> <p>12v b:33 o:22</p> <p>MERCURY Marine</p> <p>LS 5726N ME 508224621 CG 112826</p>	<p>STZ2829</p>  <p>STZ2829WA 213 9 ACR </p> <p>12v b:33.5 o:20</p> <p>MERCURY Marine YAMAHA Marine</p> <p>LS 5769N YA 65W8180000 CG 112829</p>	<p>STZ3242</p>  <p>STZ3242WA 182 16 ACR </p> <p>12v 0.6kW b:10 o:20</p> <p>BRIGGS & STRATTON Agricultural machine Industrial Engines</p> <p>LS 5744N BS 495100 CG 112242</p>
<p>STZ3539</p>  <p>STZ3539WA 186 15 ACR </p> <p>12v a:58.5 b:41 o:20</p> <p>BRIGGS & STRATTON Mowers Sports Field Equipment JOHN DEERE Tractors</p> <p>JD M143512 BS 693469 CG 113539</p>	<p>STZ3591 New</p>  <p>231 9 ACR </p> <p>12v b:34 o:20</p> <p>MERCURY MARINER Industrial applications</p> <p>MR 50834749 UT 6743240M030SM CG 113591</p>	<p>STZ3594</p>  <p>188 10 ACR </p> <p>12v 0.6kW b:9 o:20</p> <p>HONDA Industrial Engines</p> <p>HO 31200ZJ1A0040 UT 5680640M030SM CG 113594</p>	<p>STZ3650</p>  <p>291 8 ACR </p> <p>12v 0.8kW a:55 b:47 o:10</p> <p>MERCURY marine MARINER marine Outboard marine engines LANCIA Kappa 2.4L</p> <p>ME 5044415 UT 4820440M030SM CG 110650</p>

Starters

Other

STZ3853 New	STZ4075 New	STZ6935 New	STZ8149 New
 <p>170 14 ACR</p>  <p>14</p> <p>12v b:13 o:30</p> <p>BRIGGS&STRATTON CUB CADET, TORO JOHN DEERE, NH Agricultural Industrials</p> <p>BS 693551 CG 113853</p>	 <p>221 10 ACR</p>  <p>10</p> <p>12v b:18</p> <p>CUB CADET NEW HOLLAND Agricultural Industrial</p> <p>NH K0H3209801S UT 4733040M030SM CG 114075</p>	 <p>14 ACR</p>  <p>14</p> <p>12v: 1.0kW b:13 o:20</p> <p>BRIGGS & STRATTO</p> <p>BS 693552</p>	 <p>24 ACR</p>  <p>24</p> <p>12v b:12 o:20</p> <p>BRIGGS & STRATTON</p> <p>BS 498149</p>
STZ9753 New			
 <p>235 16 ACR</p>  <p>16</p> <p>12v b:48 o:31</p> <p>BRIGGS & STRATTON</p> <p>BS 490753 CG 114520</p>			

Starters

Poong Sung

<p>STY0001</p>  <p>STY0001WA</p> <p>15 CR </p> <p>12v 2.0kW a:85 b:25 o:20</p> <p>CUMMINS A2300 DEAWOO DOOSAN SSL440 Plus/450, ????- CU 4900574 PS 031013180 MH STY0001</p>	<p>STY0903</p>  <p>STY0903WA</p> <p>241 13 CR </p> <p>12v 2kW a:90 b:40.5 o:31</p> <p>FORD, MAZDA Ranger B B2200 MZ S23418400 PS 031013011 HC JS903</p>	<p>STY1234</p>  <p>STA1234WA STY1234WA</p> <p>223 9 CR </p> <p>12v 2.0kW a:82.5 b:25.5 o:22</p> <p>HYUNDAI, KIA Elantra, Santa Fe Tucson, Trajet Sportage Cerato, Carens D4EA D4EAV G4BP HY 3610027001 PS 031013170 HC JS1234</p>	<p>STY1298</p>  <p>STA1298WA STY1298WA</p> <p>236 10 CR </p> <p>12v 2.2kW a:64 b:4 o:32</p> <p>KIA J3 Carnival 2.9L KI 0K55218400 PS 031114140 HC JS1298</p>
<p>STY1446</p>  <p>STY1446WA</p> <p>10 CR </p> <p>12v 2.2kW a:64 b:12.5 o:32</p> <p>HYUNDAI J3 Terracan HY 361004X211 PS 031114240 HC CS1446</p>	<p>STY3412</p>  <p>STY3412WA</p> <p>11 ACR </p> <p>12v 2.2kW a:88 b:45 o:30</p> <p>KIA Pregio K2700 KI OK60A18400 PS 031114200 NR 014200</p>	<p>STY3420</p>  <p>STY3420WA</p> <p>11 CR </p> <p>12v 2.2kW a:86 b:22 o:20</p> <p>KIA Besta 2.7l KI OK71F18400 PS 031114020 NR 014050</p>	<p>STY3552</p>  <p>STY3552WA</p> <p>14 ACR </p> <p>12v 2.5kW a:102 b:27 o:30</p> <p>KIA PS 031115050 NR 015051</p>
<p>STY4065</p>  <p>STY4065WA</p> <p>11 ACR </p> <p>12v 2.2kW a:88 b:48 o:30</p> <p>KIA Bongo KI OK65A18400 PS 031114180 MH STY4065</p>	<p>STY5070</p>  <p>13 cr </p> <p>12v 2.5amp a:90 b:38 c:32</p> <p>KIA KI OK63818400 PO 031115070</p>		

Starters

Prestolite

<p>STP0176</p>  <p>STP0176WA 9 CR </p> <p>12v 2.8kW a:89 b:24.5 o:30</p> <p>CUMMINS</p> <p>PT M81R2003 MH STP0176</p>	<p>STP0225 <i>New</i></p>  <p>10 CR </p> <p>24v 7.5kW a:87 b:33 o:30</p> <p>PT M105R3015SE MH STP0225</p>	<p>STP0227 <i>New</i></p>  <p>12 CR </p> <p>24v 9.0kW</p> <p>OE 701127 PT MS7303A WD STR81039</p>	<p>STP0694</p>  <p>10 CR </p> <p>12v 2.6kW a:89 b:49 o:30</p> <p>HYSTER 6354 MASSEY FERGUSON ALLIS CHALMERS Tractors, Combines CA 1320015 Excavators, Loaders PT 1320510 HC CS694</p>
<p>STP0695</p>  <p>370 10 CR </p> <p>12v 3.6kW a:89 b:47.5 o:30</p> <p>PERKINS 4209 Industrial engines 4236, 4236M 6354, 6354M CV CA45G123 PT PBNS1618 HC CS695</p>	<p>STP0697</p>  <p>10 CR </p> <p>12v 2.6kW a:92 b:19 o:30</p> <p>IVECO, FORD Marine Engine</p> <p>CA 1320D183 PT 1320F183 HC CS697</p>	<p>STP0698</p>  <p>11 ACR </p> <p>24v 5.2kW a:89 b:46 o:30</p> <p>Marine</p> <p>CU 3910564 PT 1321F936 HC CS698</p>	<p>STP0700</p>  <p>371 10 CR </p> <p>24v 7.8kW a:89 b:48 o:30</p> <p>PERKINS Industrial Engines</p> <p>CV 1321022 PT 1327A410 HC CS700</p>
<p>STP0808</p>  <p>375 10 CR </p> <p>24v 5.5kW a:89 b:30.5 o:30</p> <p>KOMATSU KOMATSU Fork Lift PERKINS Industrial Engines CV 1327471 PT CA4524112 HC CS808</p>	<p>STP0871 <i>New</i></p>  <p>200 11 ACR </p> <p>12v 0.6kW a:63.5 b:43.5</p> <p>EVINRUDE JOHNSON Marine</p> <p>TK 46237 PT MDH4001 HC US871</p>	<p>STP0874 <i>New</i></p>  <p>228 10 ACR </p> <p>12v 0.6kW a:63 b:44 o:20</p> <p>JOHNSON Marine</p> <p>BD 0586283DS00 PT MKW4001 HC US874</p>	<p>STP0875</p>  <p>263 10 ACR </p> <p>12v 0.7kW a:55 b:48 o:10</p> <p>MERCURY Marine</p> <p>MR 5065436 PT MQD4108 HC US875</p>

Starters

Prestolite

<p>STP0953</p>  <p>370.5 10 CR</p> <p>12v 3.6kW a:89 b:47.5 o:30</p> <p>CLARK Fork Lift LISTER Marine MASSEY FERGUSON PERKINS Industrial Engines CV CA45F1272 PT PBNS1608 HC CS953</p>	<p>STP2016 <i>New</i></p>  <p>10 CR</p> <p>12v 4kW a:87 b:32 o:30</p> <p>IS IS1194 PE M100R2016SE</p>	<p>STP2090</p>  <p>371.5 10 CR</p> <p>24v 5.2kW a:92 b:20.5 o:30</p> <p>FORD Marine</p> <p>CV 1321D551 PT PBNS1653 CG 112090</p>	<p>STP2180 <i>New</i></p>  <p>12 CR</p> <p>24v 5.2kW a:92 b:49 o:30</p> <p>CUMMINS DENNIS</p> <p>CU 3281354 PT 1327A581 CG 112180</p>
<p>STP2240</p>  <p>209 9 ACR</p> <p>12v 0.6kW a:63.5 b:44 o:10</p> <p>JOHNSON Marine</p> <p>PT MGD4110 PT MQD4106 CG 110240</p>	<p>STP2244</p>  <p>436 12 CR</p> <p>24v 7.5kW a:92 b:47 o:30</p> <p>ERF Trucks EU SEDDON Trucks EU</p> <p>PT MS3503 HC US1244</p>	<p>STP2245</p>  <p>375.5 10, 12 CR</p> <p>24v 5.5kW a:88.5 b:48 o:30</p> <p>ERF Trucks EU FODEN Trucks EU SEDDON Trucks EU</p> <p>CUMMINS B CU 3281354RX PT MS4401 HC US1245</p>	<p>STP2656</p>  <p>375 10, 12 CR</p> <p>24v 4.5kW a:89 b:48 o:30</p> <p>DAF Trucks EU ERF Trucks EU FODEN Trucks EU SEDDON Trucks EU</p> <p>BU 859399 PT 860803 CG 112656</p>
<p>STP3001 <i>New</i></p>  <p>10 CR</p> <p>24v 6.0kW a:89 b:47.5 o:30</p> <p>PT M100R3001SE MH STP3001</p>	<p>STP3013 <i>New</i></p>  <p>11 CR</p> <p>24v 6.2kW a:92 b:51 o:30</p> <p>MERCEDES-BENZ</p> <p>ME 0051515001 PR M105R3013SE</p>	<p>STP3038</p>  <p>12 CR</p> <p>24v 7.5kW a:92 b:47.5 o:30</p> <p>YUTONG Cummins L325, L360</p> <p>Cummins 6CT YU 37E1108010 PT M105R3038SE MH STP3038</p>	<p>STP3253</p>  <p>11 CR</p> <p>12v 8kW a:92 b:47.5</p> <p>FREIGHTLINER WESTERN STAR VOLVO</p> <p>Cummins ISX VO 85124897 PT M125R2001SEP MH STP3253</p>

Starters

Prestolite

<p>STP3314 <i>New</i></p>  <p>10 CR </p> <p>12v 6.0kW a:86 b:22 o:30</p> <p>DEUTZ TBD 226B</p> <p>OE 13031614 PT M100R2005SE MH STP3314</p>	<p>STP3410</p>  <p>10 CR </p> <p>24v 5kW a:88 b:47.5</p> <p>DENNIS BUS</p> <p>DE 661096 PT M96R3014SE DE 661096</p>	<p>STP3501</p>  <p>12 CR </p> <p>24v 7.5kW a:92 b:47.5</p> <p>KING LONG-XMQ6121GEU XMQ6127EU</p> <p>CU C5255292 PT M105R3001SE MH STP3501</p>	<p>STP3502</p>  <p>STP3502WA</p> <p>11 CR </p> <p>24v 7.5kW a:89 b:47.5</p> <p>WEIFENG WD615/618</p> <p>YU HG1500095029 PT M105R3002SE MH STP3502</p>
<p>STP3503</p>  <p>STP3503WA</p> <p>11 CR </p> <p>24v 7.5kW a:88 b:47.5</p> <p>WUXI 6DM</p> <p>FW 370801053DB PT M105R3003SE MH STP3503</p>	<p>STP3506</p>  <p>12 CR </p> <p>24v 7.5kW a:92 b:47.5</p> <p>YUTONG</p> <p>Cummins ISL</p> <p>YU 100500646 PT M105R3004SE MH STP3506</p>	<p>STP3507 <i>New</i></p>  <p>12 CR </p> <p>24v 7.5kW a:92 b:47.5 o:30</p> <p>KING LONG ANKIA MERCEDES MBE4000</p> <p>CUMMINS ISB, ISC, ISL DETROIT Diesel WL 91014762N PT M105R3503SE MH STP3507</p>	<p>STP3520</p>  <p>11 CR </p> <p>24v 7.5kW a:92 b:47.5</p> <p>WEIFENG WD615/618</p> <p>PT M105R3020SE MH STP3520</p>
<p>STP3523</p>  <p>359 11 CR </p> <p>24v 7.5kW a:89 b:32</p> <p>YULIN DIESEL YC6M</p> <p>PT M105R3023SE MH STP3523</p>	<p>STP3524</p>  <p>359 11 CR </p> <p>24v 7.5kW a:89 b:32</p> <p>YULIN DIESEL YC6A240</p> <p>PT M105R3024SE MH STP3524</p>	<p>STP3525</p>  <p>STP3525WA</p> <p>371 11 CR </p> <p>24v 7.5kW a:107 b:42</p> <p>SHANGHAI DIESEL - D6114</p> <p>PT M105R3027SE MH STP3525</p>	<p>STP3601</p>  <p>316 12 ACR </p> <p>24v 6kW a:88 b:47.5</p> <p>Cummins 4BT3.9 ISBe</p> <p>EQB180-210</p> <p>CU C4929600 PT M93R3002SE MH STP3601</p>




Starters

Prestolite

<p>STP3606</p>  <p>STP3606WA 364 10 CR</p> <p>24v 5.5kw a:89 b:47.5</p> <p>Cummins ISBE220/250-30 Cummins Engines</p> <p>CU C4930605 PT MS440401 MH STP3606</p>	<p>STP3622</p>  <p>STP3622WA 316 10 cr</p> <p>24v 6.0kw a:89 b:47 o:30</p> <p>Cummins ISDE180-30 ZK 6737D YUTONG</p> <p>CU C4934622 PT M93R3014SE MH STP3622</p>	<p>STP3649</p>  <p>290 10 ACR</p> <p>12v 0.8kw a:55 b:45.5</p> <p>MERCURY Marine</p> <p>MY 5057867 PT MJL4002 CG 110649</p>	<p>STP3904</p>  <p>STP3904WA 320 10 CR</p> <p>24v 6.0kw a:28 b:89 o:30</p> <p>DEUTZ - Various engine M130, M160, AG IVECO, KHD POCLAIN</p> <p>YU S3708010D286 PT M93R3004SE MH STP3904</p>
<p>STP3909</p>  <p>11 CR</p> <p>24v 6.6kw a:88 b:33</p> <p>YUCHAI - LCK6112G, LCK6115H</p> <p>PT M90R3510SE MH STP3909</p>	<p>STP3911</p>  <p>310 12 CR</p> <p>24v 6.0kw a:89 b:47.5</p> <p>CHINESE BUS - Various models</p> <p>YU 370800043 PT M93R3011SE MH STP3911</p>	<p>STP3913</p>  <p>STP3913WA 298 11 CR</p> <p>24v 6.0kw a:87.5 b:32 o:30</p> <p>HIGER - S7-S8</p> <p>PT M93R3016SE PT M93R3005ASE MH STP3913</p>	<p>STP3914</p>  <p>STP3914WA 310 10 CR</p> <p>24v 6.0kw a:89 b:21</p> <p>Yutong Bus Forklift XCMG</p> <p>PT M93R3015SE PT M93R3007SE MH STP3914</p>
<p>STP3918</p>  <p>STP3918WA 298 11 CR</p> <p>24v 6.0kw a:88 b:32</p> <p>YUCHAI 4G 4E 6A 6G 6J</p> <p>YU 63003708100002 PT M93R3018SE MH STP3918</p>	<p>STP3925</p>  <p>STP3925WA 316 10 CR</p> <p>24v 6.0kw a:89 b:47.5</p> <p>DONGFENG-CUMMINS ISDE ENGINES</p> <p>CU C5256026 PT M93R3025SE MH STP3925</p>	<p>STP3967</p>  <p>316 12 CR</p> <p>24v 6.0kw a:89 b:47.5</p> <p>Cummins DCEC EQB180-20</p> <p>CU C4983067 PT M93R3003SE MH STP3967</p>	<p>STP4133</p>  <p>316 12 CR</p> <p>24v 6.0kw a:89 b:47.5</p> <p>CHINESE BUS Various models</p> <p>YU 101500056 PT M100R3002SE MH STP4133</p>

Starters

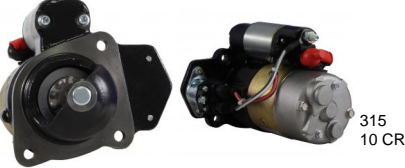Prestolite

STP4281	STP4538	STP4858	STP4961
 <p>315 10 CR</p> 	 <p>STP4538WA</p> <p>12 cr</p> 	 <p>STP4858WA</p> <p>316 12 CR</p> 	 <p>316 12 CR</p> 
<p>12v 6.0kw a:89 b:47</p> <p>Cummins ISF 3.8L 12 V</p> <p>CU 5263797 PT M100R2008SE MH STP4281</p>	<p>24v 7.5kw a:70 b:50 o:30</p> <p>DongFeng DFL3251A DFL4251, DFL4181 DFL3250A1 (Cummins)</p> <p>PT C3415538 MH STP4538</p>	<p>24v 6.0kw a:89 b:47.5 o:30</p> <p>HIGER - S7-S8</p> <p>CU C4948058 PT M93R3001SE MH STP4858</p>	<p>24v 6.0kw a:89 b:47.5 o:30</p> <p>CHINESE BUS - Various models KING LONG - XMQ6900Y</p> <p>CU C4992261 PT M93R3013SE MH STP4961</p>
STP6766	STP7305		
 <p>375 10,12 CR</p> 	 <p>11 CR</p> 		
<p>24v 5.5kW a:89 b:48 o:30</p> <p>ERF FODEN SEDDON Trucks EU</p> <p>BU 859839PB BU 856766 HC US1243</p>	<p>24v 9kW a:92 b:47 o:30</p>		

Starters

Russian (USSR)

<p>STR0063</p>  <p>STR0063WA 405 10 CR</p> <p>24v 5.0kW a:92 b:50 o:30</p> <p>VALDAY PAZ CUMMINS</p> <p>Cummins 3.8L ISF</p> <p>CU 5268413 PT M93R3042SE MH STR0063</p>	<p>STR0064 <i>New</i></p>  <p>STR0064WA 9 CR</p> <p>12v 2.5kW a:82 b:21 o:22</p> <p>GAZ UAZ</p> <p>ZMZ 405,406 409,51410 GZ 60123708 IS 11131568 MH STR0064</p>	<p>STR0065 <i>New</i></p>  <p>STR0065WA 9 CR</p> <p>12v 1.5kW a:82 b:28 o:22</p> <p>GAZ</p> <p>ZMZ53 ZMZ513</p> <p>GZ CT230?1 GZ ???230?1370800010 MH STR0065</p>	<p>STR0067 <i>New</i></p>  <p>STR0067WA 9 CR</p> <p>12v 1.8kW a:82 b:28 o:20</p> <p>ZIL LAZ LIA</p> <p>130 695H 3677M ZL ???230?43708000 LA 88123708 MH STR0067</p>
<p>STR0068 <i>New</i></p>  <p>STR0068WA 9 CR</p> <p>12v 1.8kW a:81 b:35 o:20</p> <p>GAZ VOLGA GAZEL SOBOL</p> <p>ZMZ40210 402110</p> <p>UZ 4216370800052 UZ 4216370801 MH STR0068</p>	<p>STR0070 <i>New</i></p>  <p>STR0070WA 9 CR</p> <p>12v 1.3kW a:82 b:34 o:20</p> <p>UAZ, VOLGA 3151 31512 3751 396</p> <p>LK 623708 UZ 57323708 MH STR0070</p>	<p>STR0139</p>  <p>STB0139WA 237 11 CR</p> <p>12v 1.3kW a:82.5 b:22 o:33</p> <p>FIAT, LADA 1200 1500 Niva, Nova Toscana</p> <p>VAZ2101, VAZ2103 VAZ21011, VAZ2106 VAZ2103, VAZ2105 LA 2111370801001 BO 0001208218 HC CS139</p>	<p>STR0178</p>  <p>STR0178WA 11 CR</p> <p>12v 1.2kW a:66 b:7</p> <p>LADA Kalina Priora Granta</p> <p>1.6 MT</p> <p>LA 219013708010 VA TS12E901 MH STV0178</p>
<p>STR0179</p>  <p>STR0179WA 9 CR</p> <p>12v 1.2kW a:66 b:14 o:30</p> <p>LADA Kalina Priora Granda</p> <p>1.6 AT</p> <p>LA 21902370801000 VA TS12E902 MH STV0179</p>	<p>STR0332</p>  <p>STB0332RB STB0332WA STI0332RB 245 11 ACR</p> <p>12v 1.3kW a:82.5 b:32 o:30</p> <p>LADA Samara Nova</p> <p>VAZ21081 VAZ2108 VAZ21083 LA 4243708 BO 0001108099 HC CS332</p>	<p>STR1138</p>  <p>9 CR</p> <p>12v 0.92kW a:68 b:30 o:20</p> <p>VAZ 1111 OKA</p> <p>LA 11113708000 MH STR1138</p>	<p>STR1182</p>  <p>STB1182WA STR1182WA 267 9 ACR</p> <p>12v 1.4kW a:76 b:35 o:20</p> <p>Lada 110 111 112 Samara</p> <p>VAZ2111 VAZ2112 VAZ2111 LA 2110370801002 BO 0001108203 HC CS1182</p>

Starters

Russian (USSR)

<p>STR2488</p>  <p>STR2488WA 238.5 10 CR</p> <p>12v 3kW a:100 b:32 o:30</p> <p>BELARUS D240 MTZ Series D181T Various Models D260T SK 9142780 MG 443115142780 CG 112488</p>	<p>STR3356</p>  <p>STR3356WA 235 10 CR</p> <p>24v 3.5kW a:100 b:32 o:30</p> <p>BELARUS D2602 GAZ D24512 ZIL D2457 5310 IS AZJ3223 4327 MT 9172780 CG 113356</p>	<p>STR3372</p>  <p>STR3372WA 9 CR</p> <p>12v 1.7kW</p> <p>VOLGA GAZ 3102 402 VOLGA GAZ 3110 VOLGA GAZ 3129 LA 4223708000 AT 57323708PLGR MH STR3372</p>	<p>STR3431</p>  <p>STR3431 338 10 CR</p> <p>12v 3kW a:101 b:30 o:30</p> <p>BELARUS Agricultural machine BE 24173708000 IS 11130685 CG 113431</p>
<p>STR3820 <i>New</i></p>  <p>STM3820 STM3820WA 10 CR</p> <p>12v 1.2kW a:64.5 b:7 o:22</p> <p>JEEP CH 56041436AC GAZ, GAZEL MI M0T91981 Liberty CG 113820 Wrangler Chrysler Engine</p>	<p>STR3969</p>  <p>STR3969WA 10 CR</p> <p>12v 2.5kW a:88.5 b:20</p> <p>GAZEL CUMMINS ISF 2.8 CU 5266969 CU 5295576 MH STR3969</p>	<p>STR4116</p>  <p>STR4116WA 10 CR</p> <p>24v 5.5kW a:92 b:26 o:30</p> <p>KAMAZ 6520 53215 55111 BO 0001241016 BO 0001261006 MH STR4116</p>	<p>STR4163</p>  <p>STR4163WA 10 cr</p> <p>24v 6kW a:91 b:48 o:43</p> <p>KAMAZ Euro I URAL 740.11-240 Euro I 740.13-260 KZ 89123708 IS 11131638 MH STR4163</p>
<p>STR4554</p>  <p>STR4554WA 10 cr</p> <p>24v 4kW a:92 b:46 o:30</p> <p>KAMAZ Euro-2 IS AZF4554 IS 11131150 MH STR4554</p>	<p>STR4581</p>  <p>STR4581 10CR</p> <p>24v 5.5kW a:101 b:44 o:41</p> <p>MAZ YMZ236 KRAZ YMZ238 LIAZ VOLGANIN IS AZF4581 URAL IS 11131316 MH STR4581</p>	<p>STR4935</p>  <p>STP4935 STR4935WA 316 10 CR</p> <p>24v 6.0kw a:89 b:47.5 o:30</p> <p>Cummins ISB 8.3L ISL, ISBE 185, 210, 270 KAMAZ CU C4992135 PT M93R3026SE MH STP4935</p>	<p>STR4942 <i>New</i></p>  <p>STB4942 STB4942WA 9 CR</p> <p>12v 1.8kW a:82.50 b:21 o:22</p> <p>GAZ ZMZ 560 Stayer Gazel Sobol Volga IS 11130899 BO 0001109042 NR 01109042</p>

Starters

Russian (USSR)

STR4946 New	STR4963 New	STR4965 New
 <p>STB4946 STB4946WA</p> <p>9 CR </p>	 <p>STB4963 STR4963WA</p> <p>9 CR </p>	 <p>STB4965 STR4965WA</p> <p>9 CR </p>
<p>12v 2kW a:89 b:22 o:30</p>	<p>12v 1.8kW a:82 b:24 o:22</p>	<p>12v 2kW a:82 b:24 o:22</p>
<p>GAZ Gazel 2.4d Andoria</p> <p style="text-align: right;">BO 0001109046 MH STR4946</p>	<p>GAZ UAZ HUNTER UAZ 31512 GAZELLE, SOBOL LD 60123708P VOLGA 2.3L, 2.5L BO 0001109063 MH STR4963</p>	<p>GAZ GAZELLE SOBOL VOLGA GZ 42370810 UAZ, HUNTER BO 0001109061 MH STR4965</p>












Starters

SA

<p>STW0816</p>  <p>STW0816WA</p> <p>11 CR </p> <p>24v 6kW a:105 b:35 o:30</p> <p>SAWAFUJI PD6, PE6, NF6 NISSAN PF6PE6, NF6T CD41, CD45, CK20 CK30, CK31, CW41 CM87, CM88, CW40, CP88</p> <p>NI 2330096065 SW 03506020015 NR 016076</p>	<p>STW3012</p>  <p>STW3012WA</p> <p>324 11 CR </p> <p>24v 6kW A:121 B:40 o:30</p> <p>NISSAN RD8 ISUZU RE8 TRUCKS</p> <p>NI 2330097001 SW 03507020011 CG 114422</p>	<p>STW3055</p>  <p>STW3055WA</p> <p>11 CR </p> <p>24v 7.5kW a:100 b:54 o:30</p> <p>HINO S6A MITSUBISHI S6A2 S6B</p> <p>SW 03405520111 NR 0137010</p>	<p>STW3130</p>  <p>STW3130WA</p> <p>296 11 CR </p> <p>24v 4.5kW a:105 b:32 o:21</p> <p>HINO W04 Industrial Engine W06</p> <p>HN 281001542 SW 03504020210 CG 113130</p>
<p>STW3213</p>  <p>STW3213WA</p> <p>11 cr </p> <p>24v 6kW a:122 b:43 o:30</p> <p>HINO TRUCKS EK100 750, EF550, EK100 F20C, K13C</p> <p>EL100 HN 281001645 SW 03507020025 CG 114345</p>	<p>STW3220</p>  <p>STW3220WA</p> <p>12 CR </p> <p>24v 11kW a:92 b:46 o:30</p> <p>KOMATSU SA6D140 Crawlers S6D125 Lift Trucks Motor Graders</p> <p>KT 6008134212 SW 03517020220 NR 018060</p>	<p>STW3250</p>  <p>STW3250WA</p> <p>12 CR </p> <p>24v 11kW a:91 b:48 o:30</p> <p>KOMATSU SA6D108</p> <p>KT 6008138810 SW 03517020250 NR 018820</p>	<p>STW3324</p>  <p>STW3324WA</p> <p>11 CR </p> <p>24v 4.5kW a:105 b:29 o:20</p> <p>HINO J08C Dutro S05D Ranger J05C TOYOTA HN 2810078060 Dyna SW 03555020021 NR 012326</p>
<p>STW3332</p>  <p>STW3332WA</p> <p>11 CR </p> <p>24v 4.5kW a:105 b:28 o:20</p> <p>HINO S05C Dutro Bus & Trucks KS-FS1E</p> <p>HN 2810078090 SW 03555020035 NR 012625</p>	<p>STW3540</p>  <p>STW3540WA</p> <p>11 cr </p> <p>24v 7.5kW a:122 b:43 o:30</p> <p>HINO EF750</p> <p>HN 281002590B SW 03507020541 MH STW3540</p>	<p>STW3592</p>  <p>STW3592WA</p> <p>11 cr </p> <p>24v 11kW a:92 b:49 o:30</p> <p>HINO CUMMINS QSK23 KOMATSU Excavators Wheel Loader</p> <p>KT 6008133963 SW 03517020520 NR 018060</p>	<p>STW3862</p>  <p>STW3862WA</p> <p>11 CR </p> <p>24v 6.0kW a:121 b:50</p> <p>HINO E13C, KSFS1E, KSFQ1E FE1E, FN1E, FR1E K13C, K13C, K13D</p> <p>FR1E, FN1E, FE1E SH1E, SS1E, RU1E HN 281002862 SW 03656020011 UP STR7912</p>

Starters

SA

<p>STW4026</p>  <p>STW4026WA 11 CR</p> <p>24v 5.5kW a:121 b:43 o:30</p> <p>HINO P11C 390HP</p> <p>TO 28100E0010 SW 03656020042 UP STR7911</p>	<p>STW4310</p>  <p>STW4310WA 13 cr</p> <p>24v 5kW a:100 b:50 o:30</p> <p>HINO 6DB1 P&H320 6DB10 P&H325 P&H335</p> <p>SW 03005520210 NR 0112010</p>	<p>STW4341</p>  <p>STW4341WA 11</p> <p>24v 5.5kW a:100 b:28 o:30</p> <p>HINO EH500 EH700 H06C H07C</p> <p>HN 281002062 SW 03505020041 NR 010330</p>	<p>STW4344</p>  <p>STW4344WA 11 CR</p> <p>24v 6kW a:121 b:58 o:30</p> <p>HINO EF750 EM100,EK200 EM100 HITACHI EP100 Excavator EX300 HN 281001743A Excavator UH09-7 SW 03506020118 CG 114344</p>
<p>STW4370</p>  <p>STW4370WA 11 cr</p> <p>24v 5kW a:105 b:23 o:20</p> <p>HINO W06D Lift Truck W06E AC 140 P-FD16 FD3W</p> <p>HN 281001813 SW 03505020070 NR 0101850</p>	<p>STW4421</p>  <p>STW4421WA 325 11 CR</p> <p>24v 6.0kW a:105 b:38.5 o:30</p> <p>HINO TRUCKS NF6TA, PF6, PF6T, PF6T</p> <p>NI 2330096504 SW 03506020261 CG 114421</p>	<p>STW4422</p>  <p>STW4422WA 13 cr</p> <p>24v 5kW a:105 b:38.5 o:30</p> <p>HINO DK10, DS70 EB100 EB200 NI 2330096504 SW 03005520420 CG 114421</p>	<p>STW4436</p>  <p>STW4436WA 11 CR</p> <p>24v 5kW a:105 b:32 o:20</p> <p>HINO J07C J06C JO8C HN 281002624C SW 03555020040 CG 114436</p>
<p>STW4441</p>  <p>321 11 CR</p> <p>24v 5.5kW a:105 b:31 o:20</p> <p>HINO Trucks EU W06E Diesel</p> <p>SW 03505520357 CG 114441</p>	<p>STW4510</p>  <p>STW4510WA 11 CR</p> <p>24v 6kW a:105 b:50 o:30</p> <p>NISSAN UD43 UD4 UD63 UD5 UD6</p> <p>NI 2330090006 SW 03005520510 MH STW4510</p>	<p>STW4520</p>  <p>STW4520WA 11 CR</p> <p>24v 6kW a:122 b:40 o:30</p> <p>HINO PCW54 NISSAN CD54 RE8, RF8 PRA53 NI 2330097077 SW 03506020320 NR 017077</p>	<p>STW4540</p>  <p>STW4540WA 11 cr</p> <p>24v 5kW a:105 b:30 o:30</p> <p>NISSAN NE6</p> <p>NI 2330095009 SW 03506020220 NR 012722</p>

Starters

SA

STW4812



STW4812WA

13 CR 

24v 6kW a:100 b:30 o:30

HINO ER100

**HN 281001081
SW 03006020812
MH STW4812**

Starters

Valeo

STV0081	STV0094	STV0104	STV0126
 <p>9 CR </p>	 <p>STV0094WA 9 ACR </p>	 <p>12 CR </p>	 <p>STV0126WA 9 ACR </p>
<p>12v 1.6kW a:82.5 b:22 o:21</p> <p>AUDI ZT 90 ZY 100 MERCEDES MB 0021517101 VA 433293QO HC CS81</p>	<p>12v 0.6kW a:66 b:22.5 o:20</p> <p>RENAULT 847720 Fuego B1B707 R4 800705 R5 RE 8982775079 Rodeo VA D6RA421 HC CS94</p>	<p>12v 2.2kW a:76 b:14 o:33</p> <p>RENAULT 2.0 dCi LAGUNA III Espace IV 2.0 dci VA ESW22E8 MH STV0104</p>	<p>12v 0.7kW a:66 b:20 o:20</p> <p>CITROEN M28, M281 Ami A791 Dyane A06635 Mehari CI 5426014 VA D6RA431 HC CS126</p>
STV0127	STV0129	STV0131	STV0143
 <p>9 ACR </p>	 <p>9 CR </p>	 <p>9 ACR </p>	 <p>9 CR </p>
<p>12v 0.7kW a:60 b:87 o:20</p> <p>Citroen PEUGEOT CI GX0610503 VA D8E103 HC CS127</p>	<p>12v 1.1kW a:99 b:38 o:33</p> <p>CITROEN CI 5490422 VA D9E40 HC CS165</p>	<p>12v 1.5kW a:66 b:28 o:33</p> <p>PEUGEOT 304 305 PE 7932567913 VA D10E72 HC CS273</p>	<p>12v 0.9kW a:66 b:12 o:30</p> <p>DAF RENAULT VOLVO VA D9E26 HC CS143</p>
STV0155	STV0162	STV0168	STV0170
 <p>9 CR </p>	 <p>STV0162WA 9 CR </p>	 <p>9 ACR </p>	 <p>9 CR </p>
<p>12v 2.4kW a:82 b:30 o:33</p> <p>CITROEN PEUGEOT CI 95580181 VA D11E169 HC CS155</p>	<p>12v 0.7kW a:68 b:17 o:20</p> <p>OPEL 13NB, 14NV PONTIAC E16NZ, C14NZ Astra 12S, 13S Corsa OP 1202109 Kadett VA D6RA169 HC CS162</p>	<p>12v 0.8kW a:80 b:25 o:33</p> <p>PEUGEOT PE 555818 VA 432511QO HC CS168</p>	<p>12v 1kW a:82 b:21 o:30</p> <p>RENAULT RE 7700621108 VA D10E89 HC CS170</p>




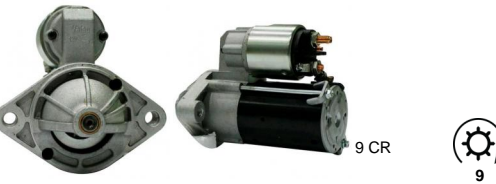








Starters

Valeo

<p>STV0181</p>  <p>220 10 CR</p> <p>10</p> <p>12v 1.4kW a:60 b:28.5 o:22</p> <p>MERCEDES-BENZ M278932 S500 4 Matic start-stop system</p> <p>MB A2789060900 VA TS14E17 MH STV0181</p>	<p>STV0182</p>  <p>220 10 CR</p> <p>10</p> <p>12v 1.4kW a:60 b:28.5 o:22</p> <p>MERCEDES-BENZ W221 M-CLASS S-CLASS 4 Matic start-stop system</p> <p>MB A2769062500 VA TS14E6 MH STV0182</p>	<p>STV0183</p>  <p>9 CR</p> <p>9</p> <p>12v 1.1kW a:76 b:20.5 o:20</p> <p>BMW 320</p> <p>BM 12411717175 VA D6RA25 HC CS183</p>	<p>STV0184</p>  <p>220 10 CR</p> <p>10</p> <p>12v 1.4kW a:60 b:28.5 o:20</p> <p>MERCEDES-BENZ C218 500</p> <p>MB A2789060800 VA TS14E7 MH STV0184</p>
<p>STV0185 <i>New</i></p>  <p>8 CR</p> <p>8</p> <p>12v 1.4kW a:76.5 b:19 o:22</p> <p>JAC, TAGAZ C190 REFINE 2.0L, 2.4L</p> <p>4GA3</p> <p>TZ 1015201GA VA SD6RA111 VA 442052</p>	<p>STV0193 <i>New</i></p>  <p>8 CR</p> <p>8</p> <p>12v 1.1kW a:76.5 b:14 o:22</p> <p>Hafei Saibao3/5 1.6L Manual/Auto FWD</p> <p>BY 471Q3708950 VA SD6RA71 MH STV0193</p>	<p>STV0196 <i>New</i></p>  <p>9 ACR</p> <p>9</p> <p>12v 1.1kW a:75.5 b:35 o:30</p> <p>CHERY Fulwin 1.6L</p> <p>CE A113708110A1 VA SD6RA78 VA 442049</p>	<p>STV0197 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 1.4kW a:82 b:11 o:21</p> <p>CHERY A3 Tiggo Orient Son Orient Son Cross</p> <p>1.6L 1.8L 2.0L CE B113708110BA VA SD6RA96 VA 442045</p>
<p>STV0199 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 2.2kW a:81 b:8 o:22</p> <p>CHERY 1.9L Diesel</p> <p>CE B113708110CA VA TS22E3 VA 442043</p>	<p>STV0203 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 1.1kW a:74 b:12 o:31</p> <p>BYD F6 1.8L (AT)</p> <p>VA D6G71 VA 442223</p>	<p>STV0204 <i>New</i></p>  <p>9 CR</p> <p>9</p> <p>12v 1.1kW a:70 b:31 o:21</p> <p>BYD F3 1.5L (MT)</p> <p>VA D6GC305 VA 442199</p>	<p>STV0205 <i>New</i></p>  <p>10 CR</p> <p>10</p> <p>12v 1.0kW a:76 b:48 o:20</p> <p>JAC Tongyue Heyue</p> <p>VA D6GCS210 VA 442222</p>

Starters

Valeo

<p>STV0206 <i>New</i></p>  <p>12v 1.4kW a:82 b:27 o:22</p> <p>INSTANA MB100</p> <p>VA D6RA99 VA 442224</p>	<p>STV0207 <i>New</i></p>  <p>12v 0.8kW a:75 b:6 o:22</p> <p>CHERY QQ3 QQ6</p> <p>1.1L</p> <p>CE S113708110 VA D6GC201 VA 442197</p>	<p>STV0208 <i>New</i></p>  <p>12v 1.1kW a:80.5 b:7.5 o:21</p> <p>CHERY A1 M1 QQ6 Riich2</p> <p>1.3L</p> <p>CE S123708110BA VA SD6RA131 VA 442047</p>	<p>STV0209 <i>New</i></p>  <p>12v 1.1kW a:75 b:9 o:20</p> <p>CHERY Riich2</p> <p>1.2L</p> <p>CE S213708110 VA D6GC208 VA 442044</p>
<p>STV0226 <i>New</i></p>  <p>12v 1.4kW a:60 b:28 o:22</p> <p>MERCEDES-BENZ C-Class E-Class S-Class GLK, SLK, CLS</p> <p>3.5L Gasoline M276950, M276952 M276956, M276957</p> <p>MB A2769062600 VA TS14E16 MH STV0226</p>	<p>STV0234 <i>New</i></p>  <p>24v 7.7kW a:100 b:21 o:30</p> <p>RE 5001014200 VA D13HP704 HC CS1127</p>	<p>STV0277 <i>New</i></p>  <p>24v 7.2kW a:90 b:48 o:30</p> <p>RE 5010217957 VA D13HP609 VA 438020</p>	<p>STV0280</p>  <p>12v 1.1kW a:66 b:3.0 o:33</p> <p>DELOREAN DMC RENAULT Espace Safrane</p> <p>STV0280WA</p> <p>197.5 9 CR</p> <p>Z7V708 Z7V711 Z7U RE 7700751495 VA D9E300 HC CS280</p>
<p>STV0306</p>  <p>12v 1.05kW a:75 b:7 o:30</p> <p>CITROEN PEUGEOT TALBOT</p> <p>STV0306RB STV0306WA</p> <p>9 CR</p> <p>PE 580253 VA D9E83 HC CS306</p>	<p>STV0310</p>  <p>12v 0.9kW a:66 b:-2 o:44</p> <p>RENAUT 9 .11. 19. 21 VOLVO 440K.460L.480E</p> <p>STV0310WA</p> <p>9, 10 CR</p> <p>F3N718,C1J782 B16F,B18FT C2J757,C2J757 RE 7700758217 VA 433309 VO 9031082</p>	<p>STV0314</p>  <p>12v 2.0kW a:89 b:21 o:30</p> <p>PEUGEOT TALBOT 504 505 604</p> <p>293 10 CR</p> <p>XD4X90 XD3T XD3TE PE 9150803080 VA D11E179 HC CS314</p>	<p>STV0315</p>  <p>12v 0.9kW a:66 b:10 o:32</p> <p>RENAULT R4 R5 R12 Traffic</p> <p>STV0315WA</p> <p>9 CR</p> <p>C1E714 688712 847712 RE 7701499200 VA D9E278 HC CS315</p>

Starters

Valeo

<p>STV0317</p>  <p>STV0317WA 208 9 CR</p> <p>12v 1.2kW a:66 b:-4 o:33</p> <p>CITROEN J5R716 PEUGEOT J5R722 RENAULT J7T780 Fuego RE 7700759283 Master VA D9E85 HC CS317</p>	<p>STV0321</p>  <p>STV0321WA 207 9 CR</p> <p>12v 1.05kW a:66 b:11 o:33</p> <p>ASTRA 847720 RENAULT A2M723 VOLVO B144E, B144S Fuego RE 7700681068 340, 343 VA D9E66 HC CS321</p>	<p>STV0326</p>  <p>STV0326WA 208 9 CR</p> <p>12v 1.2kW a:66 b:-4 o:33</p> <p>CITROEN D6B PEUGEOT 180A, 180Z B1E, BDY PE 9150864580 VA D9EP119 HC CS326</p>	<p>STV0342</p>  <p>280 10, 11, 12, 13 CR</p> <p>12v 1.7kW a:66 b:-6.5 o:33</p> <p>CITROEN A9A, DJY FIAT WJY, WJZ HYUNDAI D9B, D2F PEUGEOT FI 71719606 SUZUKI VA D7R127 HC CS342</p>
<p>STV0352</p>  <p>STV0352WA 197 9 CR</p> <p>12v 1.05kW a:66 b:22 o:22</p> <p>CITROEN XM7T FIAT CRD93LS PEUGEOT XN1TA TALBOT CI 7910004942 VA D8E124 HC CS352</p>	<p>STV0353</p>  <p>STV0353WA 12 CR</p> <p>12v 3.1kW a:75 b:-7 o:33</p> <p>ERF, JEEP, SCANIA J8S776 NEOPLAN, RENAULT 852710 Cherokee D2066LUH22 Espace CH 56026851 Master VA D9R73 HC CS353</p>	<p>STV0354</p>  <p>STV0354WA 265 10, 11 CR</p> <p>12v 1.7kW a:66 b:-1 o:33</p> <p>MITSUBISHI F8QT NEOPLAN Trucks D2066LUH47 PORSHE DC1305 RENAULT RE 7701351392 SCANIA Trucks VA D10E921 HC CS354</p>	<p>STV0355</p>  <p>STB0355RB STV0355RB STV0355WA 212 9 CR</p> <p>12v 0.85kW a:66 b:16 o:33</p> <p>CITROEN V06644 PEUGEOT 109K, 150C TALBOT KDZ, 109F Samba PE 555845 C15 VA D8E107 HC CS355</p>
<p>STV0361</p>  <p>STB0361WA 11, 12 CR</p> <p>12v 2.2kW a:98.5 b:36 o:33</p> <p>CITROEN, PEUGEOT CRD93 TALBOT CRD93LS C25, CX M25660 J5, J7 CI 95619197 Express VA D9R90 HC CS361</p>	<p>STV0365</p>  <p>STV0365WA 9 ACR</p> <p>12v 2.2kW a:98.5 b:37.5 o:33</p> <p>CITROEN FIAT CI 95493097 VA D11E164 HC CS365</p>	<p>STV0371</p>  <p>STV0371RB STV0371WA 9, 10 CR</p> <p>12v 0.9kW a:64 b:11 o:32</p> <p>FIAT, LANCIA 156C046 Panda 156A2100 Tipo 804502 Uno FI 7621040 Y VA D6RA39 HC CS371</p>	<p>STV0390</p>  <p>STV0390WA 9 CR</p> <p>12v 0.9kW a:62 b:-5 o:31</p> <p>CITROEN, PEUGEOT KFW, KFX Berlingo NFT, NFZ 205, 206, 207 KFX, KDX 306, 307, 309 CI 95624960 Partner VA D6RA10 HC CS390</p>










Starters

Valeo

<p>STV0415 New</p>  <p>12v 1.8kW a:90.5 b:22 o:55</p> <p>CITROEN 2.3L C5</p> <p>PE 5802FM VA TS18C1 VA 442128</p>	<p>STV0519</p>  <p>STB0519RB STD0519RB STV0519RB</p> <p>12v 1kW a:68 b:19 o:20</p> <p>DAEWOO C13N, 13SB CHEVROLET X16SZ, X14XE OPEL G15MF, A15MF Nexia, Lanos Astra, Corso</p> <p>OP 1202173 VA D6RA293 HC CS519</p>	<p>STV0523</p>  <p>12v 2.2kW a:65.5 b:5 o:33</p> <p>CITROEN J6TA500 EAGLE J6R726 RENAULT J7T772 Espace RE 7700664932 Fuego VA D10E88 HC CS523</p>	<p>STV0545</p>  <p>12v 1.5kW a:66 b:-6.5 o:30</p> <p>CITROEN RENAULT</p> <p>FI 73116966 VA D10E74 HC CS545</p>
<p>STV0566</p>  <p>STB0566RB STV0566RB STV0566WA</p> <p>12v 1.1kW a:62 b:-5 o:33</p> <p>CITROEN, FIAT RFL, RFW LANCIA, PEUGEOT LFX, 9HD Berlingo, Jumper BFZ, BDY Ducato, Zeta CI 96155198 Boxer, Partner VA D6RA8 HC CS566</p>	<p>STV0567</p>  <p>12v 3.1kW a:96 b:36 o:33</p> <p>CITROEN</p> <p>CI 95536160 VA D11E187 HC CS567</p>	<p>STV0575</p>  <p>12v 1.7kW a:66 b:-0.5 o:33</p> <p>DAEWOO F8QT NEOPLAN Trucks D2066LUH47 RENAULT DC1305 SCANIA Trucks RE 7700852853 VOLVO VA D10E92 HC CS575</p>	<p>STV0581</p>  <p>STV0581RB STV0581WA STV581</p> <p>12v 1kW a:62 b:-6 o:31</p> <p>CITROEN KFU, NFU PEUGEOT NFZ, CDY Berlingo, C4 C3A, M4A Partner PE 9609313280 206, 207, 306 VA D6G3 HC CS581</p>
<p>STV0594</p>  <p>STB0594RB STV0594WA</p> <p>12v 1.4kW a:70 b:-6 o:33</p> <p>CITROEN, FIAT D9B, DHX HYUNDAI, LANCIA DHY, D8C MITSUBISHI, PEUGEOT RHZ, RHR Berlingo, C4 PE 9648111680 Boxer, Expert VA D7R26 HC CS594</p>	<p>STV0621</p>  <p>STV0621WA</p> <p>12v 1.1kW b:-6 o:33</p> <p>CITROEN RFV, RFY PEUGEOT LFX, RFS Xantia RFT, RFX ZX PE 95667755 306, 405 VA D6RA51 HC CS621</p>	<p>STV0681</p>  <p>STB0681RB STV0681RB STV0681WA</p> <p>12v 1.1kW a:65.5 b:-2 o:44</p> <p>DACIA, RENAULT F3N740 VOLVO C3J710 Logan F3P704 Clio, Kangoo RE 7700100647 Megane VA D6RA33 HC CS681</p>	<p>STV0712</p>  <p>12v 2.2kW a:70 b:-6 o:33</p> <p>CITROEN FIAT PEUGEOT</p> <p>FI 71719596 VA D9R122 HC CS712</p>



Starters

Valeo

<p>STV0784</p>  <p>STB0784RB STB0784WA STB784</p> <p>231 9, 11 CR</p> <p>12v 1.4kW a:66 o:33</p> <p>CHRYSLER, RENAULT SCANIA, SUZUKI, OPEL Vision, Arena Kangoo, Megane, Clio Samurai</p> <p>F8Q730, F8Q696 F3P720, F3R722 DC1305, F01 RE 7700860915 VA D6RA104 HC CS784</p>	<p>STV0791</p>  <p>STV0791WA</p> <p>9 CR</p> <p>9</p> <p>12v 1.1kW b:-5 o:33</p> <p>RENAULT Master Safrane Trafic</p> <p>J7T788 J7R732 J7T600 RE 7700870951 VA D6RA141 HC CS791</p>	<p>STV0807</p>  <p>STV0807WA</p> <p>216 9 CR</p> <p>9</p> <p>12v 1.1kW a:76 b:15 o:20</p> <p>LOMBARDINI Agriculture Vehicles Industrial Engines</p> <p>LDW903 LDW502 LDW1204 LB 58401940 VA D6RA52 HC CS807</p>	<p>STV0825</p> <p>10 CR</p> <p>10</p> <p>12v 2.2kW a:77 b:19 o:22</p> <p>HYUNDAI H1 2.5 16V D4CB CRDI 2007-> GRAND STAREX SM</p> <p>HY 361004A020 VA S0001250825</p>
<p>STV0882</p>  <p>STB0882RB STV0882RB STV0882WA</p> <p>209 9, 10 CR</p> <p>12v 1.1kW b:9 o:33</p> <p>RENAULT Laguna Safrane Espace</p> <p>Z7X744 Z7X765 Z7X721 RE 7700759861 VA D6RA53 HC CS882</p>	<p>STV0886</p>  <p>STV0886WA</p> <p>208 8 CR</p> <p>8</p> <p>12v 1.3kW a:71 b:3.5 o:22</p> <p>MITSUBISHI Carisma Space Star</p> <p>4G13 4G18 4G92, 4G93 MI MD308088 VA D6RA76 HC CS886</p>	<p>STV0902 <i>New</i></p>  <p>8 CR</p> <p>8</p> <p>12v 2.0kW a:74 b:15 o:22</p> <p>HYUNDAI</p> <p>G4LA</p> <p>HY 3610003100 VA 1250902</p>	<p>STV0964</p>  <p>STV0964WA</p> <p>10 CR</p> <p>10</p> <p>12v 2.2kW a:75 b:-7 o:33</p> <p>RENAULT Laguna 2.2L</p> <p>RE 7700857114 VA D9R142 HC CS964</p>
<p>STV0978</p>  <p>11 CR</p> <p>11</p> <p>12v 1.7kW a:68 o:33</p> <p>RENAULT VOLVO Laguna S40</p> <p>N7Q700 N7Q704 B4184S RE 7700871055 VA D7R16 HC CS978</p>	<p>STV0980</p>  <p>STB0980RB STV0980WA</p> <p>216 9 CR</p> <p>9</p> <p>12v 0.9kW a:66 b:-1.5 o:33</p> <p>CITROEN HYUNDAI KIA RENAULT</p> <p>R06627, V06630 G6BVG, G6CTG G6BV, C3G700 RE 7700858442 VA D6RA33 HC CS980</p>	<p>STV0983</p>  <p>STV0983WA</p> <p>405 12 CR</p> <p>12</p> <p>24v 8kW a:89 b:41 o:30</p> <p>RENAULT VI Agora Ares Manager Maxter</p> <p>MIDR062045D41 MIDR062045M41 MGDR062045D491 RE 5001014196 VA D13HP703 HC CS983</p>	<p>STV0991</p>  <p>9 CR</p> <p>9</p> <p>12v 1.1kW a:82 b:36 o:22</p> <p>VOLVO Marine</p> <p>VO 8728883 VA D6RA40 HC CS991</p>

Starters

Valeo

<p>STV1035</p>  <p>STV1035WA</p> <p>303 9, 11 CR</p> <p>12v 3.1kW a:89 b:49 o:30</p> <p>VOLVO Trucks F Series Marine</p> <p>TMD41B TD40A</p> <p>VO 3581774 VA D9R116 HC CS1035</p>	<p>STV1055</p>  <p>STV1055WA</p> <p>9, 10 CR</p> <p>12v 2.2kW a:70 b:-6 o:32</p> <p>RENAULT VAUXHALL Movano</p> <p>RE 7700104346 VA D7R23 HC CS1055</p>	<p>STV1057</p>  <p>STB1057RB STV1057RB STV1057WA</p> <p>196 9 CR</p> <p>9</p> <p>12v 0.7kW a:63 o:21</p> <p>NISSAN, RENAULT Kubistar Clio Kangoo Modus, Twingo</p> <p>D4F704, D4F702 D7F700 D7F764 NI 2330000QAM VA D7E1 HC CS1057</p>	<p>STV1060</p>  <p>STB1060RB STV1060WA</p> <p>216 9 CR</p> <p>9</p> <p>12v 1.1kW b:-1 o:33</p> <p>VOLVO S40 V40</p> <p>B14184S9 B4204S2 B4164S9 VO 30808465 VA D6RA63 HC CS1060</p>
<p>STV1106</p>  <p>STV1106WA</p> <p>9 CR</p> <p>9</p> <p>12v 1.2kW a:62 b:27 o:22</p> <p>BMW Motorcycles R100R</p> <p>980cc</p> <p>BM 12419062425 VA D6RA15 HC CS1106</p>	<p>STV1108</p>  <p>STV1108WA</p> <p>10 CR</p> <p>10</p> <p>12v 1.5kW a:66 b:1 o:30</p> <p>CITROEN XANTIA, XM PEUGEOT 406, 407, 605 CLIO II, ESPACE, LAGUNA SAFRANE 3.0L</p> <p>RE 9627267180 VA D7R17 HC CS1108</p>	<p>STV1111</p>  <p>STB1111RB STV1111WA</p> <p>194 9 CR</p> <p>9</p> <p>12v 0.7kW a:62 b:-5 o:31</p> <p>CITROEN PEUGEOT Xsara Berlingo 206, 307</p> <p>H1A, NFU KFW, HFX NFZ, KFX PE 9626261480 VA D7E16 HC CS1111</p>	<p>STV1117</p>  <p>STV1117RB STV1117WA</p> <p>8, 10 CR</p> <p>12v 1kW a:70 b:14 o:20</p> <p>MERCEDES-BENZ Vaneo, 26t, 210, 200</p> <p>M266920 4G63 D9B300 MB 0041518501 VA D7E8 HC CS1117</p>
<p>STV1128</p>  <p>STV1128WA</p> <p>12 CR</p> <p>12</p> <p>24v 6.6kW a:89 b:40 o:40</p> <p>RENAULT VI Pemium C300 87->, KERAX 97-> MANAGER ->96 MAXTER ->97</p> <p>RE 5001831086 VA D13HP605 HC CS1128</p>	<p>STV1129</p>  <p>STV1129WA</p> <p>9 CR</p> <p>9</p> <p>12v 1.2kW a:67 b:13 o:21</p> <p>VOLKSWAGEN Amarok 2.0</p> <p>CDCA CNFA CDBA VW 2H0911023C VA TS12ER15M</p>	<p>STV1131</p>  <p>STV1131WA</p> <p>10 CR</p> <p>10</p> <p>12v 2.2kW b:-5 o:33</p> <p>RENAULT Laguna 2.2L Diesel</p> <p>G8T706 G8T794 G8T752 RE 7700104344 VA D7R22 HC CS1131</p>	<p>STV1147</p>  <p>STV1147RB STV1147WA</p> <p>9 CR</p> <p>9</p> <p>12v 1kW a:75 b:33.5 o:20</p> <p>HONDA ROVER Accord Civic 400</p> <p>16K4F D16Y2, D15Z8 D14A8, D14A7 HO 31200P1JE01 VA D6RA67 HC JS1147</p>



Starters

Valeo

<p>STV1152</p>  <p>9 CR</p> <p>12v 1kW a:75 b:33 o:20</p> <p>HONDA, ROVER Civic 416</p> <p>D14A2, D16Y6, D16Y2 D14A5, D16Z9 D15Z3, 16K4F HO 31200P1KE01 VA D7RS7 HC JS1152</p>	<p>STV1164</p>  <p>STD1164 STD1164WA STM1164WA</p> <p>11 CR</p> <p>24v 8kW a:92 b:47 o:30</p> <p>RENAULT Trucks</p> <p>RE 5001843276 VA D13HP709 HC CS1164</p>	<p>STV1174</p>  <p>STB1174RB STV1174RB STV1174WA</p> <p>169 8, 9 CR</p> <p>12v 1.0kW a:60.5 b:-2 o:33</p> <p>RENAULT Clio Kangoo Laguna Megane</p> <p>K4M704 K4J730 K4M701 RE 7700104674 VA D7E22 HC CS1174</p>	<p>STV1177</p>  <p>STB1177RB STB1177WA STM1177RB</p> <p>280 10, 11, 12, 13 CR</p> <p>12v 1.7kW a:66 b:-5 o:33</p> <p>RENAULT CITROEN FIAT DUCATO 98-> HYUNDAI PEUGEOT</p> <p>A9A, DJJ WJZ, RHY CRD93L, RHH FI 1320921080 VA D7R27 HC CS1177</p>
<p>STV1186</p>  <p>STV1186WA</p> <p>209 9, 10 CR</p> <p>12v 1.1kW a:66 b:-2 o:44</p> <p>RENAULT VOLVO Kangoo Megane</p> <p>F3R750 K7M703 F3N718 NI 2330000QAL VA D7E15 HC CS1186</p>	<p>STV1193</p>  <p>STV1193RB STV1193WA</p> <p>238 11 CR</p> <p>12v 1.8kW a:66 b:-1 o:43</p> <p>NISSAN, RENAULT OPEL, VOLVO Movano, Vivara Primastar, Interstar S40, V40, Laguna</p> <p>F9Q750 F9Q762 F9Q774 RE 8200064465B VA D7R47 HC CS1193</p>	<p>STV1207</p>  <p>STV1207RB STV1207WA</p> <p>238 10 CR</p> <p>12v 2kW a:72 b:-6 o:32</p> <p>NISSAN, OPEL RENAULT, VAUXHALL Interstar, Primastar Movano, Vivaro Laguna, Master</p> <p>G9U720, G9U730 G9U754, G9U720 G9T710, G9T712 NI 2330000Q0B VA D7R53 HC CS1207</p>	<p>STV1216</p>  <p>STV1216WA</p> <p>229 9 CR</p> <p>12v 1.0kW a:75 b:39 o:20</p> <p>HONDA Accord</p> <p>F20B6 H22A7 D16B6 HO 31200PDAE020 VA D6RA81 HC JS1216</p>
<p>STV1226</p>  <p>STB1226WA STV1226WA</p> <p>185 8 CR</p> <p>12v 0.7kW a:70 b:12.5 o:21</p> <p>NISSAN Almera Primera</p> <p>QG16DE QG18DE QG15DE NI 233009F660 VA D7E31 HC JS1226</p>	<p>STV1244</p>  <p>STM1244RB STV1244WA</p> <p>9, 12 CR</p> <p>12v 1.1kW a:64 b:-6 o:33</p> <p>CITROEN, FIAT LANCIA, PEUGEOT C4, C5, C8 Jumpy, Xsara Scudo, Ulysse</p> <p>6FY, RFJ 6FZ, LFY PE 96251686 VA D6RA74 HC CS1244</p>	<p>STV1251</p>  <p>STV1251WA</p> <p>12 CR</p> <p>24v 6.6kW a:102 b:23 o:30</p> <p>RENAULT Trucks Magnum R340, R350 R365, R380</p> <p>RE 5001831090 VA D13HP607 HC CS1251</p>	<p>STV1260</p>  <p>STV1260RB STV1260WA</p> <p>206 11 CR</p> <p>12v 1.1kW a:62 b:14 o:42</p> <p>CITROEN, FIAT PEUGEOT, TOYOTA Berlingo. C1, C2 Scudo, 1007 207, 307</p> <p>8HZ, 8HY 9HY, DV6UTED4 DV6B, 8HX TO 28100YV010 VA D6RA110 HC CS1260</p>

Starters

Valeo

<p>STV1263</p>  <p>STV1263WA 11 CR </p> <p>12v 2kW a:71 b:-1.5 o:32</p> <p>OPEL VAUXHALL RENAULT Movano Master</p> <p>F9Q770 RE 7711134603 VA D7R40 HC CS1263</p>	<p>STV1276</p>  <p>STV1276RB STV1276WA 168 8 CR </p> <p>12v 0.85kW a:64.5 b:-3 o:33</p> <p>RENAULT, LADA NISSAN Megane 1.6L Kangoo 1.6L Largus 1.6L</p> <p>K4M848 K4J730 K4M752 RE 7711135335 VA D7E47 HC CS1276</p>	<p>STV1277</p>  <p>STV1277WA 10 CR </p> <p>12v 1.4kW a:64 b:-5 o:33</p> <p>CITROEN, FIAT LANCIA, PEUGEOT C4, C5, C6 Jumpy, Xsara Scudo, Zeta</p> <p>6FY, 6FZ RFJ, RFK RFN, 3FZ CI 9625168680 VA D6RA74 HC CS1277</p>	<p>STV1278</p>  <p>STV1278WA 12 CR </p> <p>24v 7.7kW a:102 b:23 o:30</p> <p>RENAULT</p> <p>MIDR063540G MIDR063540H MIDR063540LI RE 5010217010 VA D13HP702 HC CS1278</p>
<p>STV1281</p>  <p>STV1281WA 238 11 CR </p> <p>12v 2.1kW a:76 b:-1 o:43</p> <p>NISSAN, RENAULT OPEL, VOLVO Movano, Vivaro Espace, Laguna, Megane S40, V40</p> <p>D4192T3, D4192T4 F9Q718, F9Q820 F9Q812, F9Q760 RE 8200064465 VA D7R48 HC CS1281</p>	<p>STV1288</p>  <p>STV1288WA 10 CR </p> <p>12v 2.4kW a:77 b:-6 o:32</p> <p>RENAULT Espace Laguna Vel Satis</p> <p>G9T645 G9T742 GT600 RE 8200634604 VA D8R1 HC CS1288</p>	<p>STV1290</p>  <p>STV1290WA 10 CR </p> <p>12v 1.3kW a:65 b:-1 o:30</p> <p>CITROEN, LANCIA PEUGEOT, RENAULT C5, C6, C8 406, 407, 607 Avantime, Clio</p> <p>ES9A, ES9J4S L7X720, L7X721 L7X760, L7X762 RE 820053977 VA D6RA70 HC CS1290</p>	<p>STV1305</p>  <p>STB1305RB STV1305WA 8 CR </p> <p>12v 0.7kW a:70 b:7.5 o:21</p> <p>NISSAN Micra</p> <p>CG10DE CGA3DE NI 233001F760 VA D7E29 HC JS1305</p>
<p>STV1307</p>  <p>STV1307RB STV1307WA 168 8 CR </p> <p>12v 0.7kW a:70 b:11 o:21</p> <p>NISSAN Micra Note</p> <p>CG10DE CGA3DE CR14DE NI 233001F710 VA D7E32 HC JS1307</p>	<p>STV1311</p>  <p>STV1311WA 8 CR </p> <p>12v 0.9kW a:77 b:17.5 o:22</p> <p>HYUNDAI, KIA Accent, Elantra Getz Coupe 1.6 Rio</p> <p>G4EA, G4EH, G4EE, G4EB, G4EBIA, HYUNDAI G4EDG, G4GA, G4ED HY 3610022800 VA TMA000A37201 HC JS1311</p>	<p>STV1312</p>  <p>STV1312RB STV1312WA 8 CR </p> <p>12v 0.9kW a:77 b:11.5 o:22</p> <p>ASSEMBIA, HYUNDAI Asccent Rio</p> <p>HY 3610022850 VA TM000A37301 HC JS1312</p>	<p>STV1324</p>  <p>STV1324WA 10 ACR </p> <p>12v 1kW a:76 b:53 o:20</p> <p>AUDI, SEAT SKODA, VW A3, Cordoba Leon, Octavia Golf</p> <p>BGU, BSE BSF, AZL BGU, CCSA VW 02T911023T VA D6GS13 HC CS1324</p>

Starters

Valeo

<p>STV1328</p>  <p>STV1328RB STV1328WA</p> <p>220 10 CR</p> <p>10</p> <p>12v 1.6kW a:74 b:20.5 o:22</p> <p>BMW 3 5 X</p> <p>M47N204D4 M57306D3</p> <p>BM 12417787354 VA D7G4 HC CS1328</p>	<p>STV1329</p>  <p>STV1329WA</p> <p>220 11, 12 CR</p> <p>12v 1.5kW a:65 b:13 o:42</p> <p>CITROEN, MINI PEUGEOT, TOYOTA Berlingo, C3, C4 Cooper 206, 207, 208, 307</p> <p>9HY, 9HR DV6DTEd 9HP, 8HX TO 28100YV020 VA D7G3 HC CS1329</p>	<p>STV1338</p>  <p>STV1338WA</p> <p>10 CR</p> <p>10</p> <p>12v 1.3kW a:70 b:15 o:20</p> <p>MERCEDES-BENZ A 190 A 210 Vaneo 1.9</p> <p>M166990 M166995 95 M166991 MB 1661510101 VA D6RAD183 HC CS1338</p>	<p>STV1342</p>  <p>STN1342WA STN342 STV1342WA</p> <p>209 11, 12 CR</p> <p>12v 1.9kW a:82 b:-5 o:33</p> <p>CITROEN, FIAT PEUGEOT C4, C5, Jumpy Scudo 307, 406, 407</p> <p>RHR RHH 4HX PE 9555507680 VA D8R27 HC CS1342</p>
<p>STV1344</p>  <p>STV1344WA</p> <p>209 11 CR</p> <p>11</p> <p>12v 1.2kW b:-1 o:33</p> <p>RENAULT Kangoo Megane Scenic</p> <p>F9Q782 F9Q790 F9Q744 RE 7711134297 VA D6RA105 HC CS1344</p>	<p>STV1345</p>  <p>STV1345WA</p> <p>208 9 CR</p> <p>9</p> <p>12v 1.3kW a:66 b:10 o:22</p> <p>FIAT, LANCIA Doblo Stilo Lybra Multipla</p> <p>182B6000 FI 46800152 VA D6RA138 HC CS1345</p>	<p>STV1346</p>  <p>STV1346WA</p> <p>201 9 CR</p> <p>9</p> <p>12v 1.3kW a:64 b:24 o:21</p> <p>FIAT, LANCIA OPEL, VAUXHALL Doblo, Panda Punto, Astra Combo, Corsa</p> <p>Z13DT, Z13DTH 283A2000 199A3000 FI 46823548 VA D6G1 HC CS1346</p>	<p>STV1353</p>  <p>STV1353WA</p> <p>9 CR</p> <p>9</p> <p>12v 1kW a:75 b:32 o:20</p> <p>HONDA Civic</p> <p>D16V1 HO 31200PMHG01 VA D6RA91 HC JS1353</p>
<p>STV1369</p>  <p>STV1369WA</p> <p>233 11 CR</p> <p>11</p> <p>12v 2.0kW a:74 b:24 o:21</p> <p>LEXUS, TOYOTA IS Auris, Avensis Corolla Rav4, Verso</p> <p>1ADFTV 2ADFTV 2ADFHV TO 281000G040 VA TS24E30 HC JS1369</p>	<p>STV1379</p>  <p>STE1379WA STN1379RB STV1379WA</p> <p>167 8, 9, 10 CR</p> <p>12v 0.9kW a:64 b:10.5 o:21</p> <p>ALFA ROMEO, FIAT FORD, LANCIA Brava, Doblo Panda, Punto Delta, Ypsilon</p> <p>188A4000 169A4000 955A1000 FI 46813058 VA D7E52 HC CS1379</p>	<p>STV1384</p>  <p>STV1384RB STV1384WA</p> <p>169 8 CR</p> <p>8</p> <p>12v 0.8kW a:70 b:15 o:20</p> <p>MERCEDES-BENZ 140 160 190 Vaneo</p> <p>M166960 OM640942 M166961 MB 1661510001 VA D7ED281 HC CS1384</p>	<p>STV1385</p>  <p>STV1385RB STV1385WA</p> <p>170 9 CR</p> <p>9</p> <p>12v 0.85kW a:62.5 b:-1 o:21</p> <p>RENAULT DACIA Twingo Logan Sandero</p> <p>D4F732 D4F782 RE 7701499651 VA TS8E6 HC CS1385</p>

Starters

Valeo

<p>STV1387</p>  <p>STV1387WA 211 9 CR</p> <p>12v 1.7kW a:82 b:7.5 o:20</p> <p>AUDI, VW A4 A6 Passat</p> <p>AVF, BGH BGW, AWX</p> <p>VW 068911024L VA D7GS9 HC CS1387</p>	<p>STV1391</p>  <p>STV1391WA 11 CR</p> <p>12v 2.2kW a:61 b:14 o:42</p> <p>CITROEN, PEUGEOT Berlingo C2, C3, C4, C5 Jumpy 206, 207, 307, 308</p> <p>9FY 9HU 9HY PE 9646694080 VA D7G26 HC CS1391</p>	<p>STV1401</p>  <p>STV1401WA 9 CR</p> <p>12v 1.1kW a:82 b:3 o:22</p> <p>AUDI SEAT A4, A6 EXEO</p> <p>BYK, BGB BPG, BWE BPJ, BWT VW 06D911023 VA D6GS19 HC CS1401</p>	<p>STV1415</p>  <p>STM1415WA 10 CR</p> <p>12v 2.2kW a:76.5 b:13.5 o:33</p> <p>NISSAN, OPEL VAUXHALL X-Trail Movana Master</p> <p>M9R M9T676 M9R824 RE 8200402016 VA TS22E5 HC CS1415</p>
<p>STV1416</p>  <p>STV1416WA 11 CR</p> <p>12v 2.5kW a:66 b:-5 o:55</p> <p>CITROEN, FIAT MITSUBISHI, PEUGEOT C4, C5, C6, C8 C-Crosser, Ulysse Outlander</p> <p>RHJ, RHR 4HT, 9HY CW7W PE 9654595680 VA D8R28 HC CS1416</p>	<p>STV1441</p>  <p>STV1441WA 12 CR</p> <p>12v 2kW a:82.5 b:24.5 o:22</p> <p>KIA Cee'd 2.0 Pro Cee'd 2.0 Sportage 2.0</p> <p>D4EAF D4EA HY 3610027700 VA 1250449 HC CS1441</p>	<p>STV1470</p>  <p>STV1470WA 10 ACR</p> <p>12v 1.1kW a:76 b:63 o:20</p> <p>AUDI SEAT SKODA VW</p> <p>BGU CAXA GDAA VW 0AM911023B VA TS12ER20 HC CS1470</p>	<p>STV1606 <i>New</i></p>  <p>9 CR</p> <p>12v 2.0kW a:89 b:24 o:30</p> <p>PEGEOUT 504 2.1L 2.3L 505 2.3L 604 2.5L</p> <p>XD4x90 134xd2 147xd29 PE 9150516480 VA 580261 BO 0001362044</p>
<p>STV1922 <i>New</i></p>  <p>9 CR</p> <p>12v 1.2kW a:82 b:9 o:22</p> <p>SEAT Exeo 1.8l,2.0l Exeo ST 1.8l,2.0</p> <p>SE 3R0911023 VA TS12ER19 VW 3R0911023</p>	<p>STV1944</p>  <p>8 cr</p> <p>12v: 0.8kW a:77 b:22 o:22</p> <p>HYUNDAI I30 1.6 Yuedong 1.6L</p> <p>HY 361002B400 VA 442119</p>	<p>STV2026 <i>New</i></p>  <p>12 CR</p> <p>12v 2.0kW a:70 b:6 o:30</p> <p>NISSAN Qashqai RENAUT Megane III Scenic III</p> <p>R9M R9M 402 R9M 404 NI 233001375R VA 458429</p>	<p>STV2058 <i>New</i></p>  <p>9 CR</p> <p>12v 1.2kW a:72 b:17 o:20</p> <p>BYD F6 1.8 2.0</p> <p>BY 483QA3708010 VA SD6RA134</p>

Starters

Valeo

<p>STV2070</p>  <p>STV2070WA 9 CR </p> <p>12v 1.3kW a:60 b:15 o:33</p> <p>FIAT Palio Siena CHINA MARKET</p> <p>FI 00551872870L VA SD6RA94 MH STV2070</p>	<p>STV2086 <i>New</i></p>  <p>9 ACR </p> <p>12v 1.1kW a:81 b:48 o:32</p> <p>Jiefang Van Light Truck</p> <p>VA SD6RA55</p>	<p>STV2241</p>  <p>10 CR </p> <p>12v 1.2kW a:73 b:13 o:21</p> <p>GREATWALL C30 1.5 Coolbear 1.5 Florid1.3</p> <p>GW 3708100AEG01 VA D6RA151 VA 442241</p>	<p>STV2319 <i>New</i></p>  <p>13 ACR </p> <p>12v 2.0KW a:79 b:42</p> <p>AUDI A3 2.0L SEAT Alhambra 2.0L SEAT Altea 2.0L VW Golf VI 2.0L VW Sharan 2.0L</p> <p>BKD, BMM, CBAB CFFB, CLJA, CFJA CFGB, CBBB, BMN VW 02E911023Q VA ESW20ER25 VA 458419</p>
<p>STV2332 <i>New</i></p>  <p>9 CR </p> <p>12v 1.2kW a:73 b:20 o:22</p> <p>GREAT WALL Pegasus 2.2 CN</p> <p>GW 3708010E00 VA SD6RA123 VA 442061</p>	<p>STV2335 <i>New</i></p>  <p>218 9 ACR </p> <p>12v 1.1kW a:61 b:34 o:20</p> <p>BMW Motorcycles</p> <p>R1100 R1150</p> <p>BM 12412306001 VA D6RA75 CG 111335</p>	<p>STV2890</p>  <p>8 cr </p> <p>12v 1.1amp a:74 b:11 o:22</p> <p>GREAT WALL Xenia 1.5 CN</p> <p>CW 28100BZ090 VA 442067</p>	<p>STV3006</p>  <p>9 CR </p> <p>12v 1.4kW a:69 b:22 o:33</p> <p>RENAULT Grand Megane Scenic</p> <p>NI 233001007X VA FS10E10 MH STV3006</p>
<p>STV3094</p>  <p>9 CR </p> <p>12v 1.3kW a:76 b:20 o:32</p> <p>BMW M3 3.2L BMW Z3 3.2L BMW Z4 3.2L</p> <p>BM 12317830793 VA D6RA108 MH STV3094</p>	<p>STV3122</p>  <p>9 CR </p> <p>12v 1.1kW a:66 b:18 o:20</p> <p>SATURN SC Series SL Series SW Series</p> <p>WL 91203533 VA D6RA65 CG 113122</p>	<p>STV3170</p>  <p>10 CR </p> <p>12v 2.2kW a:59 b:30 o:22</p> <p>MERCEDES-BENZ Class S Coupe</p> <p>MB A0051513701 VA D7R37 MH STV3170</p>	<p>STV3193</p>  <p>11 CR </p> <p>12v 2.2kW a:83 b:26</p> <p>Forklifts STILL</p> <p>ST 529572 VA D7R51 NR 010751</p>

Starters

Valeo

<p>STV3198</p>  <p>9 CR </p> <p>12v 2.2kW a:75 b:24 o:20</p> <p>OPEL Vectra V6 - 2,9LT DT CADILLAC CTS, DODGE Vitro HUMMER SAAB 9.3, 9.5</p> <p>GM 55564374 VA TS22E20 MS 220540</p>	<p>STV3212</p>  <p>12 CR </p> <p>12v 2.2kW a:96 b:12 o:20</p> <p>VW CDBA Amarok 2.0L CKUB Crafter CKTC</p> <p>VW 2H0911023AX VA TS22ER12 MS 220521</p>	<p>STV3225</p> <p>STV3225WA</p>  <p>9 ACR </p> <p>12v 1.2kW a:62 b:26 o:20</p> <p>BMW Motorcycles 1170cc R1200GS R1200RT R1200S R1200R</p> <p>BM 12312306140 VA TS12E30 MH STV3225</p>	<p>STV3236</p>  <p>10 CR </p> <p>12v 1.5kW a:73 b:22 o:32</p> <p>BMW 5.0L 5 V (E60, E60N, E61, E61N) 6 II (E64, E64N, E63, E63N) M5 M6</p> <p>BM 12417835737 VA D7G13 MH STV3236</p>
<p>STV3245</p> <p>STV3245WA</p>  <p>10 CR </p> <p>12v 2.2kW a:66 b:23 o:20</p> <p>AUDI 2.7TDI A4 Allroad 3.0TDI A5/A6/A8/Q5</p> <p>VW 059911021D VA TS22E45 MS 220531</p>	<p>STV3246</p> <p>STV3246WA</p>  <p>9, 10 CR </p> <p>12v 2.4kW a:66 b:22 o:4</p> <p>RENAULT Laguna III Laguna Grandtour III KT0/1, DT0/1, BT0/1 Latitude (L70)</p> <p>RE 8200487088 VA TS24E2 MH STV3246</p>	<p>STV3290</p> <p>STV3290WA</p>  <p>11 CR </p> <p>12v 2.4kW a:63 o:43</p> <p>RENAULT Laguna Scenic Grand Scenic</p> <p>RE 8200460883 VA D8R49 HC CS1478</p>	<p>STV3307</p>  <p>223 9 ACR </p> <p>12v 1.2kW a:76 b:27 o:20</p> <p>BUKH DEUTZ Marine LOMBARDINI Industrial</p> <p>VA D6RA34 CG 113307</p>
<p>STV3364</p>  <p>10 CR </p> <p>12v: 1.5kW a:73 b:20 o:33</p> <p>BMW Serie 3 E93, E93N, E92 E92N, E90, E90N</p> <p>BM 12417836450 VA TS18E7 MH STV3364</p>	<p>STV3651</p> <p>STV3651WA</p>  <p>9 CR </p> <p>12v 1.4kW a:68 b:6 o:30</p> <p>BUICK Century Regal GL8</p> <p>VA SD6RA51 MH STV3651</p>	<p>STV3671 <i>New</i></p>  <p>12 CR </p> <p>12v a:63 b:15 o:31</p> <p>HYUNDAI KIA</p> <p>KI 361004X970 HY 361004X971</p>	<p>STV3735 <i>New</i></p>  <p>10 CR </p> <p>12v 3.0kW a:88 b:47 o:30</p> <p>BOBCAT Deutz BF4M1011F Dsl Compact Track Loaders T200</p> <p>BC 6676958 VA TM000A29001 CG 113735</p>

Starters

Valeo

<p>STV3822</p>  <p>STV3822WA 12 CR 12</p> <p>12v 1.8kW a:76 b:62 o:20</p> <p>AUDI SEAT SKODA VW</p> <p>VW 0AM911023D VA TS18ER20 HC CS1480</p>	<p>STV3843</p>  <p>8 CR 8</p> <p>12v 1.2kW a:68 b:18 o:22</p> <p>KIA Carnival GQ 2,5 1999-2005</p> <p>5MT2WD KI 0K95H18400 VA 600887 MH STV3843</p>	<p>STV3890</p>  <p>9 CR 9</p> <p>12v 1.2kW a:76 b:26 o:20</p> <p>BMW 1, 5, 7 X3 Z4</p> <p>N55B30A BM 12417616500 VA TS12E36 MS 220539</p>	<p>STV3923</p>  <p>11 ACR 11</p> <p>12v 1.2kW a:79 b:63</p> <p>SKODA VW Fabia, Yeti Passat, Touran Polo</p> <p>VW 0AM911023K VA TS12ER22 MS 220598</p>
<p>STV3974 <i>New</i></p>  <p>STV3974WA 210 9 ACR 9</p> <p>12v 1.1kW a:62 b:9.5 o:20</p> <p>MOTO GUZZI Motorcycles</p> <p>MU 0307307110 VA D6RA21 CG 113974</p>	<p>STV4029</p>  <p>STV4029WA 215 10 CR 10</p> <p>12v 1.8kW a:64 b:23 o:20</p> <p>OPEL Astra Combo Corsa Meiva</p> <p>Z13DTH Z13DTJ A13DTR FI 55564491 VA TS18E33 CG 114029</p>	<p>STV4270</p>  <p>253 10 CR 10</p> <p>12v 2.2kW a:82.5 b:25 o:22</p> <p>SSANGYONG Actyon Rexton Rodius</p> <p>D20DT D27DT OM602962 MB 6611513801 VA TM000A34001 CG 114270</p>	<p>STV4379 <i>New</i></p>  <p>9 CR 9</p> <p>12v 1.25kW a:70 b:17 o:20</p> <p>MERCEDES-BENZ A-class B-class Vaneo</p> <p>M166.940,M166.990 M266.920,M166.961 M266.980 MB A0061510301 VA D6RA83 VA 438079</p>
<p>STV4382</p>  <p>11 cr 11</p> <p>12v 0.8kW a:69 b:30 o:43</p> <p>RENAUT CAPTUR 0.9L MAGANE III 1.2L</p> <p>H5F400 H5F404 RE 233001071R VA 438279</p>	<p>STV4400</p>  <p>8 CR 8</p> <p>12v 1.2kW a:79 b:20</p> <p>KIA Carnival</p> <p>2.5 i V6 KI 0K56P18400 VA TM000A24001 MH STV4400</p>	<p>STV4651</p>  <p>9 CR 9</p> <p>12v 1.2kW a:76 b:27</p> <p>NISSAN Stanza Multi</p> <p>ISKRA VW 330911023B VA SD6RA50 CG 113307</p>	<p>STV4698</p>  <p>9 CR 9</p> <p>12v 1.4kW a:82 b:19 o:21</p> <p>BUICK Excelle NB 1.8L HRV 1.8</p> <p>VA D6RA98 MH STV4698</p>

Starters

Valeo

<p>STV4717</p>  <p>STV4717WA 9 CR</p> <p>12v 1.7kW a:76 b:25</p> <p>VW Touareg 4.2L 10/02-ON AUDI A8 4.2L 2004-ON VW 077911023J A8 6.0L 2005-ON VA D7GS17 MH STV4717</p>	<p>STV4718</p>  <p>STB4718RB STV4718WA 10 CR</p> <p>12v 2.2kW a:60 b:26</p> <p>CHRYSLER JEEP MERCEDES-BENZ MAYBACH CH 56044572AB VA D7G18 MS 220431</p>	<p>STV4722</p>  <p>STV4722WA 10 CR</p> <p>12v 1.4kW a:60 b:27 o:22</p> <p>DODGE 3.0 CRD [EXL] FREIGHTLINER MERCEDES-BENZ JEEP Commander (XK) CH RX801472AA Grand Cherokee III (WH) VA D7G22 MS 220532</p>	<p>STV4760</p>  <p>STV4760WA 9 CR</p> <p>12v 1.7kW a:75 b:24 o:32</p> <p>AUDI BHF 100 BNK A6 Serie BAS A8 Serie VW 079911023D Allroad Quattro VA D7G6 MH STV4760</p>
<p>STV5700</p>  <p>11 ACR</p> <p>12v 1.2kW a:79 b:63 o:20</p> <p>VOLKSWAGEN Golf VI 1.2l, Jetta III, IV 1.2l AUDI A1 1.4l VW 0AM911023K SKODA VA TS12ER22S VA 442202</p>	<p>STV6135</p>  <p>8 CR</p> <p>12v 1.1kW a:76 b:21 o:22</p> <p>HYUNDAI Elantra 1.6 (MT) Accent 1.4 (MT) HY 3610026000 VA SD6RA135 VA 442055</p>	<p>STV6971</p>  <p>12 CR</p> <p>24v 6.0kW a:92 b:49 o:30</p> <p>MAN D2876LF12 TGA TGX series engine D2876LF25 D20 10,5L D2876LF13 MA 51262017199 VA FS60PR971 MI M009T61971</p>	<p>STV7101 <i>New</i></p>  <p>9 CR</p> <p>12v 2.2kW a:81 b:25 o:20</p> <p>KUBOTA Kioti Daedong Tractor 2810 4wd 2810 3510 HST KU E55006301 VA TM000A07101 NR 017101</p>
<p>STV8281</p>  <p>12 acr</p> <p>12v 2kW a:79 b:59 o:20</p> <p>AUDI A3 2.0L CRBC,CKFB,CRLB SEAT LEON 2.0L CRLB,CRVC,CRBC SKODA OCTAVIA 2.0L CKFC,CRMB VOLKSWAGEN GOLF VII SE 02M911024M VA TS18ER23</p>	<p>STV8418 <i>New</i></p>  <p>13 ACR</p> <p>12v 2kW a:78 b:61 o:20</p> <p>SEAT CAYB, CAYC SKODA CJSA, CJSB VW CBZB VW 0AM911023H VA 458418</p>	<p>STV9569 <i>New</i></p>  <p>9 CR</p> <p>12v 1.1kW a:81 b:7 o:21</p> <p>GREATWALL HOVER GW 3708010BJA VA SD6RA30 VA 442065</p>	



















Starters

China

<p>STQ1315</p>  <p>STQ1315WA</p> <p>11</p> <hr/> <p>12v 2.8kW a:82 b:21 o:20</p> <p>XC485, XC490 YSD490, QC490 CN490, 4L22</p> <p>CH QD1315A MH STQ1315</p>	<p>STQ1319</p>  <p>STQ1319WA STQ9319WA</p> <p>328 11 cr</p>  <p>11</p> <hr/> <p>12v 3.7kW a:82 b:16 o:20</p> <p>Engine S-Series S195 S1100 S1110</p> <p>CH QD1315C MH STQ1319</p>	<p>STQ2251</p>  <p>STQ2251WA</p> <p>12 CR</p>  <p>12</p> <hr/> <p>24v 5.5kW a:110 b:64 o:21</p> <p>Xichai 4113</p> <p>CH QD251DA MH STQ2251</p>	<p>STQ2262</p>  <p>STQ2262WA</p> <p>11 CR</p>  <p>11</p> <hr/> <p>24v 5.2kW a:78 b:28 o:20</p> <p>Nanchong 6102</p> <p>CH QD262 MH STQ2262</p>
<p>STQ2293</p>  <p>STQ2293WA</p> <p>11 cr</p>  <p>11</p> <hr/> <p>24v 6.6kW a:88 b:28 o:30</p> <p>Yuchai 6108, 6112 Turbocharged</p> <p>CH QD293 MH STQ2293</p>	<p>STQ2634</p>  <p>STQ2634WA</p> <p>11 CR</p>  <p>11</p> <hr/> <p>24v 5.2kW a:88 b:30 o:30</p> <p>Yuchai 6105</p> <p>CH QD2634 MH STQ2634</p>	<p>STQ2636</p>  <p>STQ2636WA</p> <p>9 CR</p>  <p>9</p> <hr/> <p>24v 4.5kW a:81.5 b:21 o:20</p> <p>Yuejin NJ 1080</p> <p>Yangchai 4102, 4105 Series Xichai 485, 495 Series</p> <p>CH QD2636C MH STQ2636</p>	<p>STQ2637</p>  <p>STQ2637WA</p> <p>11 CR</p>  <p>11</p> <hr/> <p>24v 4.5kW a:81 b:20 o:20</p> <p>4100QBZL, 4100QB 490QZL XCMG ZL-18 Yangchai 4102, 4105 Series</p> <p>CH QD2636A MH STQ2637</p>
<p>STQ2827</p>  <p>STQ2827WA</p> <p>11 CR</p>  <p>11</p> <hr/> <p>24v 7.5kW a:91.50 b:44 o:41</p> <p>Shangcai QD6114 engine Diesel Hongyan heavy truck Ouman heavy truck Chenglongwang heavy-duty truck</p> <p>CH QD2827A MH STQ2827</p>	<p>STQ3074</p>  <p>STQ3074WA</p> <p>11 CR</p>  <p>11</p> <hr/> <p>24v 7kW a:92 b:44 o:30</p> <p>DAEWOO DOOSAN Solar S340LC-V S400LC-V, S420LC-V S450LC-V, S470LC-V</p> <p>DW 65262017074 CH QDJ2908 MH STQ3074</p>	<p>STQ3151</p>  <p>STQ3151WA</p> <p>12 CR</p>  <p>12</p> <hr/> <p>12v 3.7kW a:82 b:18 o:20</p> <p>S1115 Engine</p> <p>CH QDJ1315C1 MH STQ3151</p>	<p>STQ3152</p>  <p>STQ3152WA STQ9152WA</p> <p>11 CR</p>  <p>11</p> <hr/> <p>12v 2.8kW a:82 b:16 o:20</p> <p>YUCHAI DOZER MORTOX KDE56STA3 XC485, XC490 YSD49, CN490</p> <p>495DZ-1 CH QDJ1315A MH STQ3152</p>










Starters

China

<p>STQ3154</p>  <p>STQ3154WA 9 CR </p> <p>12v 4.2kW a:88 b:28 o:30</p> <p>YTO 4105/3105</p> <p>CH QDJ154E MH STQ3154</p>	<p>STQ3155</p>  <p>STQ3155WA STQ9155WA 10</p> <p>24v 6.5kW a:89 b:45 o:30</p> <p>CUMMINS 6BT Cummins 6BT</p> <p>CH QDJ153 MH STQ3155</p>	<p>STQ3180</p>  <p>STQ3180WA STQ9180WA 12 cr </p> <p>12v 3kW a:75 b:16 o:20</p> <p>Shanghai S195/S1000/S1100</p> <p>CH QDJ1318D MH STQ3180</p>	<p>STQ3251</p>  <p>STQ3251WA 12</p> <p>24v 4.8kW a:81.5 b:18</p> <p>FOTON 1069 6BD1 6BB1 ChaoChai 6102, 6105</p> <p>CH QDJ251 MH STQ3251</p>
<p>STQ3252</p>  <p>STQ3252WA 9 CR </p> <p>24v 3.7kW a:95 b:16 o:20</p> <p>FOTON-1049 (CY4100) Chaochai 4102, 4105 Series Diesel</p> <p>CH QDJ251C MH STQ3252</p>	<p>STQ3254</p>  <p>STQ3254WA 11</p> <p>24v 5.5kW a:89 b:36</p> <p>Chaoyang Diesel Engine 4102, 4105</p> <p>CH QDJ254 MH STQ3254</p>	<p>STQ3255</p>  <p>STQ3255WA 9</p> <p>24v 5kW a:95 b:16</p> <p>YUTONG BUS</p> <p>CH QDJP255 MH STQ3255</p>	<p>STQ3262</p>  <p>STQ3262WA 9 cr </p> <p>24v 6.5kW a:82 b:30 o:20</p> <p>Nanchong 6102, 6105 Diesel Engine Series</p> <p>CH QDJ262C MH STQ3262</p>
<p>STQ3263</p>  <p>STQ3263WA 9 cr </p> <p>24v 5.5kW a:88 b:27 o:20</p> <p>HUAFENG 4105, 6105 LUOTUO 4105, 6105</p> <p>CH QDJ263E MH STQ3263</p>	<p>STQ3265</p>  <p>STQ3265WA 11 cr </p> <p>24v 5.5kW a:92 b:21 o:30</p> <p>WEICHAI 6105 JAC HFC3051 KR1</p> <p>CH QDJ265F MH STQ3265</p>	<p>STQ3266</p>  <p>STQ3266WA 12 CR </p> <p>24v 6.5kW a:110 b:64 o:20</p> <p>Xichai</p> <p>CH QDJ265CA MH STQ3266</p>	<p>STQ3271</p>  <p>STQ3271WA 11</p> <p>24v 6kW a:110 b:64</p> <p>CHAOCHAI 6102 Series 6105 Series Diesel</p> <p>CH QDJ271 MH STQ3271</p>

Starters

China

<p>STQ3273</p>  <p>STQ3273WA 12 cr </p> <p>24v 6.5kW a:110 b:76.5 o:20</p> <p>Yuchai4110 ZLQ4112</p> <p>6105 Series 6108 Series Diesel</p> <p>CH QDJ273 MH STQ3273</p>	<p>STQ3274</p>  <p>STQ3274WA 12 cr </p> <p>24v 6.5kW a:110 b:67 o:20</p> <p>SHANGHAI</p> <p>Diesel Engine</p> <p>CH QDJ274 MH STQ3274</p>	<p>STQ3275</p>  <p>STQ3275WA 12</p> <p>24v 6.5kW a:110 b:65 o:20</p> <p>FAW Dachai Xichai</p> <p>6110 Series 6113 Series Diesel</p> <p>CH QDJ275 MH STQ3275</p>	<p>STQ3276</p>  <p>STQ3276WA STQ9276WA 11 cr </p> <p>24v 4.8kW a:81.5 b:21 o:20</p> <p>Yang Cai Guangxi YUEJIN 1041</p> <p>4100 4102 4105</p> <p>CH QDJ3Q5 MH STQ3276</p>
<p>STQ3511</p>  <p>STQ3511WA 9 cr </p> <p>12v 3.7kW a:95 b:11.5 o:20</p> <p>DONGFENG DIESEL 4100 Diesel</p> <p>CH QDJ1511C MH STQ3511</p>	<p>STQ3538</p>  <p>STQ3538WA 9 CR </p> <p>24v 4kW a:95 b:9 o:20</p> <p>FAW</p> <p>Caterpillar 4D32</p> <p>CH QDJ2538 MH STQ3538</p>	<p>STQ3605</p>  <p>STQ3605WA 12 CR </p> <p>24v 6kW a:92 b:45 o:30</p> <p>CUMMINS 6C T8.3 Cummins 6CT83</p> <p>CU 3938502 CH QD2605 MH STQ3605</p>	<p>STQ3614</p>  <p>STQ3614WA 11 CR </p> <p>24v 6.5kW a:88 b:30 o:30</p> <p>XCMG Forklift</p> <p>CH QDJ614 MH STQ3614</p>
<p>STQ3615</p>  <p>STQ3615WA 11</p> <p>24v 6.5kW a:105 b:38</p> <p>Dongfeng Tianjin</p> <p>DCEC ISDE</p> <p>CH QDJ2615 MH STQ3615</p>	<p>STQ3624</p>  <p>STQ3624WA 10 CR </p> <p>24v 5.5kW a:88 b:26 o:30</p> <p>Lister-Peters Tractors</p> <p>28MT</p> <p>CH QDJ2624 MH STQ3624</p>	<p>STQ3800</p>  <p>STQ3800WA 11 CR </p> <p>12v 3kW a:67.5 b:15 o:20</p> <p>Changzhou Jiang Yangzhou Lai Power</p> <p>475Q 480Q Diesel Engine</p> <p>CH QDJ138C MH STQ3800</p>	<p>STQ3801</p>  <p>STQ3801WA 11</p> <p>12v 3.7kW a:82 b:25 o:20</p> <p>Changchai N485 Diesel QC485, WX485, NB485B SD485, SD4W55A YZ485, YD480 Y480G, YND485, YSD490</p> <p>Diesel type</p> <p>CH QDJ138A CH QDJ138Y MH STQ3801</p>

Starters

China

STQ4347



STQ4347WA

11 CR



12v **2kW** a:68 b:18 o:20

Jinma
Rhino
Tractors

CH QD1332C
MH STQ4347